


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



Voyageurs National Park Overview

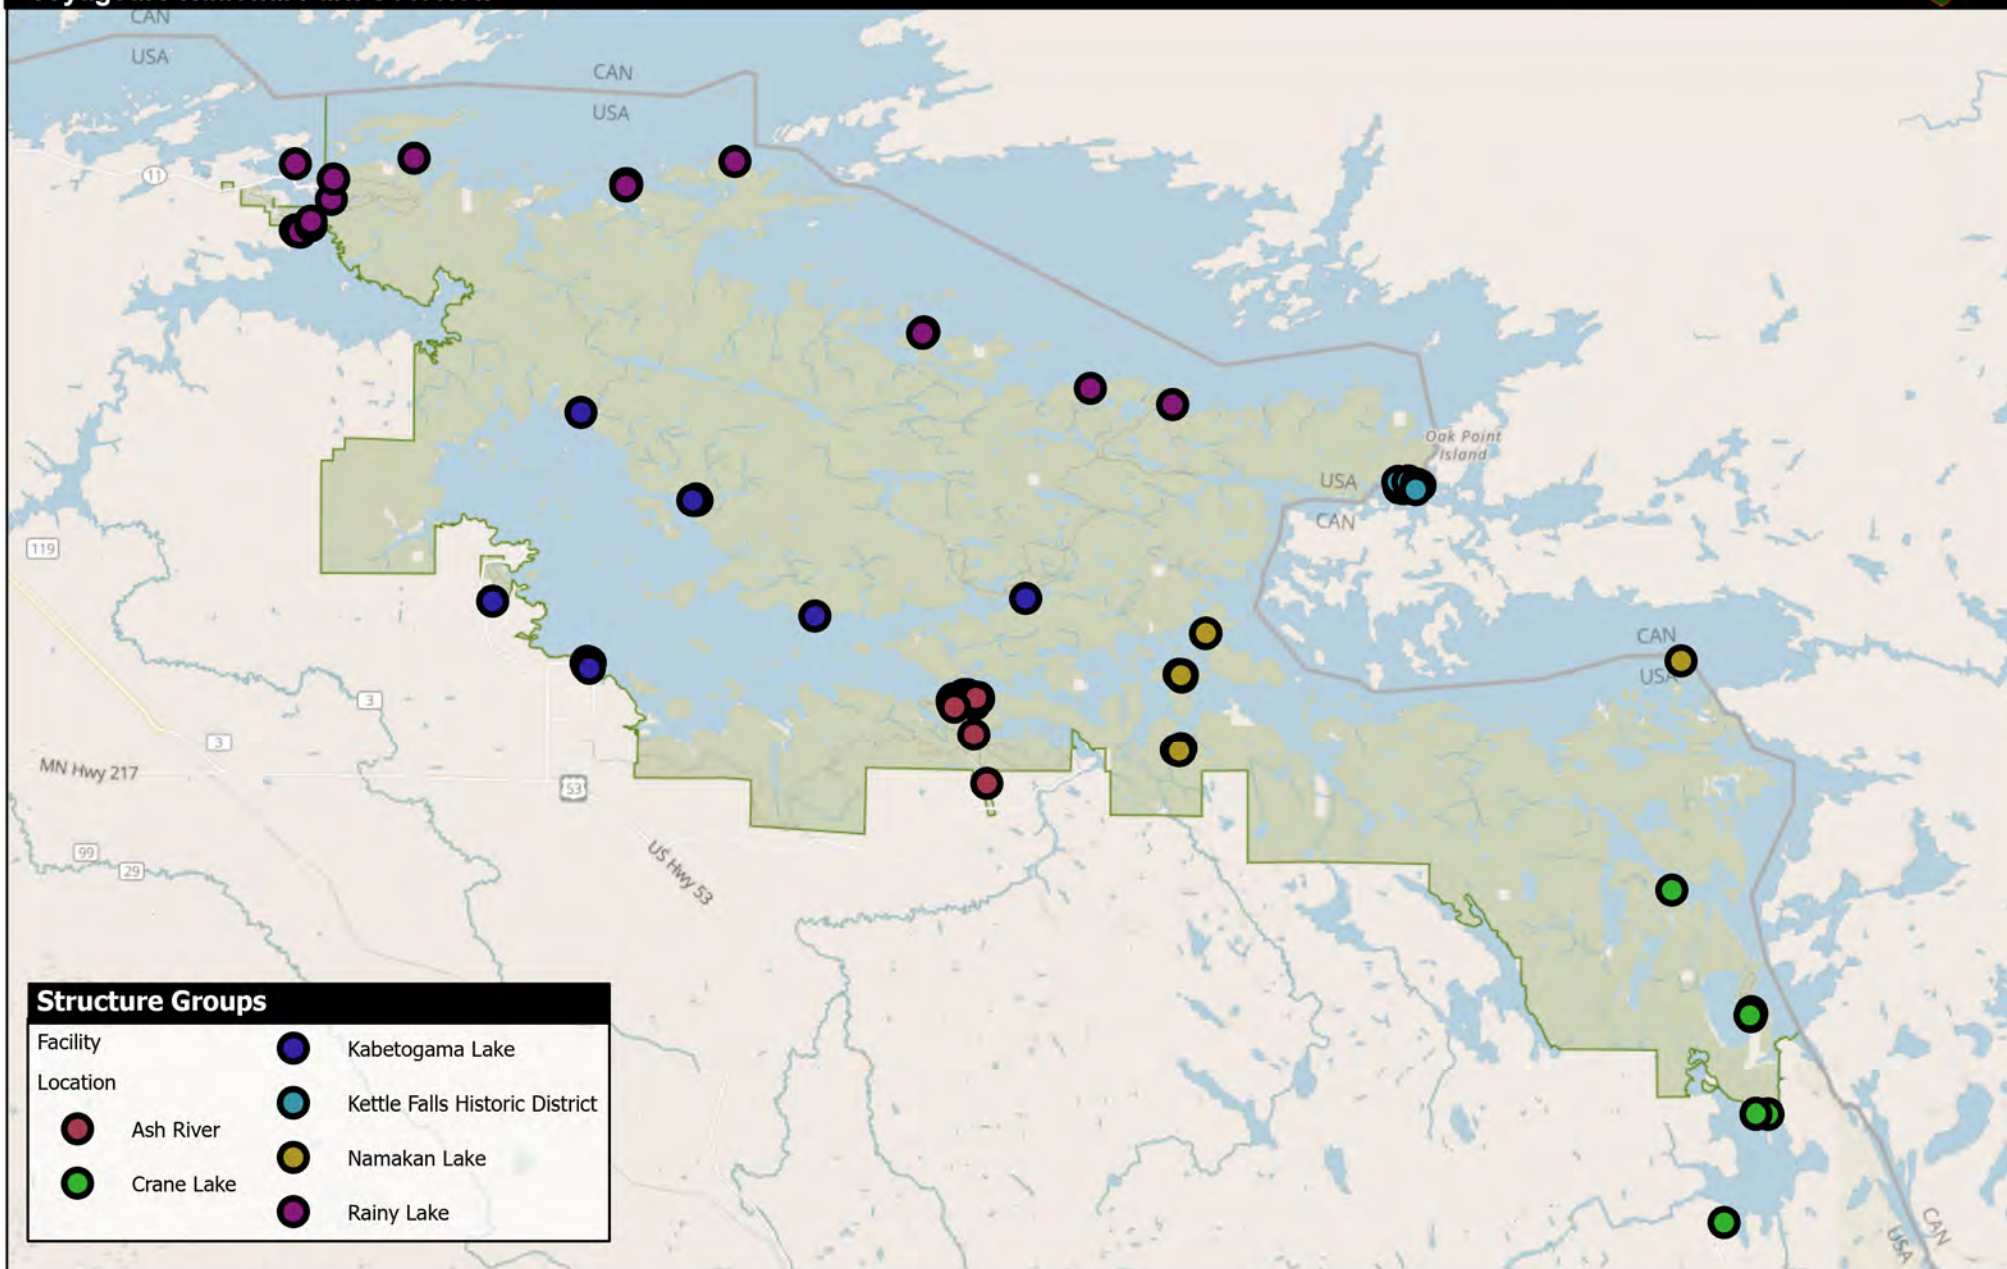

Structure Groups

Facility		Kabetogama Lake
Location		Kettle Falls Historic District
	Ash River	
	Crane Lake	
	Rainy Lake	
	Namakan Lake	



0 15 30 Miles

Author: sszturm
9/7/2023 7:35 PM

Intermountain Region Geographic Resources Division
June 2023
Data Sources: ESRI Basedata, NPS Park Data


NPS Wildfire Risk Assessment Project

NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



Voyageurs National Park - Ash River Overview

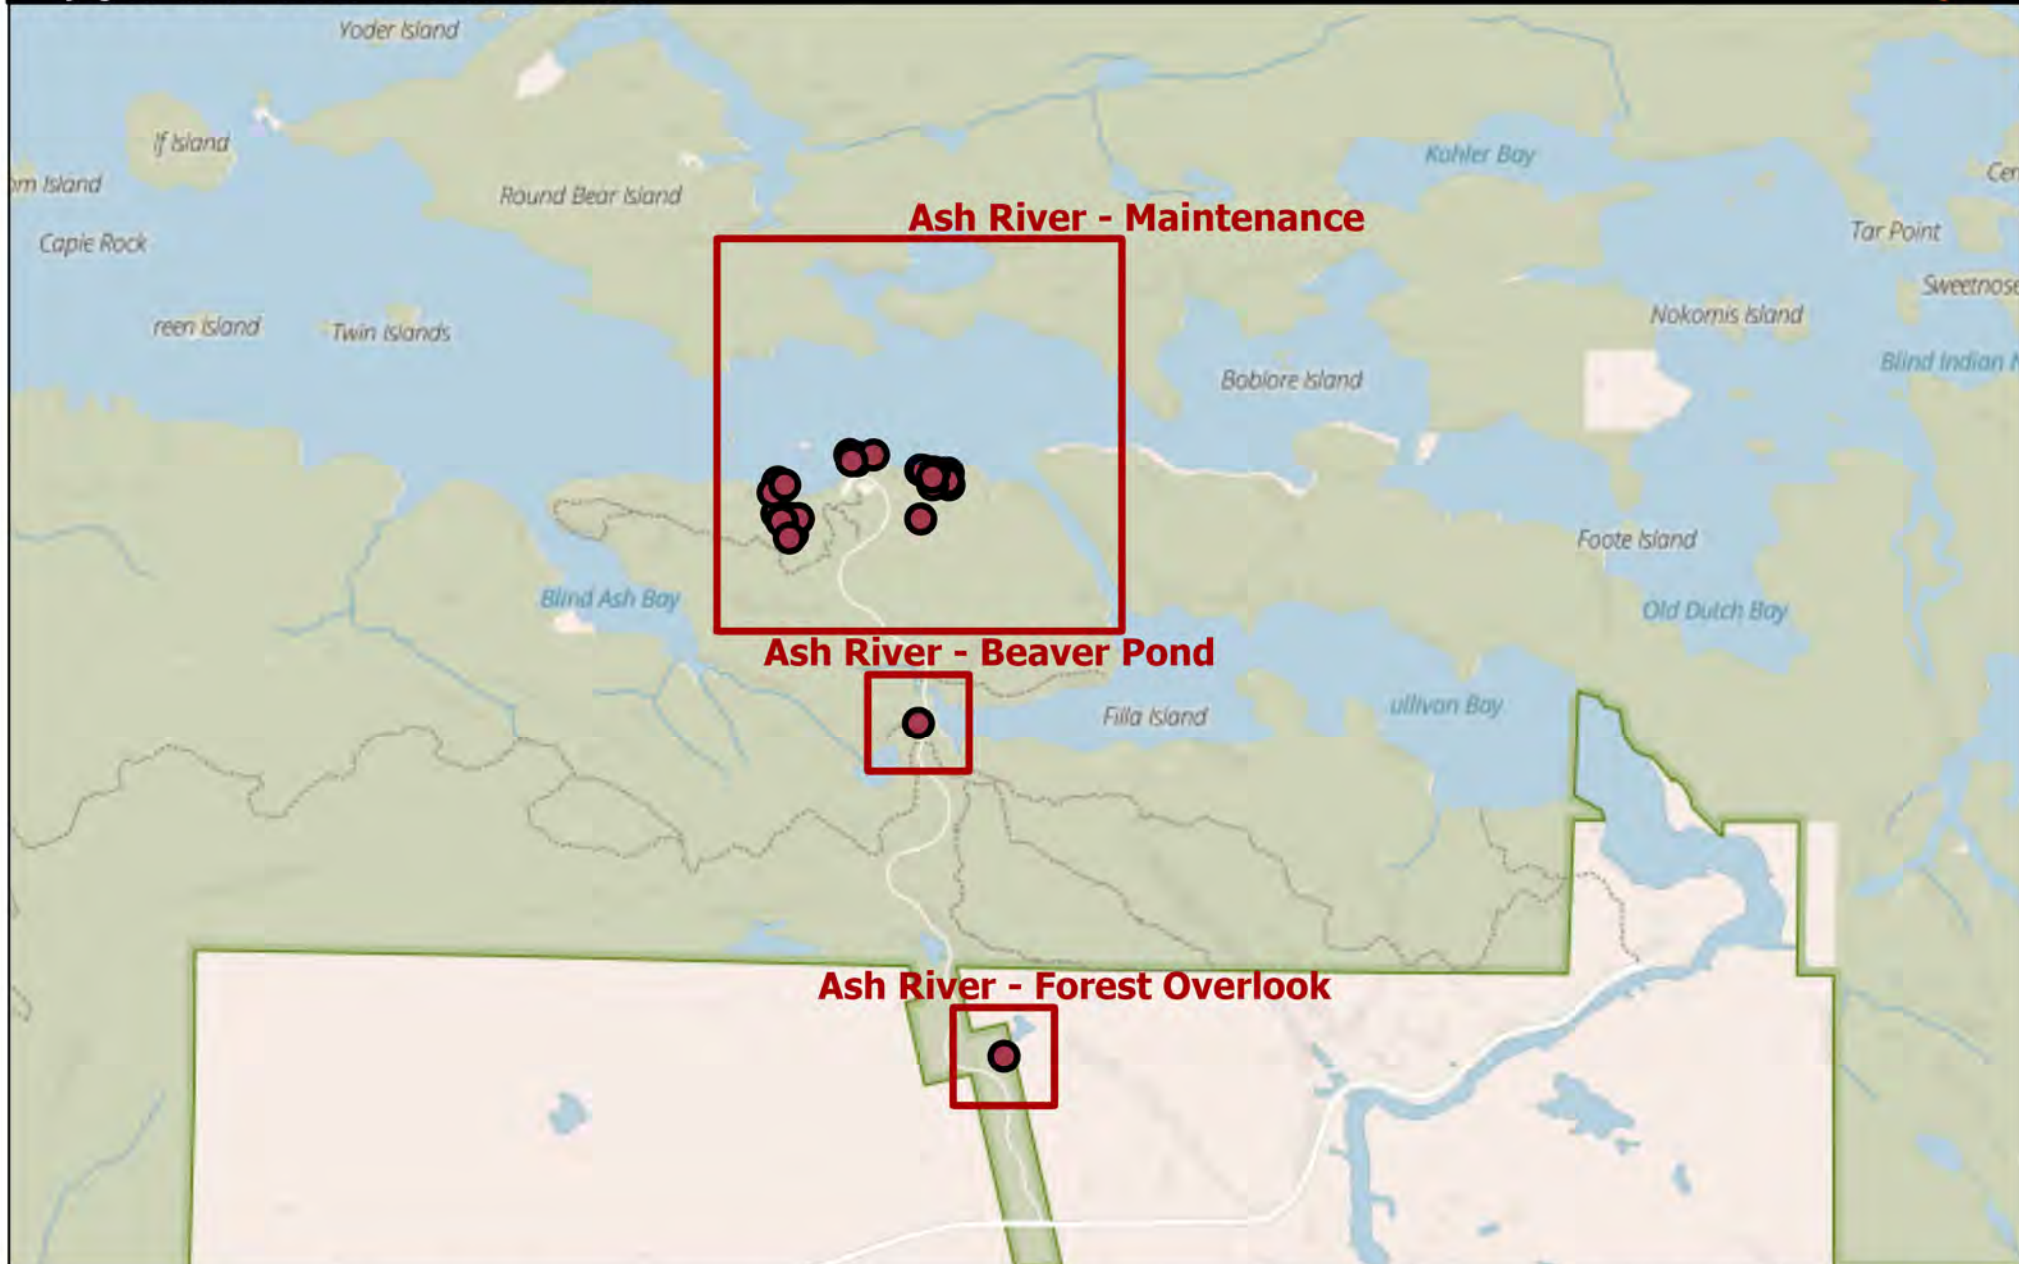

0

2.5

5

Miles

Author: sszturm
9/7/2023 7:27 PM

Intermountain Region Geographic Resources Division

June 2023

Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Ash River - Beaver Pond
VOYA - Voyageurs National Park

National Park Service
U.S. Department of the Interior



Rating


Facility

 High

Map Label	FMSS ID	Common Name
98	23366	NAR B179 Beaver Pond Overlook Comfort Station



Author: sszturm
9/7/2023 7:17 PM



NPS Wildfire Risk Assessments
NPS Fire GIS
June 2023
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project

Ash River - Forest Overlook

VOYA - Voyageurs National Park

National Park Service
U.S. Department of the Interior



Rating

Facility

 High

Map Label	FMSS ID	Common Name
108	17758	NAR B169 Unisex Comfort station at Forest Overlook



Author: sszturm
9/7/2023 7:19 PM

0 500 Feet
Scale: 1:3,000

NPS Wildfire Risk Assessments
NPS Fire GIS
June 2023
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project

Ash River - Maintenance

VOYA - Voyageurs National Park

National Park Service
U.S. Department of the Interior



Rating

Facility

- Moderate
- Not Found
- High
- Not Surveyed

Map Label	FMSS ID	Common Name
111	18260	Q-043B NAR BQ043B Whispering Pines Qtrs 0000043B
93	18246	NAR BH016 Laundry bldg. at ARVC
95	18247	NAR BH017 Ash River V.C. Historic Log Structure
96	18266	Q-0014 NAR BQ014 Qtrs at Ash River VC, Ranger Qtrs.00000014
97	17756	NAR B168 Comfort Station Ash River boat ramp
94	18241	NAR B174 Ash Riv comfort station w/full utilities
100	18264	Q-18264 NAR BQ053 Qtrs.53 at Whispering Pines housing area 00000053
101	18261	Q-0044 NAR BQ044 Qtrs 44 at Whispering Pines housing area 00000044
104	18259	Q-043A NAR BQ043A Whispering Pines Qtrs 0000043A
80	85976	NAR B097 Comfort Station at Levin Cabin
112	18254	Q-0041 NAR BQ041 Quarters #41 at Whispering Pines 00000041
83	18242	NAR B073 Fire Cache storage at Ash River
107	3934	Q-0054 NAR BQ54 Quarters Unit #54 00000054
105	18253	Q-0040 NAR BQ040 Quarters #40 at Whispering Pines 00000040
106	18262	Q-0051 NAR BQ051 Qtrs 51 at Whispering pines housing area 00000051
89	3931	NAR B094 Maintenance bldg. & shop
102	18256	Q-042A NAR BQ042A Qtrs. #42A at Whispering Pines 0000042A
79	18248	NAR BH081 Levin Cabin Historic Log bldg.
87	237815	Ash River Maintenance Garage 97
90	17751	Ash River Maintenance Garage 96
91	236649	Ash River Maintenance Greenhouse
78	Not in	Ash River Maintenance Carport
77	239779	Ash River Maintenance Sand Shed
84	18303	Ash River Maintenance Boat Dock Depot
99	00002898	Ash River Pumphouse
86	17754	NAR B164 Pesticide storage bldg. Ash River
85	23380	NAR B178 Haz-mat bldg. Ash River
82	17752	NAR B015 Cold storage bldg. Ash River maint. yard
92	69696	NAR B095 Operations Bldg at Ash River
81	18243	NAR B093 Capitol tool storage bldg Ash River Maint
103	18251	Q-0037 NAR BQ037 Quarters #37 at Whispering Pines 00000037
109	18243	Ash River Maintenance Storage Shed
110	237379	NAR B038 Laundry Bldg Whispering Pines
88	17751	NAR B045 Cold Storage bldg. ARMA



Author: sszturm
9/7/2023 7:23 PM

0

0.5
Miles

Scale: 1:12,000

NPS Wildfire Risk Assessments
NPS Fire GIS
June 2023
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-043B NAR BQ043B Whispering Pines Qtrs 0000043B

Unit - Location: VOYA - Ash River

FMSS ID: 18260, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.084' N 92° 50.694' W

Rating: Moderate

Protection Level: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 111

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments: Facility join to Q-043A. Pictures for facility attached to Q-043A





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR BH016 Laundry bldg. at ARVC

Unit - Location: VOYA - Ash River

FMSS ID: 18246, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.148' N 92° 51.054' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Visitor Center

Revisit Interval: 5 yrs

Map Label: 93

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Log construction

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

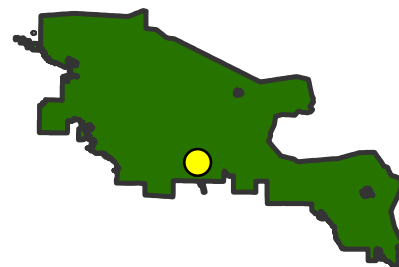



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR BH017 Ash River V.C. Historic Log Structure

Unit - Location: VOYA - Ash River

FMSS ID: 18247, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.131' N 92° 51.028' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Visitor Center

Revisit Interval: 5 yrs

Map Label: 95

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Log construction

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

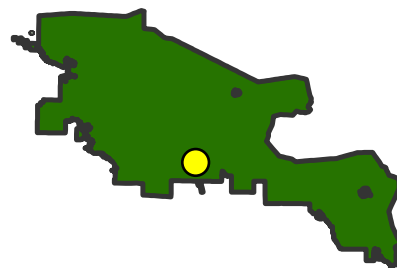



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0014 NAR BQ014 Qtrs at Ash River VC, Ranger Qtrs.00000014

Unit - Location: VOYA - Ash River

FMSS ID: 18266, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.139' N 92° 51.019' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Visitor Center

Revisit Interval: 5 yrs

Map Label: 96

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Log construction

Foundation: Open or deck

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B168 Comfort Station Ash River boat ramp
Unit - Location: VOYA - Ash River
FMSS ID: 17756, **Local ID:**
Structure Type, Use: Toilet, Public
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 26.147' N 92° 50.955' W

Rating: High
Protection Level: Full,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Ash River Visitor Center
Revisit Interval: 5 yrs
Map Label: 97

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 2 lanes (Greater than 24')
Access Condition: Surfaced-paved, grade Less than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Propane: None
Overhead Hazards: No overhead hazards
Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B174 Ash Riv comfort station w/full utilities

Unit - Location: VOYA - Ash River

FMSS ID: 18241, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, June 20, 2023

Coordinates (DDM): 48° 26.131' N 92° 51.048' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Visitor Center

Revisit Interval: 5 yrs

Map Label: 94

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: Adjacent to/under deck of facility

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-18264 NAR BQ053 Qtrs.53 at Whispering Pines housing area 00000053

Unit - Location: VOYA - Ash River

FMSS ID: 18264, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 100

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0044 NAR BQ044 Qtrs 44 at Whispering Pines housing area 00000044

Unit - Location: VOYA - Ash River

FMSS ID: 18261, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 101

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

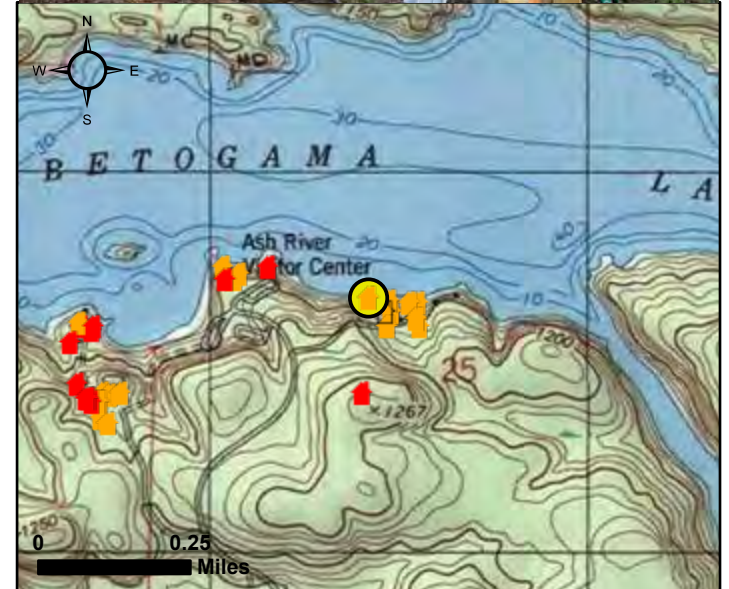



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-043A NAR BQ043A Whispering Pines Qtrs 0000043A

Unit - Location: VOYA - Ash River

FMSS ID: 18259, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.085' N 92° 50.693' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 104

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments: Facility join to Q-043B. Pictures for Q-043B are attached to this facility.

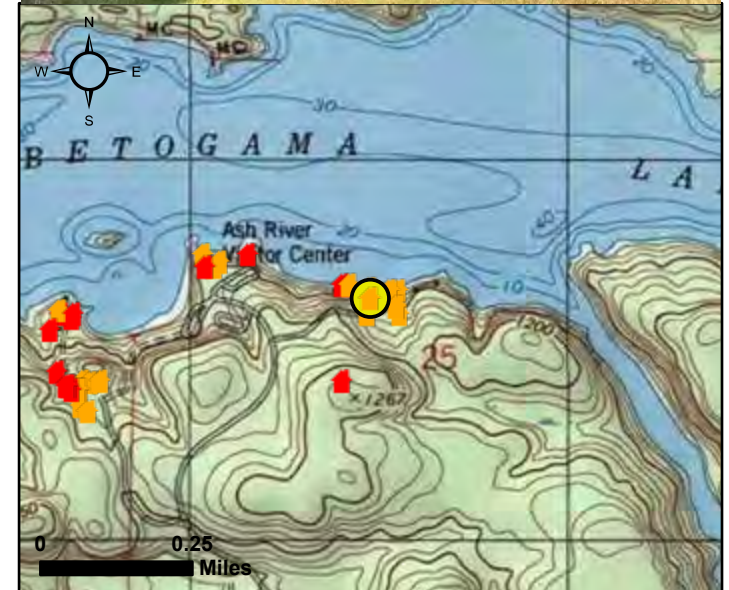



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B097 Comfort Station at Levin Cabin

Unit - Location: VOYA - Ash River

FMSS ID: 85976, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.063' N 92° 51.360' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 10 yrs

Map Label: 80

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6 in masonry exposed

Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B179 Beaver Pond Overlook Comfort Station
Unit - Location: VOYA - Ash River
FMSS ID: 23366, **Local ID:**
Structure Type, Use: Toilet, Public
Owner: National Park Service
Field Crew, Visit Date: J Doke, September 3, 2015
Coordinates (DDM): 48° 25.39021962' N 092° 50.76320388' W

Rating: High
ProtectionLevel: Full,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: yrs
Map Label: 98

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 2 lanes (Greater than 24')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: No defensible space
Topography: Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Open or deck
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards
Comments:






NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0041 NAR BQ041 Quarters #41 at Whispering Pines 00000041
Unit - Location: VOYA - Ash River
FMSS ID: 18254, **Local ID:**
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 26.096' N 92° 50.637' W

Rating: Moderate
ProtectionLevel: Full,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Ash River Quarters
Revisit Interval: 5 yrs
Map Label: 112

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with no turnaround
Access and Turnarounds: Less than 300 ft with no turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Open or deck
Firewood: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Propane: None
Overhead Hazards: No overhead hazards
Comments:

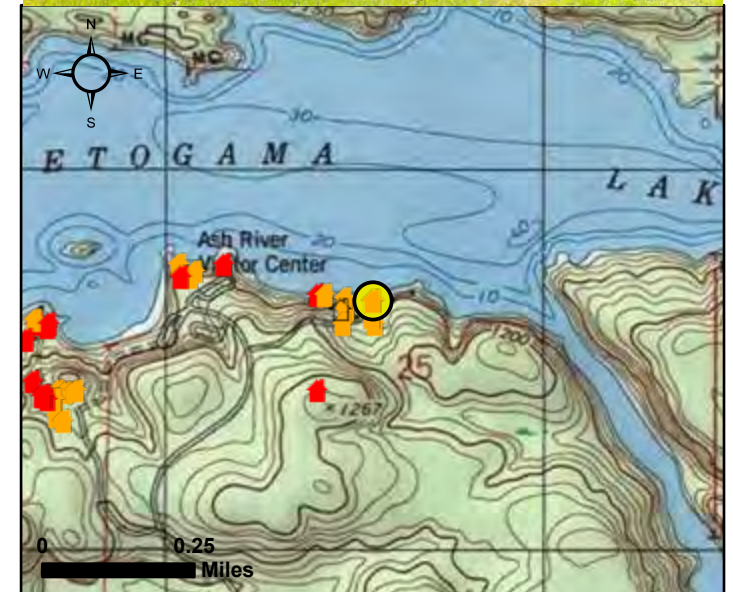



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B073 Fire Cache storage at Ash River

Unit - Location: VOYA - Ash River

FMSS ID: 18242, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.059' N 92° 51.335' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 83

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

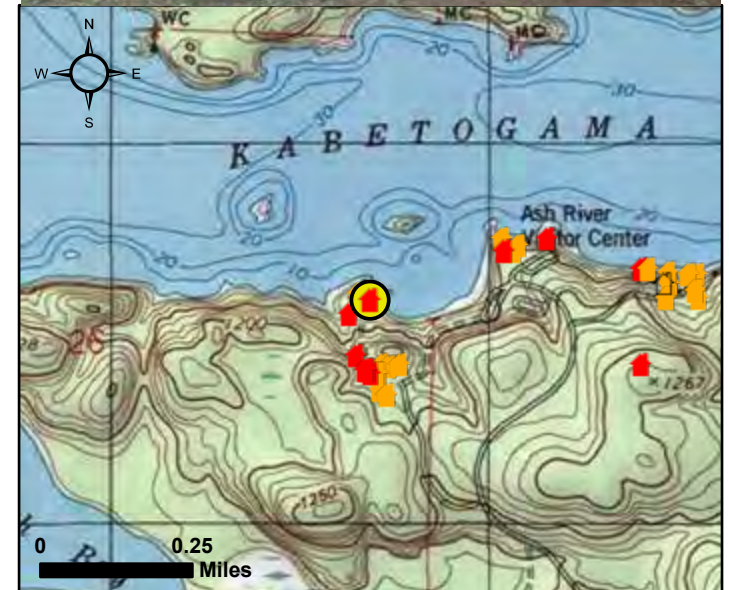



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0054 NAR BQ54 Quarters Unit #54 00000054

Unit - Location: VOYA - Ash River

FMSS ID: 3934, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.063' N 92° 50.633' W

Rating: Moderate

Protection Level: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 107

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:






NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0040 NAR BQ040 Quarters #40 at Whispering Pines 00000040
Unit - Location: VOYA - Ash River
FMSS ID: 18253, **Local ID:**
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 26.095' N 92° 50.656' W

Rating: Moderate
Protection Level: Full,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Ash River Quarters
Revisit Interval: 5 yrs
Map Label: 105

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, grade Greater than 5%
Bridge Condition: Less than 300 ft with no turnaround
Access and Turnarounds: Less than 300 ft with no turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Open or deck
Firewood: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Propane: None
Overhead Hazards: No overhead hazards
Comments:

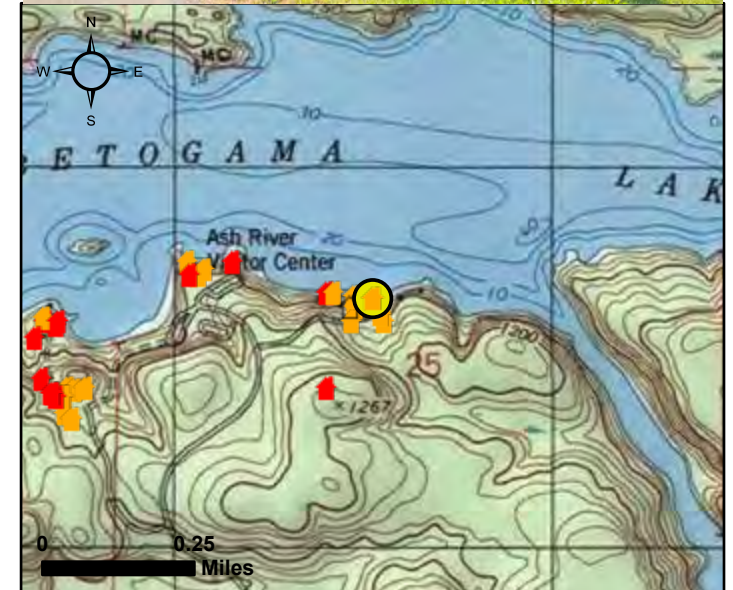



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B169 Unisex Comfort station at Forest Overlook

Unit - Location: VOYA - Ash River

FMSS ID: 17758, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 24.448' N 92° 50.400' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 108

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Limited or dependent on electricity

Propane: None

Overhead Hazards: No overhead hazards

Comments:

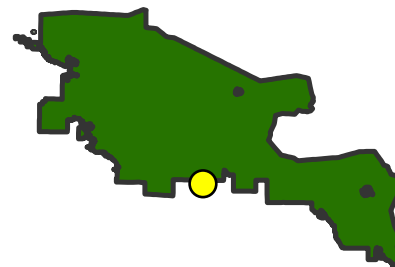



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0051 NAR BQ051 Qtrs 51 at Whispering pines housing area
00000051

Unit - Location: VOYA - Ash River

FMSS ID: 18262, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Rating: Moderate

Protection Level: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 106

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

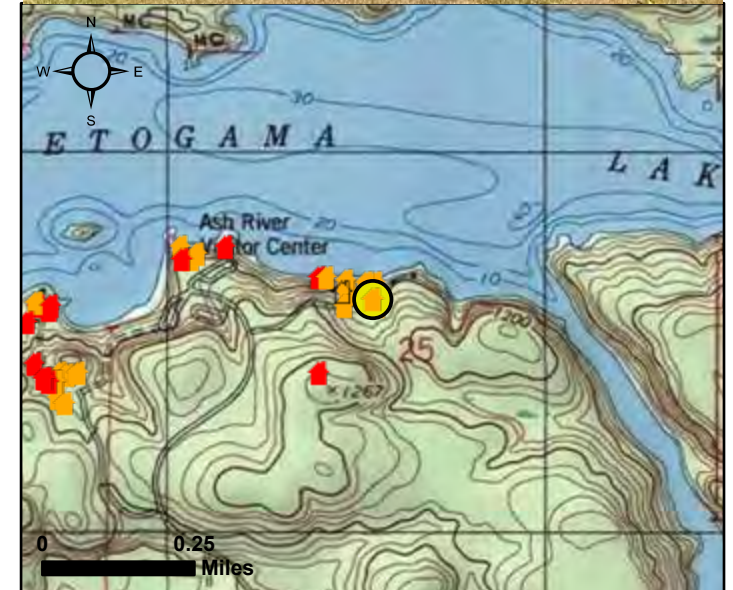



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B094 Maintenance bldg. and shop

Unit - Location: VOYA - Ash River

FMSS ID: 3931, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.969' N 92° 51.311' W

Rating: Moderate

Protection Level: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 89

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: Adjacent to/under deck of facility

Water Supply: Reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:






NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-042A NAR BQ042A Qtrs. #42A at Whispering Pines 0000042A
Unit - Location: VOYA - Ash River
FMSS ID: 18256, **Local ID:**
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 26.063' N 92° 50.702' W

Rating: Moderate
Protection Level: Full,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Ash River Quarters
Revisit Interval: 5 yrs
Map Label: 102

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, grade Greater than 5%
Bridge Condition: Less than 300 ft with no turnaround
Access and Turnarounds: Less than 300 ft with no turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Open or deck
Firewood: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Propane: None
Overhead Hazards: No overhead hazards
Comments:

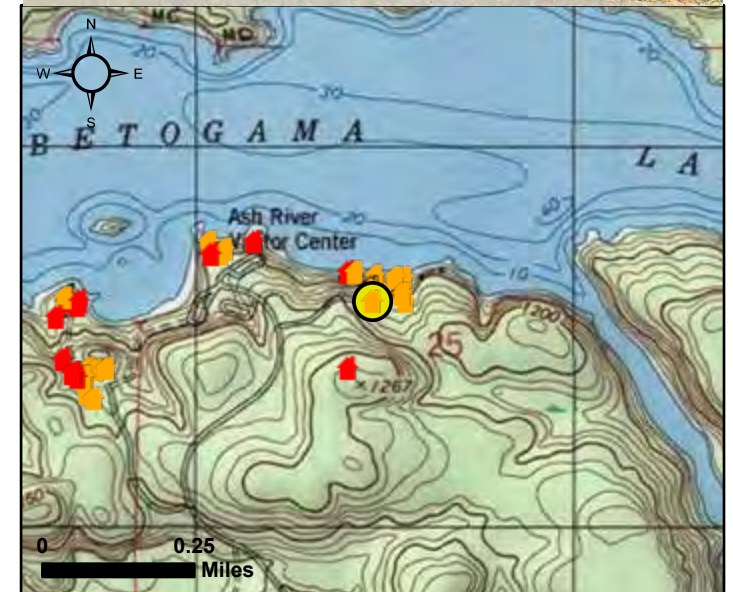



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR BH081 Levin Cabin Historic Log bldg.

Unit - Location: VOYA - Ash River

FMSS ID: 18248, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.070' N 92° 51.361' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 10 yrs

Map Label: 79

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Log construction

Foundation: Open or deck


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

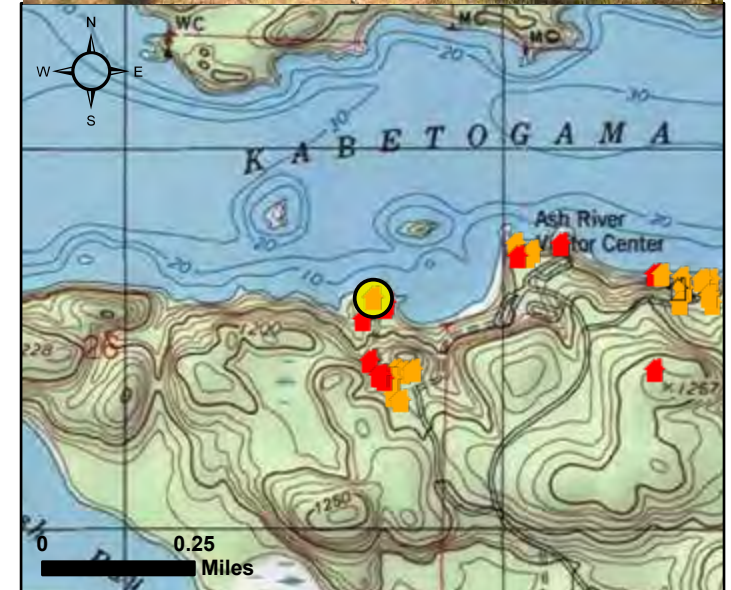




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Garage 97
Unit - Location: VOYA - Ash River
FMSS ID: 237815, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 25.933' N 92° 51.315' W

Rating: Moderate
Protection Level: Full,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Ash River Maintenance
Revisit Interval: 5 yrs
Map Label: 87

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, grade Greater than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: Reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments:

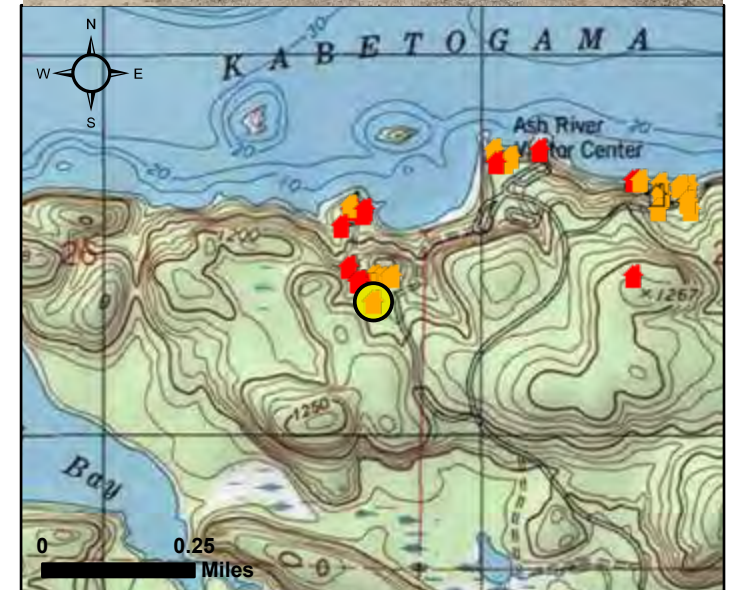




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Garage 96
Unit - Location: VOYA - Ash River
FMSS ID: 17751, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 25.924' N 92° 51.299' W

Rating: Moderate
Protection Level: Full,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Ash River Maintenance
Revisit Interval: 5 yrs
Map Label: 90

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, grade Greater than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: Reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments:

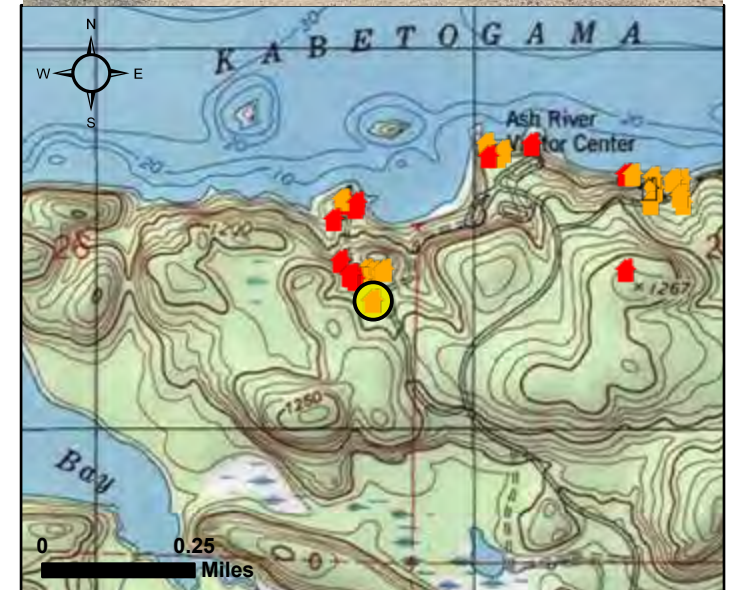



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Greenhouse

Unit - Location: VOYA - Ash River

FMSS ID: 236649, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo, June 20, 2023

Coordinates (DDM): 48° 25.967' N 92° 51.297' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 91

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Vinyl

Foundation: Closed, Less than 6in masonry exposed


Firewood: 5ft to 30ft from facility

Water Supply: Reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:

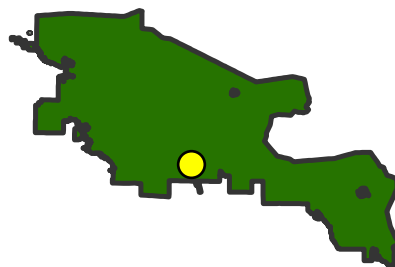



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Carport
Unit - Location: VOYA - Ash River
FMSS ID: Not in System, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Castillo , June 20, 2023
Coordinates (DDM): 48° 25.982' N 92° 51.365' W

Rating: High
Protection Level: Full,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Ash River Maintenance
Revisit Interval: 5 yrs
Map Label: 78

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, grade Greater than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: No defensible space
Topography: Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Firewood: None
Water Supply: Reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Sand Shed

Unit - Location: VOYA - Ash River

FMSS ID: 239779, **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.041' N 92° 51.382' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 77

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

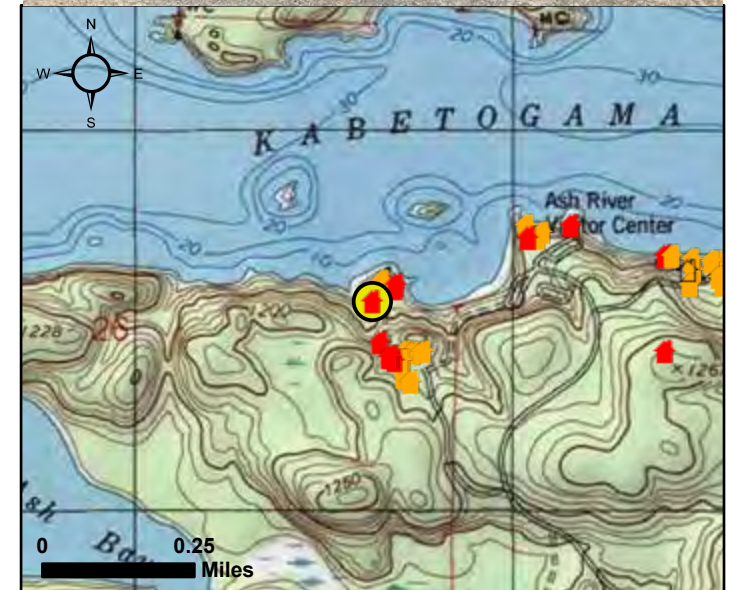



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Boat Dock Depot

Unit - Location: VOYA - Ash River

FMSS ID: 18303, **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.063' N 92° 51.332' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 84

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

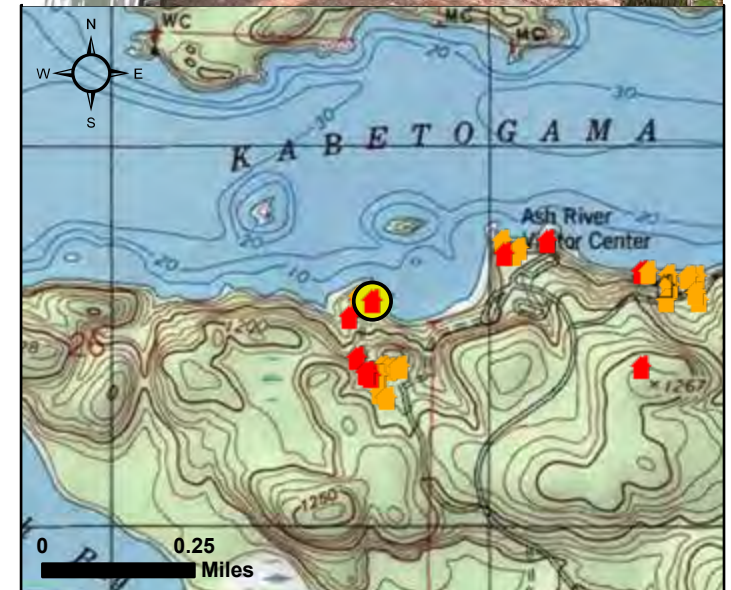



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Pumphouse

Unit - Location: VOYA - Ash River

FMSS ID: 00002898, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.967' N 92° 50.754' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 99

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Limited or dependent on electricity

Propane: None

Overhead Hazards: No overhead hazards

Comments:

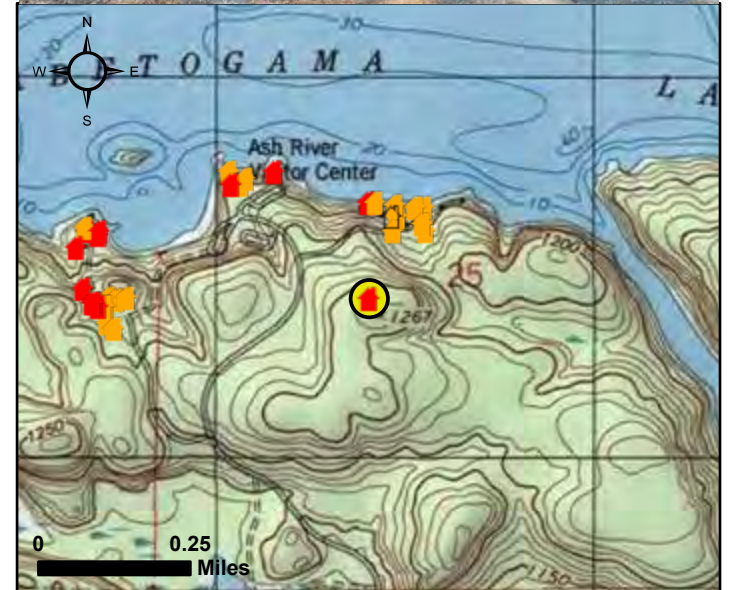



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B164 Pesticide storage bldg. Ash River

Unit - Location: VOYA - Ash River

FMSS ID: 17754, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.956' N 92° 51.320' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 86

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed



Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

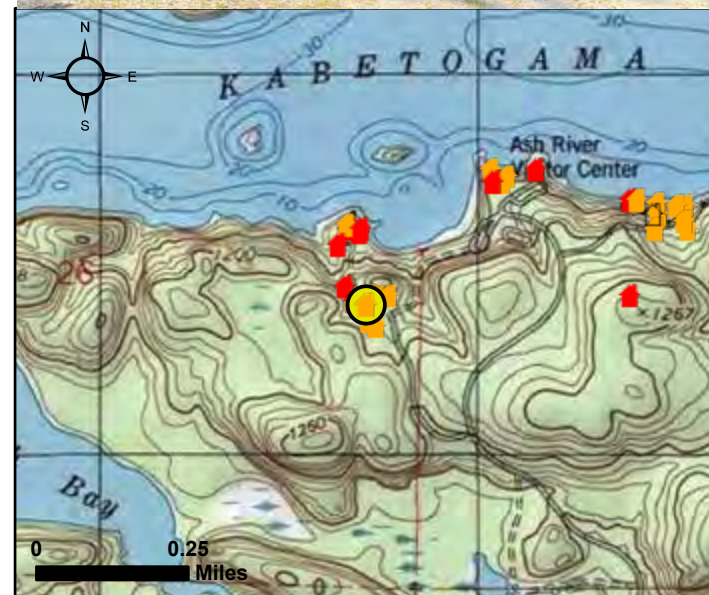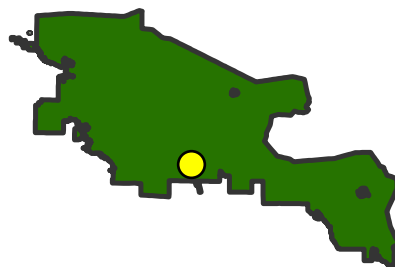



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B178 Haz-mat bldg. Ash River

Unit - Location: VOYA - Ash River

FMSS ID: 23380, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.955' N 92° 51.324' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 10 yrs

Map Label: 85

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: Reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B015 Cold storage bldg. Ash River maint. yard

Unit - Location: VOYA - Ash River

FMSS ID: 17752, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.956' N 92° 51.336' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 82

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:

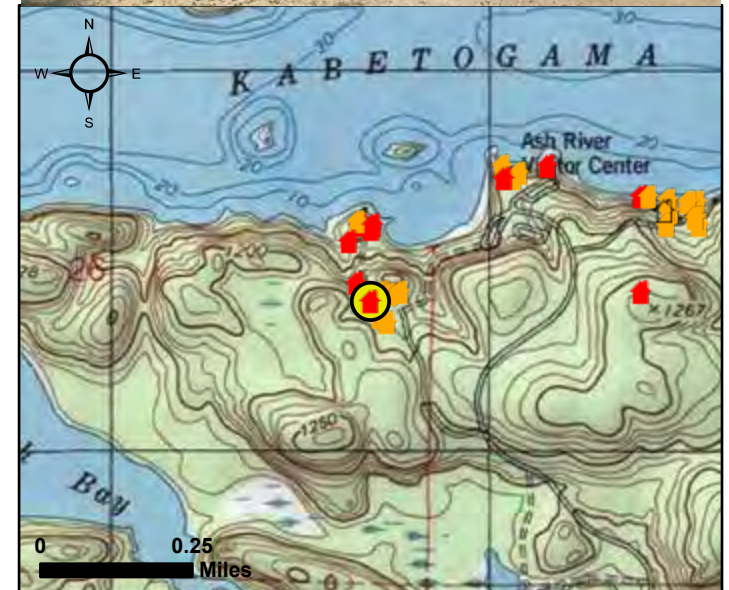



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B095 Operations Bldg at Ash River

Unit - Location: VOYA - Ash River

FMSS ID: 69696, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.968' N 92° 51.275' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 92

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: Reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B093 Capitol tool storage bldg Ash River Maint

Unit - Location: VOYA - Ash River

FMSS ID: 18243, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.960' N 92° 51.343' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 81

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

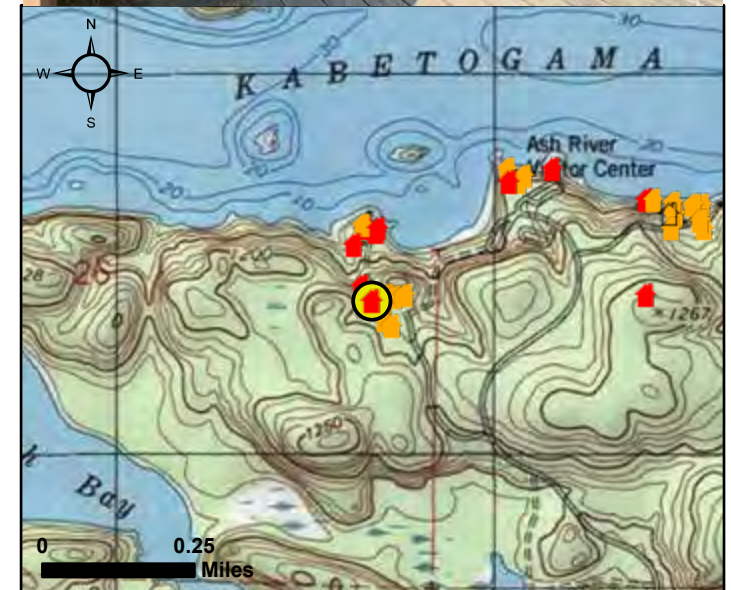



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Q-0037 NAR BQ037 Quarters #37 at Whispering Pines 00000037

Unit - Location: VOYA - Ash River

FMSS ID: 18251, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 26.099' N 92° 50.696' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: 5 yrs

Map Label: 103

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Ash River Maintenance Storage Shed

Unit - Location: VOYA - Ash River

FMSS ID: 18243, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , June 20, 2023

Coordinates (DDM): 48° 25.961' N 92° 51.345' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Ash River Maintenance

Revisit Interval: 5 yrs

Map Label: 109

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:

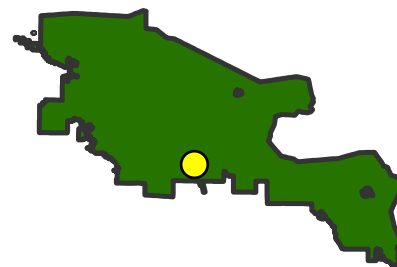



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NAR B038 Laundry Bldg Whispering Pines

Unit - Location: VOYA - Ash River

FMSS ID: 237379, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: J Doke, September 3, 2015

Coordinates (DDM): 48° 26.08437714' N 092° 50.70424902' W

Rating: Not Surveyed

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Ash River Quarters

Revisit Interval: yrs

Map Label: 110

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane:

Overhead Hazards: No overhead hazards

Comments:

