


NPS Wildfire Risk Assessments

Assessment Locations

Theodore Roosevelt National Park

National Park Service
U.S. Department of the Interior

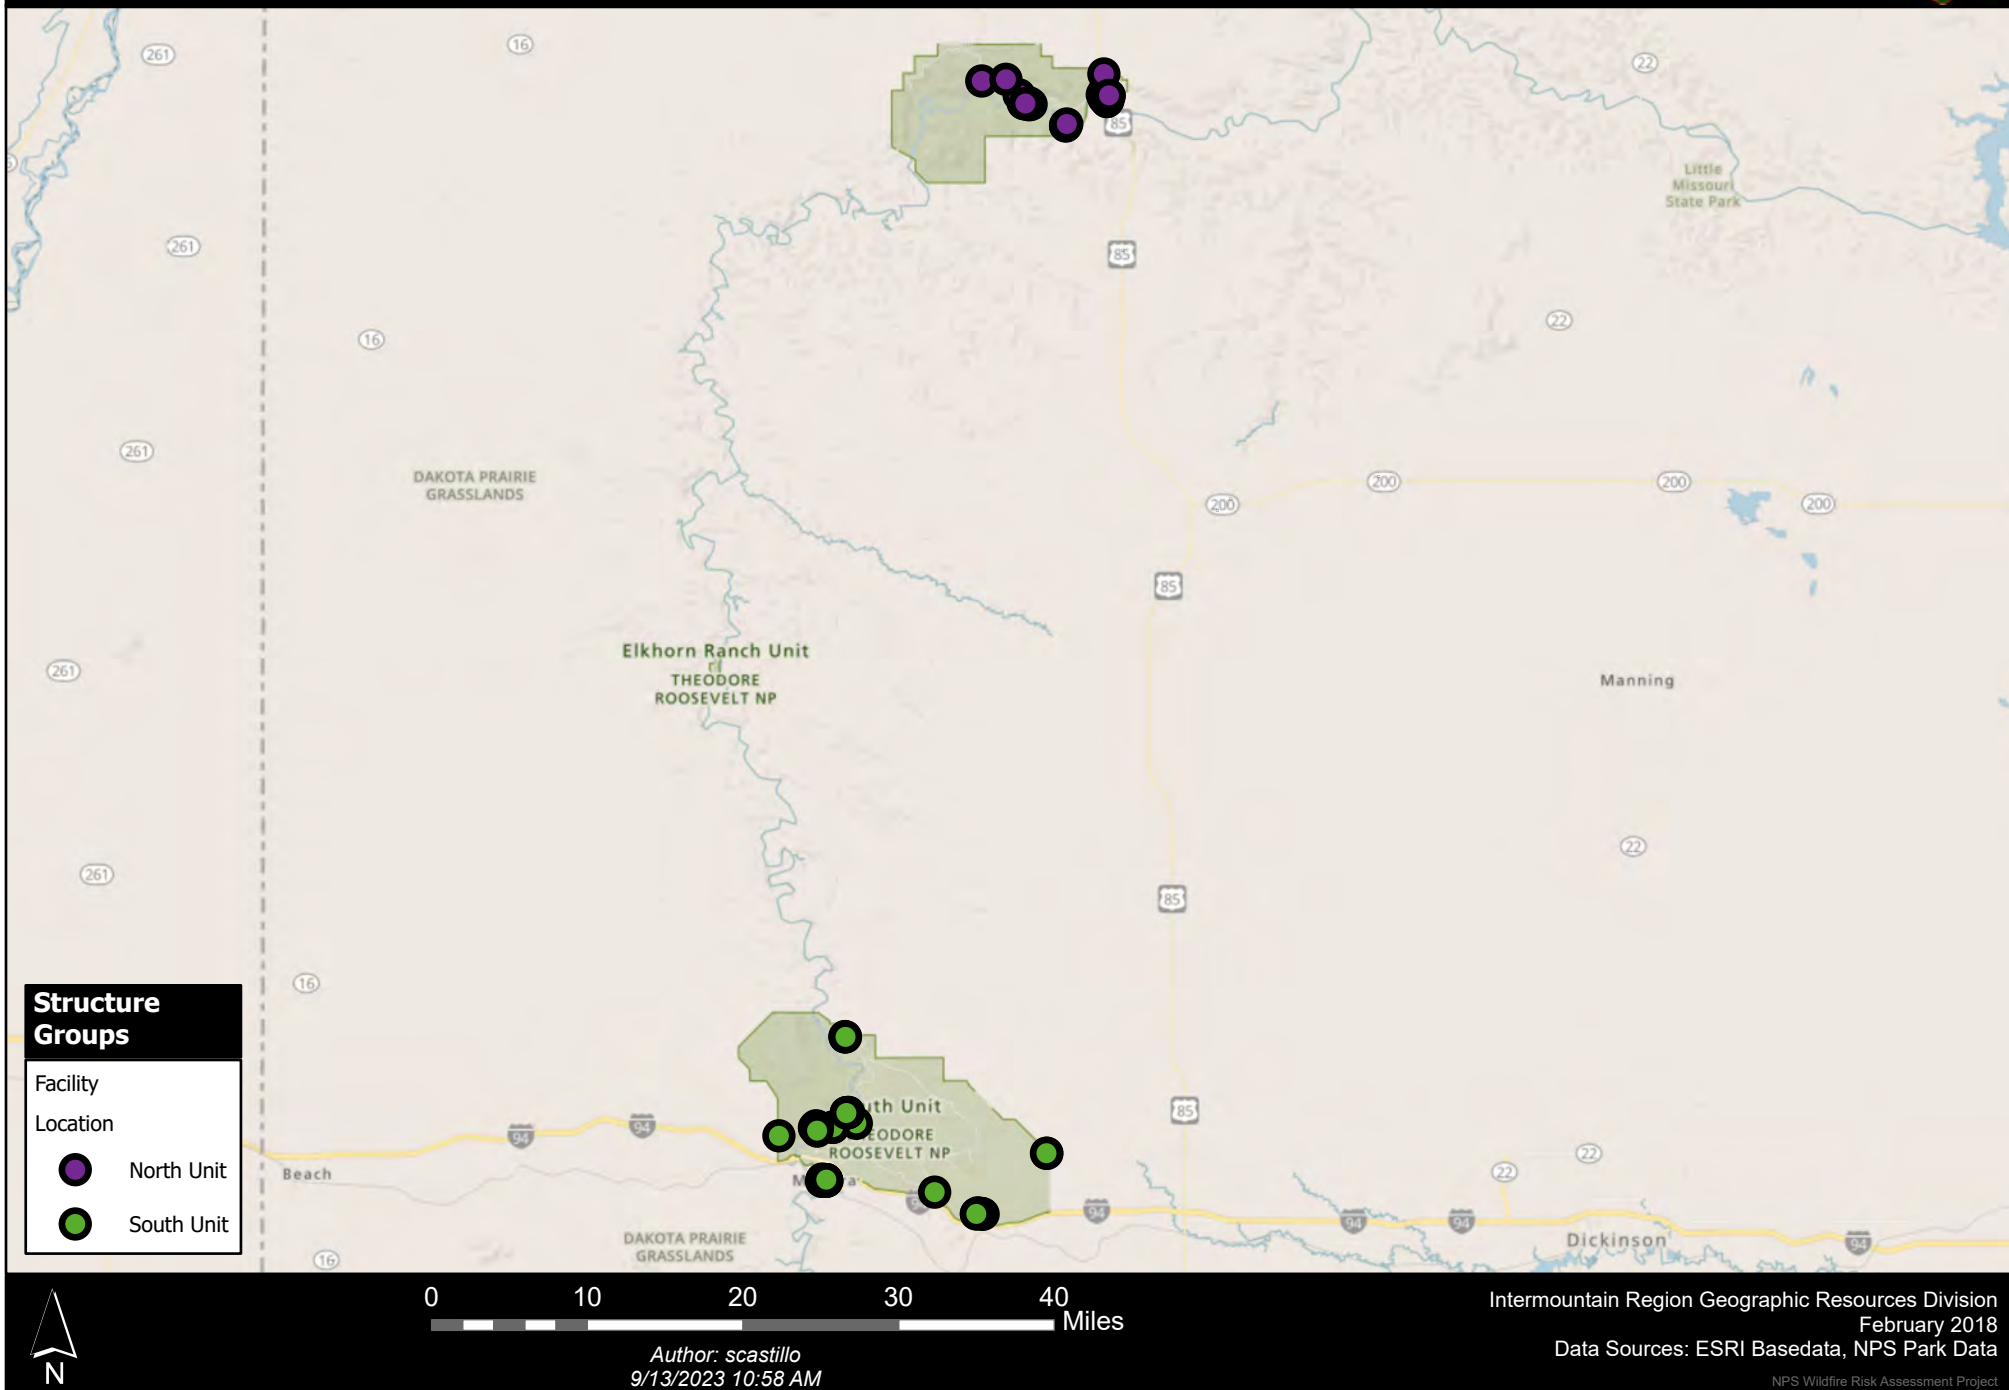

NPS Wildfire Risk Assessments Assessment Locations

Theodore Roosevelt National Park-North Unit

National Park Service
U.S. Department of the Interior



North Unit 1

North Unit 2

North Unit 3

US 85, ND 200

US 85, ND 200

Structure Groups

Location

- North Unit (35)
- South Unit (0)

0 2 4 Miles

Author: scastillo
9/16/2022 4:51 PM

Intermountain Region Geographic Resources Division
July 2022
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project


North Unit 1

THRO

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
1	28415	NU-Historic Shelter 215, Overlook Area

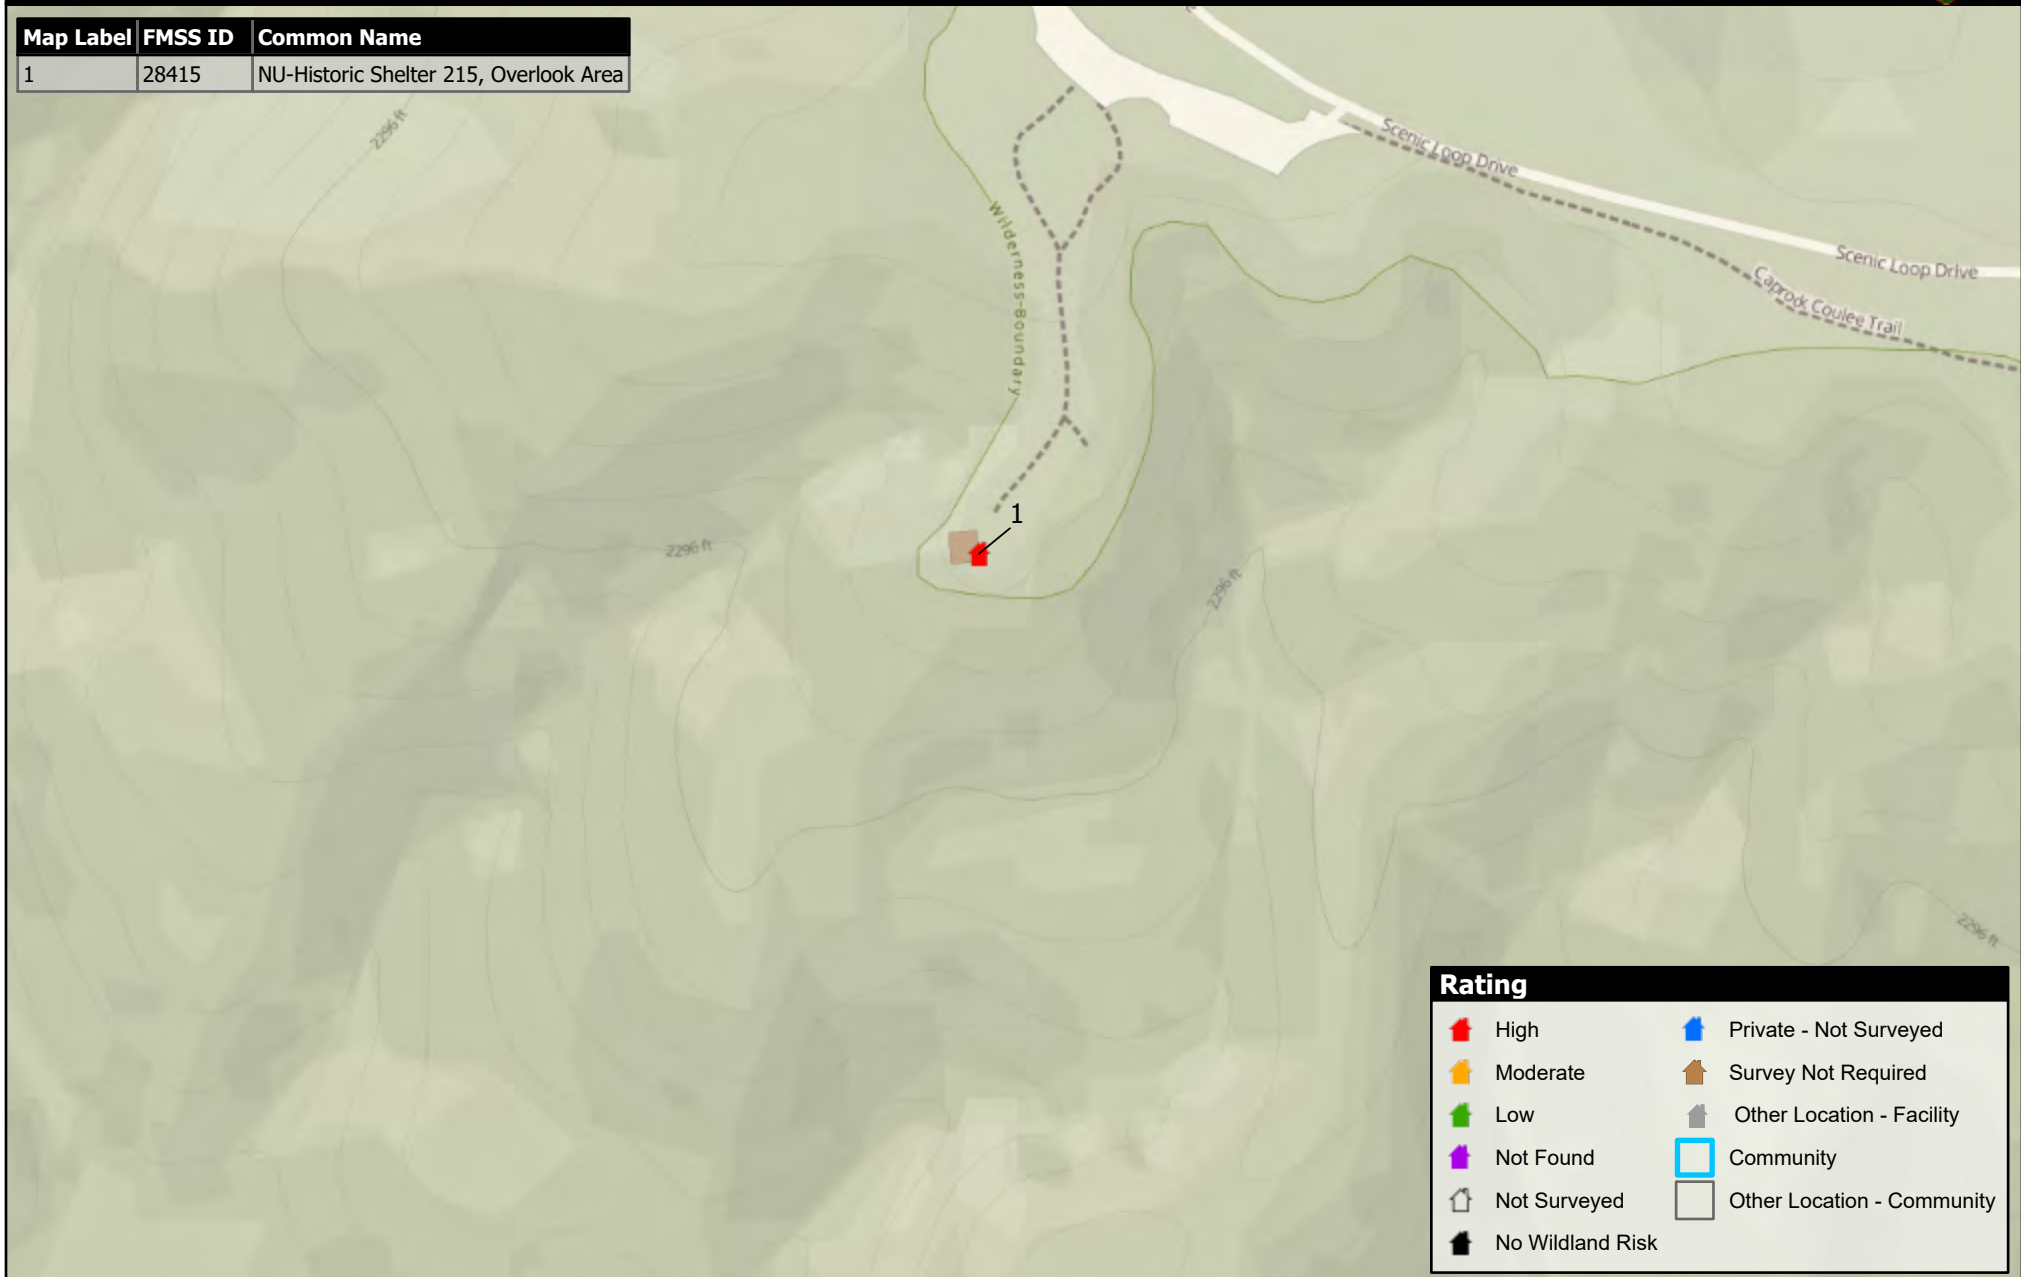

Rating	
High	Private - Not Surveyed
Moderate	Survey Not Required
Low	Other Location - Facility
Not Found	Community
Not Surveyed	Other Location - Community
No Wildland Risk	



Author: scastillo
9/16/2022 5:40 PM

0 500 Feet
Scale: 1:3,000

NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project


North Unit 2

THRO

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
10	28450	NU-Historic Shelter 213
2	28453	NU-Campground - Wellhouse 225
3	28448	NU-Restroom 68, Campgrounds
4	28454	NU-Juniper Campground Vault Restroom 230
5	28447	NU-Restroom 67, Picnic Area
6	not found	NU - Amphitheater
7	28451	NU-Historic Shelter 214 (Picnic Area)
8	28449	NU-Restroom 69, Group Camp
9	28455	NU-Quarters 239, Seasonal "Camptenders' Residence"

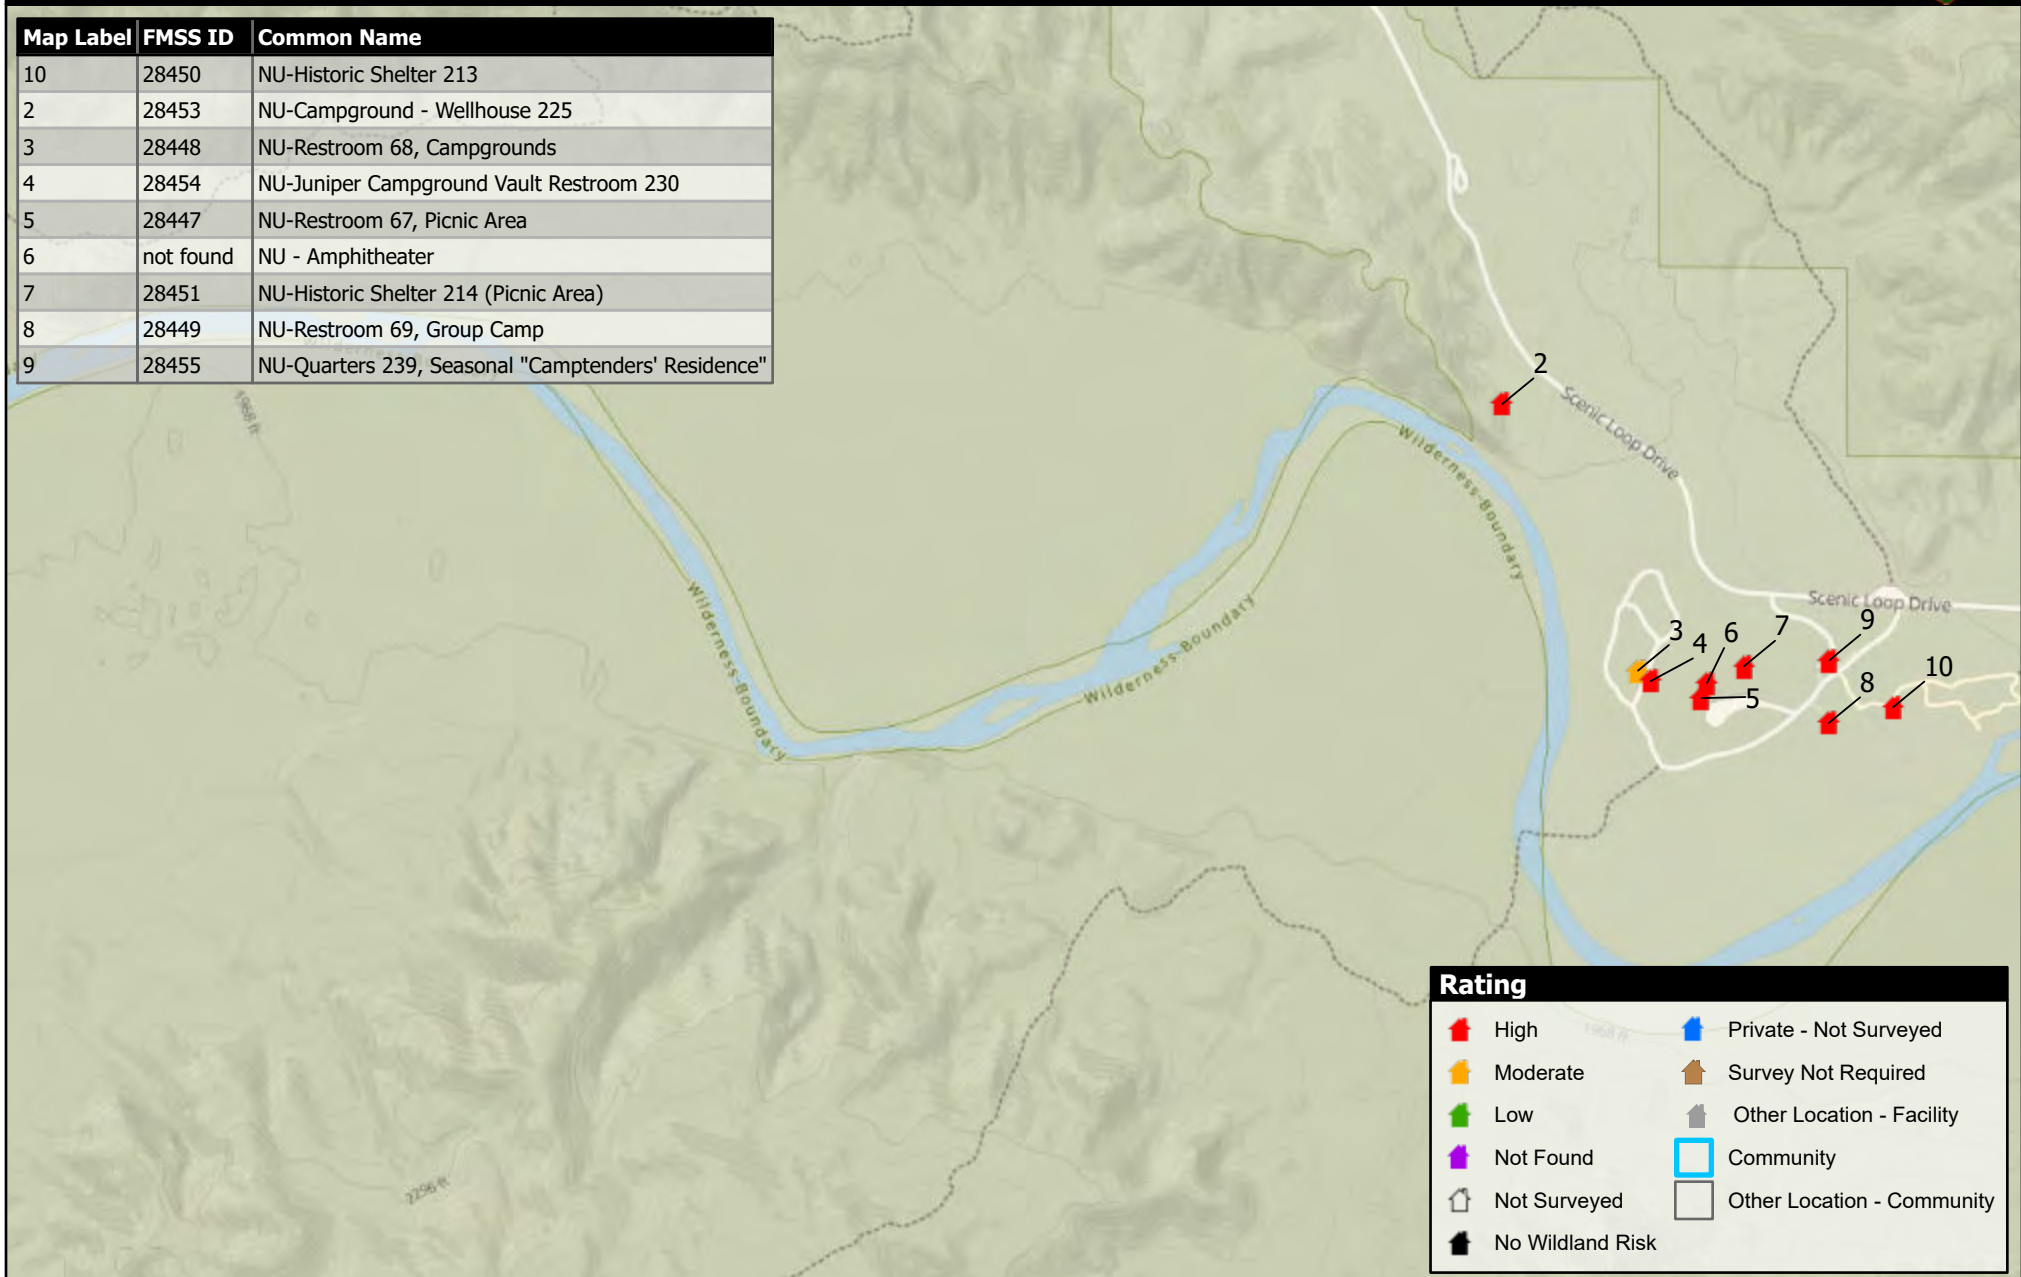

Rating			
	High		Private - Not Surveyed
	Moderate		Survey Not Required
	Low		Other Location - Facility
	Not Found		Community
	Not Surveyed		Other Location - Community
	No Wildland Risk		



Author: scastillo
9/16/2022 5:39 PM

0 0.25 0.5 0.75 1 Miles
Scale: 1:24,000

NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project


North Unit 3

THRO

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
15	28428	NU-Headquarters-Wellhouse 212
17	28424	NU-Historic HQ Storage House 209 (Grey House)
18	28426	NU-Gray House Garage 211
19	28429	NU-Entrance Station 217
19	not found	visitor center
20	28434	NU - Quarters 204, Alan/Ron
21	28435	NU - Quarters 204B, Permanent
22	28433	NU - Quarters 203, Permanent-Greg
23	28431	NU - Quarters 201, Seasonal
24	28432	NU - Quarters 202, Seasonal
25	28437	NU - Quarters 205B, Permanent
26	28436	NU - Quarters 205, Duane/Seasonal
27	not found	NU - Storage Garage
28	not found	NU - Storage Garage 2
29	not found	NU - Flammables Storage Cabinet
30	not found	NU - Mower Shed
31	28425	NU - Carpenter Shop 210
32	not found	NU - Wood Shop
33	28421	NU - Custodial Storage Building 238

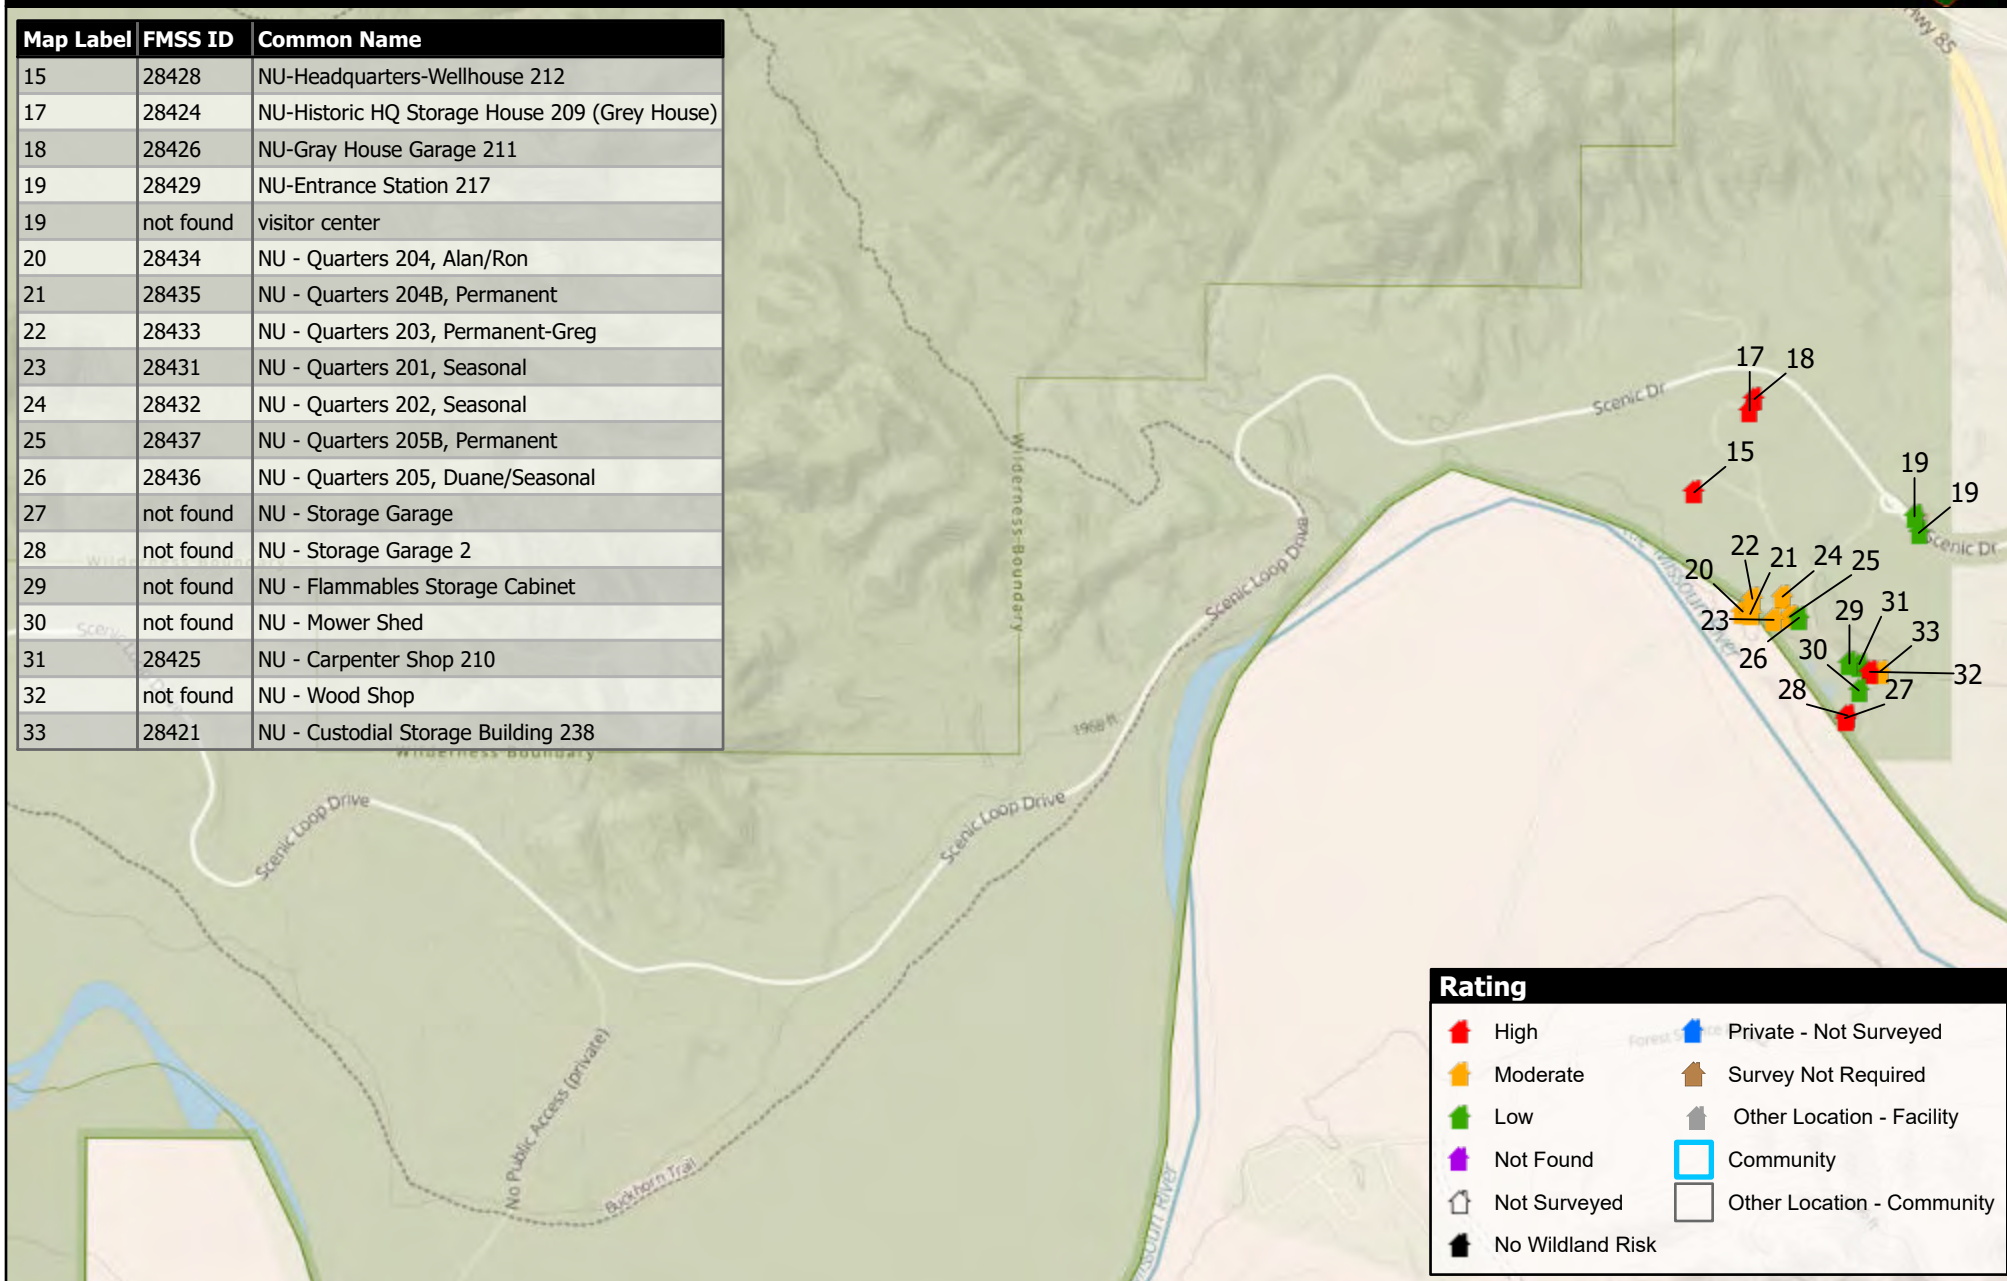

Author: scastillo
9/16/2022 5:39 PM

0 0.25 0.5 0.75 1 Miles

Scale: 1:24,000

NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Custodial Storage Building 238

Unit - Location: THRO - North Unit

FMSS ID: 28421, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.80396848' N 103° 15.66169812' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 33

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: River bank 25 ft behind structure.

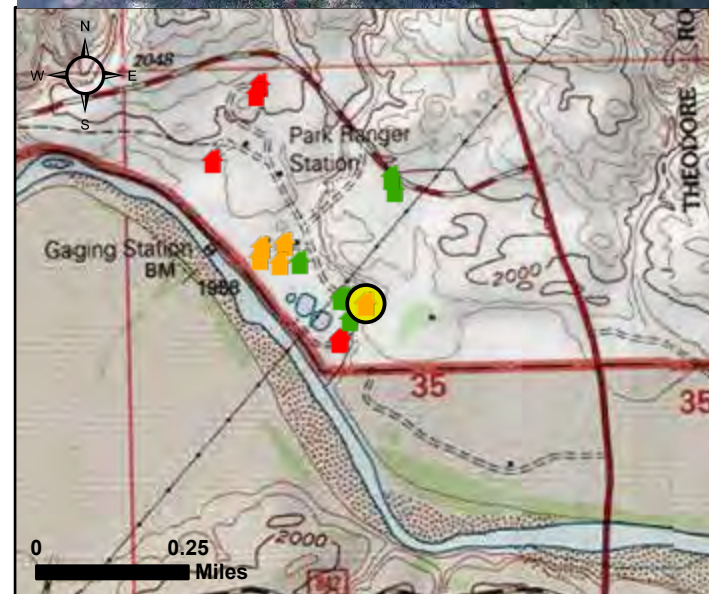



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Restroom 68, Campgrounds

Unit - Location: THRO - North Unit

FMSS ID: 28448, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.68941132' N 103° 20.38098690' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 3

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 100 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

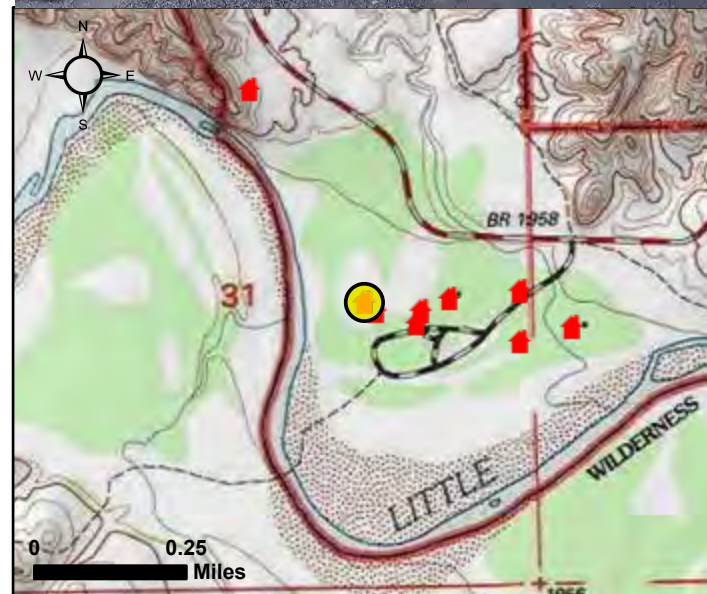



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Gray House Garage 211

Unit - Location: THRO - North Unit

FMSS ID: 28426, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 36.11850510' N 103° 15.87688650' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 18

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combination of fire resisitant and combustible

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

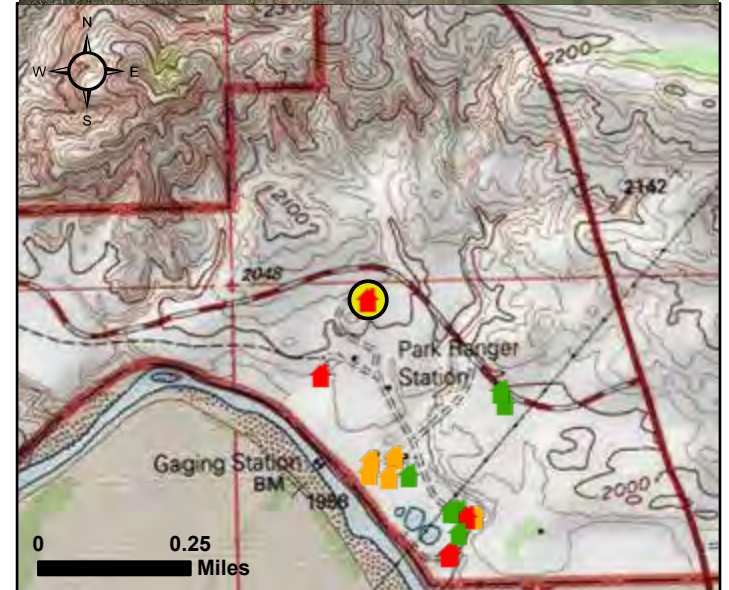



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-WHF Pit Toilet 241

Unit - Location: THRO - North Unit

FMSS ID: 28465, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 34.82933994' N 103° 18.01151046' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 13

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

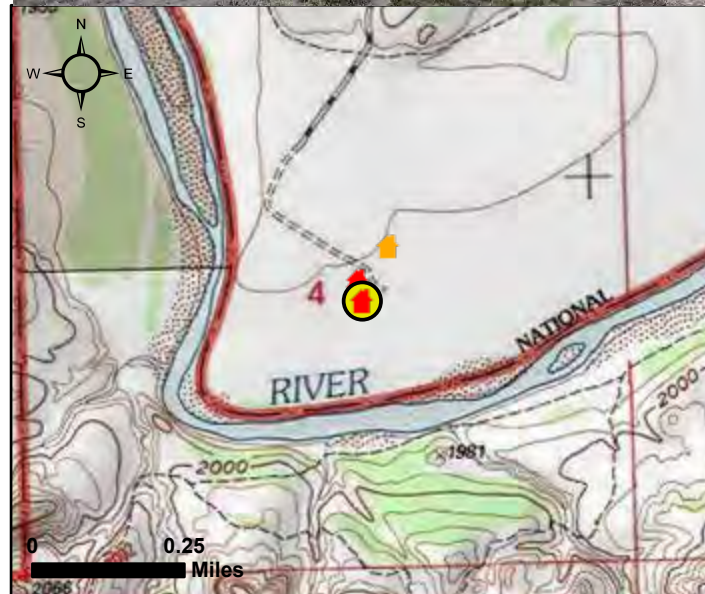



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Headquarters-Wellhouse 212

Unit - Location: THRO - North Unit

FMSS ID: 28428, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 36.01095588' N 103° 15.97981668' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 15

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

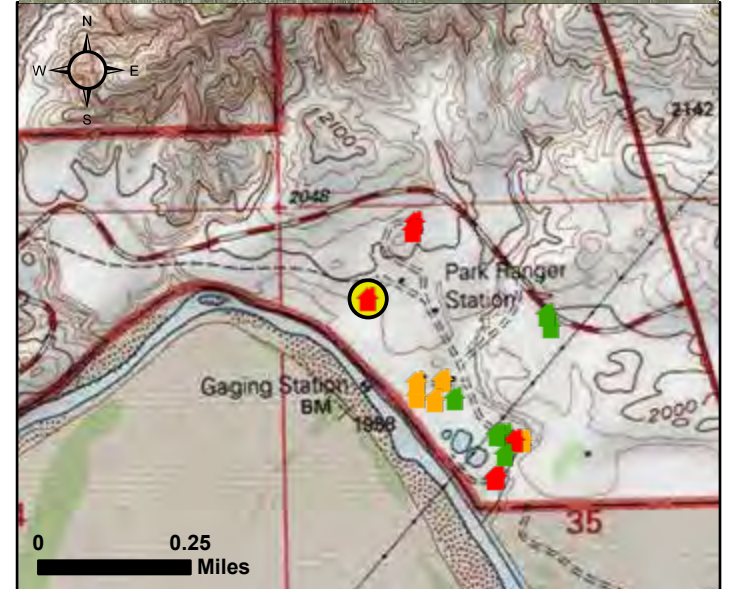



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Restroom 67, Picnic Area

Unit - Location: THRO - North Unit

FMSS ID: 28447, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, July 29, 2022

Coordinates (DDM): 47° 35.65794000' N 103° 20.27203200' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 5

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

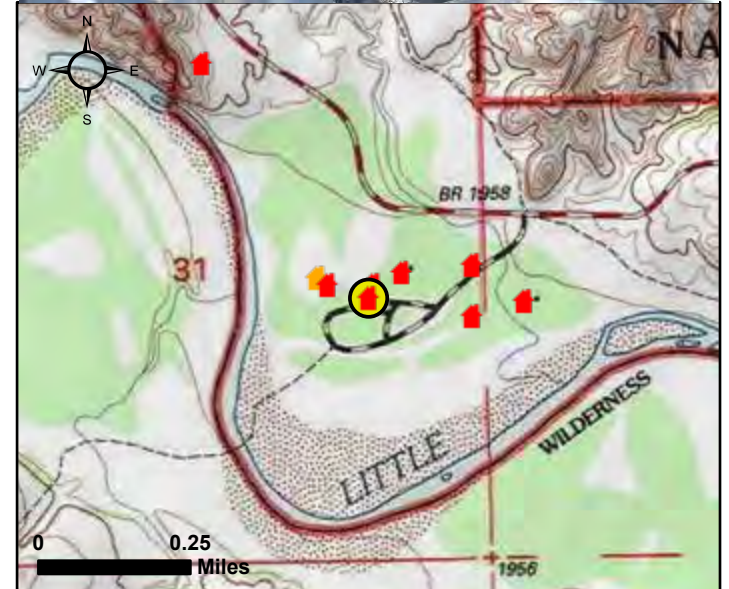



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Historic HQ Storage House 209 (Grey House)

Unit - Location: THRO - North Unit

FMSS ID: 28424, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 36.10543086' N 103° 15.88490136' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 17

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

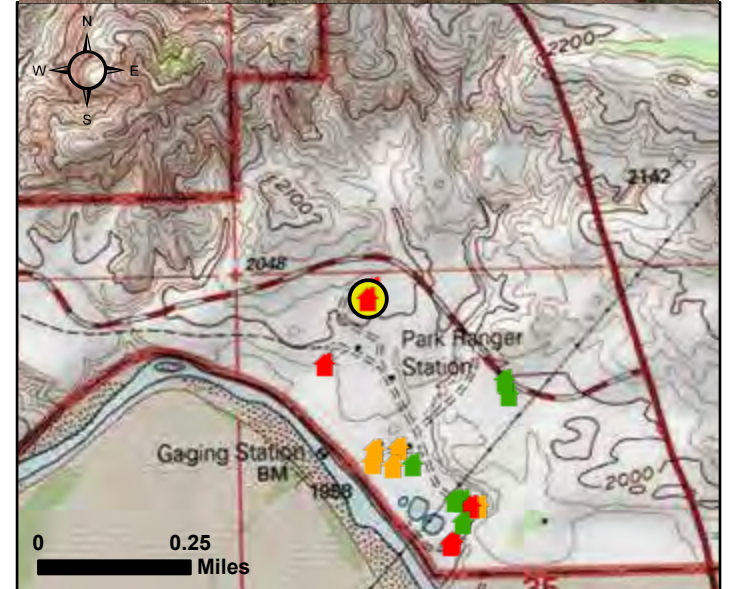



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-WHF Tack Shed 240

Unit - Location: THRO - North Unit

FMSS ID: 28464, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 34.84881468' N 103° 18.02107422' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 12

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: No reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Radio Equipment Building 220

Unit - Location: THRO - North Unit

FMSS ID: 28430, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 36.78679872' N 103° 15.88903650' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 16

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, 6in to 30in masonry exposed


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: Accessed by non maintained one lane road.
Radio Tower may be hazard to aircraft.

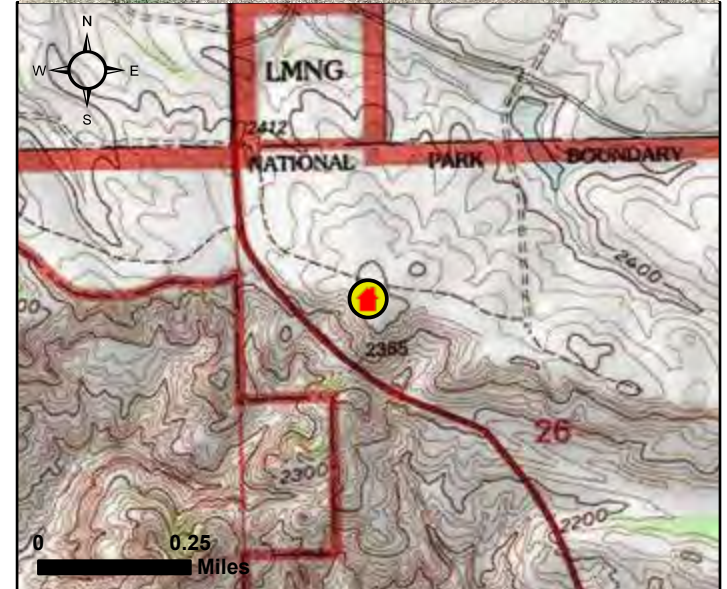



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Historic Shelter 215, Overlook Area

Unit - Location: THRO - North Unit

FMSS ID: 28415, **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 36.52299240' N 103° 22.69054998' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 1

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Greater than 40%

Roof Material: Combustible or no roof

Siding Material: Not applicable

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Historic Structure

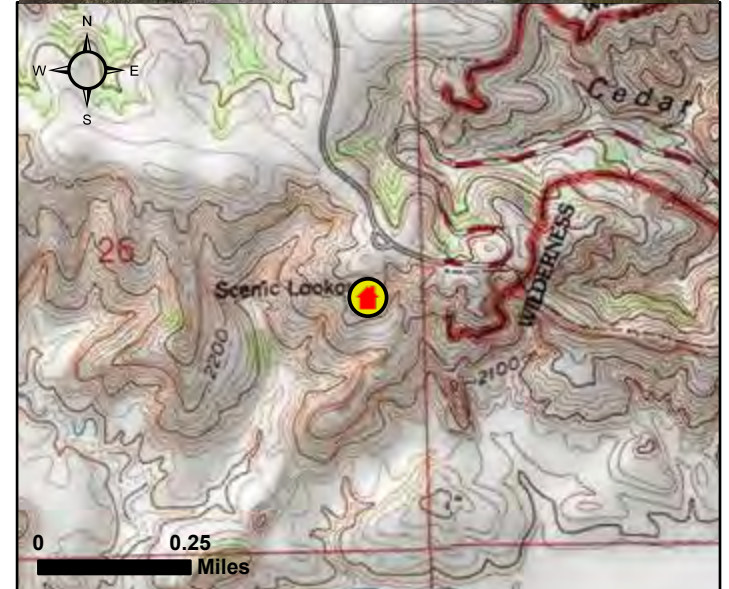



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Historic Shelter 213

Unit - Location: THRO - North Unit

FMSS ID: 28450, **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.64750096' N 103° 19.94394072' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 10

Primary Access: Foot

Ingress Egress: N/A,access by foot,boat,or air only

Access Width: N/A,access by foot,boat,or air only

Access Condition: N/A,access by foot,boat,or air only

Bridge Condition: N/A,access by foot,boat,or air only

Access and Turnarounds: N/A,access by foot,boat,or air only

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Accessed by walking over small wooden bridge from group campground.

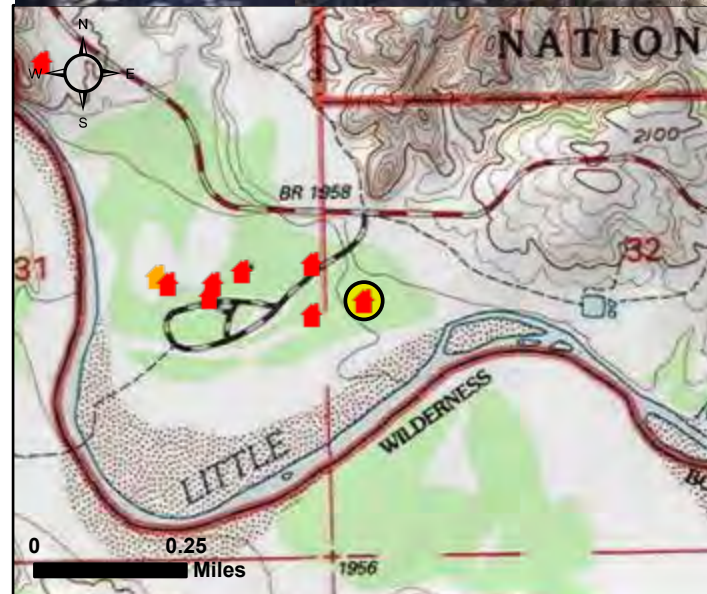



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Quarters 202, Seasonal

Unit - Location: THRO - North Unit

FMSS ID: 28432, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.89066566' N 103° 15.82899348' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 24

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

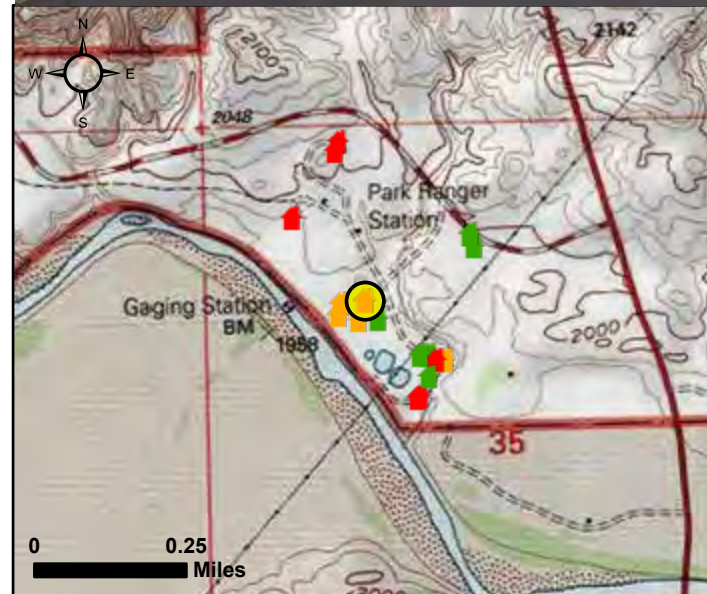




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Juniper Campground Vault Restroom 230
Unit - Location: THRO - North Unit
FMSS ID: 28454, **Local ID:**
Structure Type, Use: Toilet, Public
Owner: National Park Service
Field Crew, Visit Date: Castillo , July 29, 2022
Coordinates (DDM): 47° 35.67762240' N 103° 20.35908564' W

Rating: High
ProtectionLevel: Full,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 5 yrs
Map Label: 4

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: No reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments:

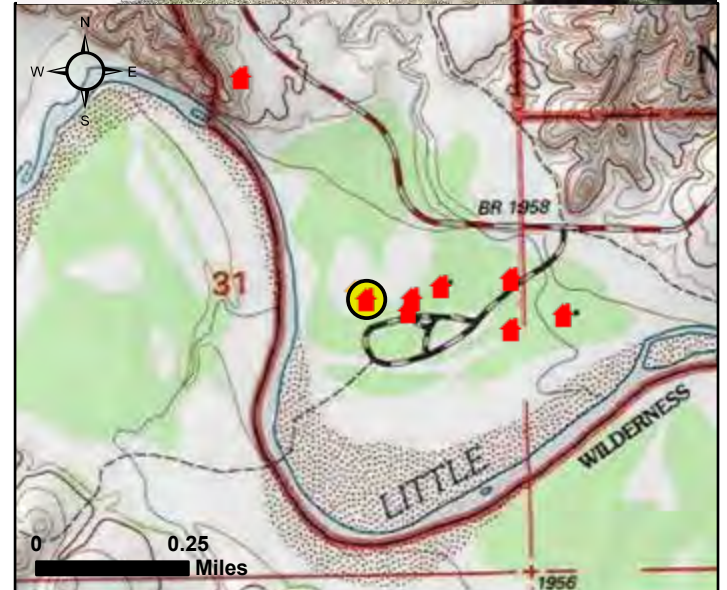



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Quarters 239, Seasonal "Camptenders Residence"

Unit - Location: THRO - North Unit

FMSS ID: 28455, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.70163194' N 103° 20.05338522' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 5 yrs

Map Label: 9

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: No reliable water source nearby

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments: May not be occupied but has potential to be.





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Historic Shelter 214 (Picnic Area)

Unit - Location: THRO - North Unit

FMSS ID: 28451, **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.69432730' N 103° 20.19970968' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 7

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

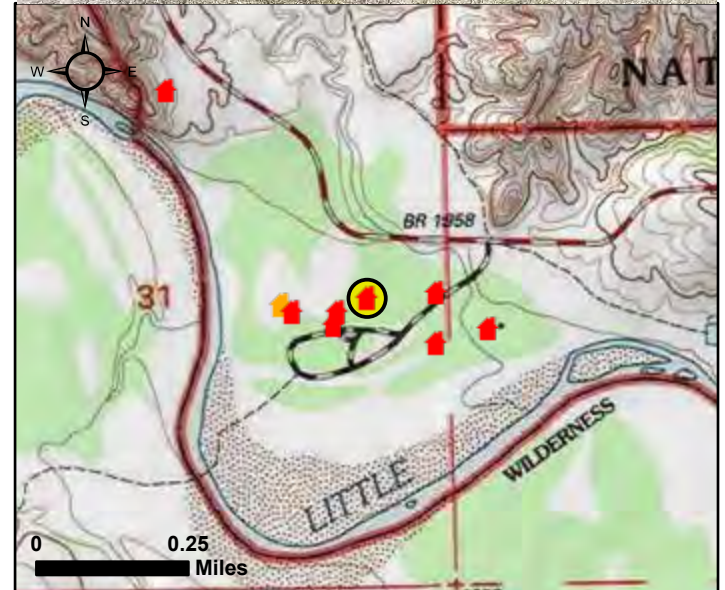



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Entrance Station 217

Unit - Location: THRO - North Unit

FMSS ID: 28429, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.96401800' N 103° 15.59555412' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 5 yrs

Map Label: 19

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: High voltage powerlines east of structure could limit aircraft.

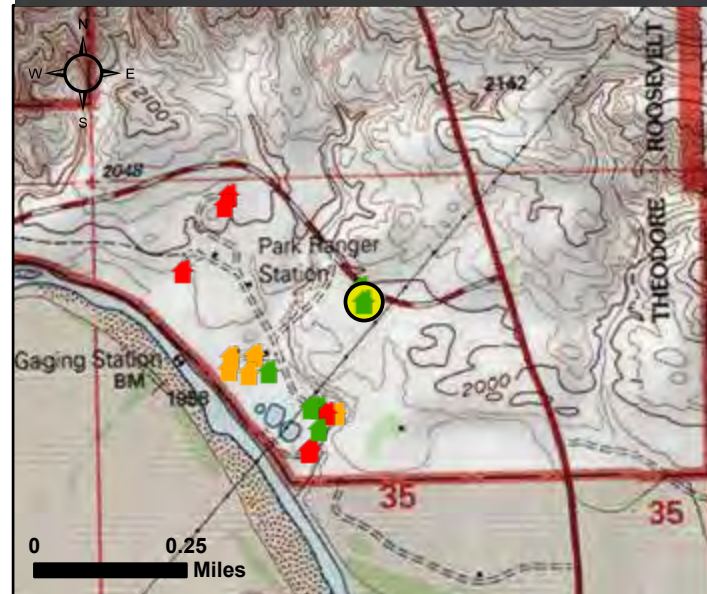



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Restroom 69, Group Camp

Unit - Location: THRO - North Unit

FMSS ID: 28449, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.62909326' N 103° 20.05411728' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 8

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

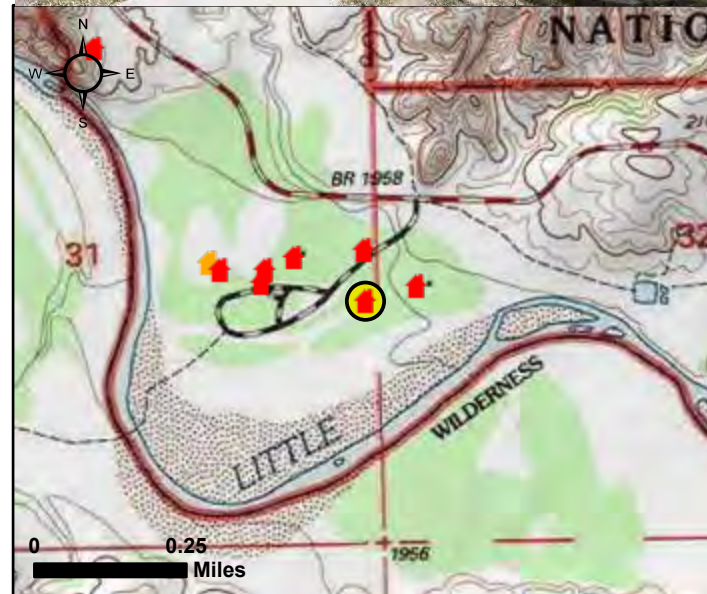



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Quarters 201, Seasonal

Unit - Location: THRO - North Unit

FMSS ID: 28431, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.86366416' N 103° 15.84406506' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 23

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

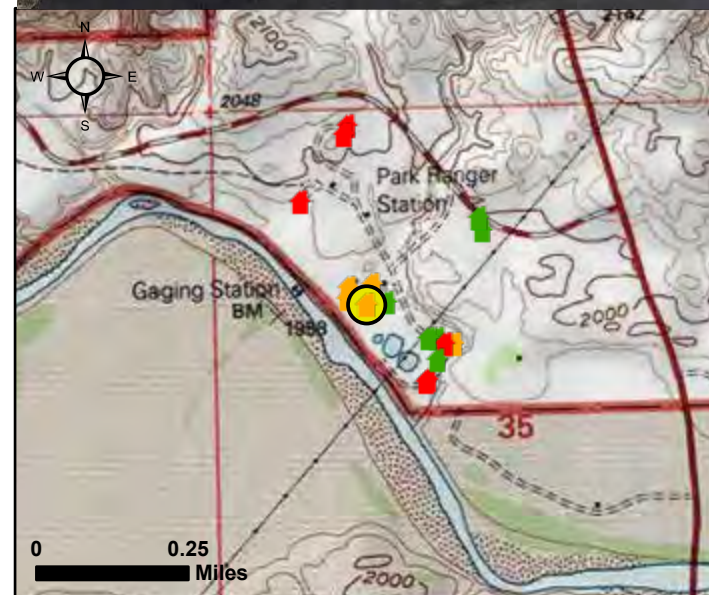



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-Campground - Wellhouse 225

Unit - Location: THRO - North Unit

FMSS ID: 28453, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.99724540' N 103° 20.61307344' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 2

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Greater than 40%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Sets at the bse of a steep slope.

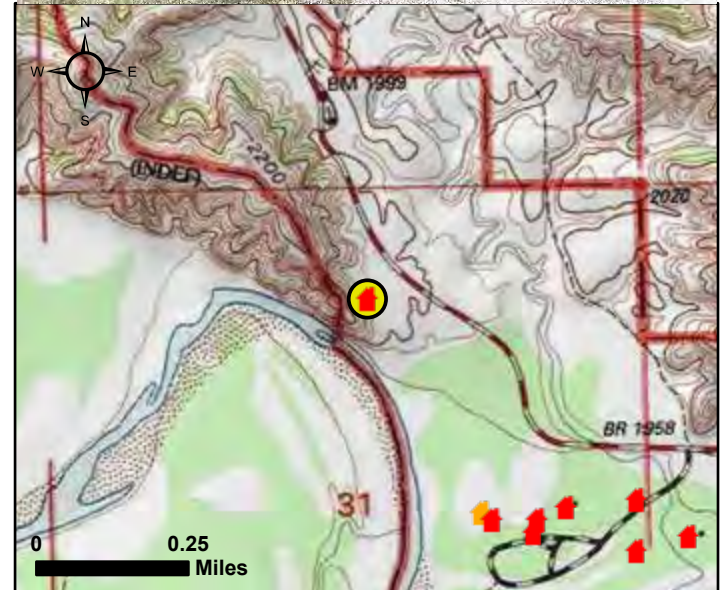



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Carpenter Shop 210

Unit - Location: THRO - North Unit

FMSS ID: 28425, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.81264142' N 103° 15.69758178' W

Rating: Low

Protection Level: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 31

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Quarters 205, Duane/Seasonal

Unit - Location: THRO - North Unit

FMSS ID: 28436, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.86632750' N 103° 15.80078220' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 26

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments: Facility attached to 205B

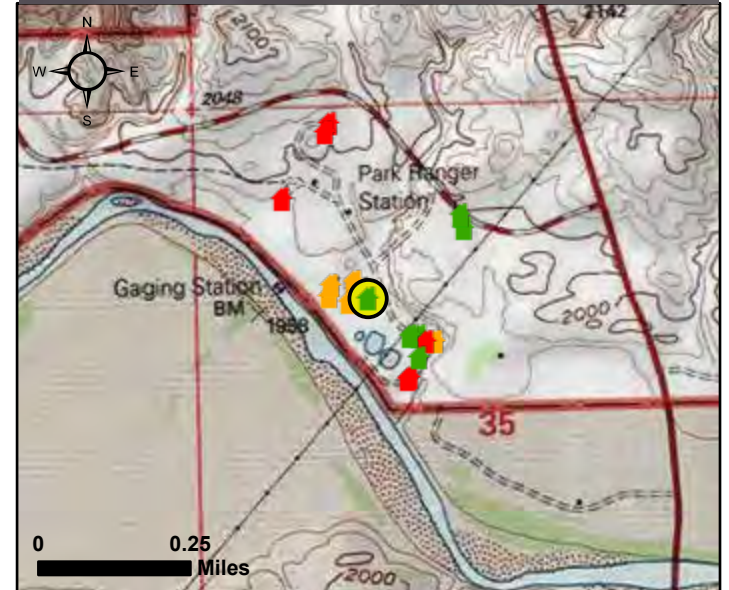



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Quarters 204B, Permanent

Unit - Location: THRO - North Unit

FMSS ID: 28435, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.87039700' N 103° 15.88400544' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 21

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments: Facility attached to 204

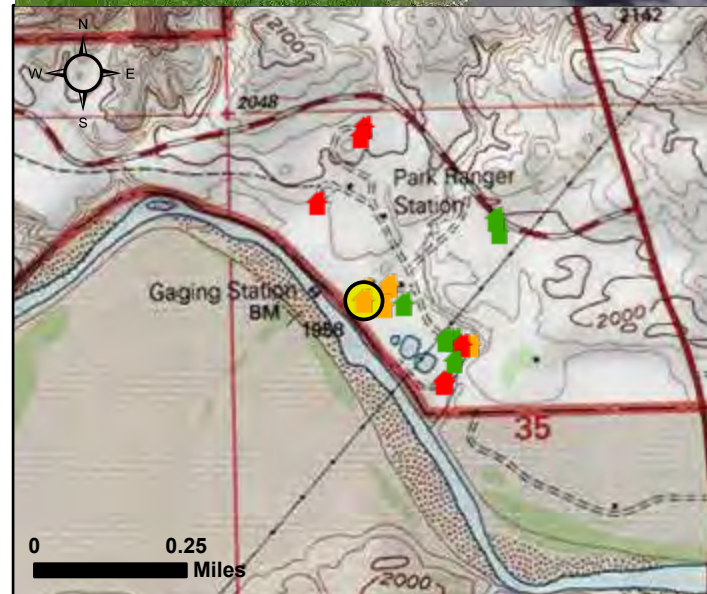



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Quarters 203, Permanent-Greg

Unit - Location: THRO - North Unit

FMSS ID: 28433, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.88809190' N 103° 15.88038018' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 22

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

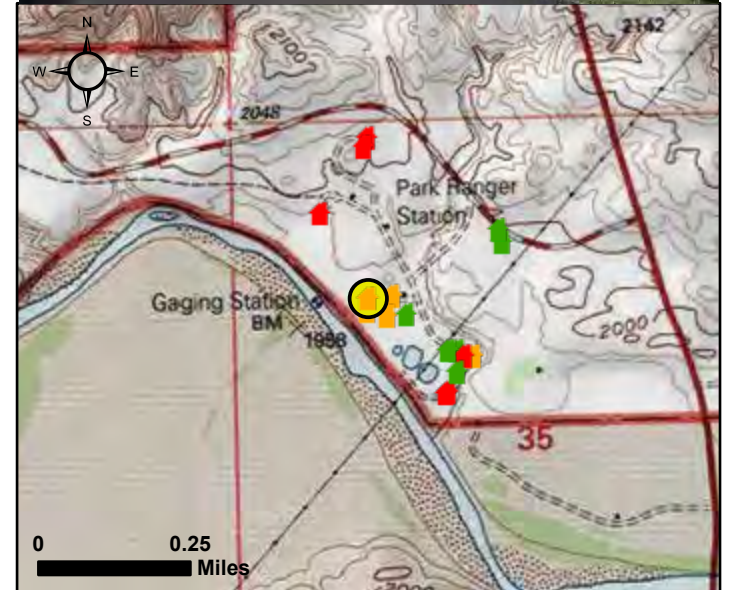



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU-WHF Pole Barn 231

Unit - Location: THRO - North Unit

FMSS ID: 28463, **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 34.85792508' N 103° 18.02252412' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 11

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Shade structure surrounded by wooden corrals.

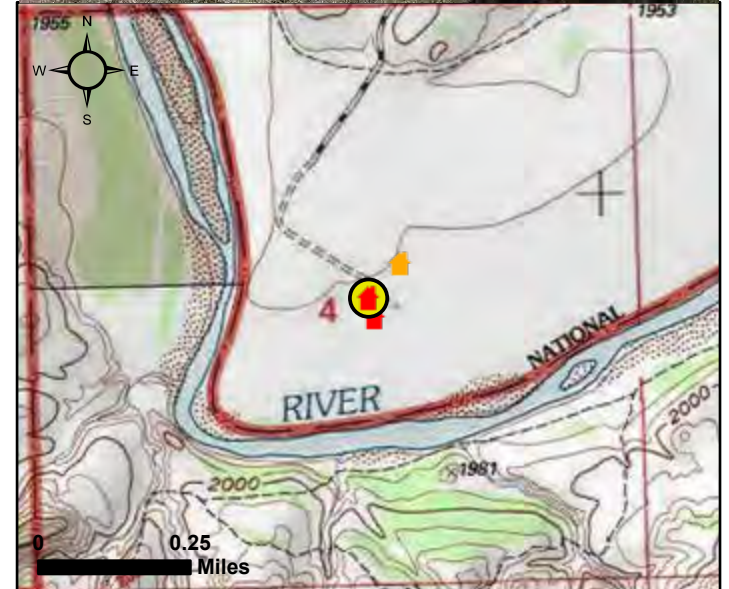



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Wood Shop

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.80363200' N 103° 15.67989000' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 32

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

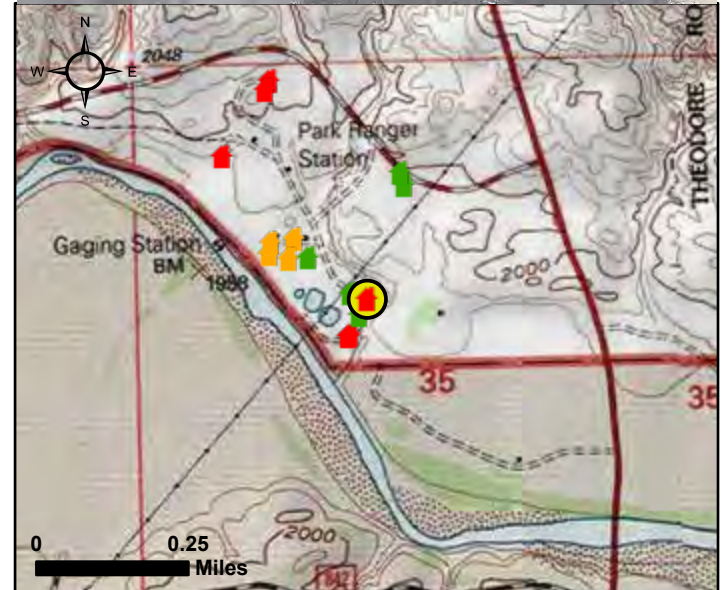



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Storage Garage

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.75018400' N 103° 15.72195000' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 27

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

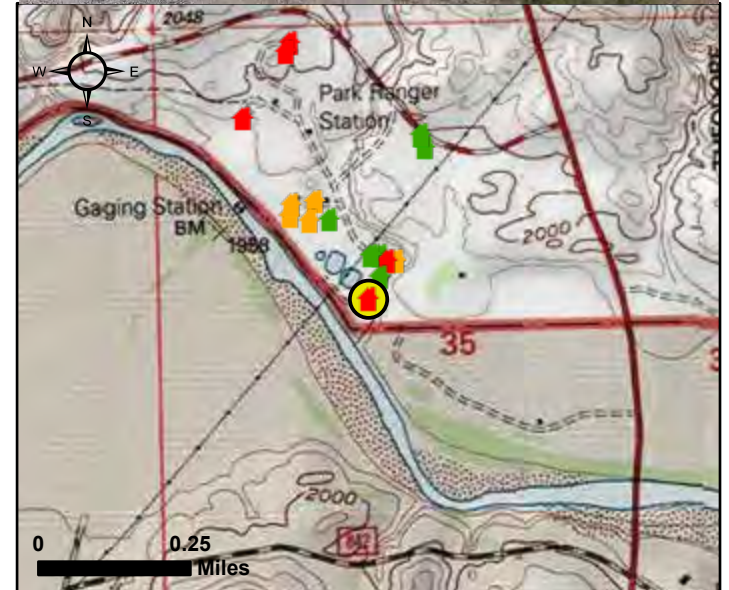



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Storage Garage 2

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.75328000' N 103° 15.71770200' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 28

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

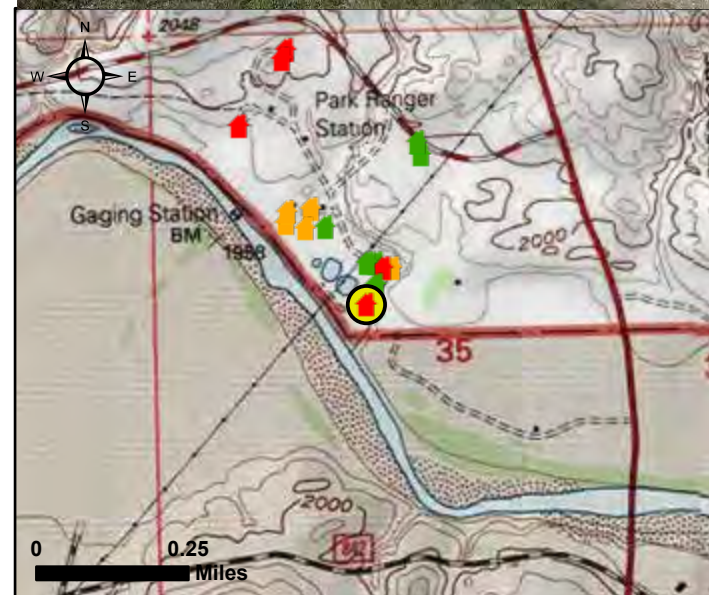



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Mower Shed

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.78226000' N 103° 15.69858600' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 30

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

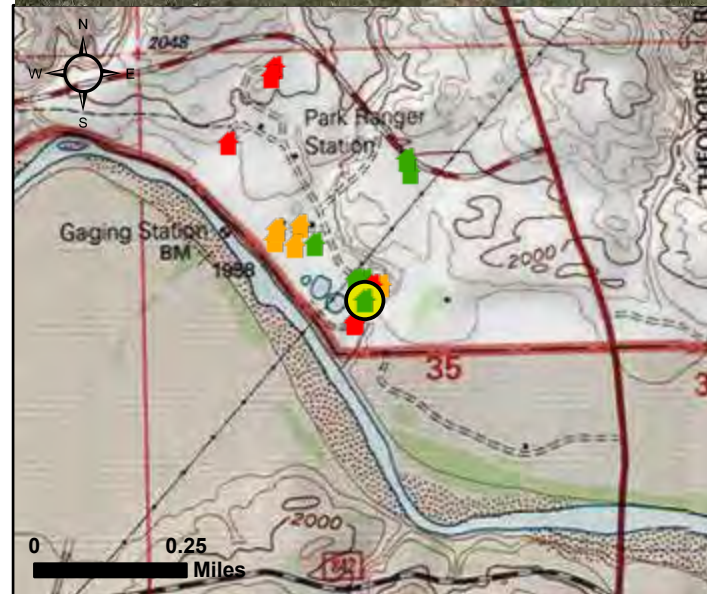



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Flammables Storage Cabinet

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.81329200' N 103° 15.71446200' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, NU Quarters

Revisit Interval: 5 yrs

Map Label: 29

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments:

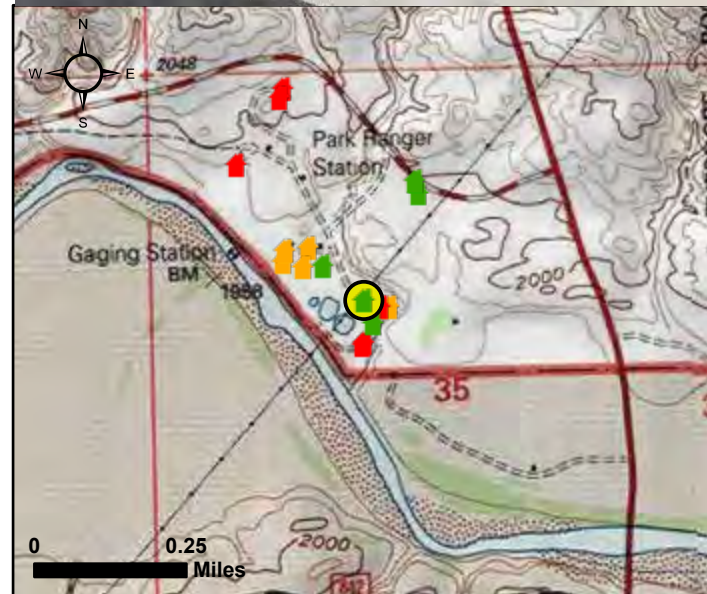



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Air Quality Station

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 34.90730400' N 103° 17.95575000' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 14

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Believed to,be air monitoring station.

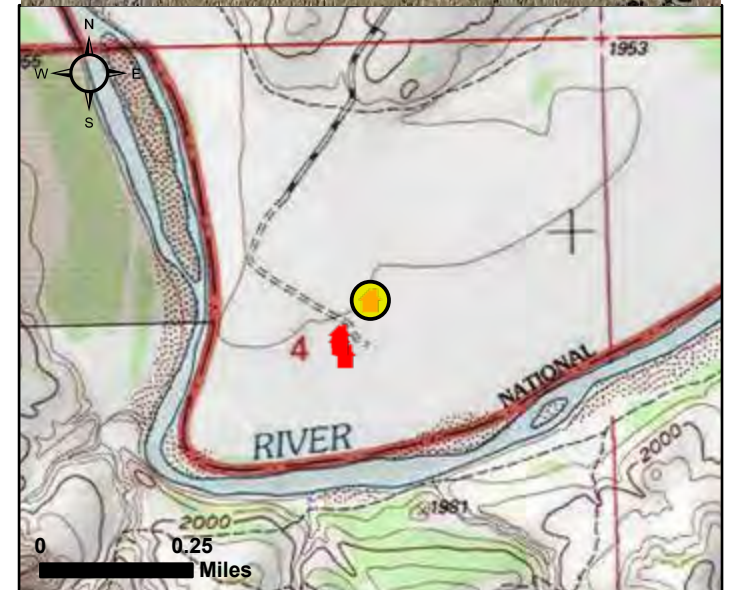



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: NU - Amphitheater

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.67529200' N 103° 20.26247400' W

Rating: High

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 6

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6 in masonry exposed


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

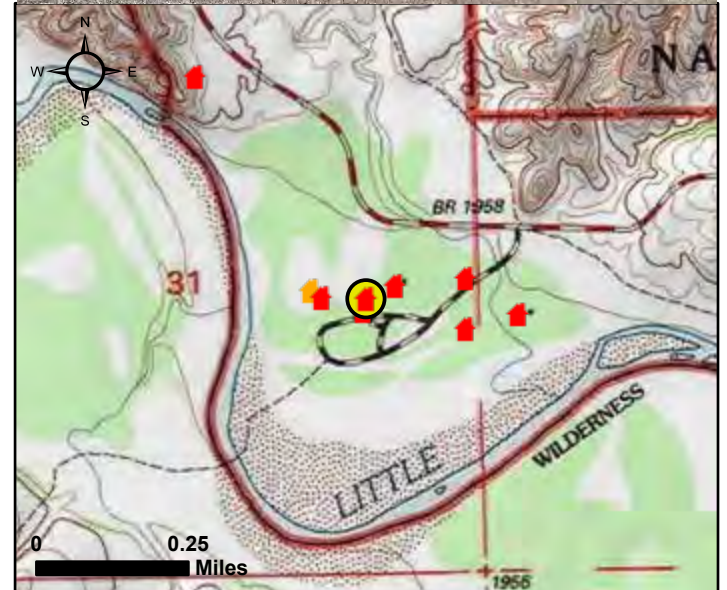



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Vault Restroom

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 36.58569096' N 103° 21.34519182' W

Rating: High

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 4

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: visitor center

Unit - Location: THRO - North Unit

FMSS ID: not found, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 29, 2022

Coordinates (DDM): 47° 35.98313520' N 103° 15.60295308' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 5 yrs

Map Label: 19

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: High voltage powerlines east of structure could limit aircraft.

