


# NPS Wildfire Risk Assessments Assessment Locations

National Park Service  
U.S. Department of the Interior



## Mojave National Preserve - Overview

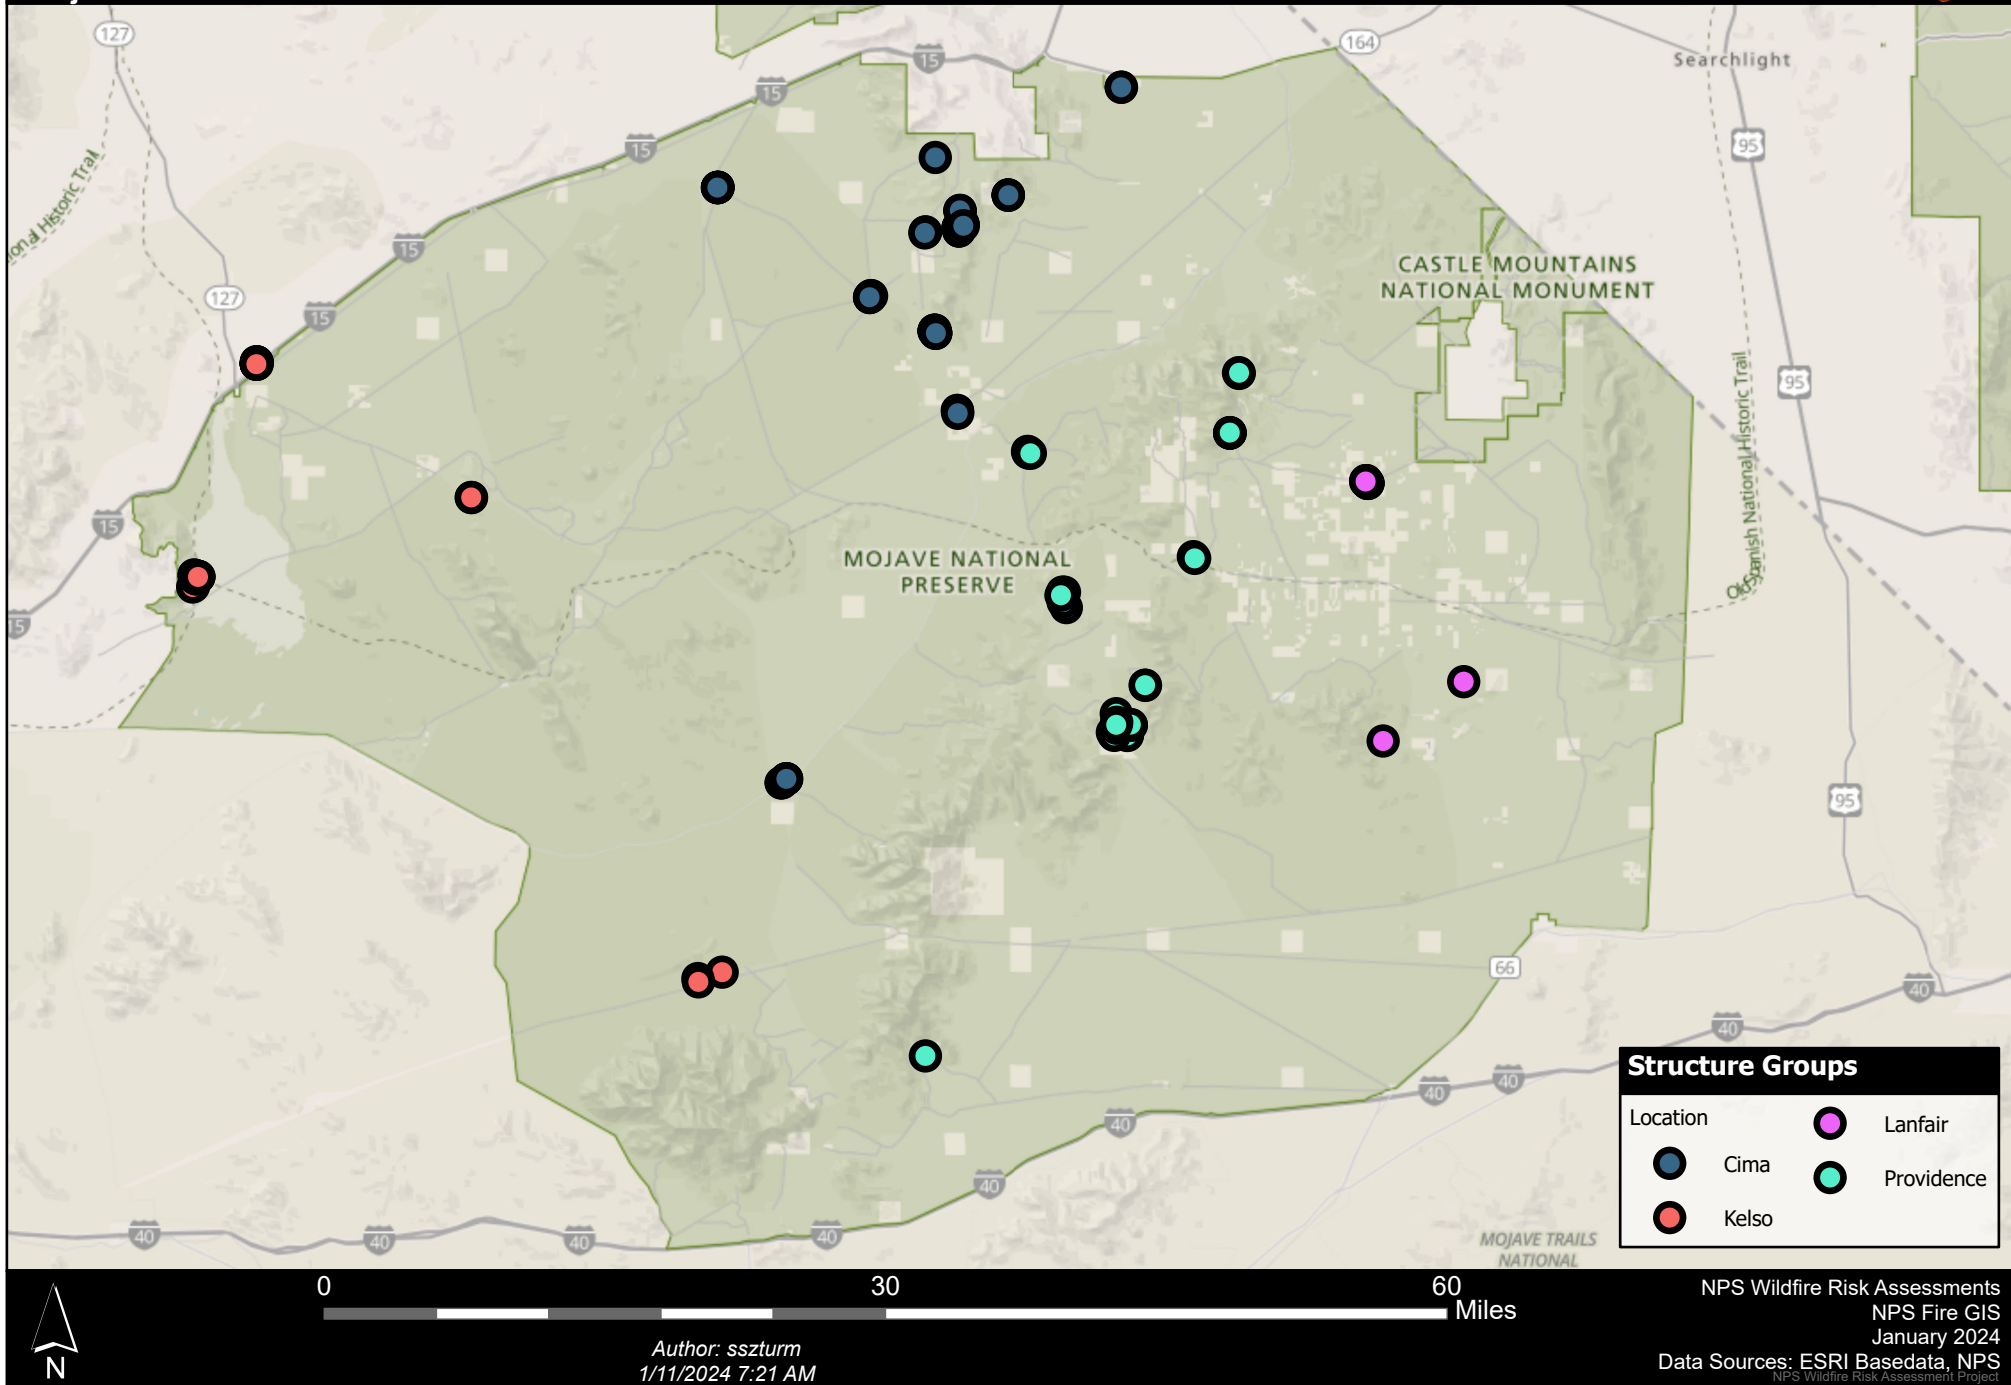


# NPS Wildfire Risk Assessments Assessment Locations

National Park Service  
U.S. Department of the Interior



Cima - Overview

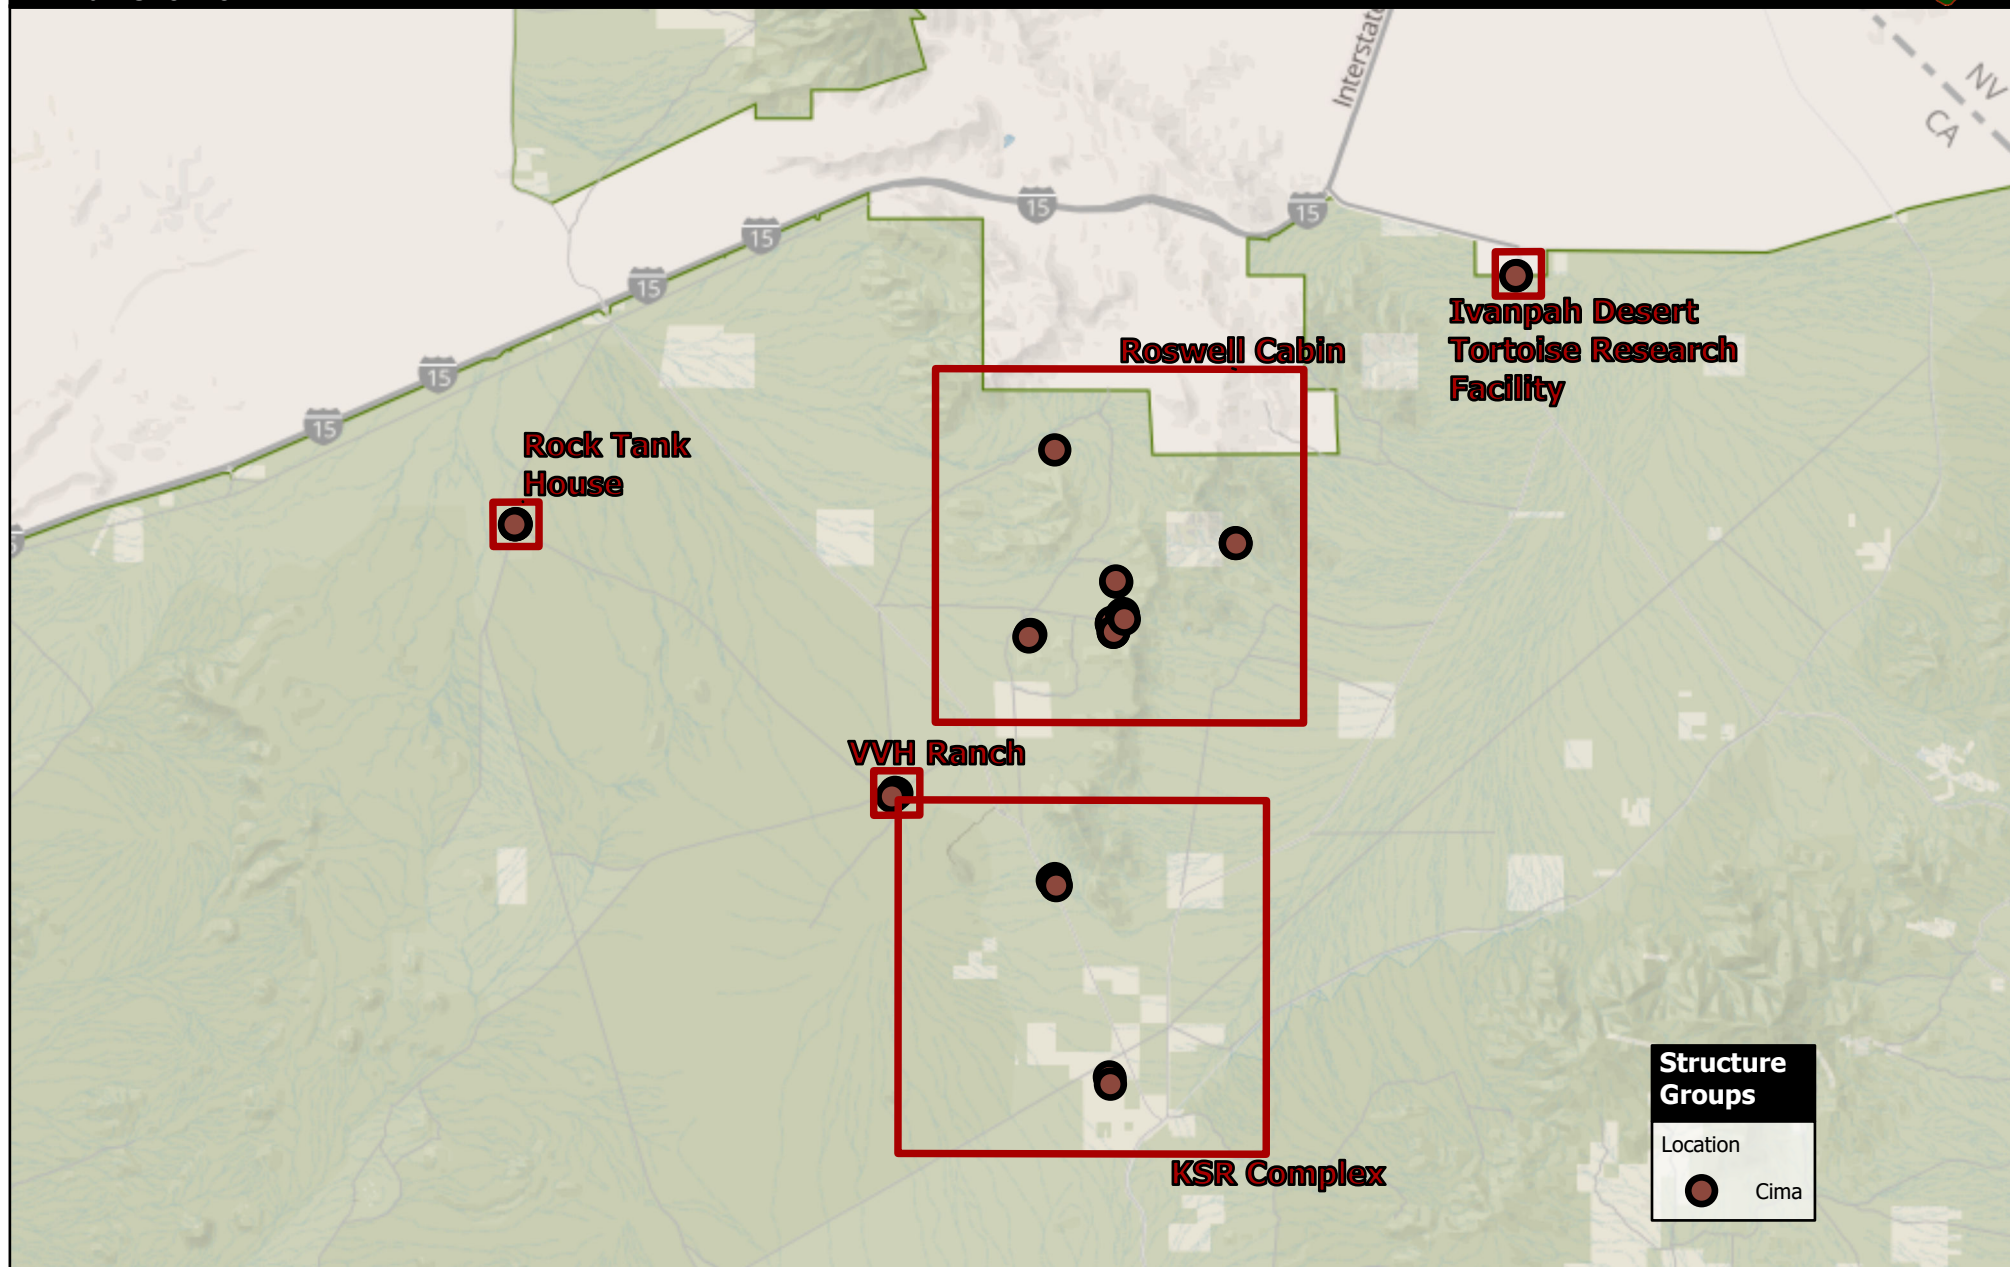

0

15

30


Miles

Author: sszturm  
2/1/2024 12:15 PM

NPS Wildfire Risk Assessments  
NPS Fire GIS  
February 2024  
Data Sources: ESRI Basedata, NPS  
NPS Wildfire Risk Assessment Project



| Map Label | FMSS ID   | Common Name                                    |
|-----------|-----------|------------------------------------------------|
| 108       | 236267    | Ivanpah Desert Tortoise Research Facility      |
| 107       | not found | Ivanpah Desert Tortoise Research Facility shed |

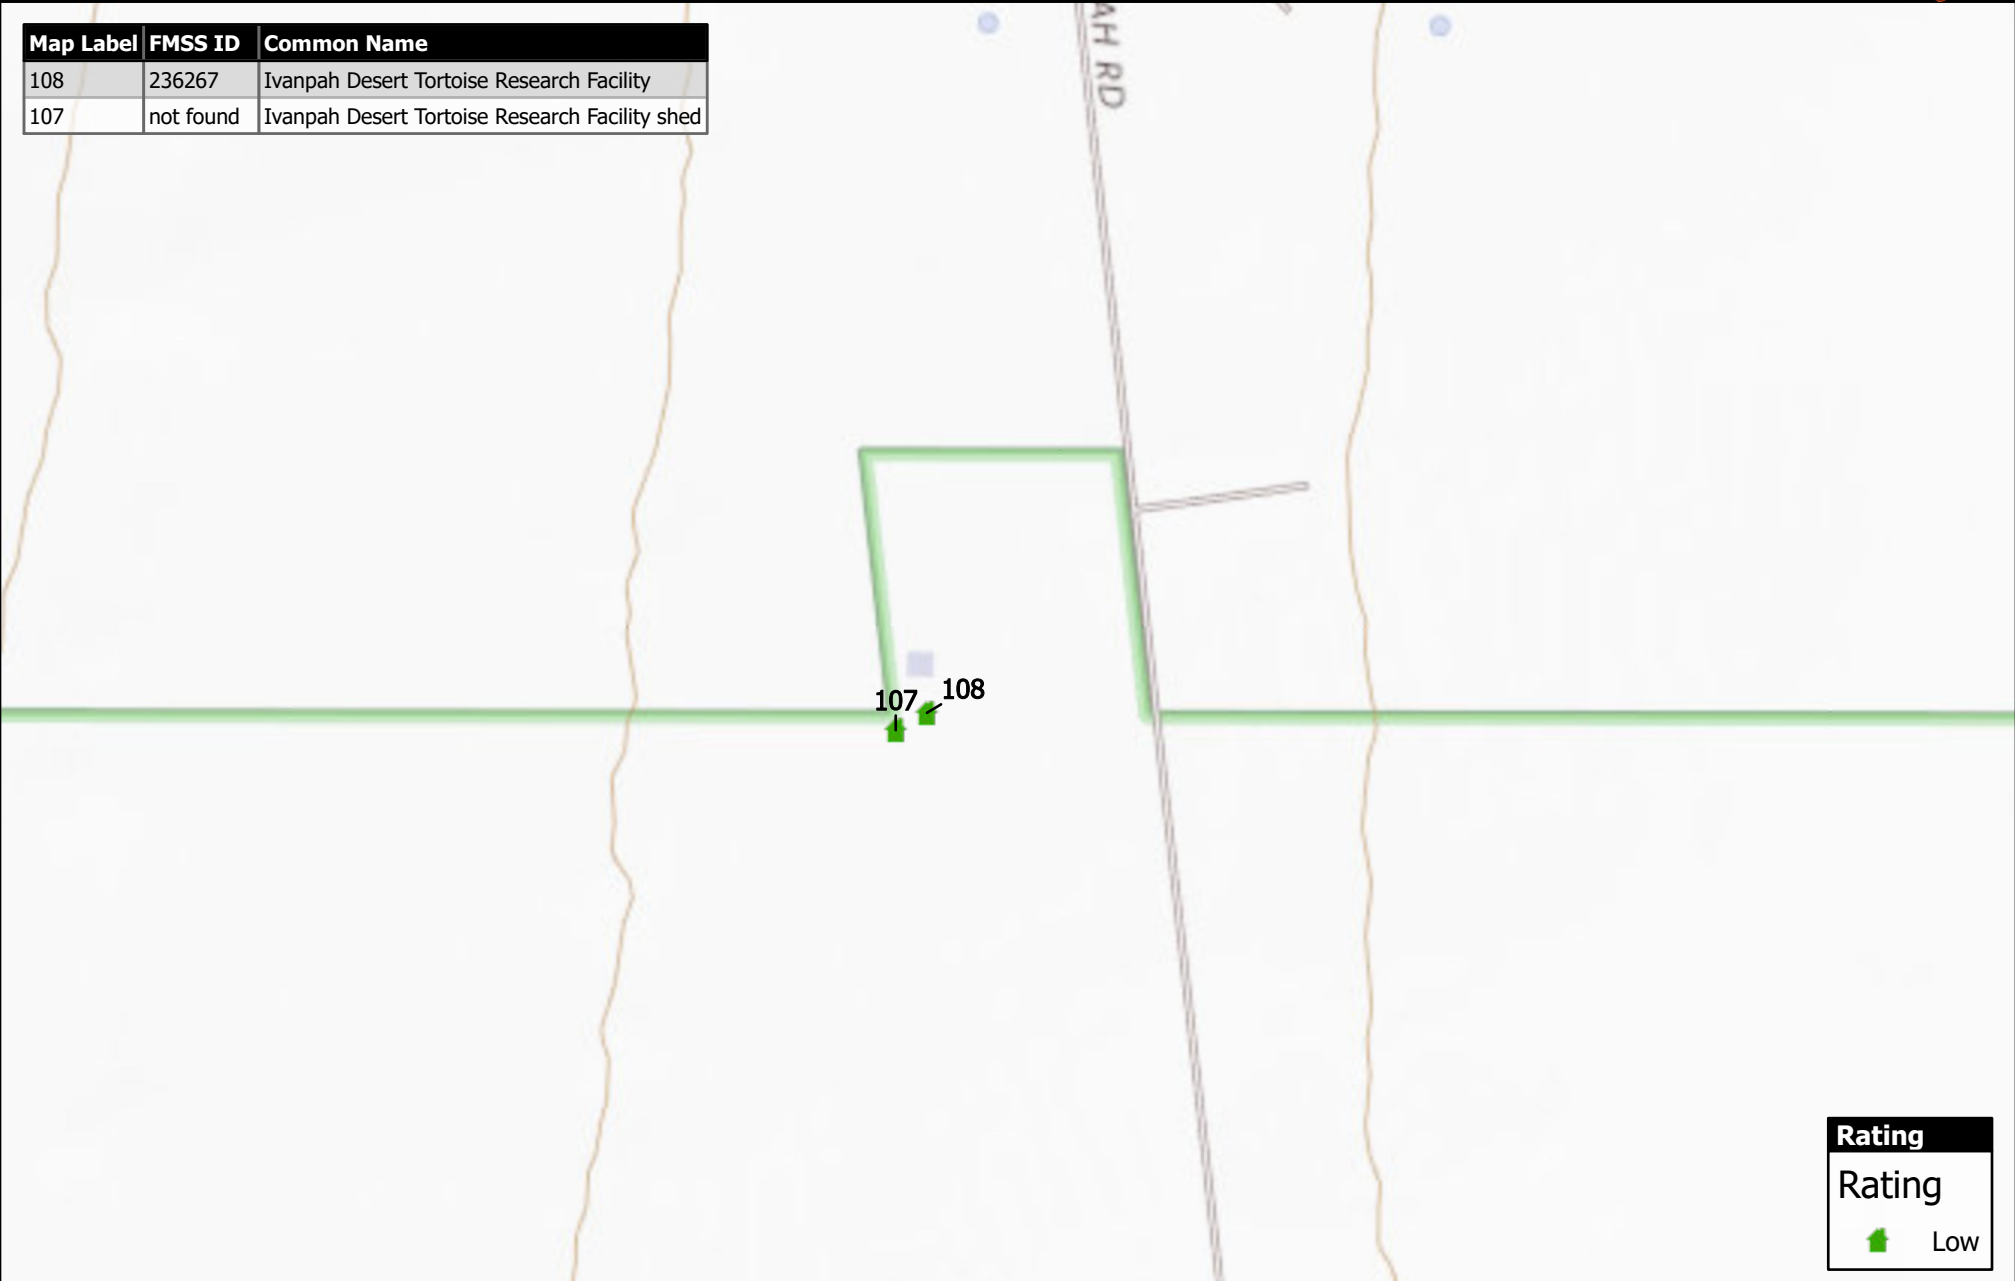


Rating

Rating

Low



Author: sszturm  
2/1/2024 11:30 AM



NPS Wildfire Risk Assessments  
NPS Fire GIS  
February 2024  
Data Sources: ESRI Basedata, NPS  
NPS Wildfire Risk Assessment Project


# KSR Complex

## MOJA - Mojave National Preserve

National Park Service  
U.S. Department of the Interior



| Map Label | FMSS ID   | Common Name                                                                                |
|-----------|-----------|--------------------------------------------------------------------------------------------|
| 118       | 84688     | KSR Hay Barn 310                                                                           |
| 119       | 66000     | KSRH Carport Shade Structure 401A                                                          |
| 120       | not found | unknown house                                                                              |
| 86        | 84687     | KSR Trapping Shed 314                                                                      |
| 91        | 66023     | KSR Metal Storage Building 307                                                             |
| 93        | 231462    | KSR PV Storage House                                                                       |
| 94        | 230048    | KSRH Kessler 4 Plex Housing<br>KSRH Kessler 4 Plex Housing<br>KSR Kessler Fourplex Housing |
| 95        | 66003     | KSRH Landerman Cima 402                                                                    |

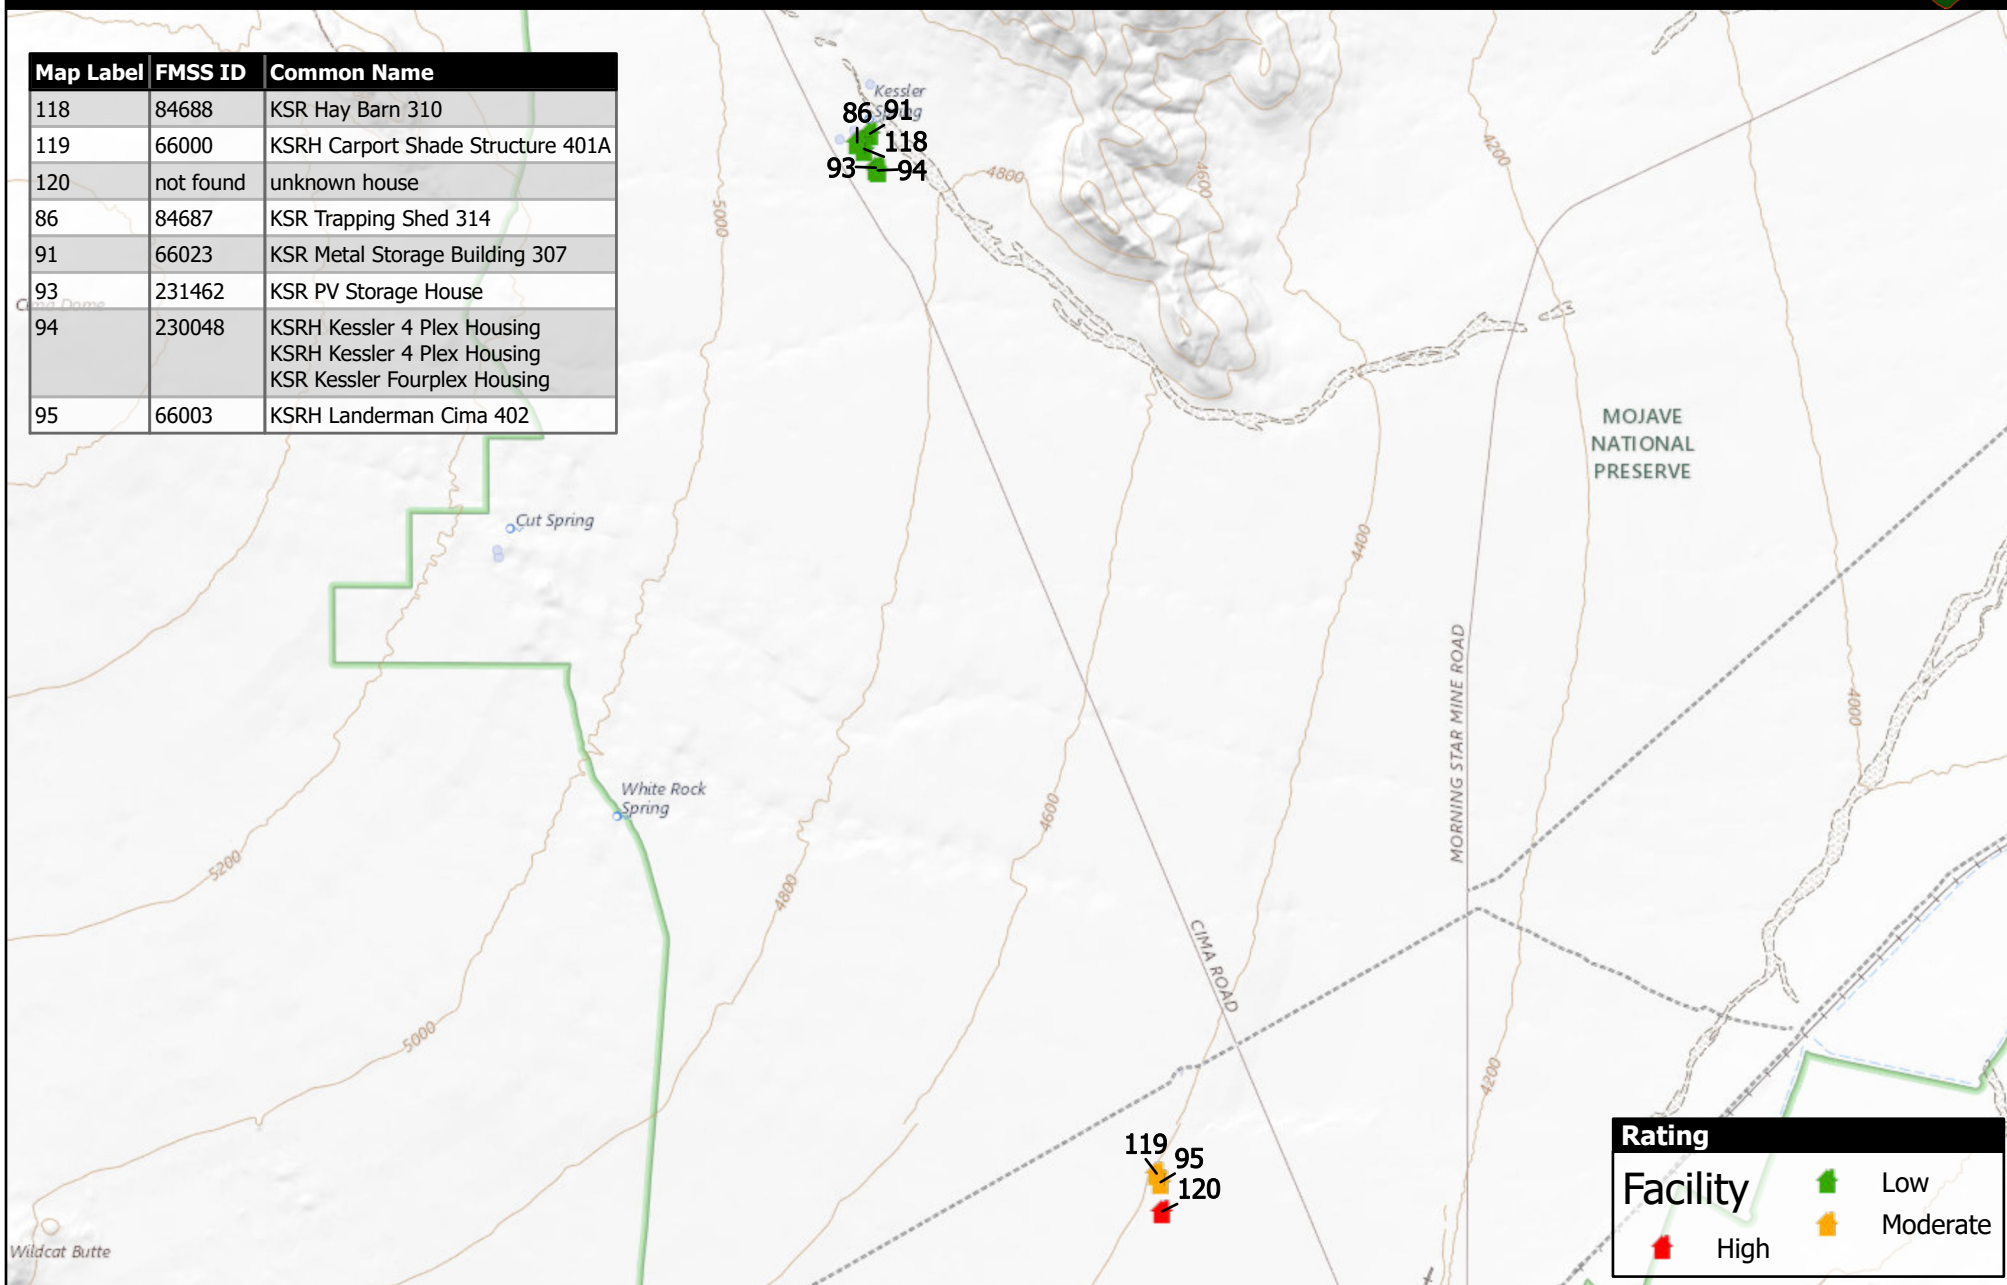

Author: sszturm  
2/1/2024 11:00 AM

0


4 Miles

Scale: 1:50,000

NPS Wildfire Risk Assessments  
NPS Fire GIS  
February 2024  
Data Sources: ESRI Basedata, NPS  
NPS Wildfire Risk Assessment Project



| Map Label | FMSS ID   | Common Name                |
|-----------|-----------|----------------------------|
| 112       | 236678    | Rock Tank Bunk House       |
| 65        | 236681    | Rock Tank Cook House       |
| 66        | not found | Rock Tank Root Cellar      |
| 110       | not found | Rock Tank Garage           |
| 111       | not found | Rock Tank Water Tank       |
| 109       | not found | Rock Tank Water Tank Large |
| 64        | not found | Rock Tank Corral           |

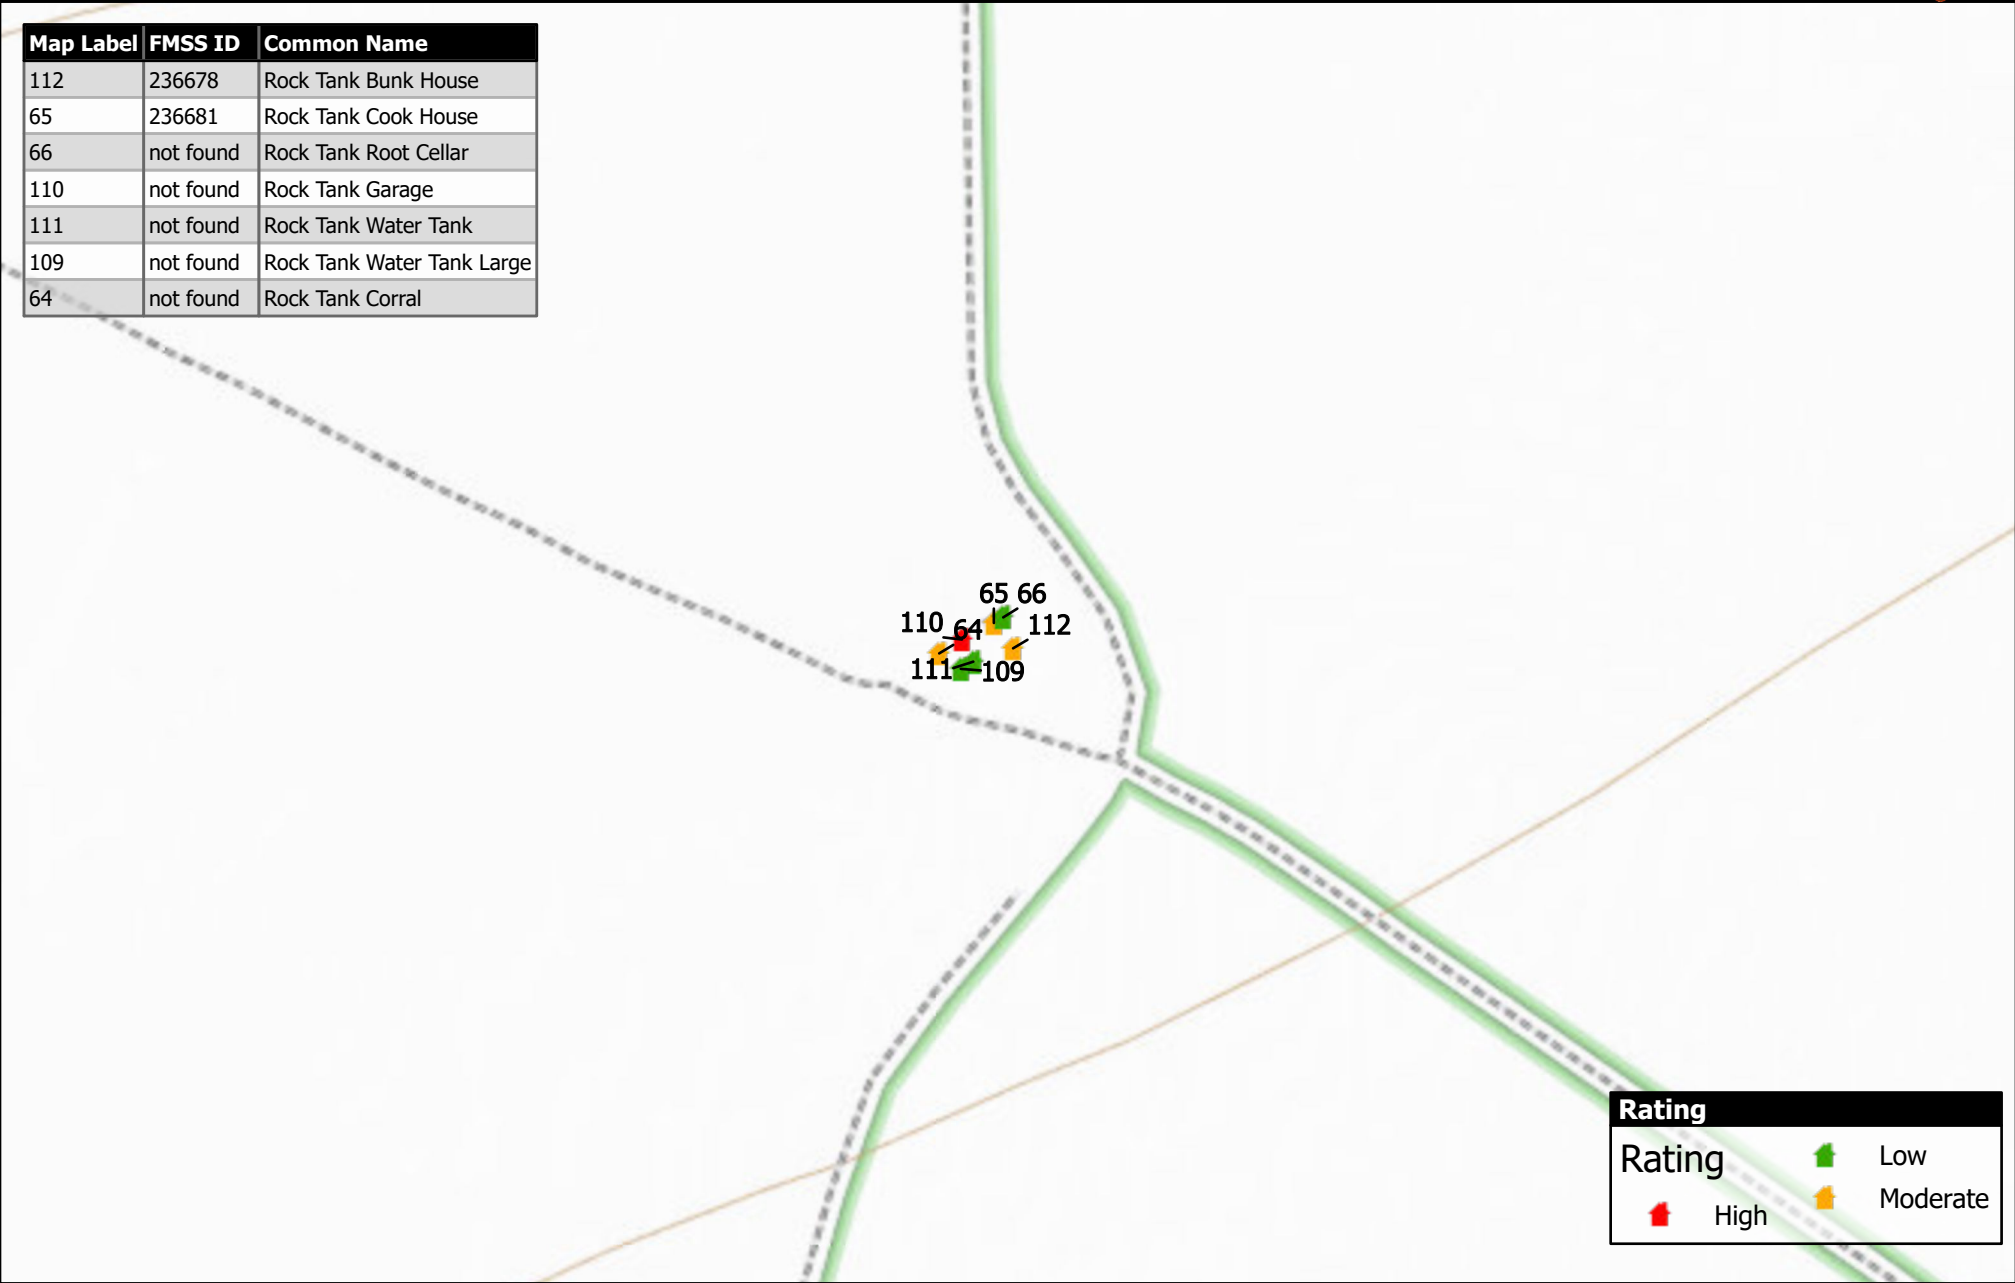

Rating

Rating

Low

Moderate


High



Roswell Cabin  
MOJA - Mojave National Preserve



| Map Label | FMSS ID   | Common Name                      |
|-----------|-----------|----------------------------------|
| 100       | not found | Rowsell metal shed               |
| 101       | 236676    | Rowsell Cabin                    |
| 102       | not found | Rowsell unknown barn             |
| 103       | 233917    | Lone Star Outhouse               |
| 104       | 233909    | Lone Star Cabin North            |
| 105       | 233912    | Lone Star Cabin South            |
| 106       | 233918    | Lone Star Garage                 |
| 121       | not found | Geer Garage                      |
| 122       | 115783    | Rileys Cabin                     |
| 123       | 115784    | Rileys Lab                       |
| 124       | 115785    | Rileys Outhouse                  |
| 125       | not found | unknown cabin 2                  |
| 128       | not found | Geer Outhouse                    |
| 129       | not found | Rowsell unknown root cellar      |
| 81        | 115787    | Evening star explosives building |
| 82        | not found | Evening star collared shaft      |
| 83        | not found | Evening star ore shaft           |
| 92        | 233969    | Rogers Camp                      |
| 96        | 230319    | Geer Main Cabin                  |
| 97        | not found | Geer Coal Storage                |
| 98        | not found | unknown cabin 1                  |
| 99        | not found | unknown cabin shed               |

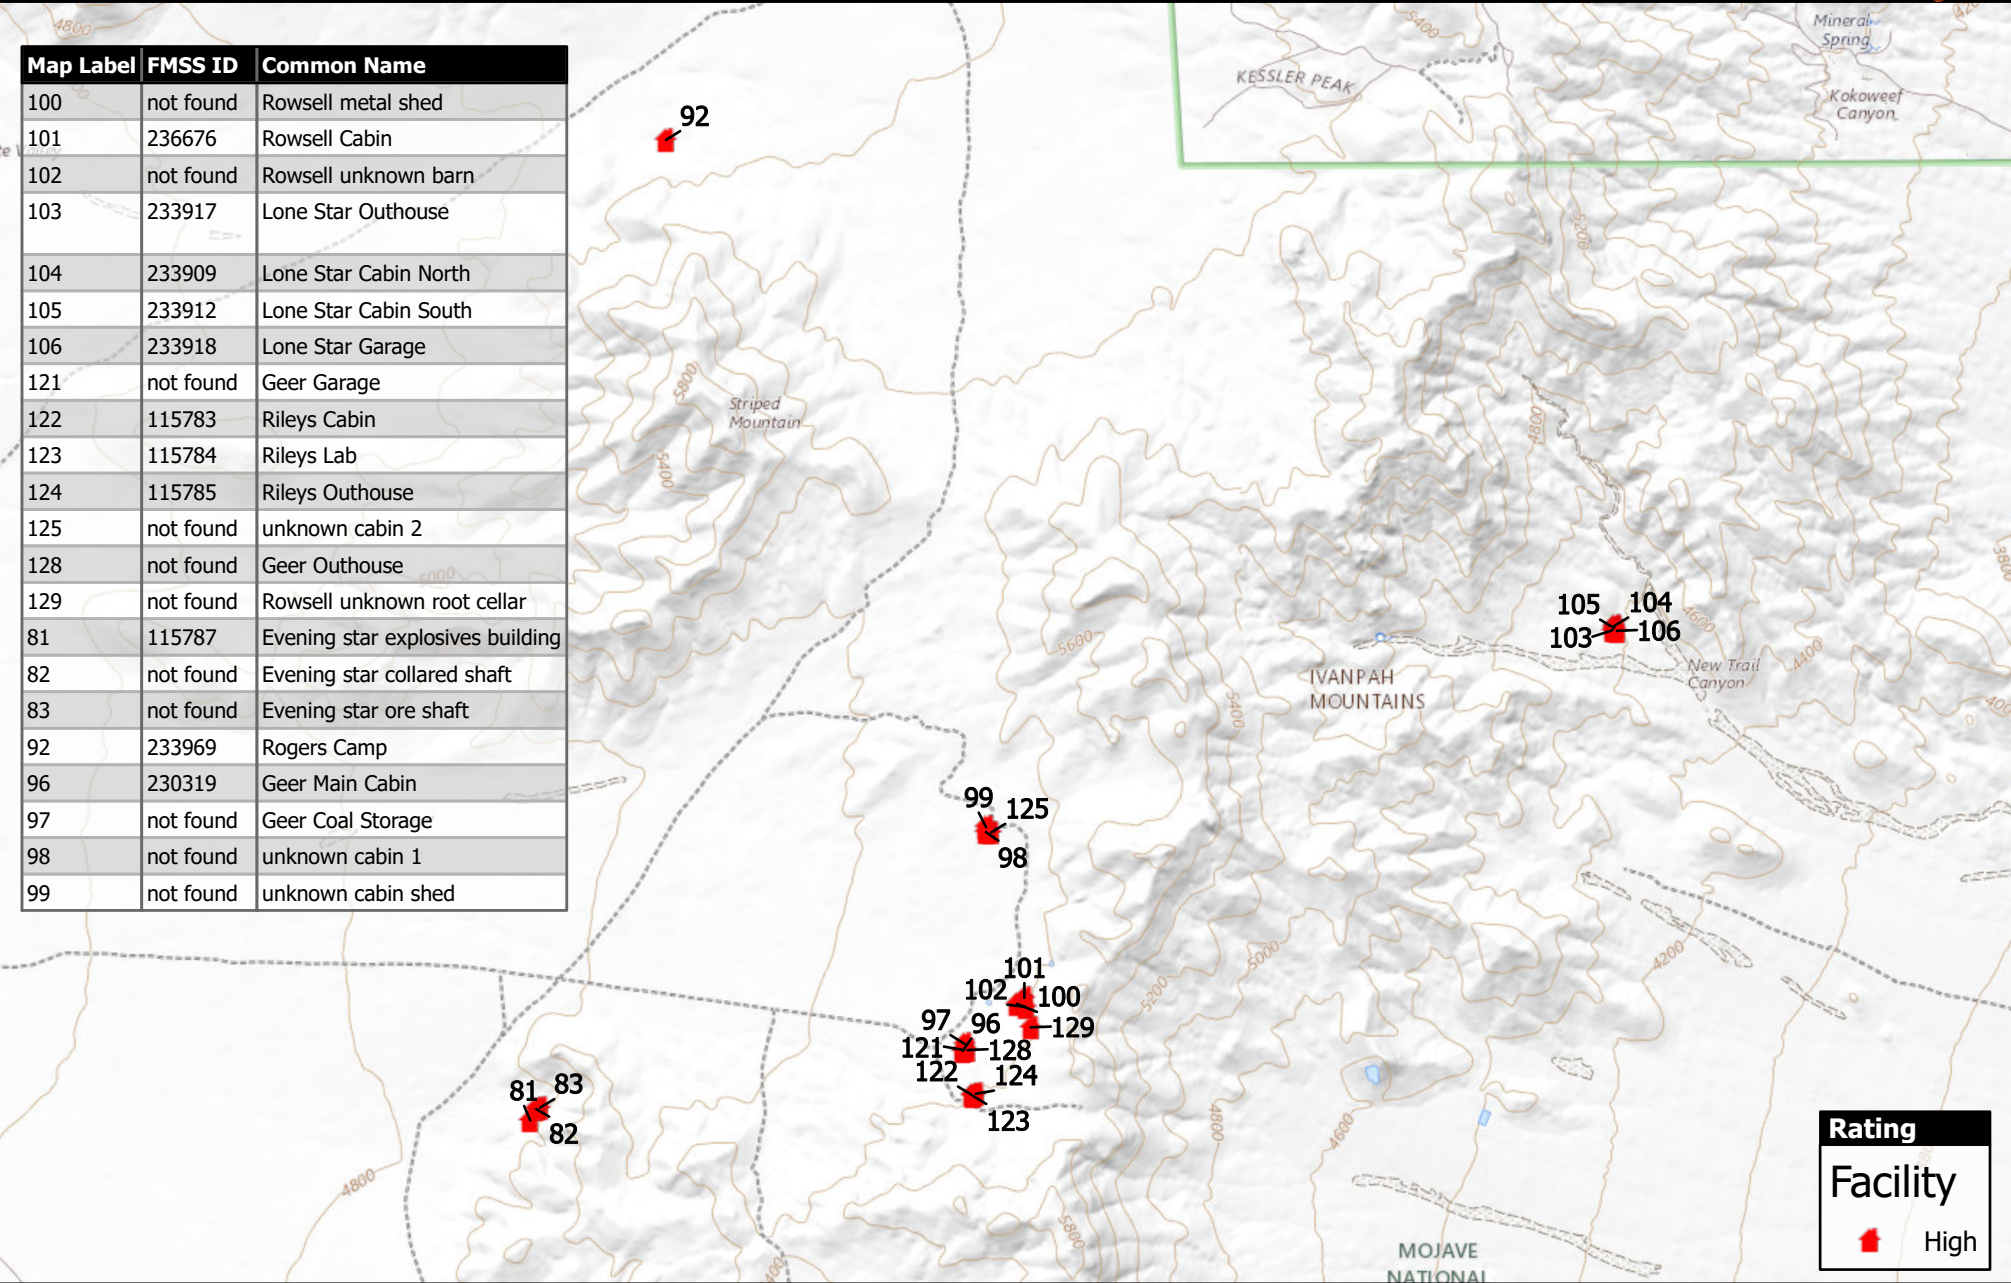

Rating

Facility

High



Author: sszturm  
2/1/2024 11:06 AM



Scale: 1:50,000


# VVH Ranch

## MOJA - Mojave National Preserve

National Park Service  
U.S. Department of the Interior



| Map Label | FMSS ID   | Common Name                  |
|-----------|-----------|------------------------------|
| 80        | 70271     | VV Hay Barn 312              |
| 78        | 70269     | VV Horse Barn 311            |
| 115       | 70260     | 00000301 VVH Ranch House 301 |
| 79        | not found | VV Animal barn               |
| 114       | not found | VV Root Cellar               |

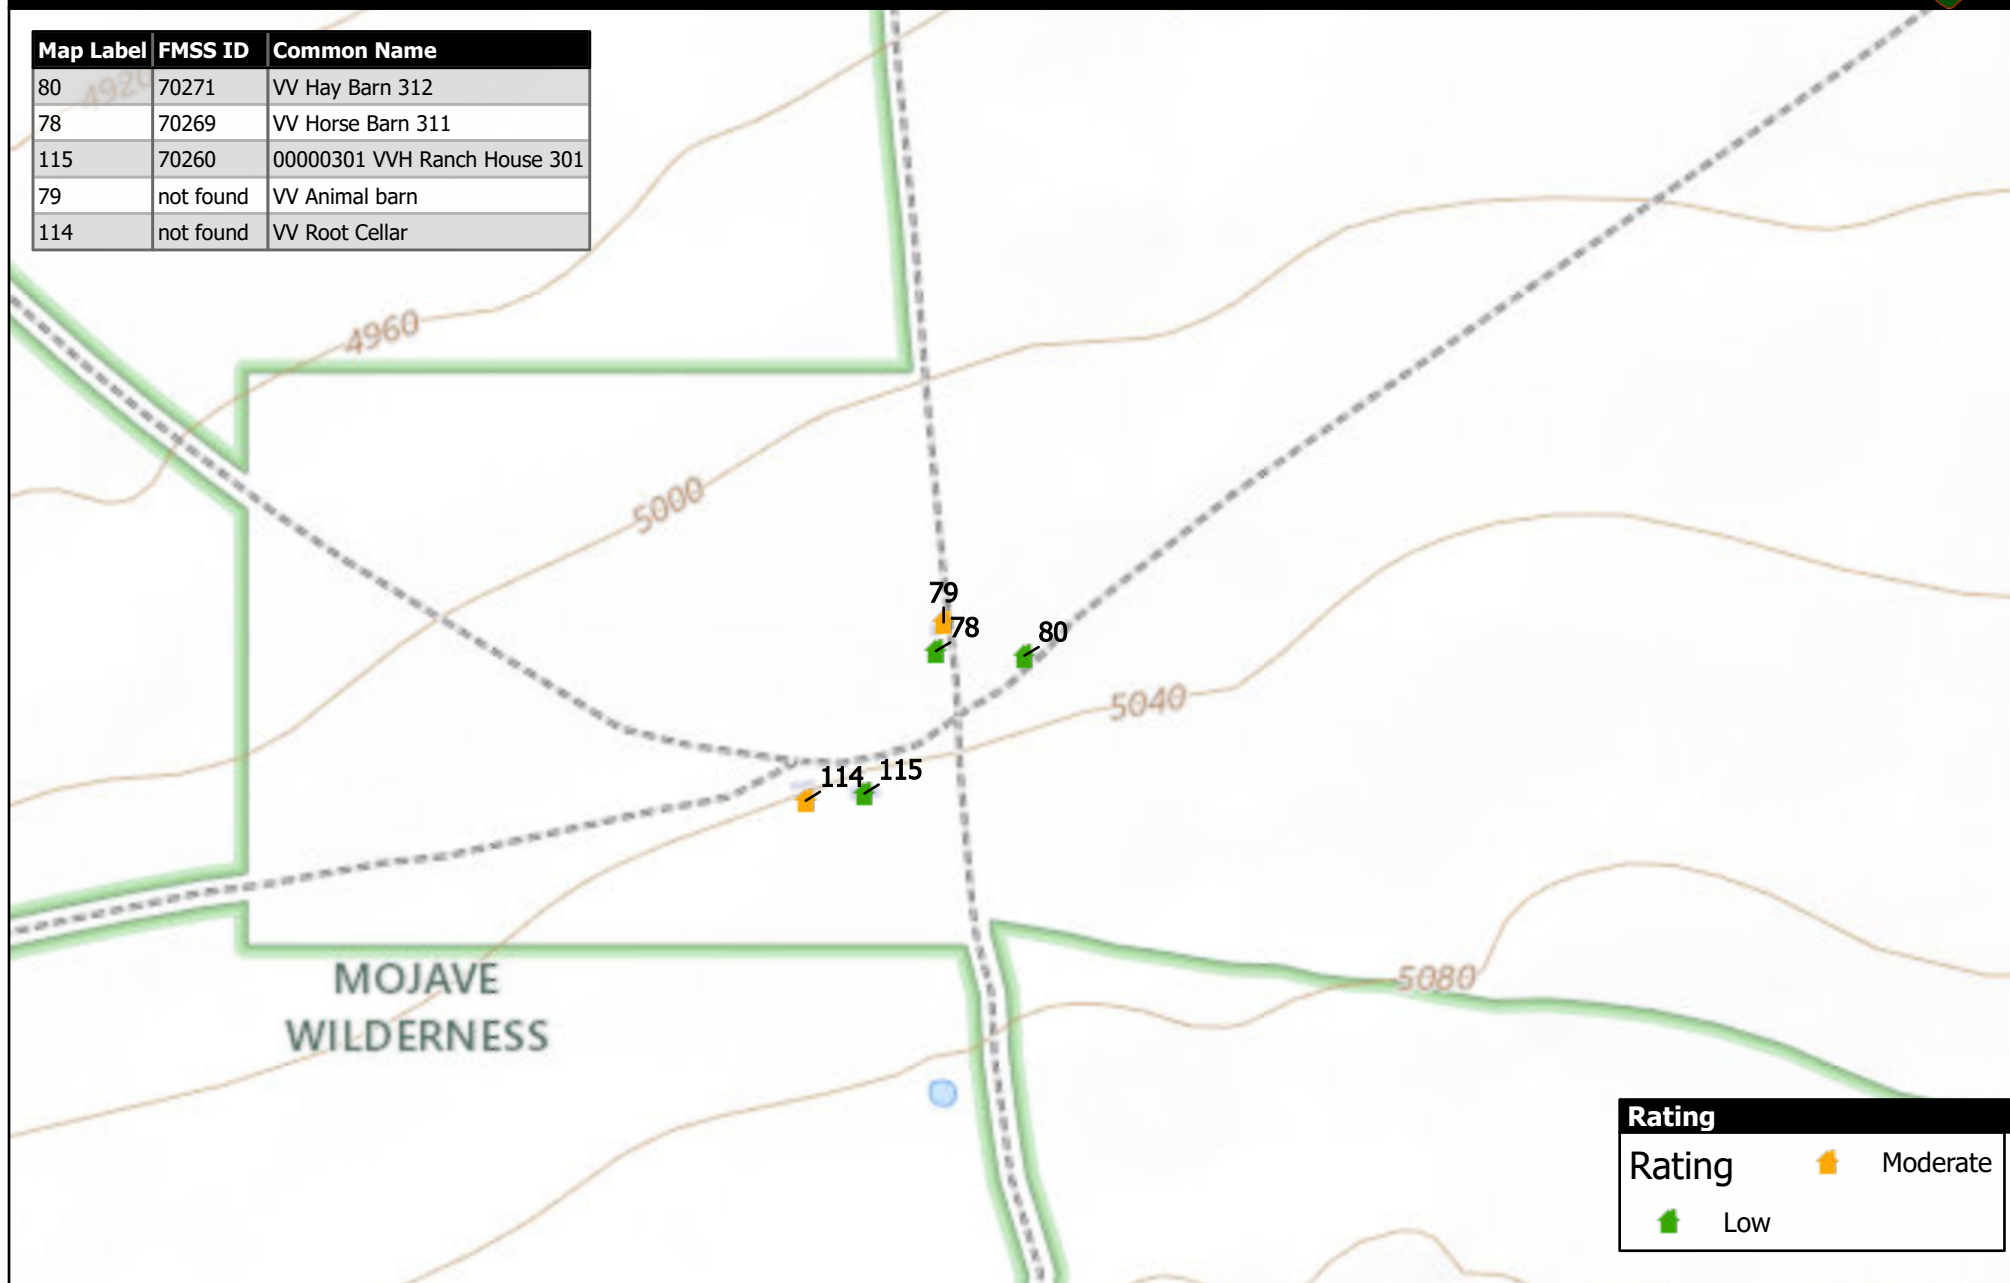

Author: sszturm  
2/1/2024 11:36 AM

0 500 1,000 1,500 Feet  
Scale: 1:6,000

NPS Wildfire Risk Assessments  
NPS Fire GIS  
February 2024  
Data Sources: ESRI Basedata, NPS  
NPS Wildfire Risk Assessment Project



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSRH Landerman Cima 402

**Unit - Location:** MOJA - Cima

**FMSS ID:** 66003, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 14.82949998' N 115° 31.01486664' W

**Rating:** Moderate

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 95

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with no turnaround

**Access and Turnarounds:** Less than 300 ft with no turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Combination of fire resistant and combustible

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed


**Firewood:** None

**Water Supply:** Reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

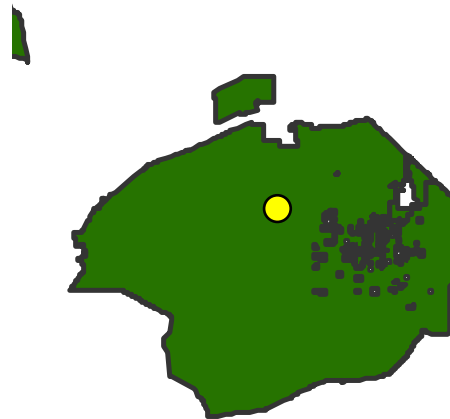



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSRH Carport Shade Structure 401A

**Unit - Location:** MOJA - Cima

**FMSS ID:** 66000, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 14.85469998' N 115° 31.02936666' W

**Rating:** Moderate

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 119

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with no turnaround

**Access and Turnarounds:** Less than 300 ft with no turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** Reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

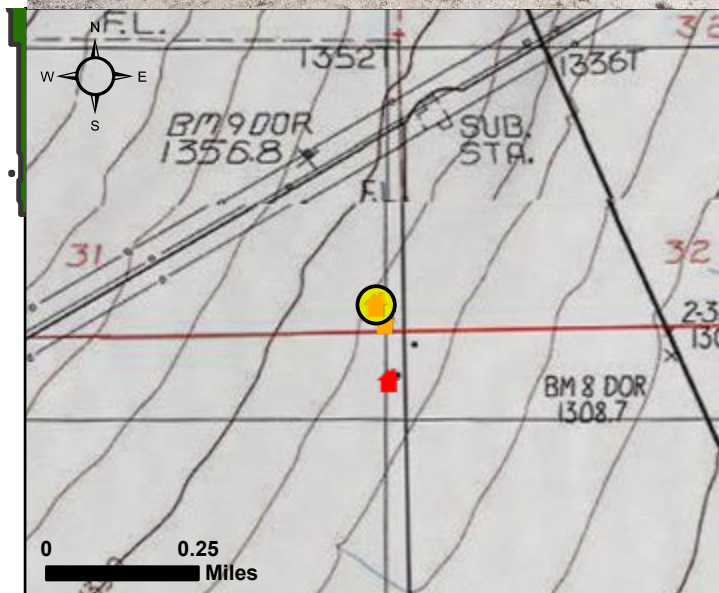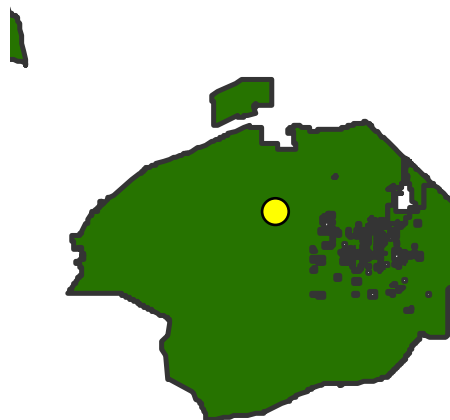



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Depot 201

**Unit - Location:** MOJA - Cima

**FMSS ID:** 65897, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.72900000' N 115° 39.19290000' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** Yes

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 67

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** Marked and clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:**

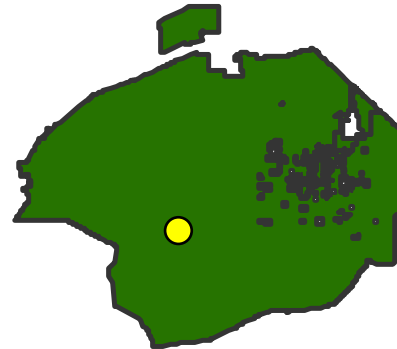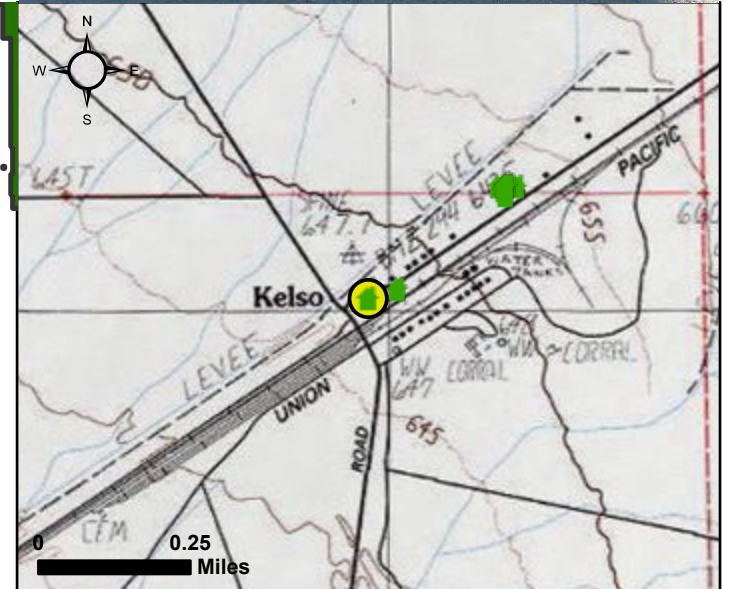



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Depot Comfort Station 206

**Unit - Location:** MOJA - Cima

**FMSS ID:** 65962, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.74236668' N 115° 39.14149998' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 68

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** Marked and clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed


**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

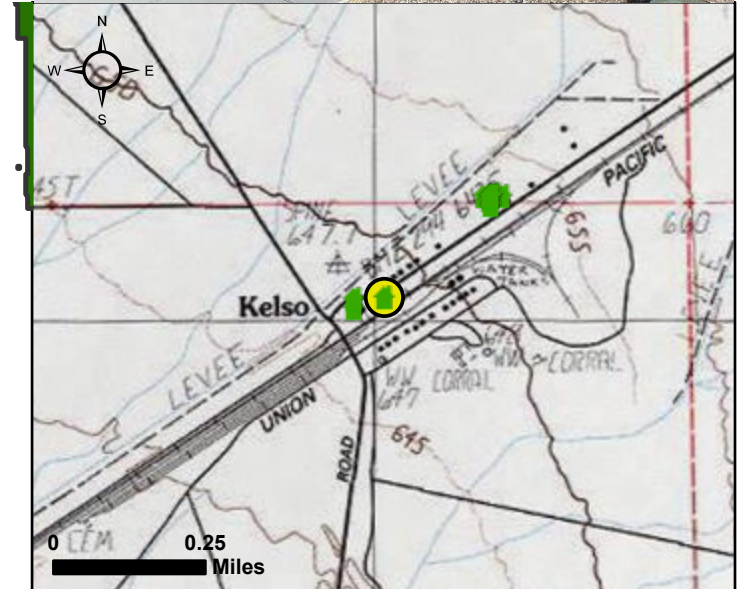



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso School House 203

**Unit - Location:** MOJA - Cima

**FMSS ID:** 65934, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.88540002' N 115° 38.93470002' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Kelso School

**Revisit Interval:** 5 yrs

**Map Label:** 75

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:** building behind locked fence, limited view

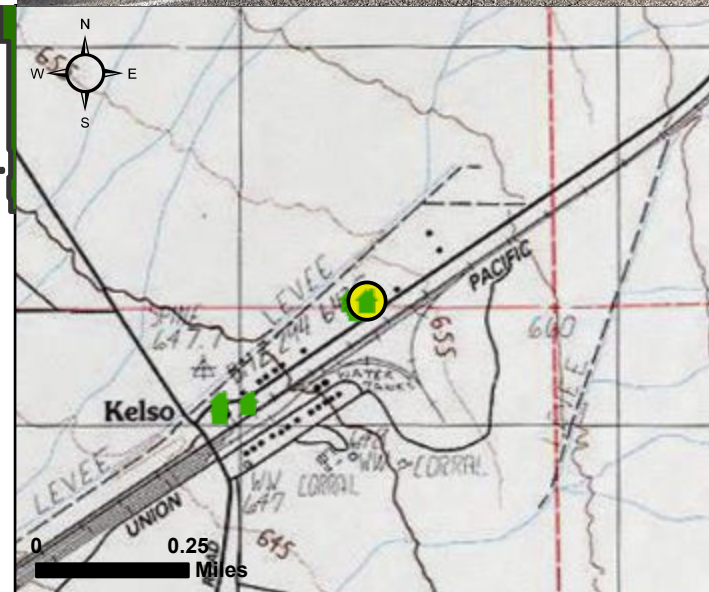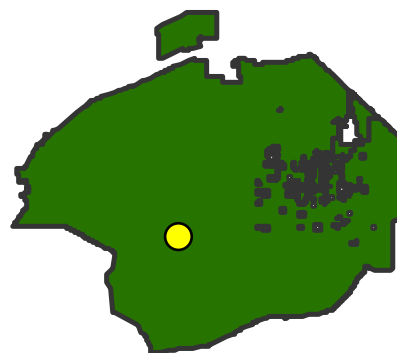



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Depot Coal Shed 205

**Unit - Location:** MOJA - Cima

**FMSS ID:** 65989, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.74233332' N 115° 39.19330002' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 113

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:**

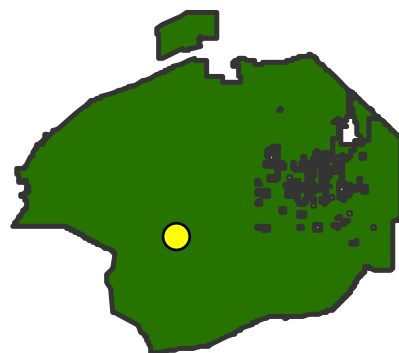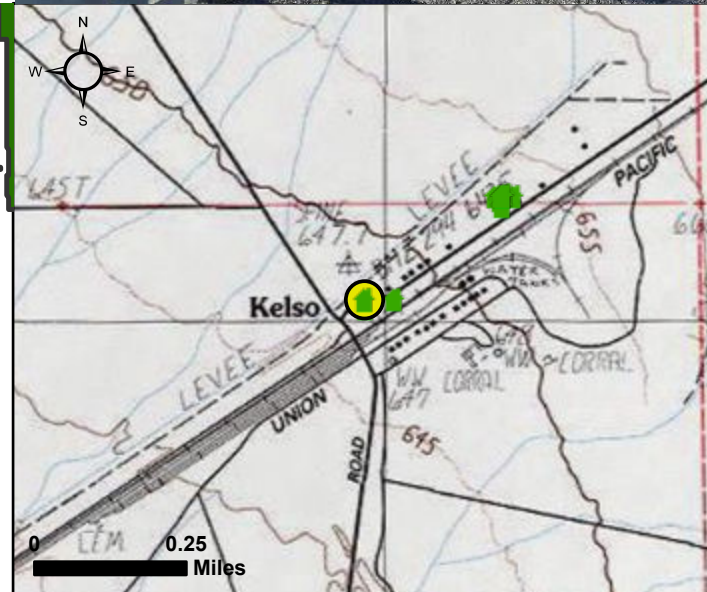



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** VV Hay Barn 312

**Unit - Location:** MOJA - Cima

**FMSS ID:** 70271, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 19.18473336' N 115° 35.00196666' W

**Rating:** Low

**Protection Level:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Valley View

**Revisit Interval:** 5 yrs

**Map Label:** 80

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 100 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

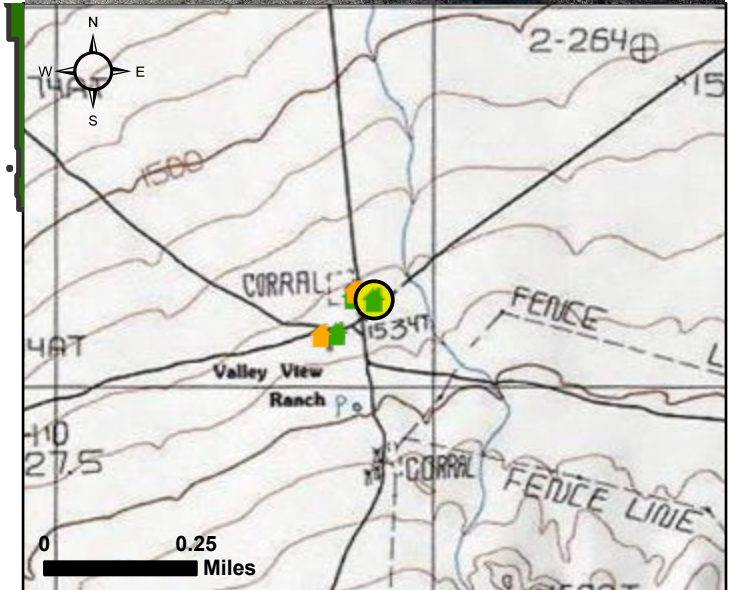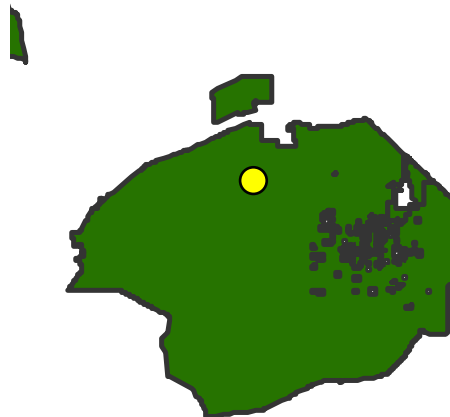



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** VV Horse Barn 311

**Unit - Location:** MOJA - Cima

**FMSS ID:** 70269, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 19.18633332' N 115° 35.03983332' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Valley View

**Revisit Interval:** 5 yrs

**Map Label:** 78

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 100 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck


**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

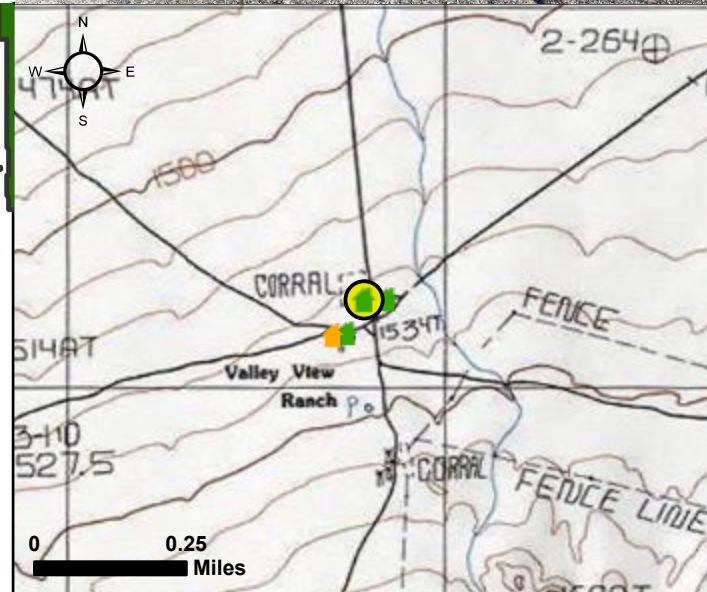



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** 00000301 VVH Ranch House 301

**Unit - Location:** MOJA - Cima

**FMSS ID:** 70260, **Local ID:**

**Structure Type, Use:** Building, Residence

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 19.13666664' N 115° 35.07043332' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** Yes

**In Community:** Yes, Valley View

**Revisit Interval:** 5 yrs

**Map Label:** 115

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed


**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** Present and fuels clearance

**Overhead Hazards:** No overhead hazards

**Comments:** in 2020 Dome fire area

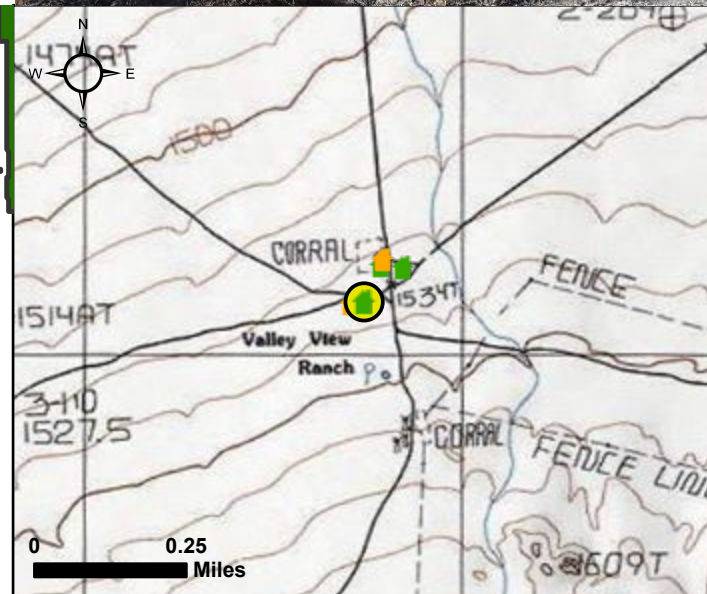



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSR Metal Storage Building 307

**Unit - Location:** MOJA - Cima

**FMSS ID:** 66023, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 17.88166668' N 115° 32.05073334' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, KSR Historic Ranch

**Revisit Interval:** 5 yrs

**Map Label:** 91

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 100 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed


**Firewood:** None

**Water Supply:** Limited or dependent on electricity

**Propane:** Present and fuels clearance

**Overhead Hazards:** No overhead hazards

**Comments:** in the 2020 Dome fire area

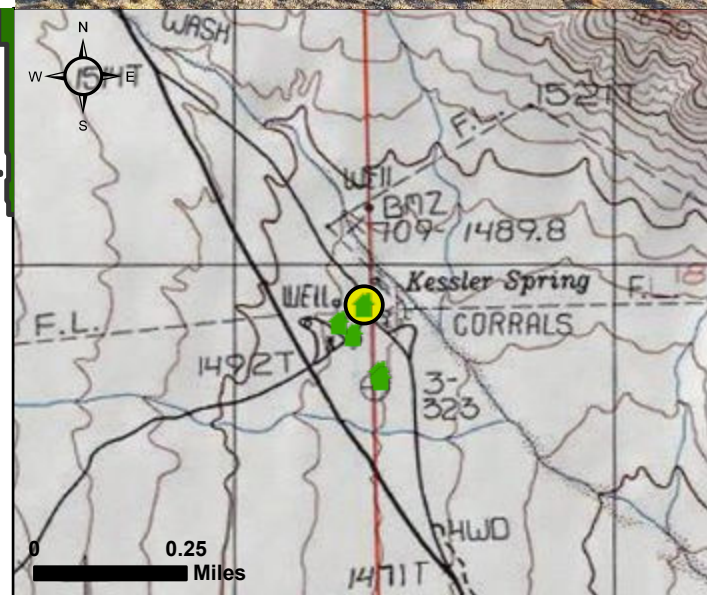



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSR Hay Barn 310

**Unit - Location:** MOJA - Cima

**FMSS ID:** 84688, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 17.83750002' N 115° 32.07316668' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, KSR Historic Ranch

**Revisit Interval:** 5 yrs

**Map Label:** 118

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** Limited or dependent on electricity

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** being rebuilt/repaired following 2020 Dome fire damage

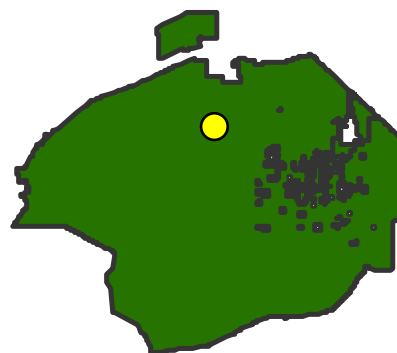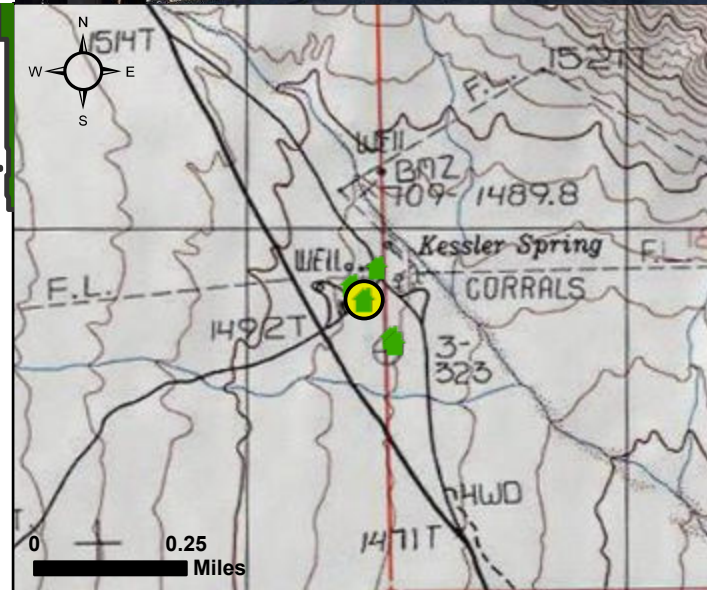



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSR Trapping Shed 314

**Unit - Location:** MOJA - Cima

**FMSS ID:** 84687, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 17.85613332' N 115° 32.09620002' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, KSR Historic Ranch

**Revisit Interval:** 5 yrs

**Map Label:** 86

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck


**Firewood:** None

**Water Supply:** Limited or dependent on electricity

**Propane:** Present and fuels clearance

**Overhead Hazards:** No overhead hazards

**Comments:** in 2020 Dome fire area

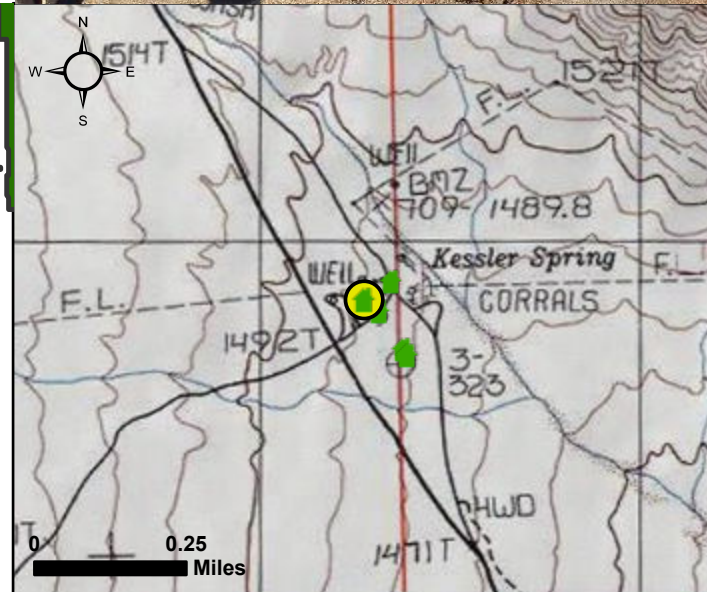



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Schoolhouse Restroom 207

**Unit - Location:** MOJA - Cima

**FMSS ID:** 76797, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.88860000' N 115° 38.94960000' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Kelso School

**Revisit Interval:** 5 yrs

**Map Label:** 74

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** Marked and clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Fire resistant- tar,rubberized

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:** buildings behind locked fence, limited view

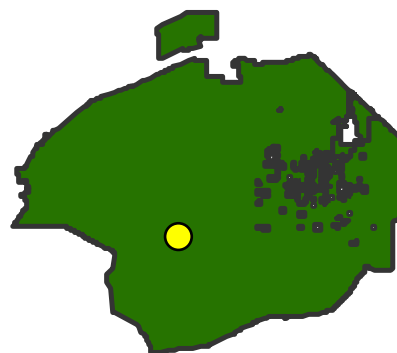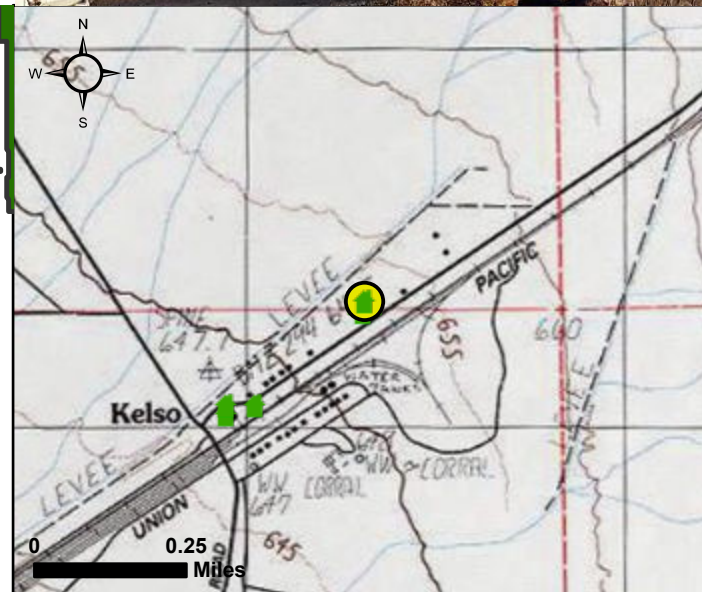



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSR PV Storage House

**Unit - Location:** MOJA - Cima

**FMSS ID:** 231462, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 17.78223612' N 115° 32.02961004' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, KSR Historic Ranch

**Revisit Interval:** 5 yrs

**Map Label:** 93

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** Limited or dependent on electricity

**Propane:** Present and fuels clearance

**Overhead Hazards:** No overhead hazards

**Comments:** building is on edge of 2020 Dome fire area.  
other photos not taken due to dog

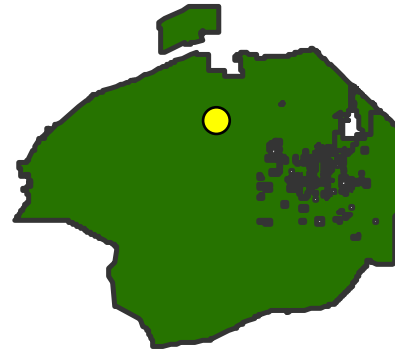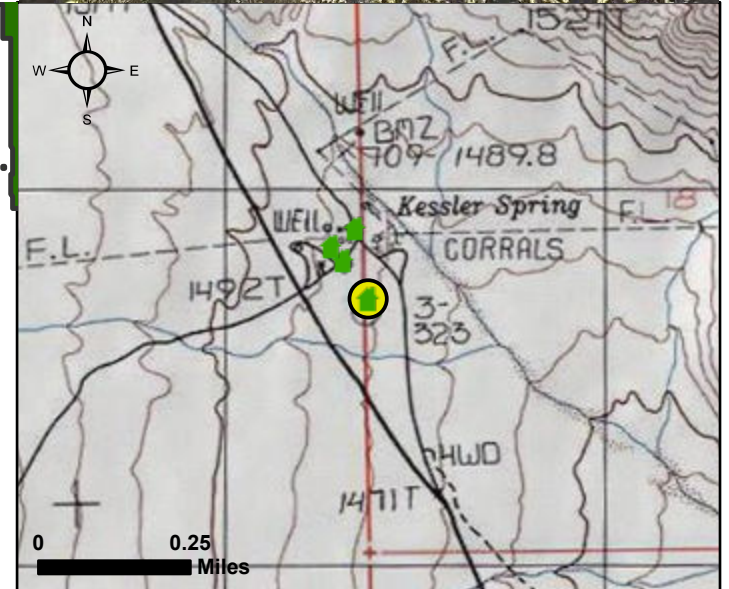



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KSRH Kessler 4 Plex Housing

KSRH Kessler 4 Plex Housing

KSR Kessler Fourplex Housing

**Unit - Location:** MOJA - Cima

**FMSS ID:** 230048, **Local ID:**

**Structure Type, Use:** Building, Residence

**Owner:** National Park Service

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** Yes

**In Community:** Yes, KSR Historic Ranch

**Revisit Interval:** 5 yrs

**Map Label:** 94

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** Limited or dependent on electricity

**Propane:** Present and fuels clearance

**Overhead Hazards:** No overhead hazards

**Comments:** building is on edge of 2020 Dome fire area.  
other photos not taken due to dog

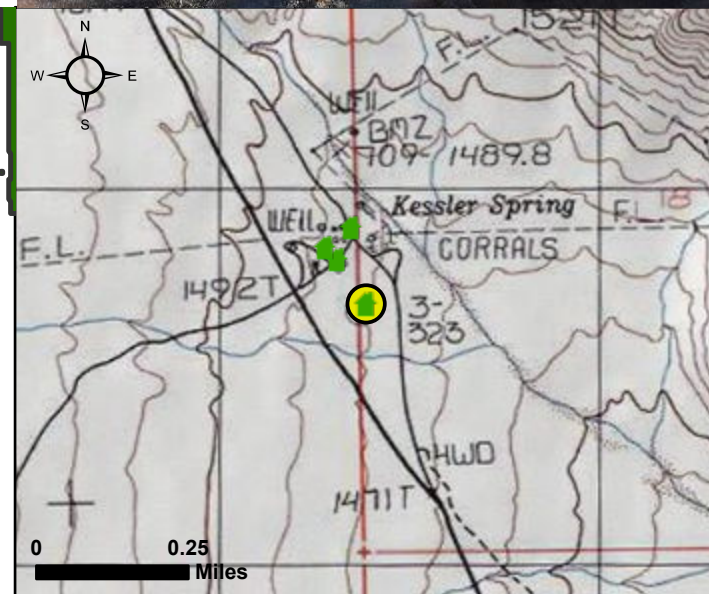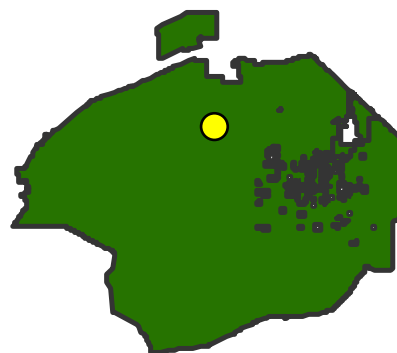



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** VV Animal barn

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 19.19642982' N 115° 35.03659824' W

**Rating:** Moderate

**Protection Level:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Valley View

**Revisit Interval:** 5 yrs

**Map Label:** 79

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 100 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

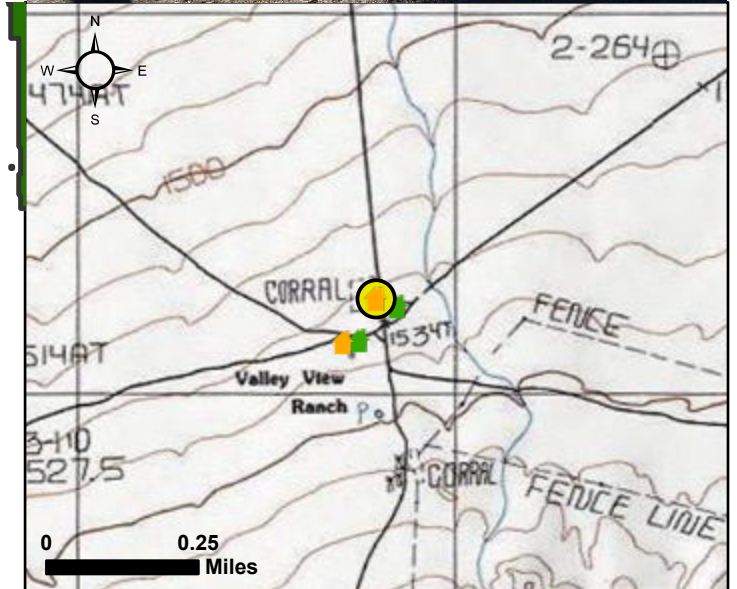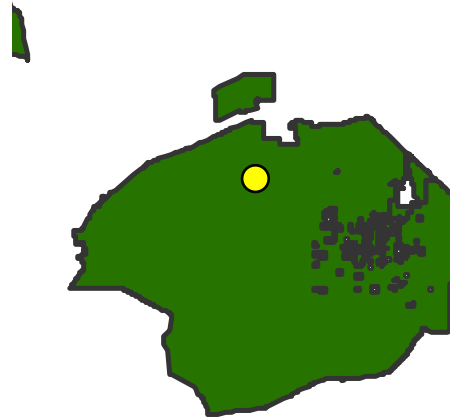



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** VV Root Cellar

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 19.13414604' N 115° 35.09557866' W

**Rating:** Moderate

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Valley View

**Revisit Interval:** 5 yrs

**Map Label:** 114

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed


**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** Present and fuels clearance

**Overhead Hazards:** No overhead hazards

**Comments:** building damaged in 2020 Dome fire

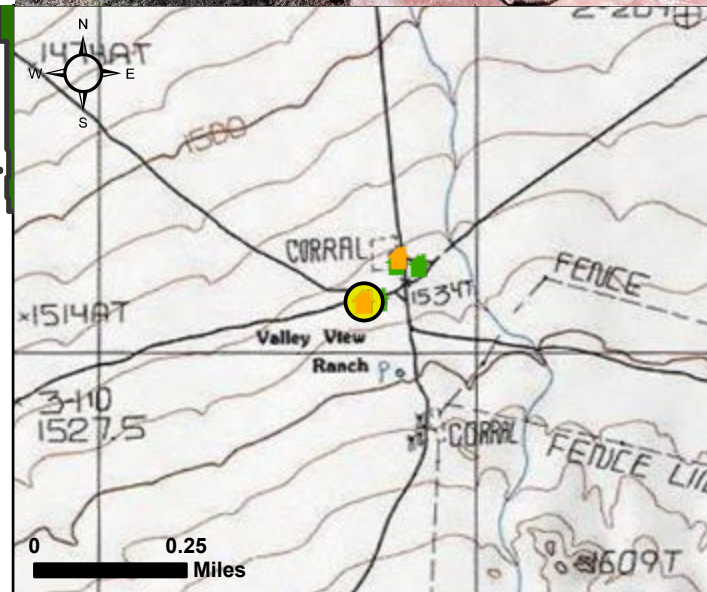



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Chicken Shed 211/East Dope House

**Unit - Location:** MOJA - Cima

**FMSS ID:** 76815, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.88623378' N 115° 38.96558280' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Kelso School

**Revisit Interval:** 5 yrs

**Map Label:** 69

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:** building behind locked fence, limited view

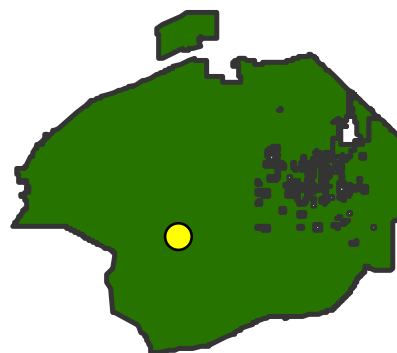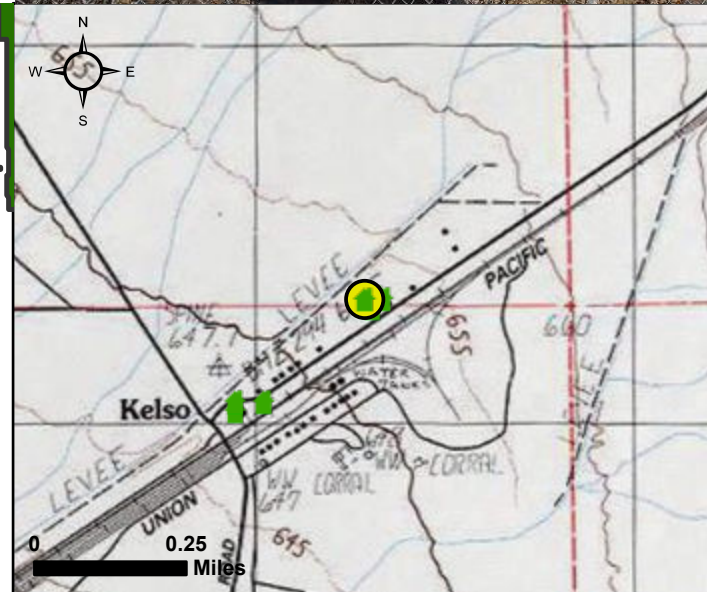



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Storage Shed 210

**Unit - Location:** MOJA - Cima

**FMSS ID:** 76813, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.88012020' N 115° 38.95421664' W

**Rating:** Low

**Protection Level:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Kelso School

**Revisit Interval:** 5 yrs

**Map Label:** 70

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, grade Greater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Fire resistant- tar, rubberized

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:** buildings behind locked fence- only one view visible

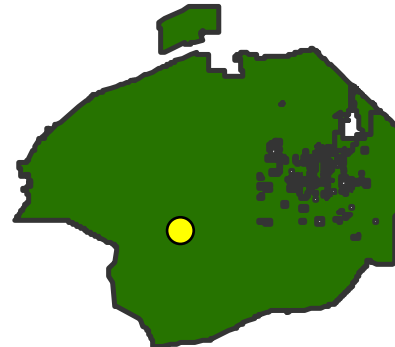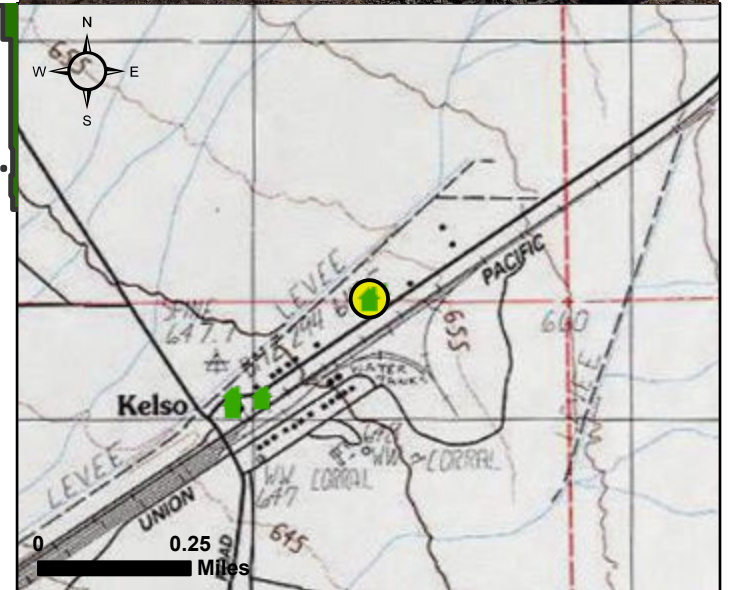



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Schoolhouse Garage 209

**Unit - Location:** MOJA - Cima

**FMSS ID:** 76788, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 00.87366372' N 115° 38.95306650' W

**Rating:** Low

**Protection Level:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Kelso School

**Revisit Interval:** 5 yrs

**Map Label:** 71

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, grade Greater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Shrub or timber

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Fire resistant- tar, rubberized

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance

**Overhead Hazards:** Overhead hazards will limit aircraft

**Comments:**

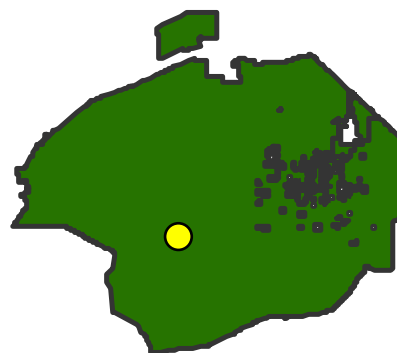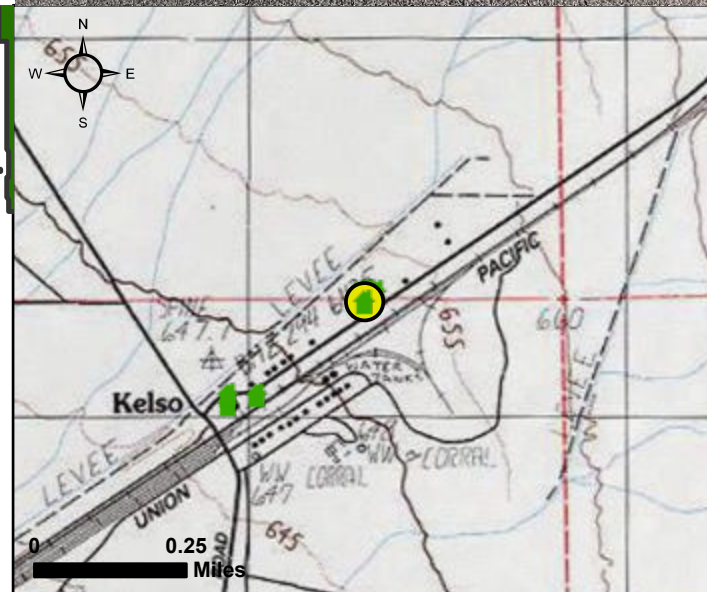



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Evening star ore shaft

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found, **Local ID:**

**Structure Type, Use:** Cultural Resource, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.60381648' N 115° 32.49898920' W

**Rating:** High

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 83

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Greater than 300ft with no turnaround

**Access and Turnarounds:** Greater than 300ft with no turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** high clearance and 4x4 recommended

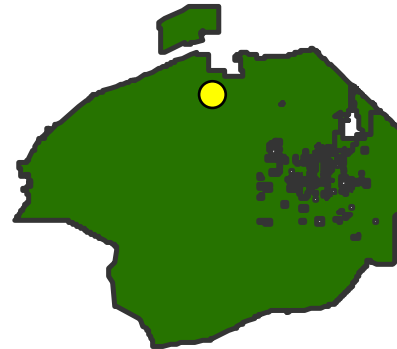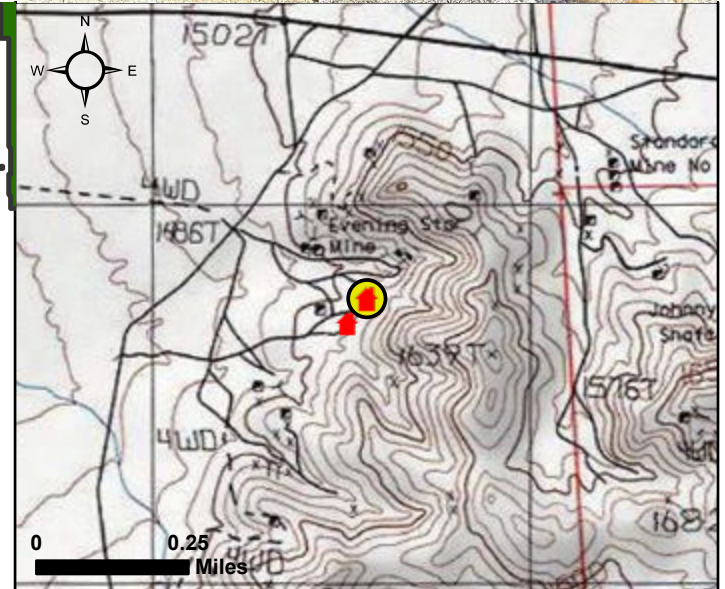



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Evening star collared shaft

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Cultural Resource, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.60005616' N 115° 32.51353248' W

**Rating:** High

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 82

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Greater than 300ft with no turnaround

**Access and Turnarounds:** Greater than 300ft with no turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** high clearance and 4x4 recommended

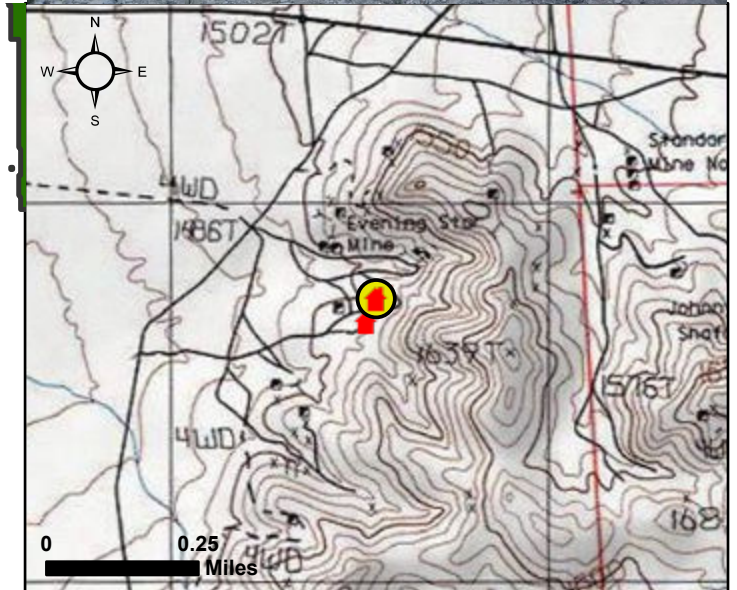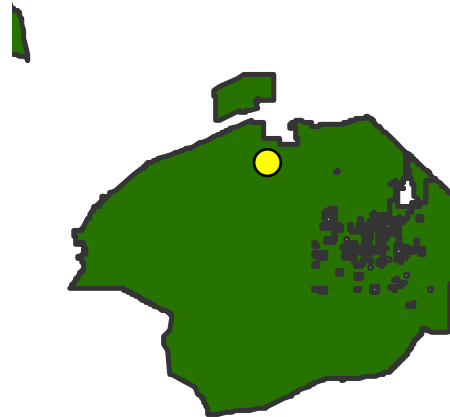



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Evening star explosives building

**Unit - Location:** MOJA - Cima

**FMSS ID:** 115787, **Local ID:**

**Structure Type, Use:** Cultural Resource, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.56680656' N 115° 32.53447488' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 81

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** high clearance and 4x4 recommended

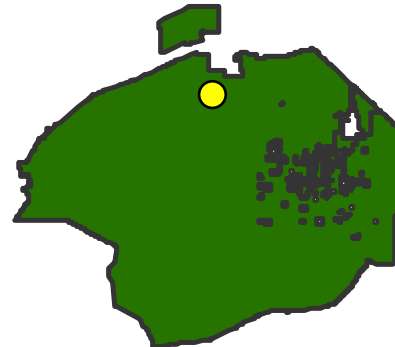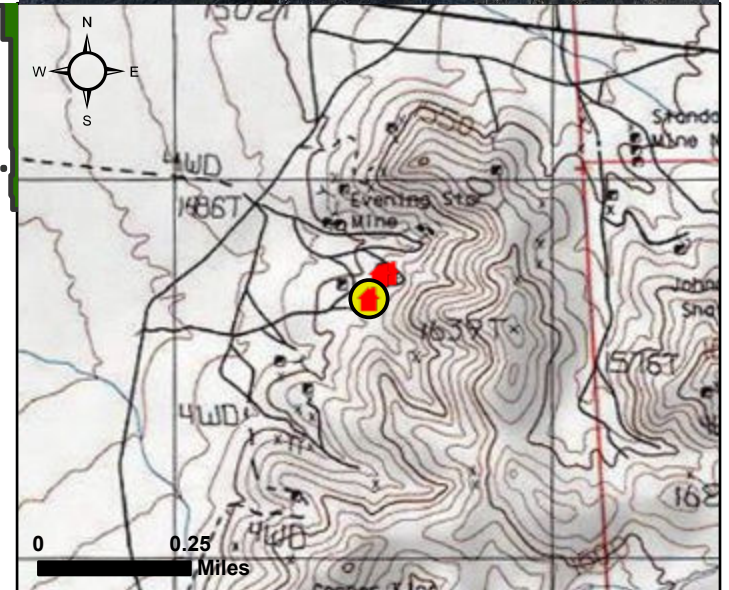



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Geer Main Cabin

**Unit - Location:** MOJA - Cima

**FMSS ID:** 230319, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.76852128' N 115° 30.99378600' W

**Rating:** High

**Protection Level:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 96

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Surfaced-paved, grade Greater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Fire resistant- tar, rubberized

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

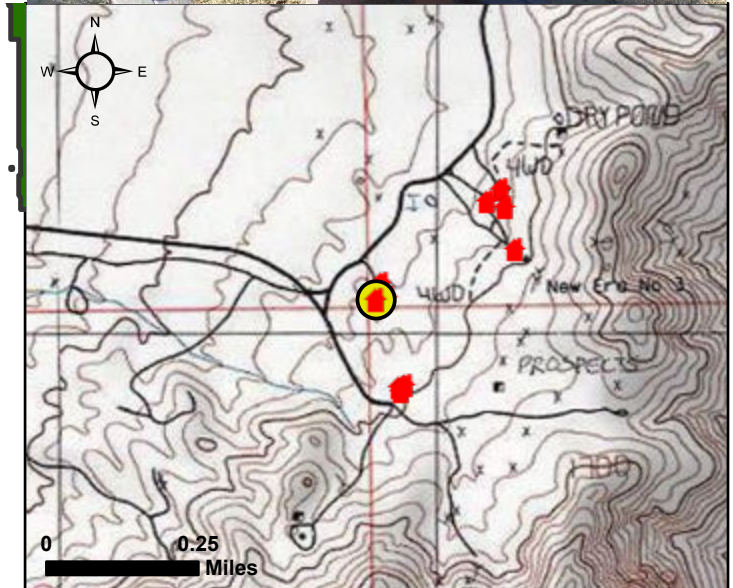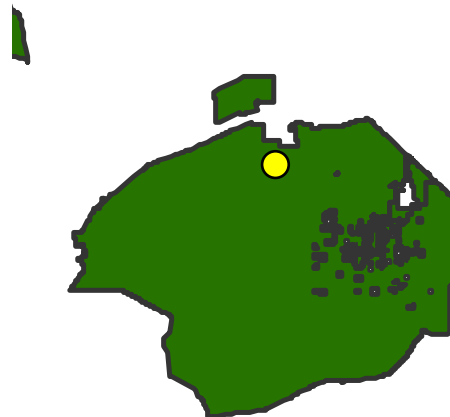



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Geer Garage

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.77162616' N 115° 30.98849328' W

**Rating:** High

**Protection Level:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 121

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Surfaced-paved, grade Greater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck


**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

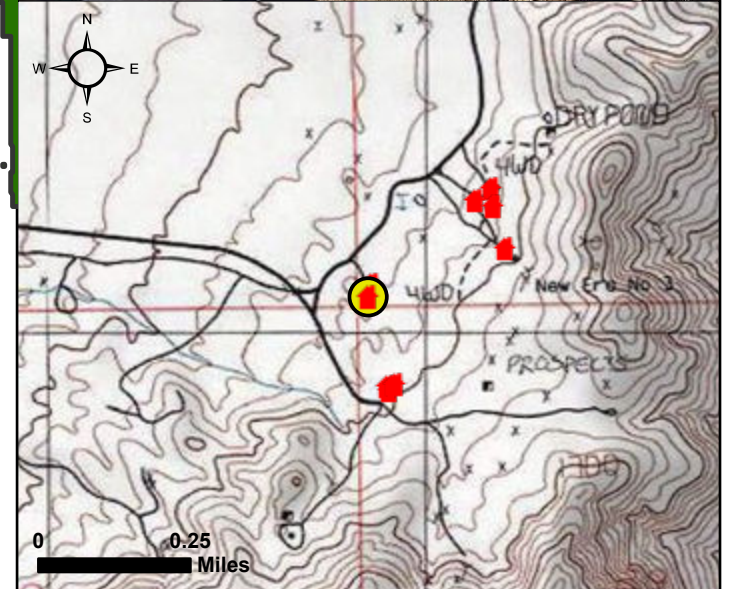



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Geer Outhouse

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Toilet, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.77135424' N 115° 30.97511616' W

**Rating:** High

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 128

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Surfaced-paved, gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** Spring nearby

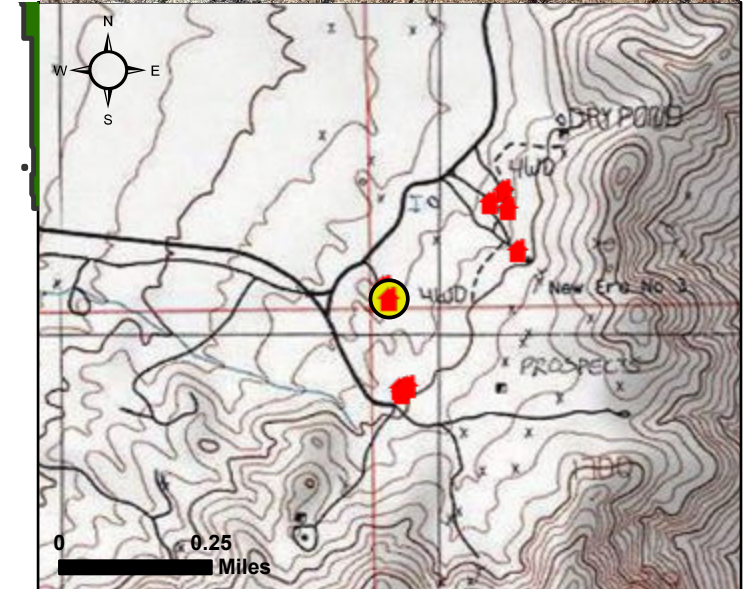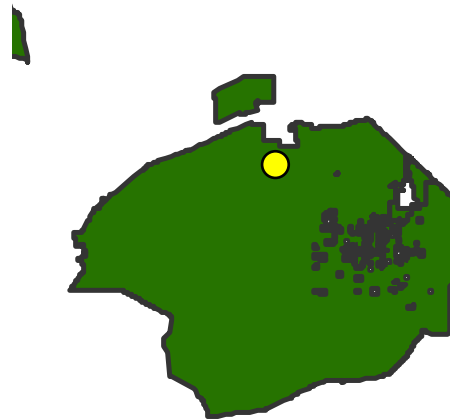



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Geer Coal Storage

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.78951636' N 115° 30.98579994' W

**Rating:** High

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 97

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** No defensible space

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

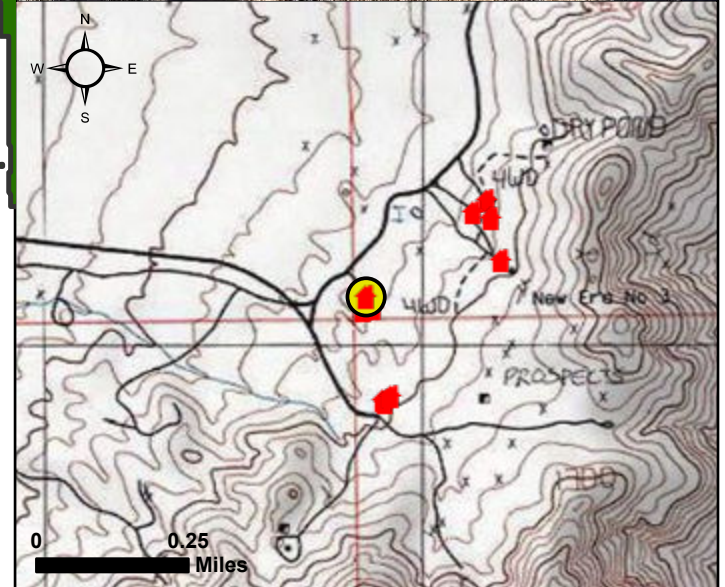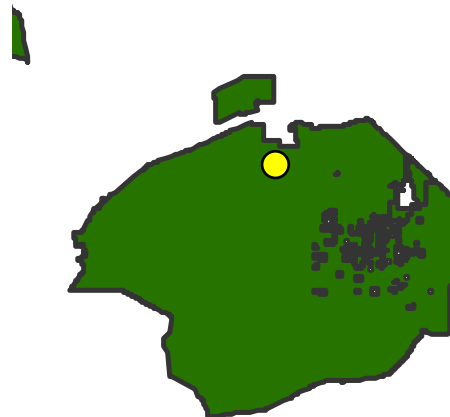



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rowsell Cabin

**Unit - Location:** MOJA - Cima

**FMSS ID:** 236676, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.92371998' N 115° 30.77263998' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 101

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck


**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

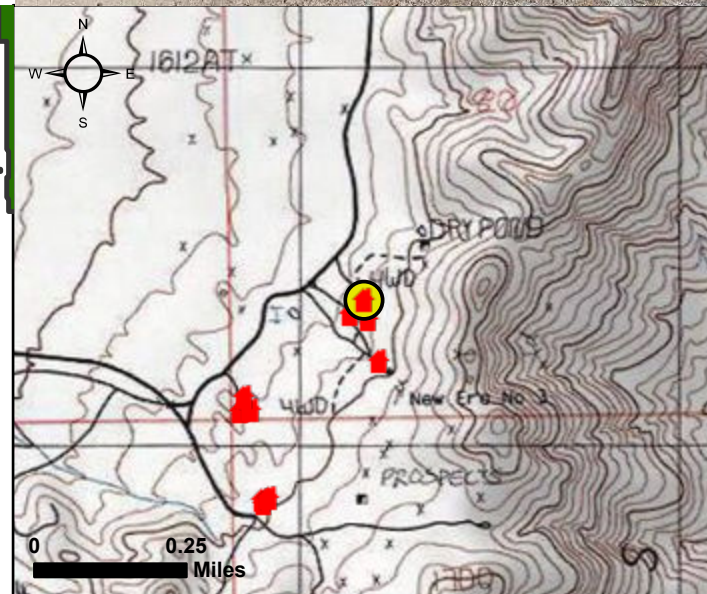





# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rileys Lab  
**Unit - Location:** MOJA - Cima  
**FMSS ID:** 115784, **Local ID:**  
**Structure Type, Use:** Building, Public  
**Owner:** National Park Service  
**Field Crew, Visit Date:** L. Catlin, February 2, 2021  
**Coordinates (DDM):** 35° 21.63723624' N 115° 30.95557842' W

**Rating:** High  
**ProtectionLevel:** Not Designated, December 31, 1899  
**Resources of Concern:** Yes  
**Occupied:** No  
**In Community:** No,  
**Revisit Interval:** 5 yrs  
**Map Label:** 123

**Primary Access:** Road  
**Ingress Egress:** 1 road in/out  
**Access Width:** 1 lane (Less than 18')  
**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%  
**Bridge Condition:** Less than 300 ft with turnaround  
**Access and Turnarounds:** Less than 300 ft with turnaround  
**Facility Number or Sign:** None or not clearly visible  
**Fuel Type:** Grass and shrub, hardwood litter  
**Fuel Load:** Moderate  
**Defensible Space:** Less than 30 ft treated  
**Topography:** Slope 5% to 20%  
**Roof Material:** Combination of fire resitant and combustible  
**Siding Material:** Wood or open sided  
**Foundation:** Open or deck  
**Firewood:** None  
**Water Supply:** No reliable water source nearby  
**Propane:** None  
**Overhead Hazards:** No overhead hazards  
**Comments:**

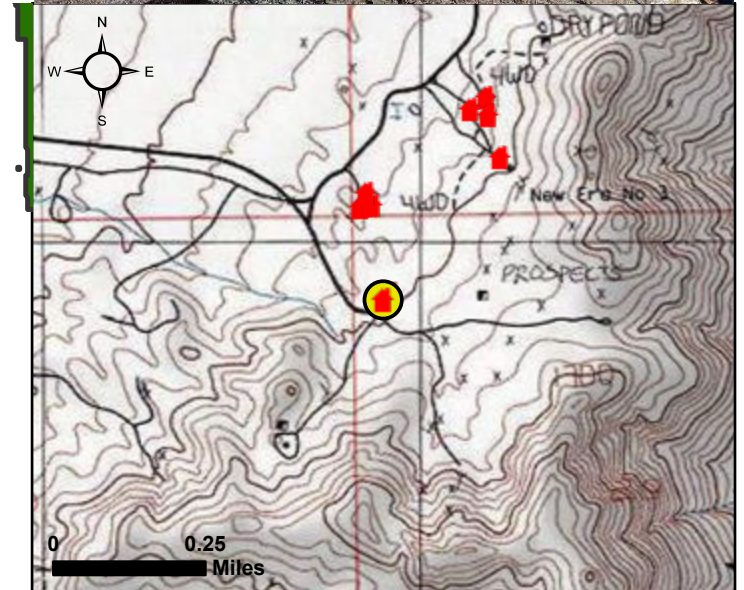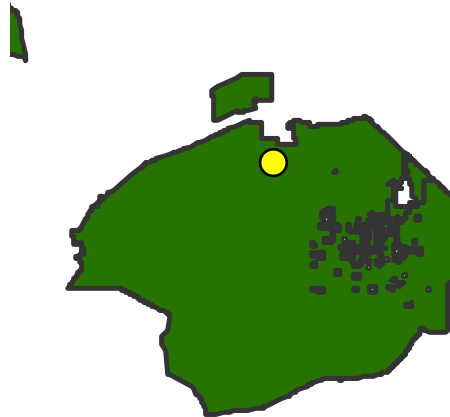



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rileys Cabin

**Unit - Location:** MOJA - Cima

**FMSS ID:** 115783, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.64058850' N 115° 30.95884500' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 122

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

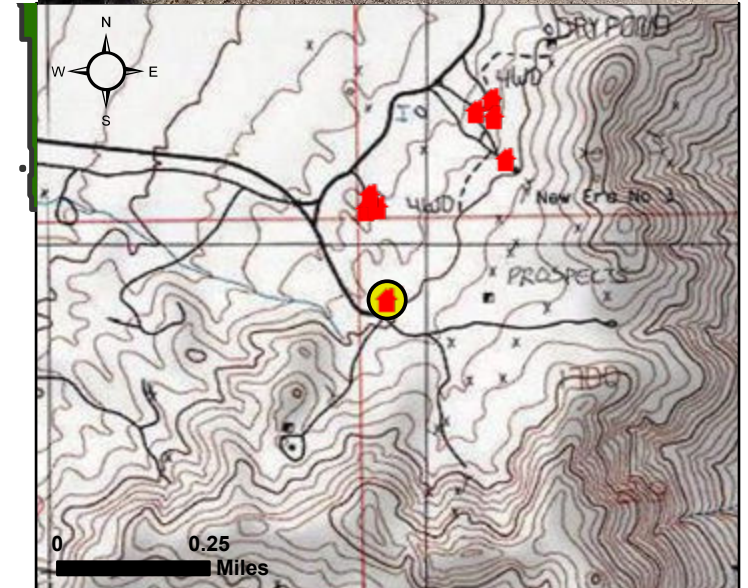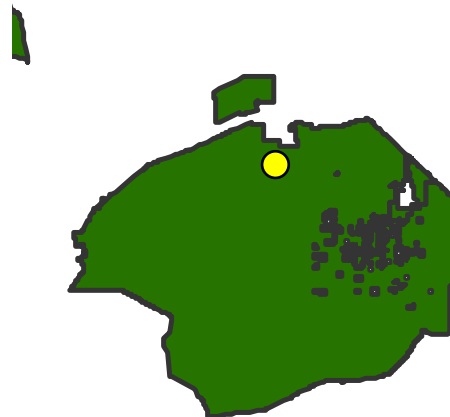



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rileys Outhouse

**Unit - Location:** MOJA - Cima

**FMSS ID:** 115785, **Local ID:**

**Structure Type, Use:** Toilet, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 21.64411044' N 115° 30.94545414' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 124

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Greater than 300 ft with turnaround

**Access and Turnarounds:** Greater than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

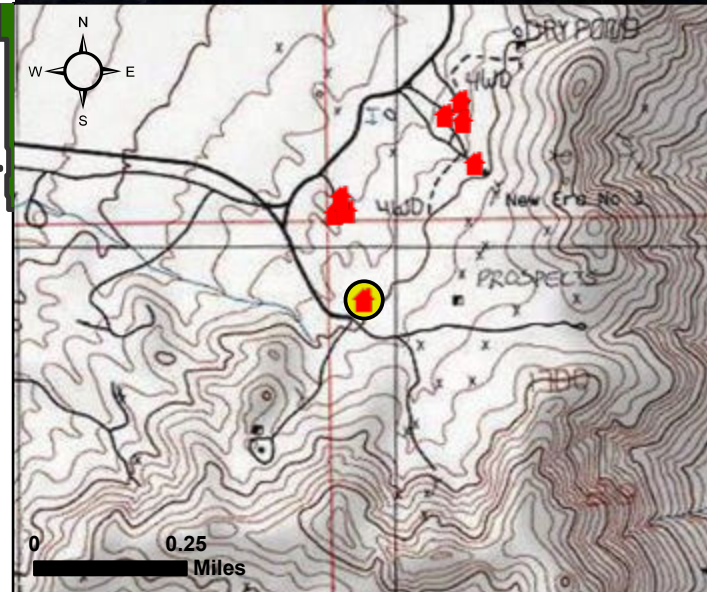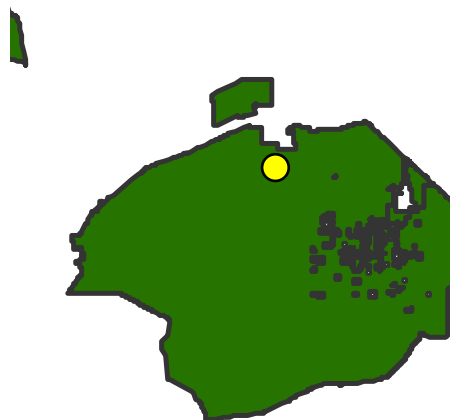




# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rogers Camp  
**Unit - Location:** MOJA - Cima  
**FMSS ID:** 233969, **Local ID:**  
**Structure Type, Use:** Building, Administrative  
**Owner:** National Park Service  
**Field Crew, Visit Date:** Hansen, May 1, 2017  
**Coordinates (DDM):** 35° 24.41708256' N 115° 32.05023072' W

**Rating:** High  
**Protection Level:** Not Designated,  
**Resources of Concern:** Yes  
**Occupied:** No  
**In Community:** No,  
**Revisit Interval:** 5 yrs  
**Map Label:** 92

**Primary Access:** Road  
**Ingress Egress:** 1 road in/out  
**Access Width:** 1 lane (Less than 18')  
**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%  
**Bridge Condition:** Less than 300 ft with turnaround  
**Access and Turnarounds:** Less than 300 ft with turnaround  
**Facility Number or Sign:** None or not clearly visible  
**Fuel Type:** Grass and shrub, hardwood litter  
**Fuel Load:** Light or no wildland fuels  
**Defensible Space:** Less than 30 ft treated  
**Topography:** Slope 5% to 20%  
**Roof Material:** Combination of fire resitant and combustible  
**Siding Material:** Rock, concrete, metal  
**Foundation:** Open or deck  
**Firewood:** None  
**Water Supply:** No reliable water source nearby  
**Propane:** None  
**Overhead Hazards:** No overhead hazards  
**Comments:**

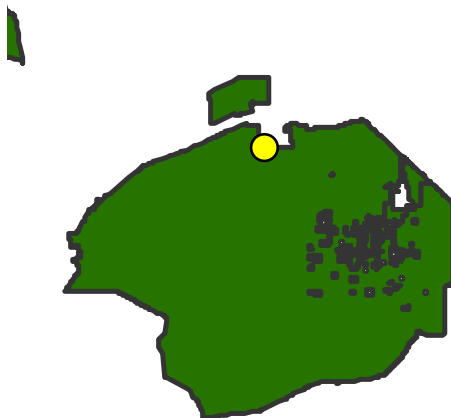



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Bunk House

**Unit - Location:** MOJA - Cima

**FMSS ID:** 236678, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.28191592' N 115° 42.11756688' W

**Rating:** Moderate

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 112

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

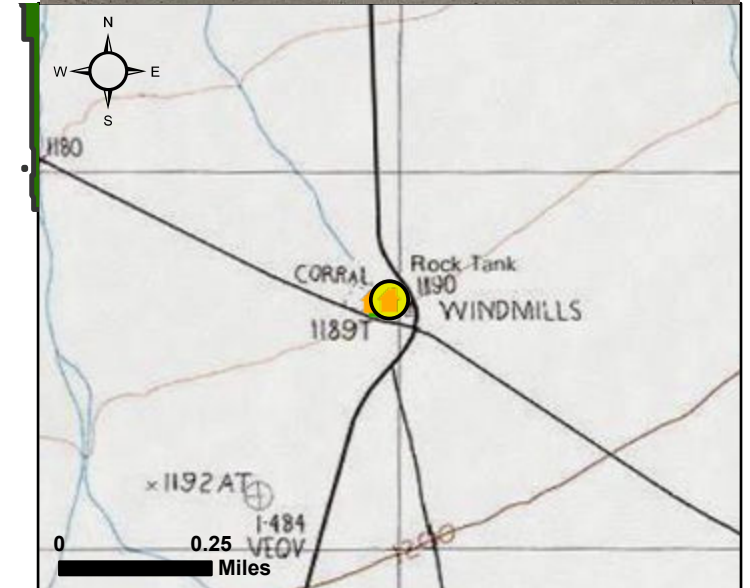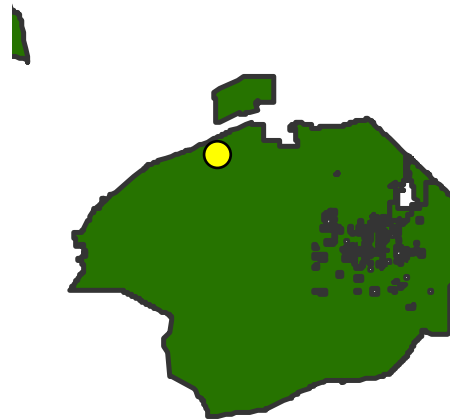



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Cook House

**Unit - Location:** MOJA - Cima

**FMSS ID:** 236681, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.29078632' N 115° 42.12583560' W

**Rating:** Moderate

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 65

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

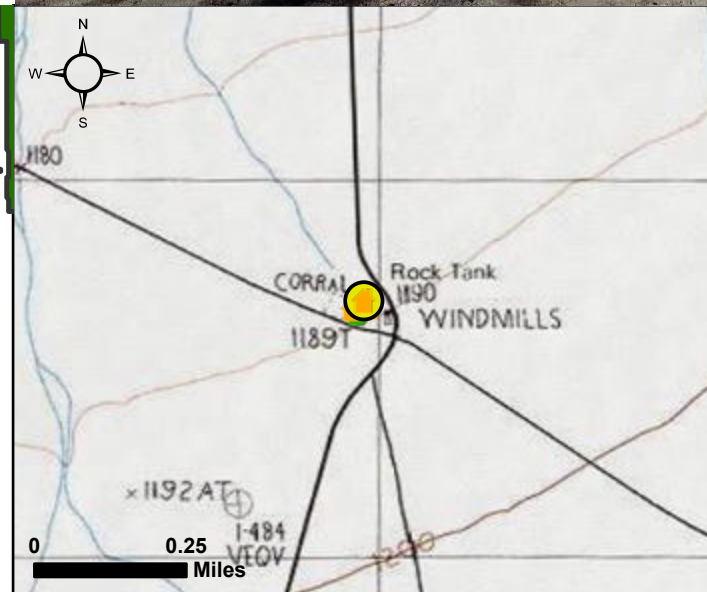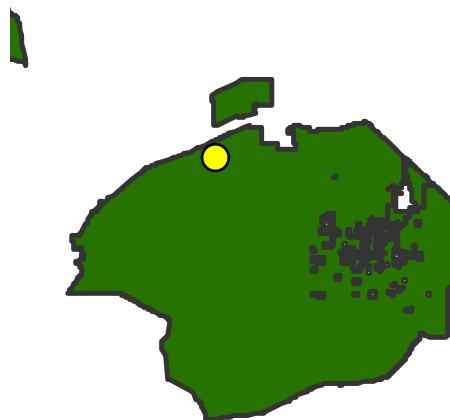



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Root Cellar

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Other, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.29278312' N 115° 42.12186360' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 66

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

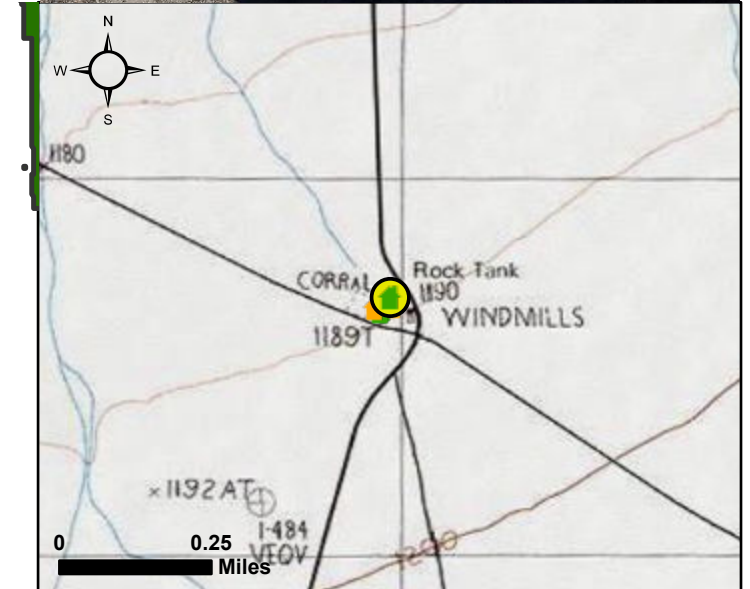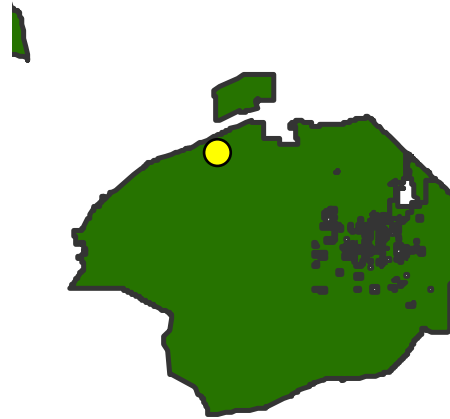



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Garage

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.28503208' N 115° 42.13953600' W

**Rating:** High

**Protection Level:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 110

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Combination of fire resisitant and combustible

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

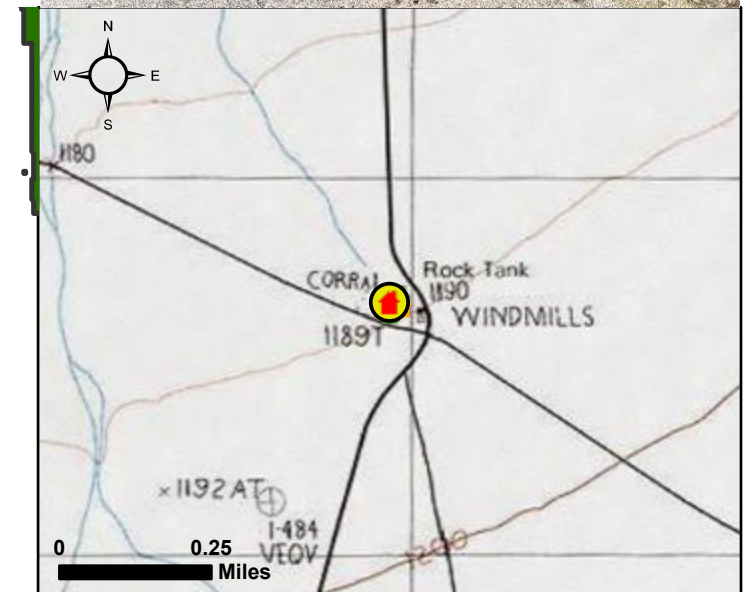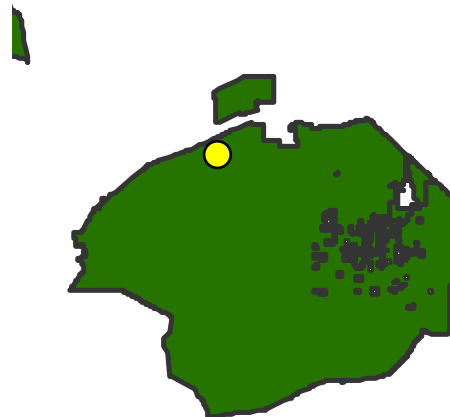



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Water Tank

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Utility Site (Water, Gas, Elec), Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.27729280' N 115° 42.13460616' W

**Rating:** Low

**Protection Level:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 111

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel, dirt, grade Less than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, 6in to 30in masonry exposed



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

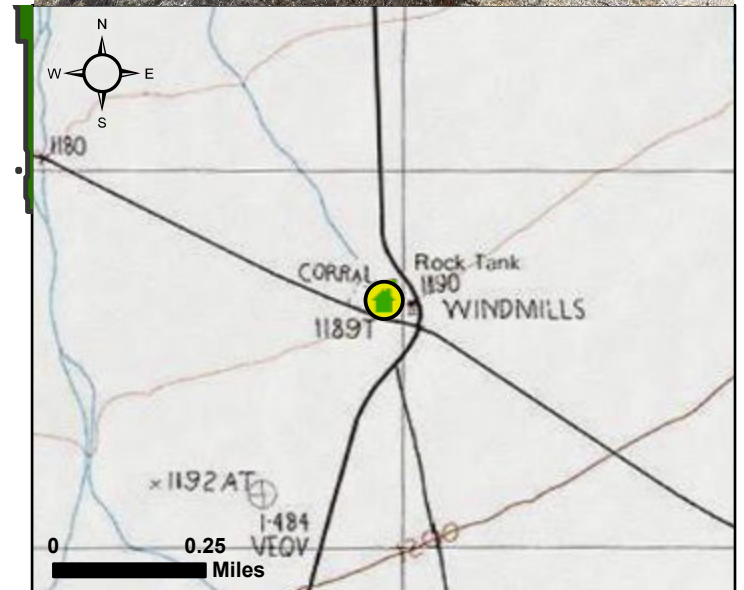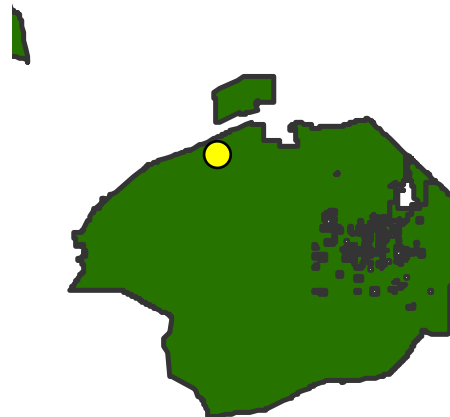



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Water Tank Large

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Utility Site (Water, Gas,Elec), Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.27476992' N 115° 42.13995120' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 109

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Closed, 6in to 30in masonry exposed



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

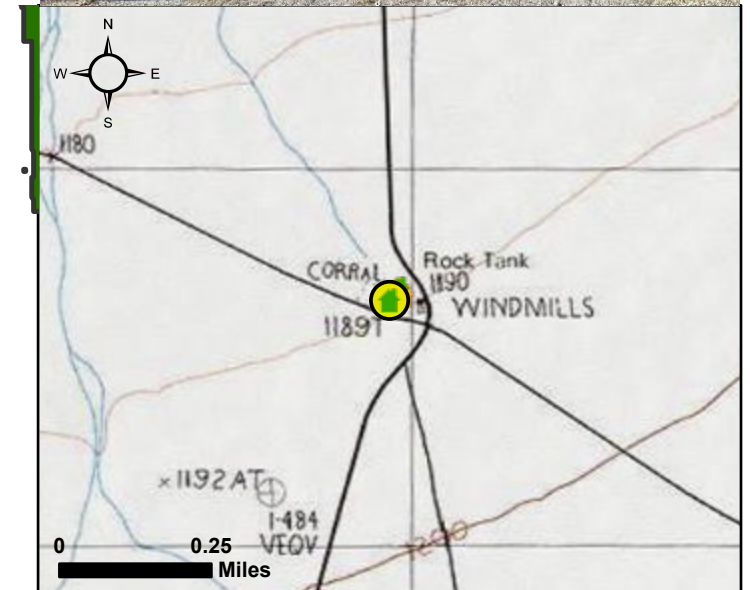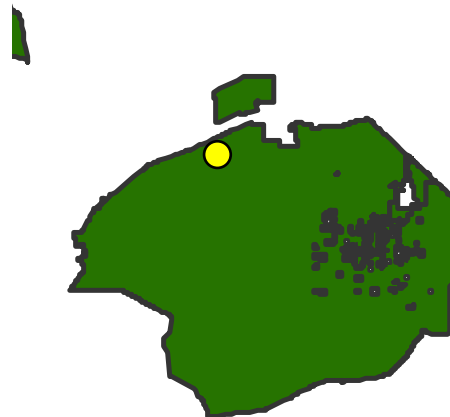



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rock Tank Corral

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Other, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 23.28017472' N 115° 42.14919552' W

**Rating:** Moderate

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** Yes, Rock Tank

**Revisit Interval:** 5 yrs

**Map Label:** 64

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

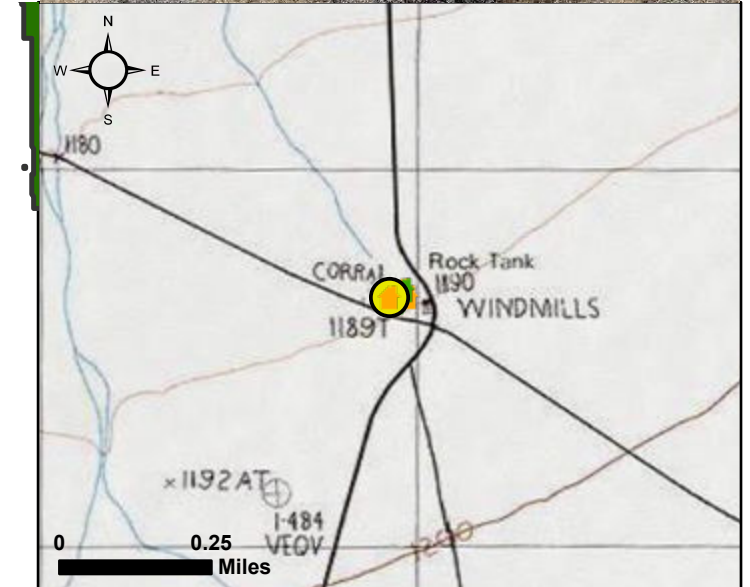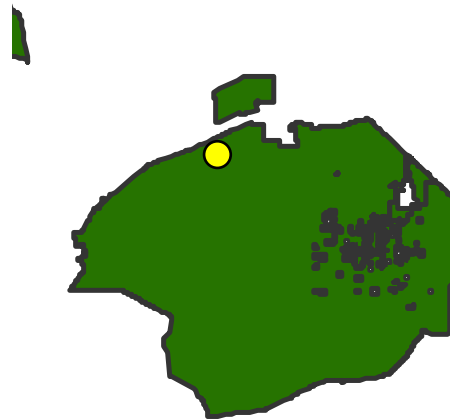



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Ivanpah Desert Tortoise Research Facility

**Unit - Location:** MOJA - Cima

**FMSS ID:** 236267, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):** 35° 27.07283880' N 115° 23.42067144' W

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 108

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** Marked and clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Fire resistant- tar,rubberized

**Siding Material:** Wood or open sided

**Foundation:** Closed, Less than 6in masonry exposed



**Firewood:** None

**Water Supply:** Reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** Desert tortoise research facility with creosote. facility enclosed in fence with locked gate

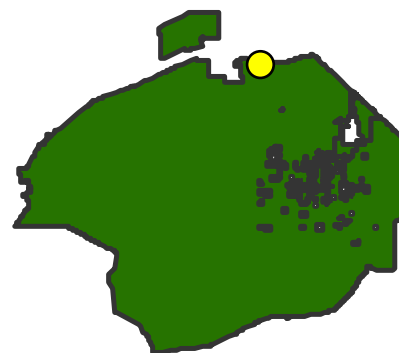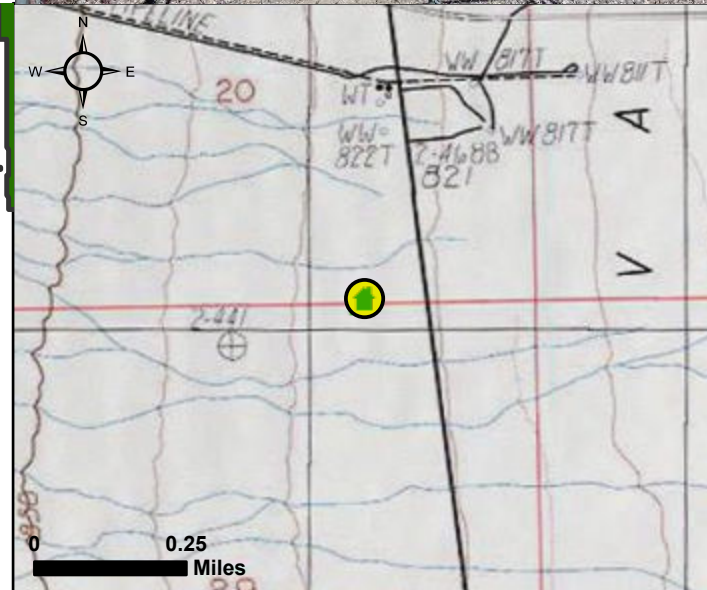



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Lone Star Cabin North

**Unit - Location:** MOJA - Cima

**FMSS ID:** 233909, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** Hansen, May 1, 2017

**Coordinates (DDM):** 35° 23.00379456' N 115° 28.67041080' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 104

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** Historic

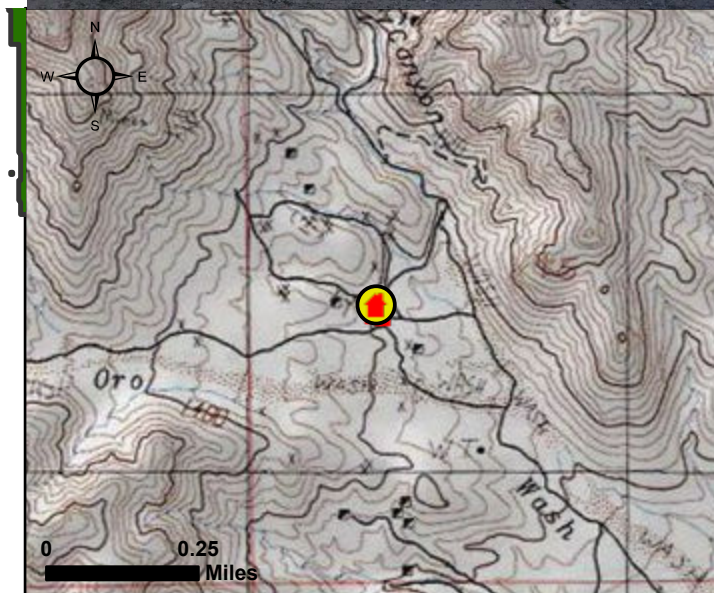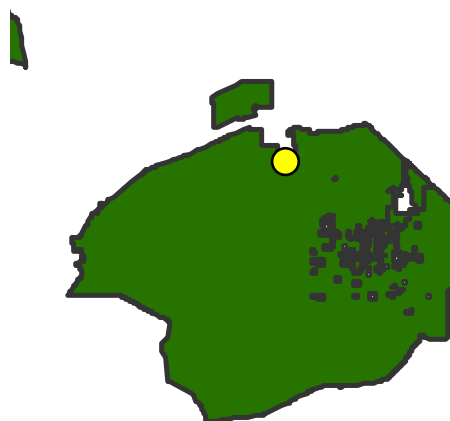



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Lone Star Cabin South

**Unit - Location:** MOJA - Cima

**FMSS ID:** 233912, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** Hansen, May 1, 2017

**Coordinates (DDM):** 35° 22.99790472' N 115° 28.66969848' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 105

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:** Historic

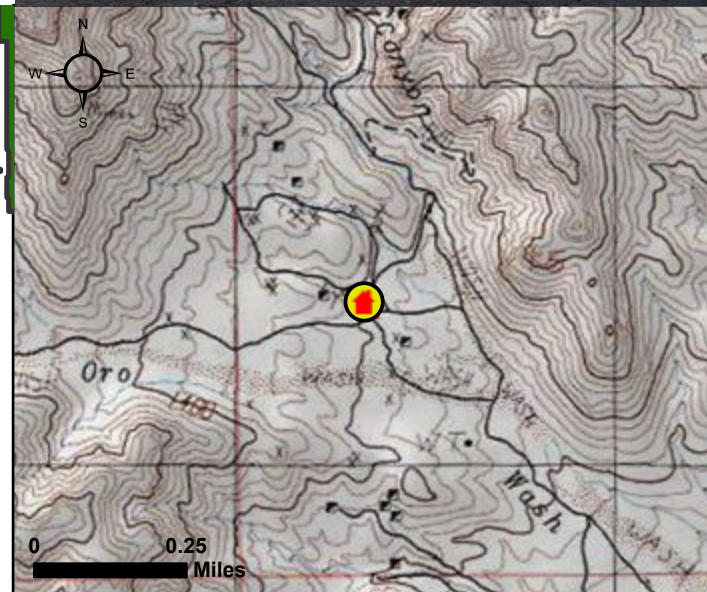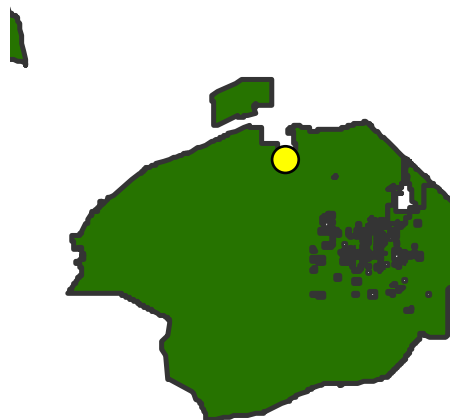



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Lone Star Outhouse

**Unit - Location:** MOJA - Cima

**FMSS ID:** 233917

**Local ID:**

**Structure Type, Use:** Toilet, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** Hansen, May 1, 2017

**Rating:** High

**Protection Level:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 103

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

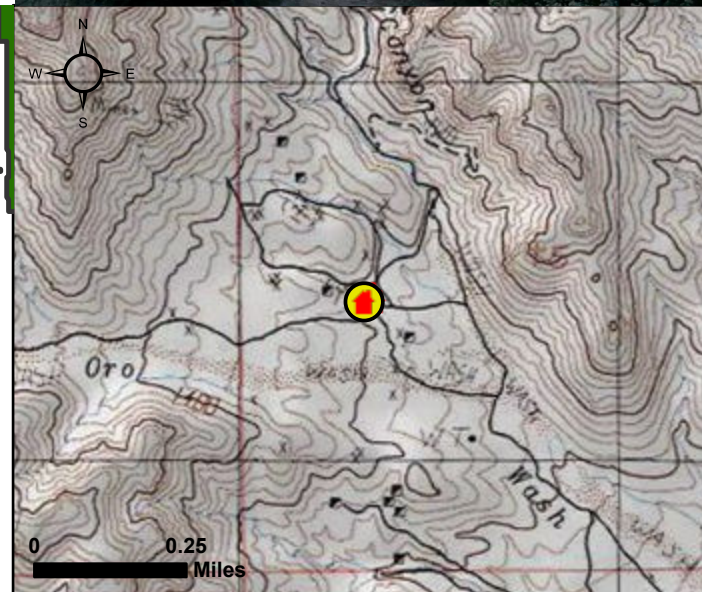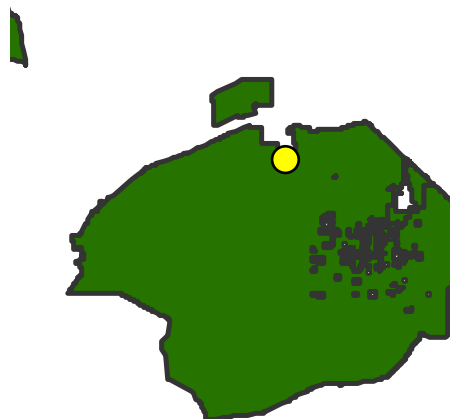



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Lone Star Garage

**Unit - Location:** MOJA - Cima

**FMSS ID:** 233918, **Local ID:**

**Structure Type, Use:** Shade/Picnic Structure, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** Hansen, May 1, 2017

**Coordinates (DDM):** 35° 22.98990048' N 115° 28.66041864' W

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 106

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Light or no wildland fuels

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Wood or open sided

**Foundation:** Open or deck



**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

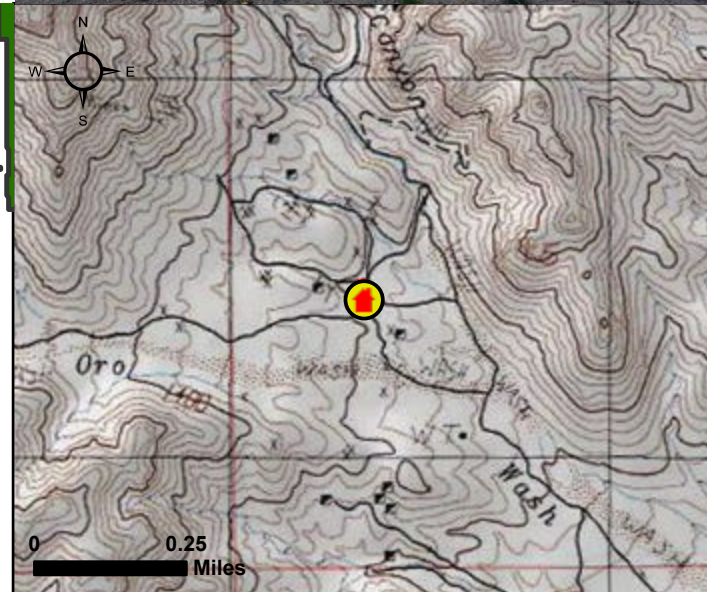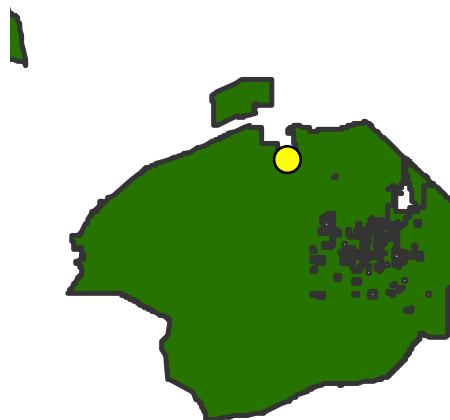



# NPS Wildland Fire Risk Assessment - Facility Assessment



For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Storage Shed 210 KD Kelso Storage Shed 210  
**Unit - Location:** MOJA - Cima MOJA - Cima  
**FMSS ID:** 76813, **Local ID:**  
**Structure Type, Use:** Building, Administrative  
**Owner:** National Park Service  
**Field Crew, Visit Date:** L. Catlin, February 2, 2021 February 2, 2021  
**Coordinates (DDM):**

**Rating:** Low  
**ProtectionLevel:** Not Designated,  
**Resources of Concern:** Unknown  
**Occupied:** No  
**In Community:** Yes, Kelso School Kelso School  
**Revisit Interval:** 5 yrs  
**Map Label:** 72

**Primary Access:** Road Road  
**Ingress Egress:** 2 or more roads in/out 2 or more roads in/out  
**Access Width:** 1.5 lanes (Greater than 18') 1.5 lanes (Greater than 18')  
**Access Condition:** Surfaced-paved, gradeGreater than 5% Surfaced-paved, gradeGreater than 5%  
**Bridge Condition:** Less than 300 ft with turnaround Less than 300 ft with turnaround  
**Access and Turnarounds:** Less than 300 ft with turnaround Less than 300 ft with turnaround  
**Facility Number or Sign:** None or not clearly visible None or not clearly visible  
**Fuel Type:** Shrub or timber Shrub or timber  
**Fuel Load:** Light or no wildland fuels Light or no wildland fuels  
**Defensible Space:** Greater than 100ft treated Greater than 100ft treated  
**Topography:** Slope Less than 5% Slope Less than 5%  
**Roof Material:** Fire resistant- tar,rubberized Fire resistant- tar,rubberized  
**Siding Material:** Wood or open sided Wood or open sided  
**Foundation:** Open or deck Open or deck  
**Firewood:** None None  
**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system Pressurized hydrant(s) or fixed sprinkler system  
**Propane:** Present and fuels clearance Present and fuels clearance  
**Comments:** buildings behind locked fence- only one view visible buildings behind locked fence- only one view visible

NO PHOTO AVAILABLE

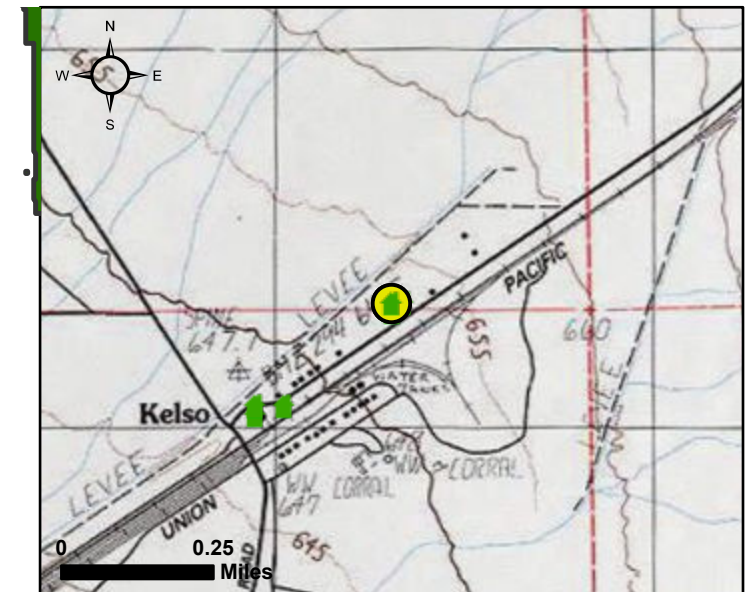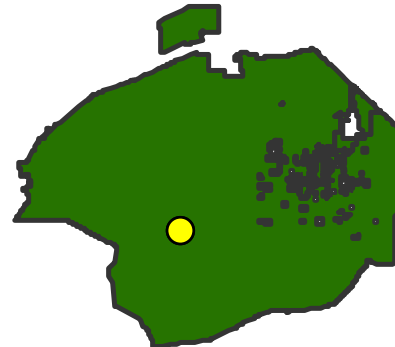



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** unknown house

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**Protection Level:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 120

**Primary Access:** Road

**Ingress Egress:** 2 or more roads in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%

**Bridge Condition:** Less than 300 ft with no turnaround

**Access and Turnarounds:** Less than 300 ft with no turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope Less than 5%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck

**Firewood:** None



**Water Supply:** Reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

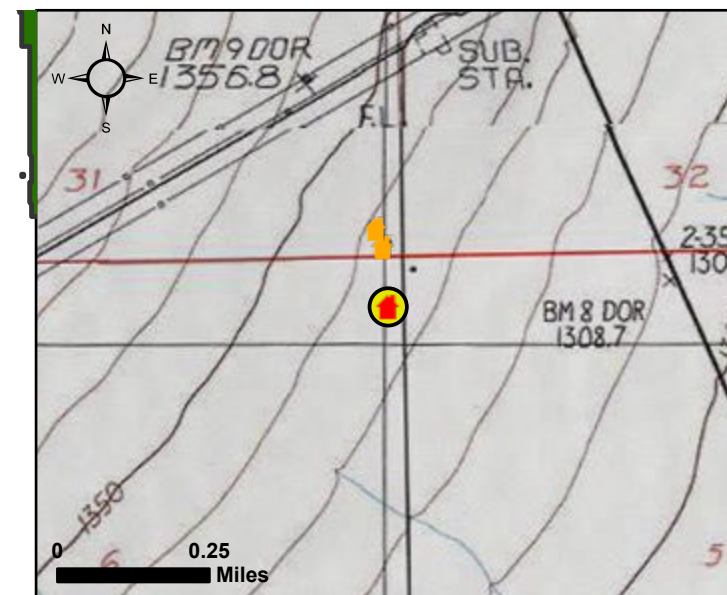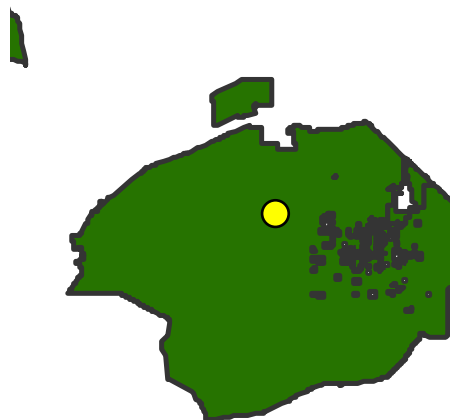



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rowsell metal shed

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 100

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** No defensible space

**Topography:** Slope 5% to 20%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Rock, concrete, metal

**Foundation:** Open or deck

**Firewood:** None



**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

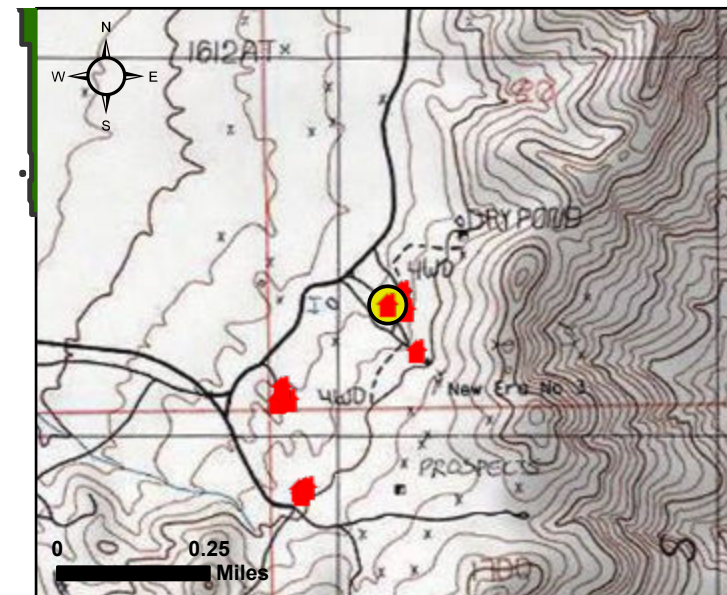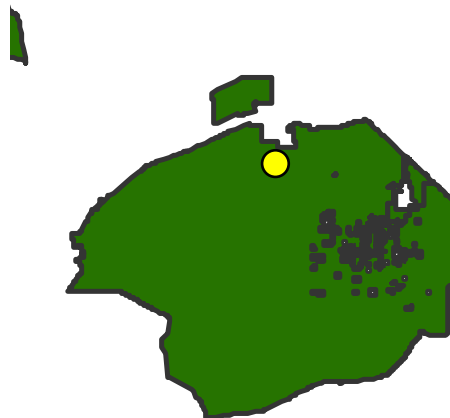



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rowsell unknown barn

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**Protection Level:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 102

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** No defensible space

**Topography:** Slope 5% to 20%

**Roof Material:** Combination of fire resitant and combustible

**Siding Material:** Wood or open sided

**Foundation:** Open or deck

**Firewood:** None



**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

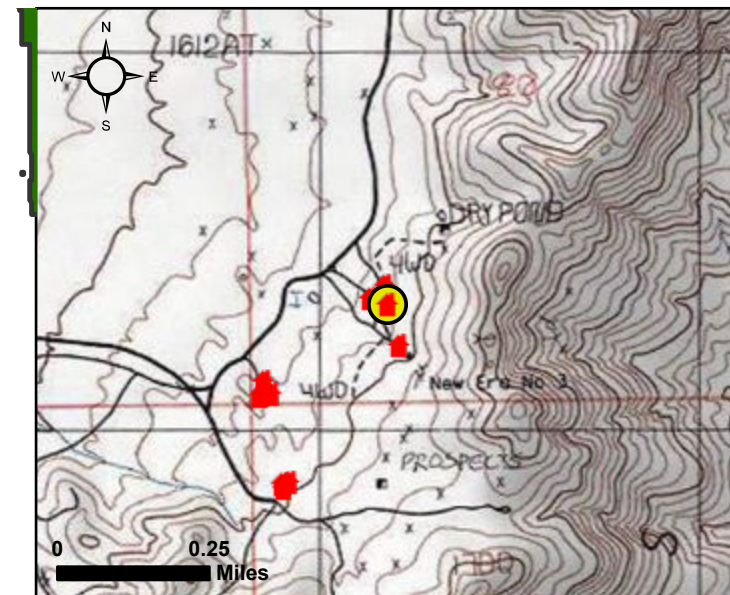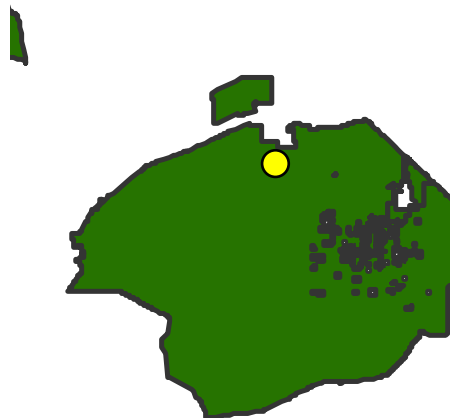



# NPS Wildland Fire Risk Assessment - Facility Assessment



For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Ivanpah Desert Tortoise Research Facility shed  
**Unit - Location:** MOJA - Cima  
**FMSS ID:** not found , **Local ID:**  
**Structure Type, Use:** Building, Administrative  
**Owner:** National Park Service  
**Field Crew, Visit Date:** L. Catlin, February 2, 2021  
**Coordinates (DDM):**

**Rating:** Low  
**ProtectionLevel:** Not Designated,  
**Resources of Concern:** Yes  
**Occupied:** No  
**In Community:** No,  
**Revisit Interval:** 5 yrs  
**Map Label:** 107

**Primary Access:** Road  
**Ingress Egress:** 2 or more roads in/out  
**Access Width:** 1.5 lanes (Greater than 18')  
**Access Condition:** Non-surfaced- gravel,dirt,gradeLess than 5%  
**Bridge Condition:** Less than 300 ft with turnaround  
**Access and Turnarounds:** Less than 300 ft with turnaround  
**Facility Number or Sign:** Marked and clearly visible  
**Fuel Type:** Grass and shrub, hardwood litter  
**Fuel Load:** Light or no wildland fuels  
**Defensible Space:** 30 ft treated  
**Topography:** Slope Less than 5%  
**Roof Material:** Fire resistant- tar,rubberized  
**Siding Material:** Wood or open sided  
**Foundation:** Open or deck  
**Firewood:** None  
**Water Supply:** Reliable water source nearby  
**Propane:** None  
**Overhead Hazards:** No overhead hazards  
**Comments:** Desert tortoise research facility with creosote. facility enclosed in fence with locked gate

NO PHOTO AVAILABLE

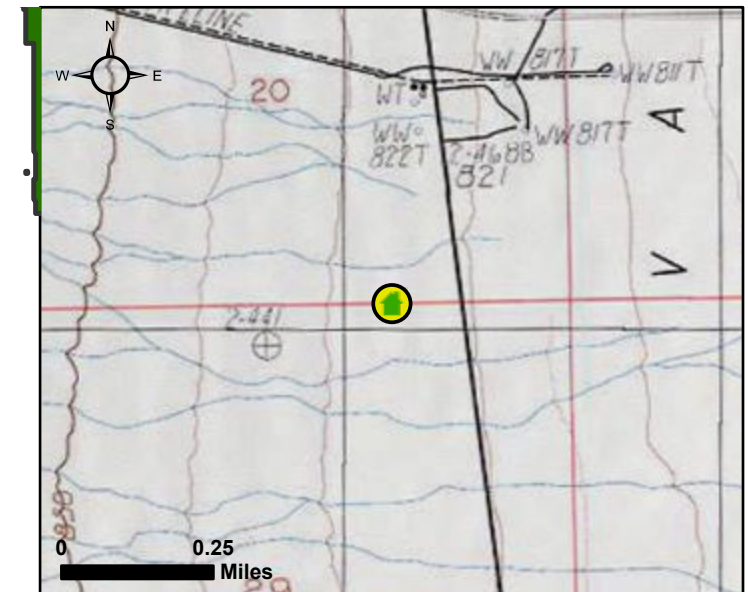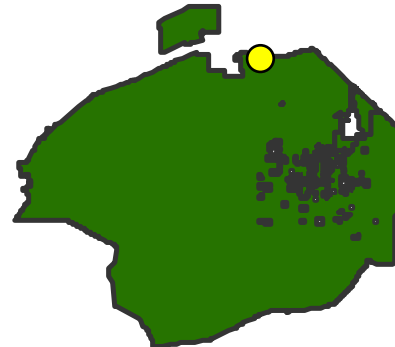



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** unknown cabin 2

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 125

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** No defensible space

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck

**Firewood:** None



**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

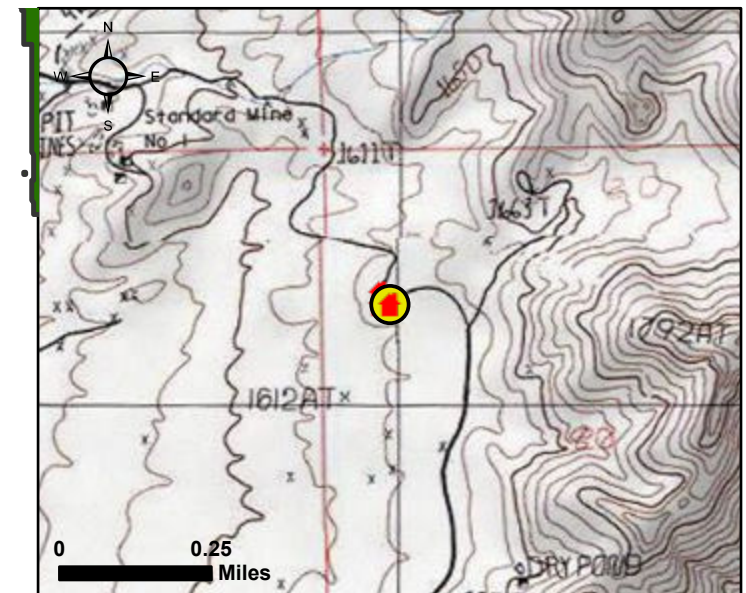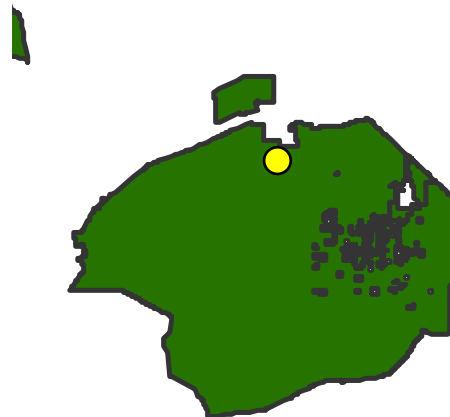



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** unknown cabin 1

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 98

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** No defensible space

**Topography:** Slope 5% to 20%

**Roof Material:** Combustible or no roof

**Siding Material:** Wood or open sided

**Foundation:** Open or deck

**Firewood:** None



**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

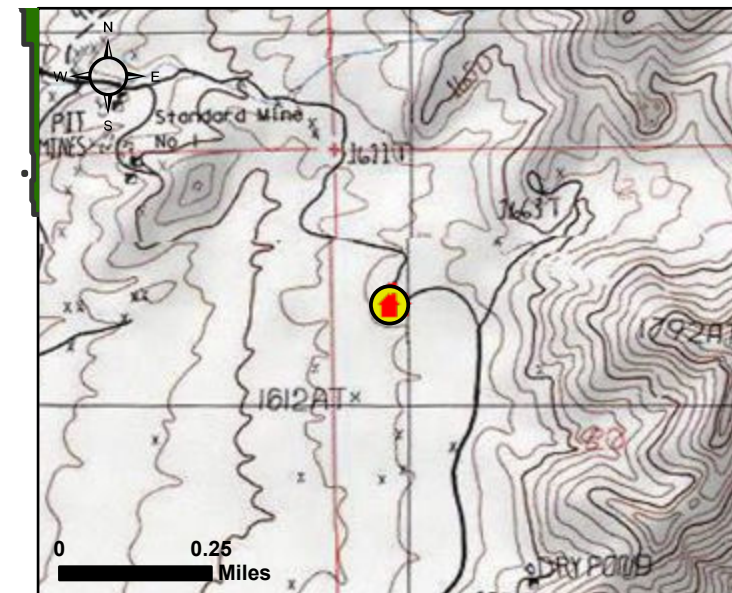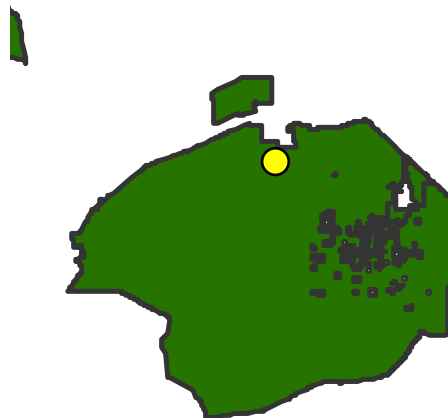



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** unknown cabin shed

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found, **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**Protection Level:** Not Designated,

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 99

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** No defensible space

**Topography:** Slope 5% to 20%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck

**Firewood:** 5ft to 30ft from facility



**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

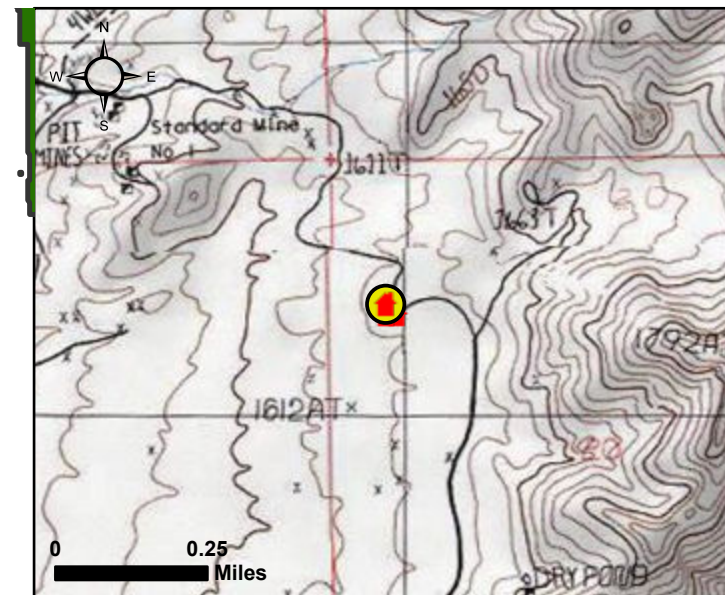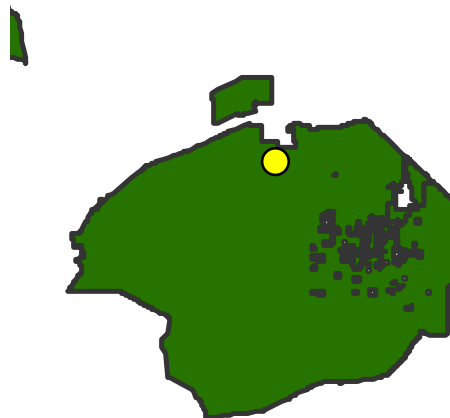



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** KD Kelso Storage Shed 210 KD Kelso Storage Shed 210

**Unit - Location:** MOJA - Cima MOJA - Cima

**FMSS ID:** 76813, **Local ID:**

**Structure Type, Use:** Building, Administrative

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021 February 2, 2021

**Coordinates (DDM):**

**Rating:** Low

**ProtectionLevel:** Not Designated,

**Resources of Concern:** Unknown

**Occupied:** No

**In Community:** Yes, Kelso School Kelso School

**Revisit Interval:** 5 yrs

**Map Label:** 73

**Primary Access:** Road Road

**Ingress Egress:** 2 or more roads in/out 2 or more roads in/out

**Access Width:** 1.5 lanes (Greater than 18') 1.5 lanes (Greater than 18')

**Access Condition:** Surfaced-paved, gradeGreater than 5% Surfaced-paved, gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible None or not clearly visible

**Fuel Type:** Shrub or timber Shrub or timber

**Fuel Load:** Light or no wildland fuels Light or no wildland fuels

**Defensible Space:** Greater than 100ft treated Greater than 100ft treated

**Topography:** Slope Less than 5% Slope Less than 5%

**Roof Material:** Fire resistant- tar,rubberized Fire resistant- tar,rubberized

**Siding Material:** Wood or open sided Wood or open sided

**Foundation:** Open or deck Open or deck



**Firewood:** None None

**Water Supply:** Pressurized hydrant(s) or fixed sprinkler system Pressurized hydrant(s) or fixed sprinkler system

**Propane:** Present and fuels clearance Present and fuels clearance

**Comments:** buildings behind locked fence- only one view  
visible buildings behind locked fence- only one view visible

NO PHOTO AVAILABLE

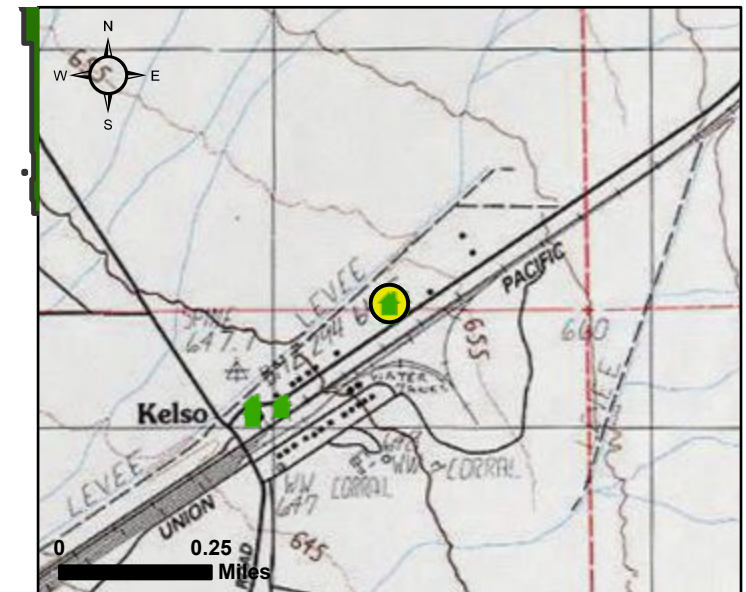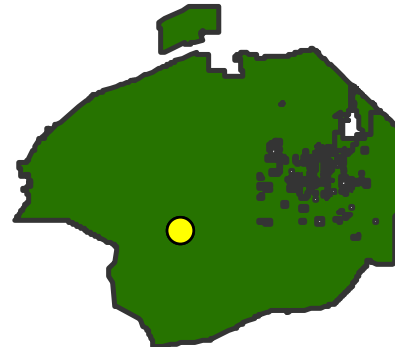



# NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

**Facility Name:** Rowsell unknown root cellar

**Unit - Location:** MOJA - Cima

**FMSS ID:** not found , **Local ID:**

**Structure Type, Use:** Building, Public

**Owner:** National Park Service

**Field Crew, Visit Date:** L. Catlin, February 2, 2021

**Coordinates (DDM):**

**Rating:** High

**ProtectionLevel:** Not Designated, December 31, 1899

**Resources of Concern:** Yes

**Occupied:** No

**In Community:** No,

**Revisit Interval:** 5 yrs

**Map Label:** 129

**Primary Access:** Road

**Ingress Egress:** 1 road in/out

**Access Width:** 1 lane (Less than 18')

**Access Condition:** Non-surfaced- gravel,dirt,gradeGreater than 5%

**Bridge Condition:** Less than 300 ft with turnaround

**Access and Turnarounds:** Less than 300 ft with turnaround

**Facility Number or Sign:** None or not clearly visible

**Fuel Type:** Grass and shrub, hardwood litter

**Fuel Load:** Moderate

**Defensible Space:** Less than 30 ft treated

**Topography:** Slope 5% to 20%

**Roof Material:** Noncombustible or not applicable

**Siding Material:** Wood or open sided

**Foundation:** Open or deck

**Firewood:** None

**Water Supply:** No reliable water source nearby

**Propane:** None

**Overhead Hazards:** No overhead hazards

**Comments:**

NO PHOTO AVAILABLE

