

NPS Wildfire Risk Assessments Assessment Locations

Gila Cliff Dwellings National Monument

National Park Service
U.S. Department of the Interior



Structure Locations

● Gila Cliff Dwellings (22)



0

40
Miles

Author: sszturm
2/3/2022 10:42 AM

Intermountain Region Geographic Resources Division
February 2021


Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Gila Cliff Dwellings National Monument

NPS Wildfire Risk Assessments

National Park Service
U.S. Department of the Interior

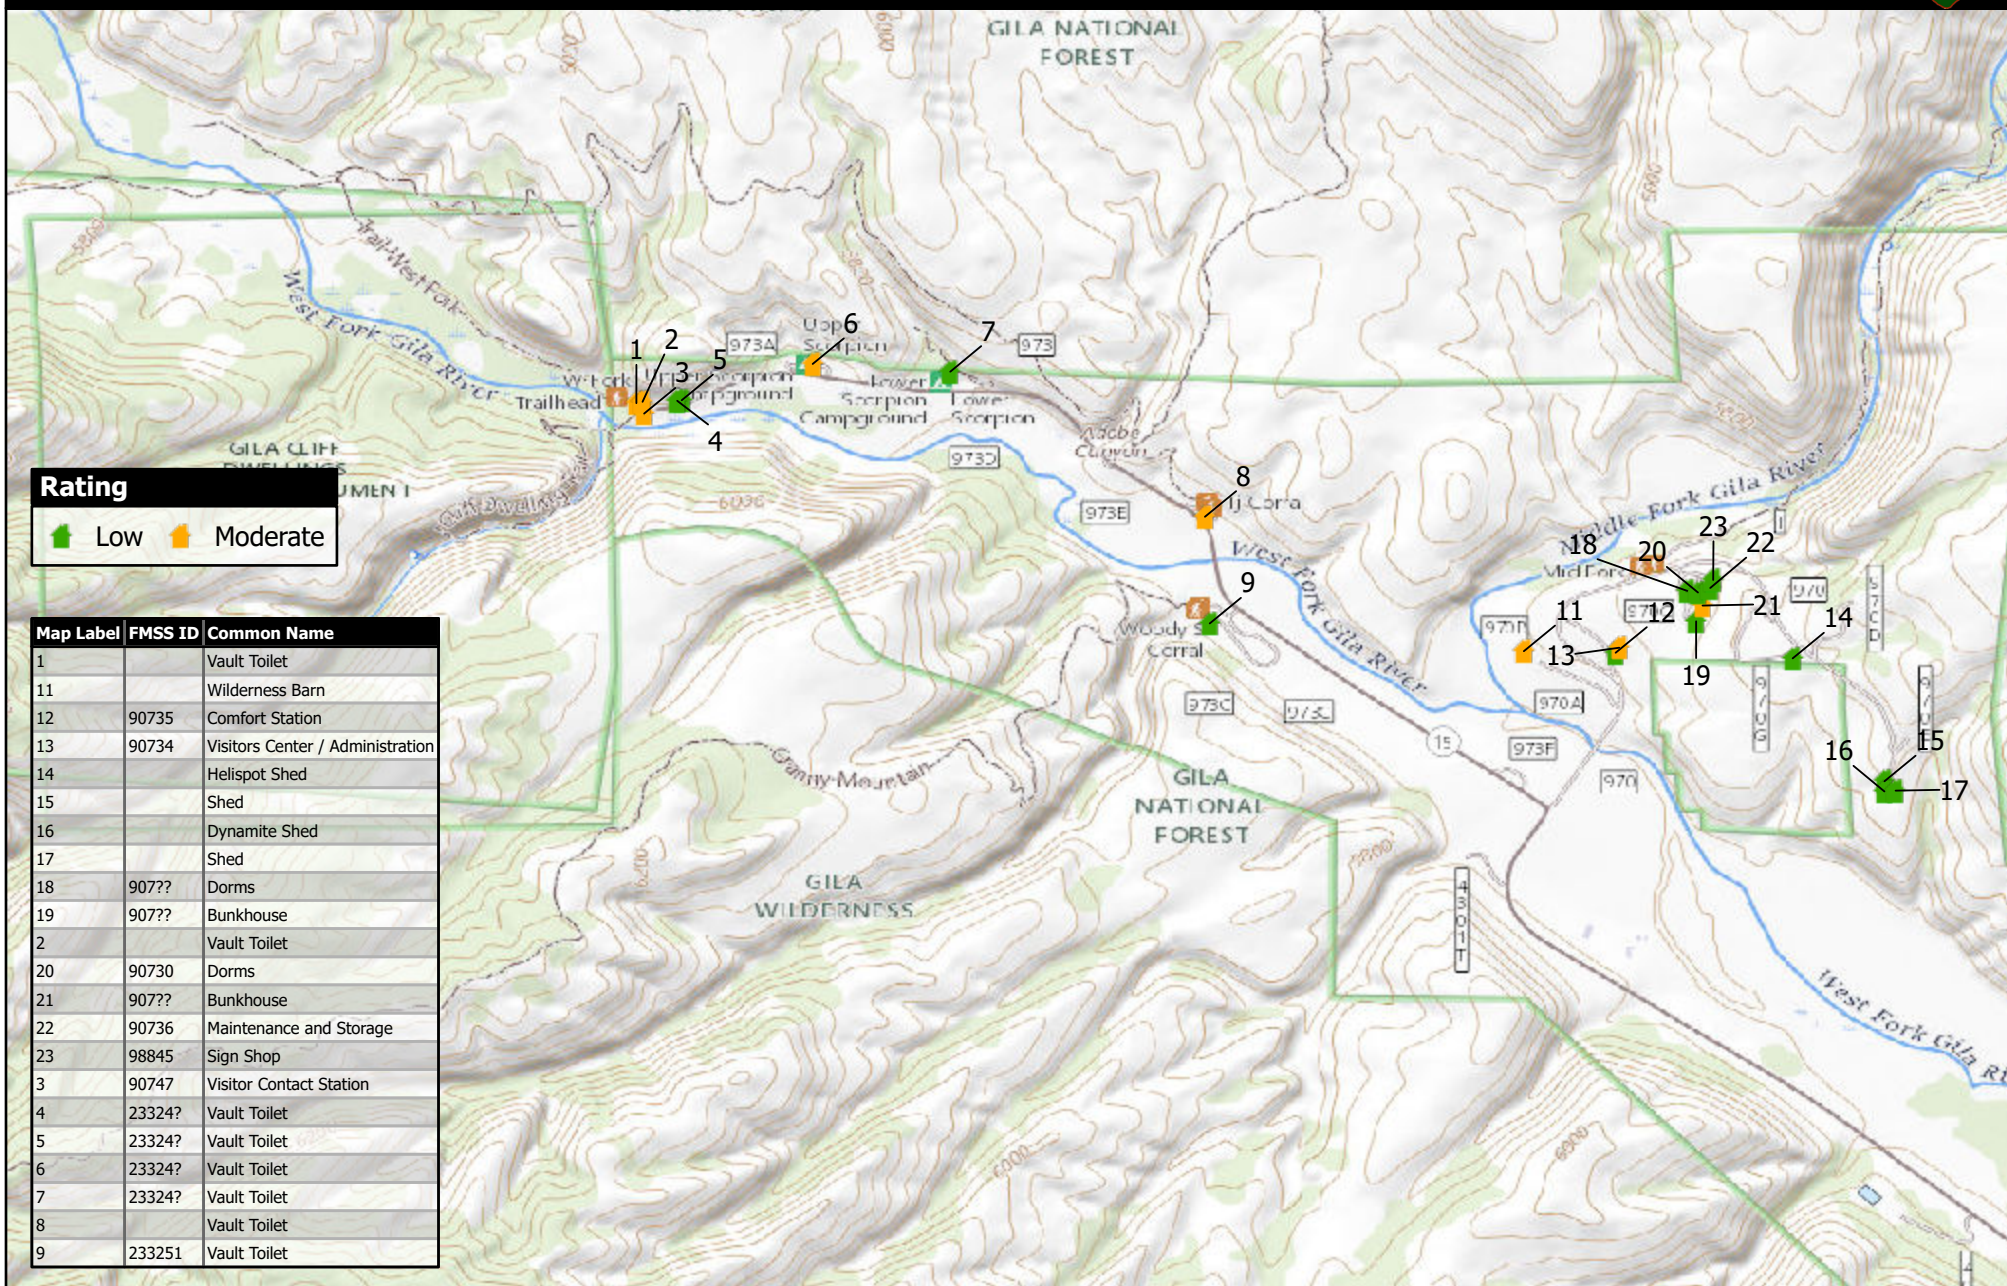

0

2

Miles

Author: sszturm
2/3/2022 10:48 AM

Intermountain Region Geographic Resources Division
February 2021
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: GICL - Gila Cliff Dwellings

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
	well house woody's	USFS	246251	Utility	Admin	N	2/26/21	No	29	Low			UNR
1	Vault Toilet	USFS		Toilet	Public	N	2/25/21	Unknown	52	Moderate	Not Designated		UNR
2	Vault Toilet	USFS		Toilet	Public	N	2/25/21	Unknown	52	Moderate	Not Designated		UNR
3	Visitor Contact Station	NPS	90747	Building	Public	Y	2/25/21	Yes	61	Moderate	Not Designated		UNR
4	Vault Toilet	USFS	23324?	Building	Public	N	2/25/21	No	42	Low	Not Designated		UNR
5	Vault Toilet	USFS	23324?	Building	Public	N	2/25/21	No	39	Low	Not Designated		UNR
6	Vault Toilet	USFS	23324?	Building	Public	N	2/25/21	Unknown	49	Moderate	Not Designated		UNR
7	Vault Toilet	USFS	23324?	Building	Public	N	2/25/21	Unknown	36	Low	Not Designated		UNR
8	Vault Toilet	USFS		Toilet	Public	N	2/25/21	Unknown	59	Moderate	Not Designated		UNR
9	Vault Toilet	USFS	233251	Building	Public	N	2/25/21	Unknown	39	Low	Not Designated		UNR
11	Wilderness Barn	USFS		Building	Admin	N	2/25/21	Unknown	60	Moderate	Not Designated		UNR
12	Comfort Station	NPS	90735	Toilet	Public	N	2/25/21	Yes	40	Low	Not Designated	Tactics included in adjacent structure.	UNR
13	Visitors Center / Administration	NPS	90734	Building	Admin	Y	2/25/21	Yes	46	Moderate	Not Designated		UNR
14	Helispot Shed	USFS		Building	Public	N	2/25/21	Unknown	42	Low	Not Designated		UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: GICL - Gila Cliff Dwellings

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
15	Shed	USFS		Building	Public	N	2/25/21	Unknown	42	Low	Not Designated		UNR
16	Dynamite Shed	USFS		Building	Public	N	2/25/21	Unknown	42	Low	Not Designated		UNR
17	Shed	USFS		Building	Public	N	2/25/21	Unknown	42	Low	Not Designated		UNR
18	Dorms	NPS	907??	Building	Residence	Y	2/25/21	No	39	Low	Not Designated		UNR
19	Bunkhouse	NPS	907??	Building	Residence	Y	2/25/21	Yes	31	Low	Not Designated		UNR
20	Dorms	NPS	90730	Building	Residence	Y	2/25/21	Yes	35	Low	Not Designated		UNR
21	Bunkhouse	NPS	907??	Building	Residence	Y	2/25/21	Yes	48	Moderate	Not Designated		UNR
22	Maintenance and Storage	NPS	90736	Building	Admin	Y	2/25/21	Yes	29	Low	Not Designated		UNR
23	Sign Shop	NPS	98845	Building	Admin	N	2/25/21	No	42	Low	Not Designated		UNR



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: GICL - Gila Cliff Dwellings

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours
	well house woody's	Individual Facility		0			
11	Wilderness Barn	Individual Facility					
12	Comfort Station	Individual Facility					
13	Visitors Center / Administration	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		2.0
		Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		4.0
		Individual Facility	Initial	1	Limb trees 6 to 15 feet above ground		4.0
		Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		3.0
14	Helispot Shed	Individual Facility					
15	Shed	Individual Facility					
		Individual Facility					
16	Dynamite Shed	Individual Facility					



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

18	Dorms	Facility In Community (Maintenance and Housing)					
		Facility In Community (Maintenance and Housing)					
19	Bunkhouse	Facility In Community (Maintenance and Housing)					
		Facility In Community (Maintenance and Housing)					
22	Maintenance and Storage	Facility In Community (Maintenance and Housing)					
23	Sign Shop	Facility In Community (Maintenance and Housing)					
3	Visitor Contact Station	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		8.0
		Individual Facility	Initial	2	Flammable ground cover should be removed or isolated		40.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

3	Visitor Contact Station	Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		8.0
7	Vault Toilet	Individual Facility	SiteVisit	2	Limb trees 6 to 15 feet above ground		15.0
		Individual Facility	SiteVisit	2	Open crown spacing 10 to 30 feet depending on slope		25.0
		Individual Facility		0			
		Individual Facility	SiteVisit	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		3.0
		Individual Facility	SiteVisit	1	Limb trees 6 to 15 feet above ground		5.0
		Individual Facility	SiteVisit	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		5.0
		Individual Facility	SiteVisit	1	Limb trees 6 to 15 feet above ground		2.0
		Individual Facility	SiteVisit	1	Limb trees 6 to 15 feet above ground		5.0
		Individual Facility	SiteVisit	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		8.0



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

7	Vault Toilet	Individual Facility	SiteVisit	2	Limb trees 6 to 15 feet above ground		20.0
		Individual Facility	SiteVisit	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		6.0



NPS Wildland Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: Gila Cliff Dwellings National Monument - Gila Cliff Dwellings

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
	well house woody's	Individual Facility	Standalone	-		-	
1	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	6.0	-	
11	Wilderness Barn	Individual Facility	PrepLeave	-		-	
12	Comfort Station	Individual Facility	PrepLeave	-		-	
13	Visitors Center / Administration	Individual Facility	PrepLeave	Fuels reduction -	40.0	-	
				Engine on scene -	36.0	Engine/OtherVehicle-Wildland Heavy Engine, Type 3,4 or 5, EA	1
				Install sprinkler system -	20.0	-	
14	Helispot Shed	Individual Facility	PrepLeave	-		-	
15	Shed	Individual Facility	PrepLeave	-		-	
16	Dynamite Shed	Individual Facility	PrepLeave	-		-	
17	Shed	Individual Facility	PrepLeave	-		-	
18	Dorms	Facility In Community (Maintenance and Housing)	PrepLeave	-		-	
19	Bunkhouse	Facility In Community (Maintenance and Housing)	PrepLeave	-		-	
2	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	6.0	-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
20	Dorms	Facility In Community (Maintenance and Housing)	PrepLeave	-		-	
21	Bunkhouse	Facility In Community (Maintenance and Housing)	PrepLeave	-		-	
22	Maintenance and Storage	Facility In Community (Maintenance and Housing)	PrepLeave	-		-	
23	Sign Shop	Facility In Community (Maintenance and Housing)	PrepLeave	-		-	
3	Visitor Contact Station	Individual Facility	PrepLeave	Fuels reduction -	50.0	-	
				Install sprinkler system -	8.0	Pump Kit-Volume 3, KT	2
						Sprinkler Kit-Sprinkler (2008) kit	3
				Engine on scene -	100.0	Engine/OtherVehicle-Wildland Heavy Engine, Type 3,4 or 5, EA	1
4	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction - 8		-	
5	Vault Toilet	Individual Facility	PrepLeave	-		-	
6	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	20.0	-	
7	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	15.0	-	
8	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	5.0	-	
9	Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	6.0	-	



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: well house woody's

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 246251
Structure Type: Utility
Structure Use: Admin
Owner: USFS
Field Crew: Castillo
Last Site Visit Date: 2/26/2021


Rating: Low
Protection Level :
Resources of Concern Present? No
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.4494' **Long(WGS84):** -108° 15.0441'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Non-surfaced- gravel,dirt,grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Vinyl
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_246251_well house woody's _Front.jpg


Score: 29
Rating: Low

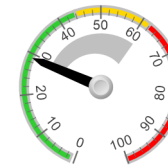

Asset Priority Index (API):
N/A



Factors Driving the Ratings

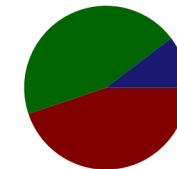

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Toilet

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 33° 13.7776' **Long(WGS84):** -108° 15.9018'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:




2021_GICL__Vault Toilet_Front.jpg




Score: 52
Rating: Moderate

Asset Priority Index (API):
N/A

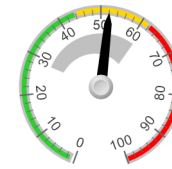

Factors Driving the Ratings

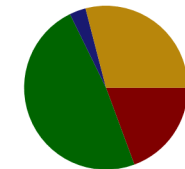

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Toilet

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 33° 13.7796' **Long(WGS84):** -108° 15.8931'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:



2021_GICL__Vault Toilet_Front.jpg




Score: 52
Rating: Moderate

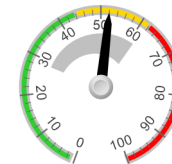

Asset Priority Index (API):
N/A



Factors Driving the Ratings

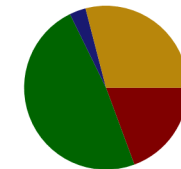

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Visitor Contact Station

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID: 90747

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Yes, contact unit staff before engaging.

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 13.7629' **Long(WGS84):** -108° 15.8908'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Limited or dependent on electricity

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_GICL_90747_Visitor Contact Station_Front.jpg


Score: 61
Rating: Moderate

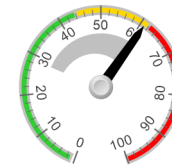


Asset Priority Index (API): 52

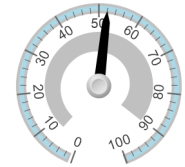

Factors Driving the Ratings

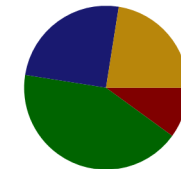

Access
Environment
Structure
Protection

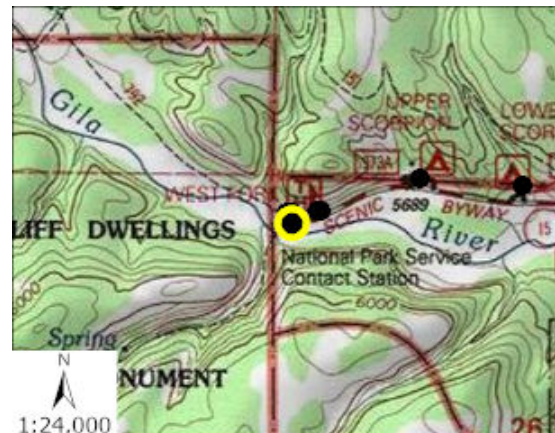

1:24,000



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 23324?
Structure Type: Building
Structure Use: Public
Owner: USFS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? No
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.7812' **Long(WGS84):** -108° 15.8437'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: Overhead hazards will limit aircraft
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_23324?_Vault Toilet_Front.jpg


Score: 42
Rating: Low

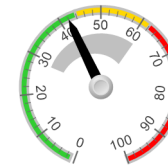


Asset Priority Index (API):
N/A



Factors Driving the Ratings

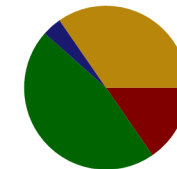

■ Access
■ Environment
■ Structure
■ Protection

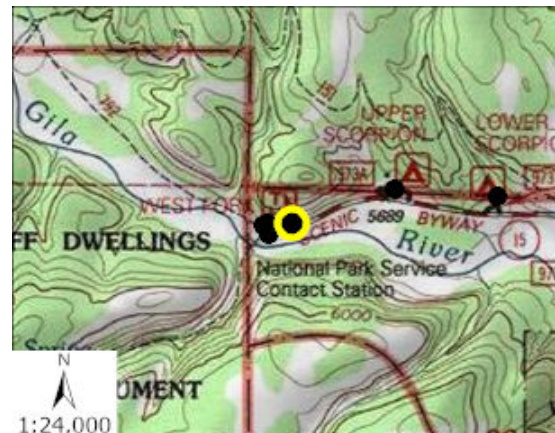



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 23324?
Structure Type: Building
Structure Use: Public
Owner: USFS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? No
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.7817' **Long(WGS84):** -108° 15.837'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: Overhead hazards will limit aircraft
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_23324?_Vault Toilet_Front.jpg


Score: 39
Rating: Low

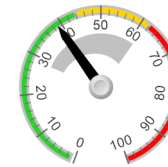

Asset Priority Index (API):
N/A



Factors Driving the Ratings

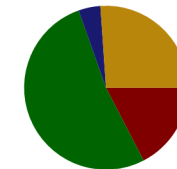

■ Access
■ Environment
■ Structure
■ Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 23324?
Structure Type: Building
Structure Use: Public
Owner: USFS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.8335' **Long(WGS84):** -108° 15.6503'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_GICL_23324?_Vault Toilet_Front.jpg

Score: 49
Rating: Moderate



Asset Priority Index (API):
N/A

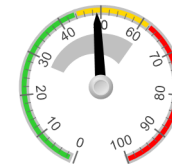

Factors Driving the Ratings

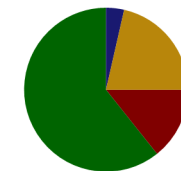

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

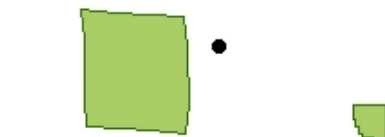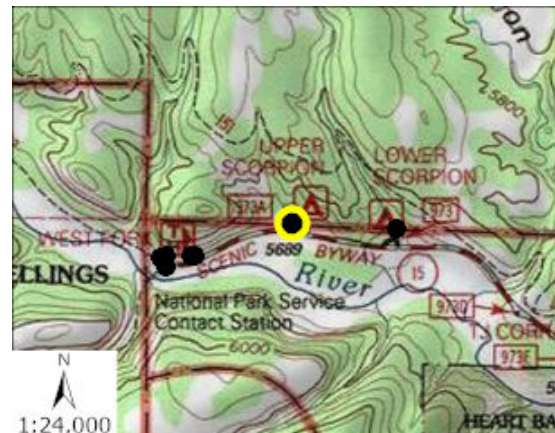

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 23324?
Structure Type: Building
Structure Use: Public
Owner: USFS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.8224' **Long(WGS84):** -108° 15.4543'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_23324?_Vault Toilet_Front.jpg


Score: 36
Rating: Low

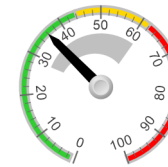


Asset Priority Index (API):
N/A



Factors Driving the Ratings

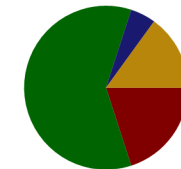

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

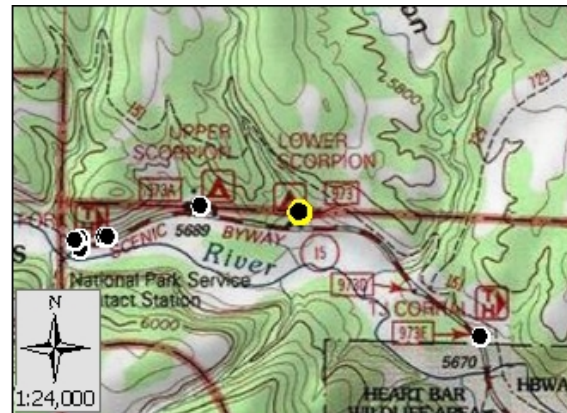

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Toilet

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 33° 13.6157' **Long(WGS84):** -108° 15.0908'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2021_GICL__Vault Toilet_Front.jpg

Score: 59
Rating: Moderate

Asset Priority Index (API):
N/A

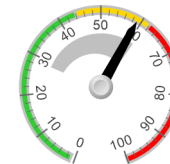

Factors Driving the Ratings

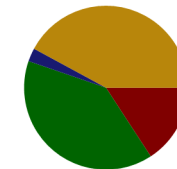

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Vault Toilet

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 233251
Structure Type: Building
Structure Use: Public
Owner: USFS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.4637' **Long(WGS84):** -108° 15.0841'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: Overhead hazards will limit aircraft
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_233251_Vault Toilet_Front.jpg


Score: 39
Rating: Low

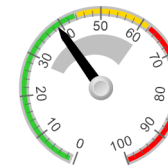

Asset Priority Index (API): 40



Factors Driving the Ratings

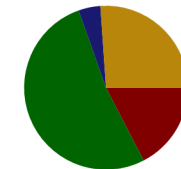

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Wilderness Barn

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Building

Structure Use: Admin

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 33° 13.424' **Long(WGS84):** -108° 14.6361'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300ft from facility w/o turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: Adjacent to/under deck of facility

Propane Tanks: Adjacent to facility and no fuels clearance

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2017_GICL__Wilderness Barn_Front.jpg

Score: 60
Rating: Moderate

Asset Priority Index (API):
N/A

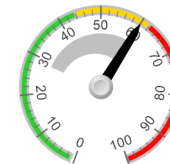

Factors Driving the Ratings

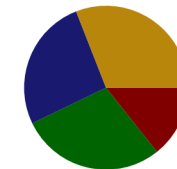

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Comfort Station

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 90735
Structure Type: Toilet
Structure Use: Public
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Yes, contact unit staff before engaging.
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 13.4217' **Long(WGS84):** -108° 14.5053'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: Tactics included in adjacent structure.



2021_GICL_90735_Comfort Station_Front.jpg


Score: 40
Rating: Low

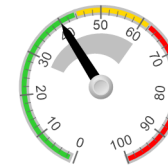

Asset Priority Index (API): 77



Factors Driving the Ratings

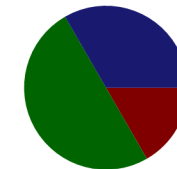

Access
Environment
Structure
Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Visitors Center / Administration

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID: 90734

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Yes, contact unit staff before engaging.

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 13.4292' **Long(WGS84):** -108° 14.4999'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2021_GICL_90734_Visitors Center /
Administration_Front.jpg

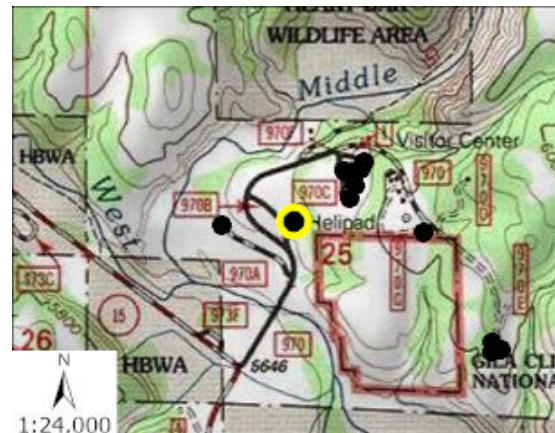


Score: 46
Rating: Moderate

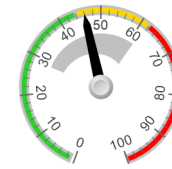

Asset Priority Index (API): 90



Factors Driving the Ratings

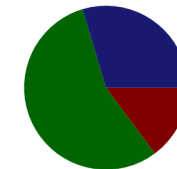

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Helispot Shed

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Building

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 33° 13.4138' **Long(WGS84):** -108° 14.2528'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:

Score: 42
Rating: Low


Asset Priority Index
(API):
N/A

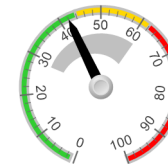

Factors Driving the Ratings

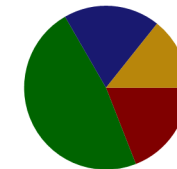

■ Access
■ Environment
■ Structure
■ Protection

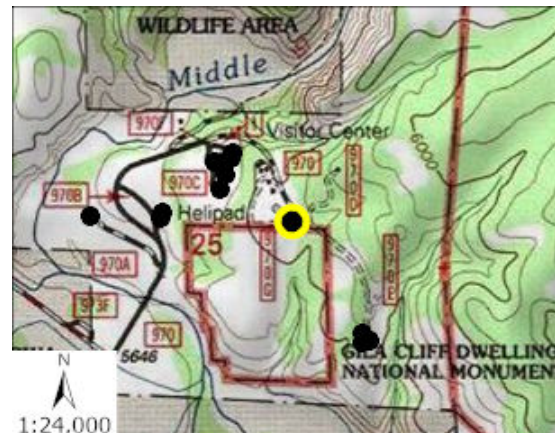



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Shed

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Building

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 13.2385' **Long(WGS84):** -108° 14.1219'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_GICL__Shed_Front.jpg


Score: 42
Rating: Low

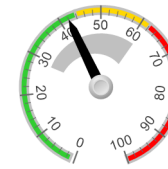

Asset Priority Index (API):
N/A



Factors Driving the Ratings

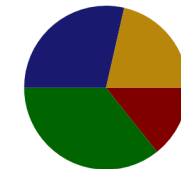

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Dynamite Shed

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Building

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 13.2239' Long(WGS84): -108° 14.1219'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_GICL__Dynamite Shed_Front.jpg


Score: 42
Rating: Low

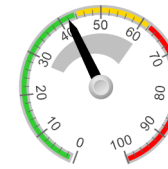


Asset Priority Index
(API):
N/A



Factors Driving the Ratings

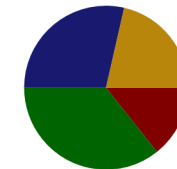

Access
Environment
Structure
Protection

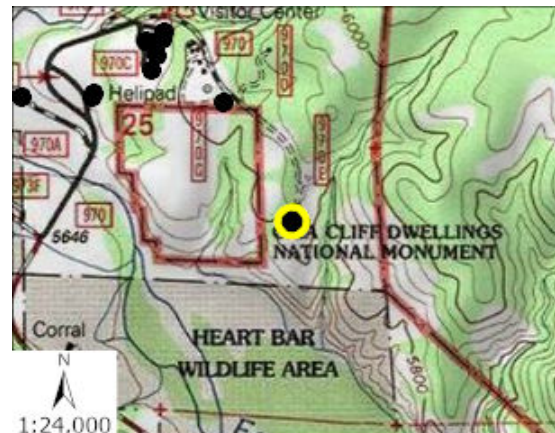

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Shed

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID:

Structure Type: Building

Structure Use: Public

Owner: USFS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 13.2251' **Long(WGS84):** -108° 14.1061'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_GICL__Shed_Front.jpg


Score: 42
Rating: Low

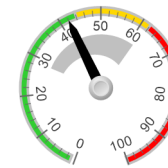

Asset Priority Index (API):
N/A



Factors Driving the Ratings

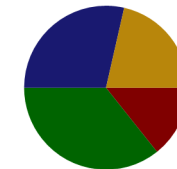

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Dorms

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 907??
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? No
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Maintenance and Housing
Lat(WGS84): 33° 13.51' **Long(WGS84):** -108° 14.4031'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_907??_Dorms_Front.jpg


Score: 39
Rating: Low

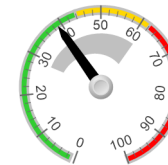

Asset Priority Index (API):
N/A



Factors Driving the Ratings

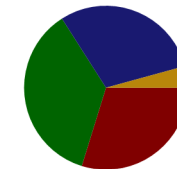

■ Access
■ Environment
■ Structure
■ Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Bunkhouse

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 907??
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Yes, contact unit staff before engaging.
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Maintenance and Housing
Lat(WGS84): 33° 13.4666' **Long(WGS84):** -108° 14.3905'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_907??_Bunkhouse_Front.jpg


Score: 31
Rating: Low

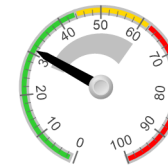

Asset Priority Index (API):
N/A



Factors Driving the Ratings

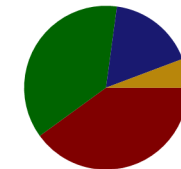

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Dorms

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 90730
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Yes, contact unit staff before engaging.
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Maintenance and Housing
Lat(WGS84): 33° 13.5077' **Long(WGS84):** -108° 14.388'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_90730_Dorms_Front.jpg


Score: 35
Rating: Low

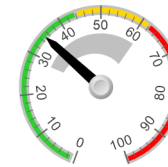

Asset Priority Index (API): 40



Factors Driving the Ratings

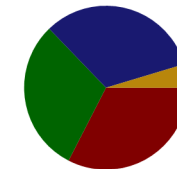

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Bunkhouse

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 907??
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Yes, contact unit staff before engaging.
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Maintenance and Housing
Lat(WGS84): 33° 13.4891' **Long(WGS84):** -108° 14.3814'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: Adjacent to/under deck of facility
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_907??_Bunkhouse_Front.jpg


Score: 48
Rating: Moderate

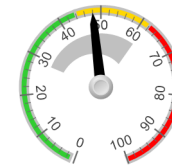


Asset Priority Index (API):
N/A



Factors Driving the Ratings

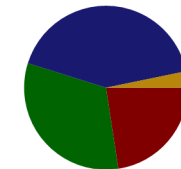

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

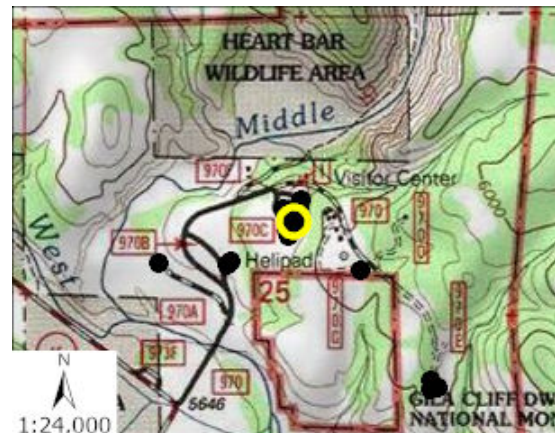

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance and Storage

Unit - Location: GICL - Gila Cliff Dwellings

FMSS ID: 90736

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 2/25/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Yes, contact unit staff before engaging.

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Maintenance and Housing

Lat(WGS84): 33° 13.5143' **Long(WGS84):** -108° 14.3703'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_GICL_90736_Maintenance and Storage_Front.jpg


Score: 29
Rating: Low

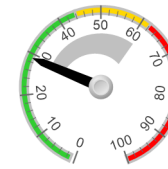

Asset Priority Index (API): 52



Factors Driving the Ratings

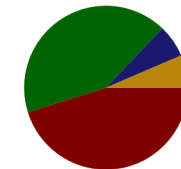

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Sign Shop

Unit - Location: GICL - Gila Cliff Dwellings
FMSS ID: 98845
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 2/25/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? No
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance and Housing
Lat(WGS84): 33° 13.5257' **Long(WGS84):** -108° 14.366'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_GICL_98845_Sign Shop_Front.jpg


Score: 42
Rating: Low

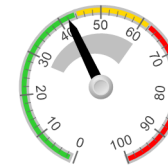

Asset Priority Index (API):
7



Factors Driving the Ratings

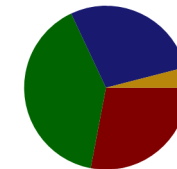

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary