


NPS Wildfire Risk Assessments Assessment Locations

El Morro National Monument


National Park Service
U.S. Department of the Interior

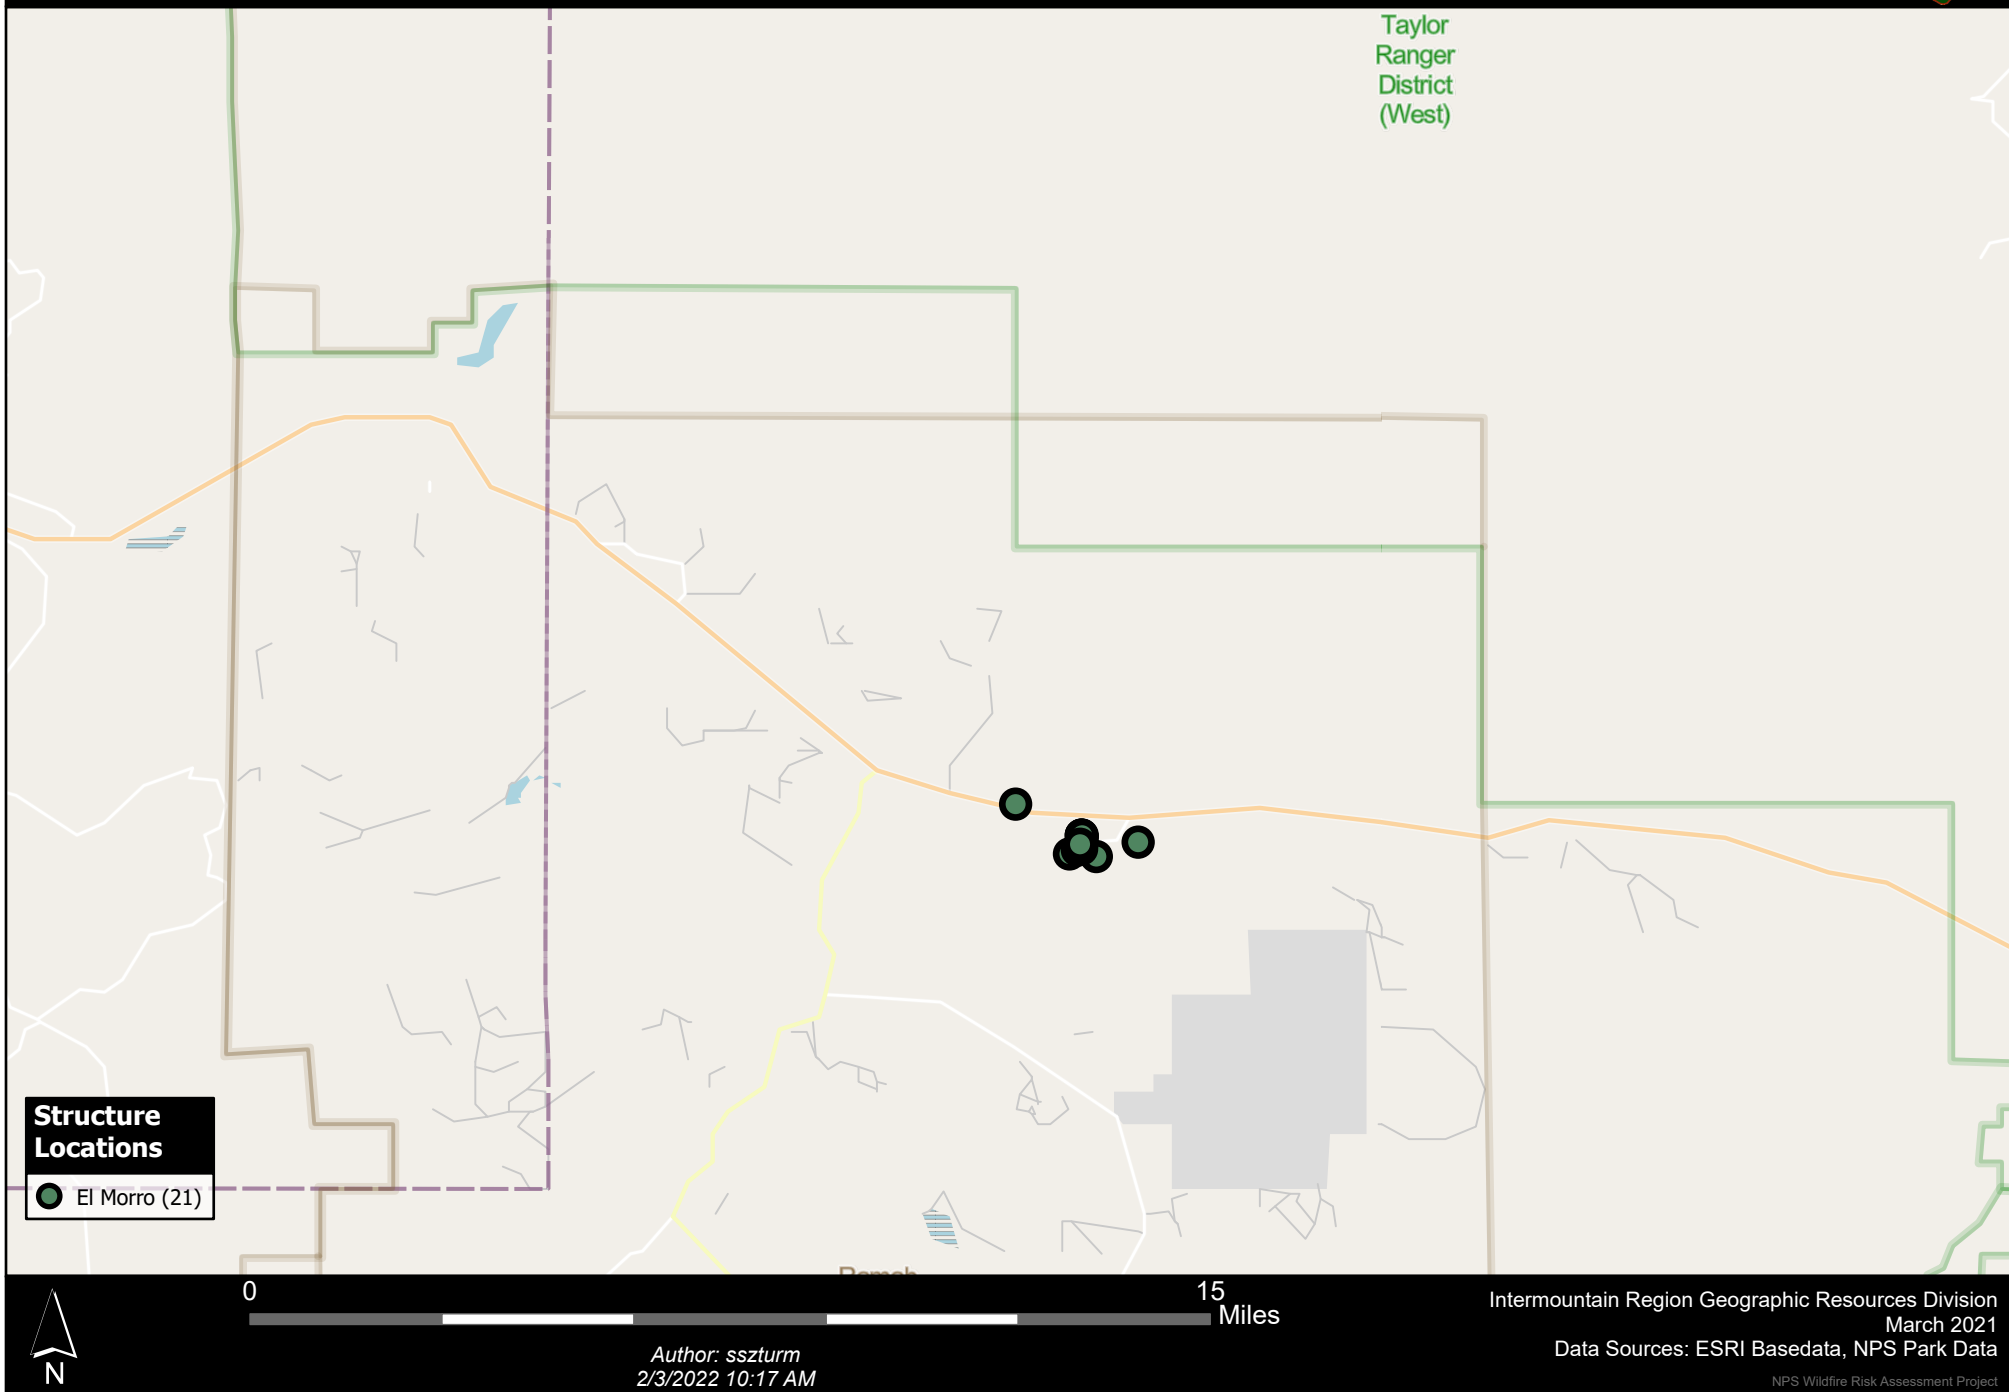

El Morro National Monument

NPS Wildfire Risk Assessments

National Park Service
U.S. Department of the Interior

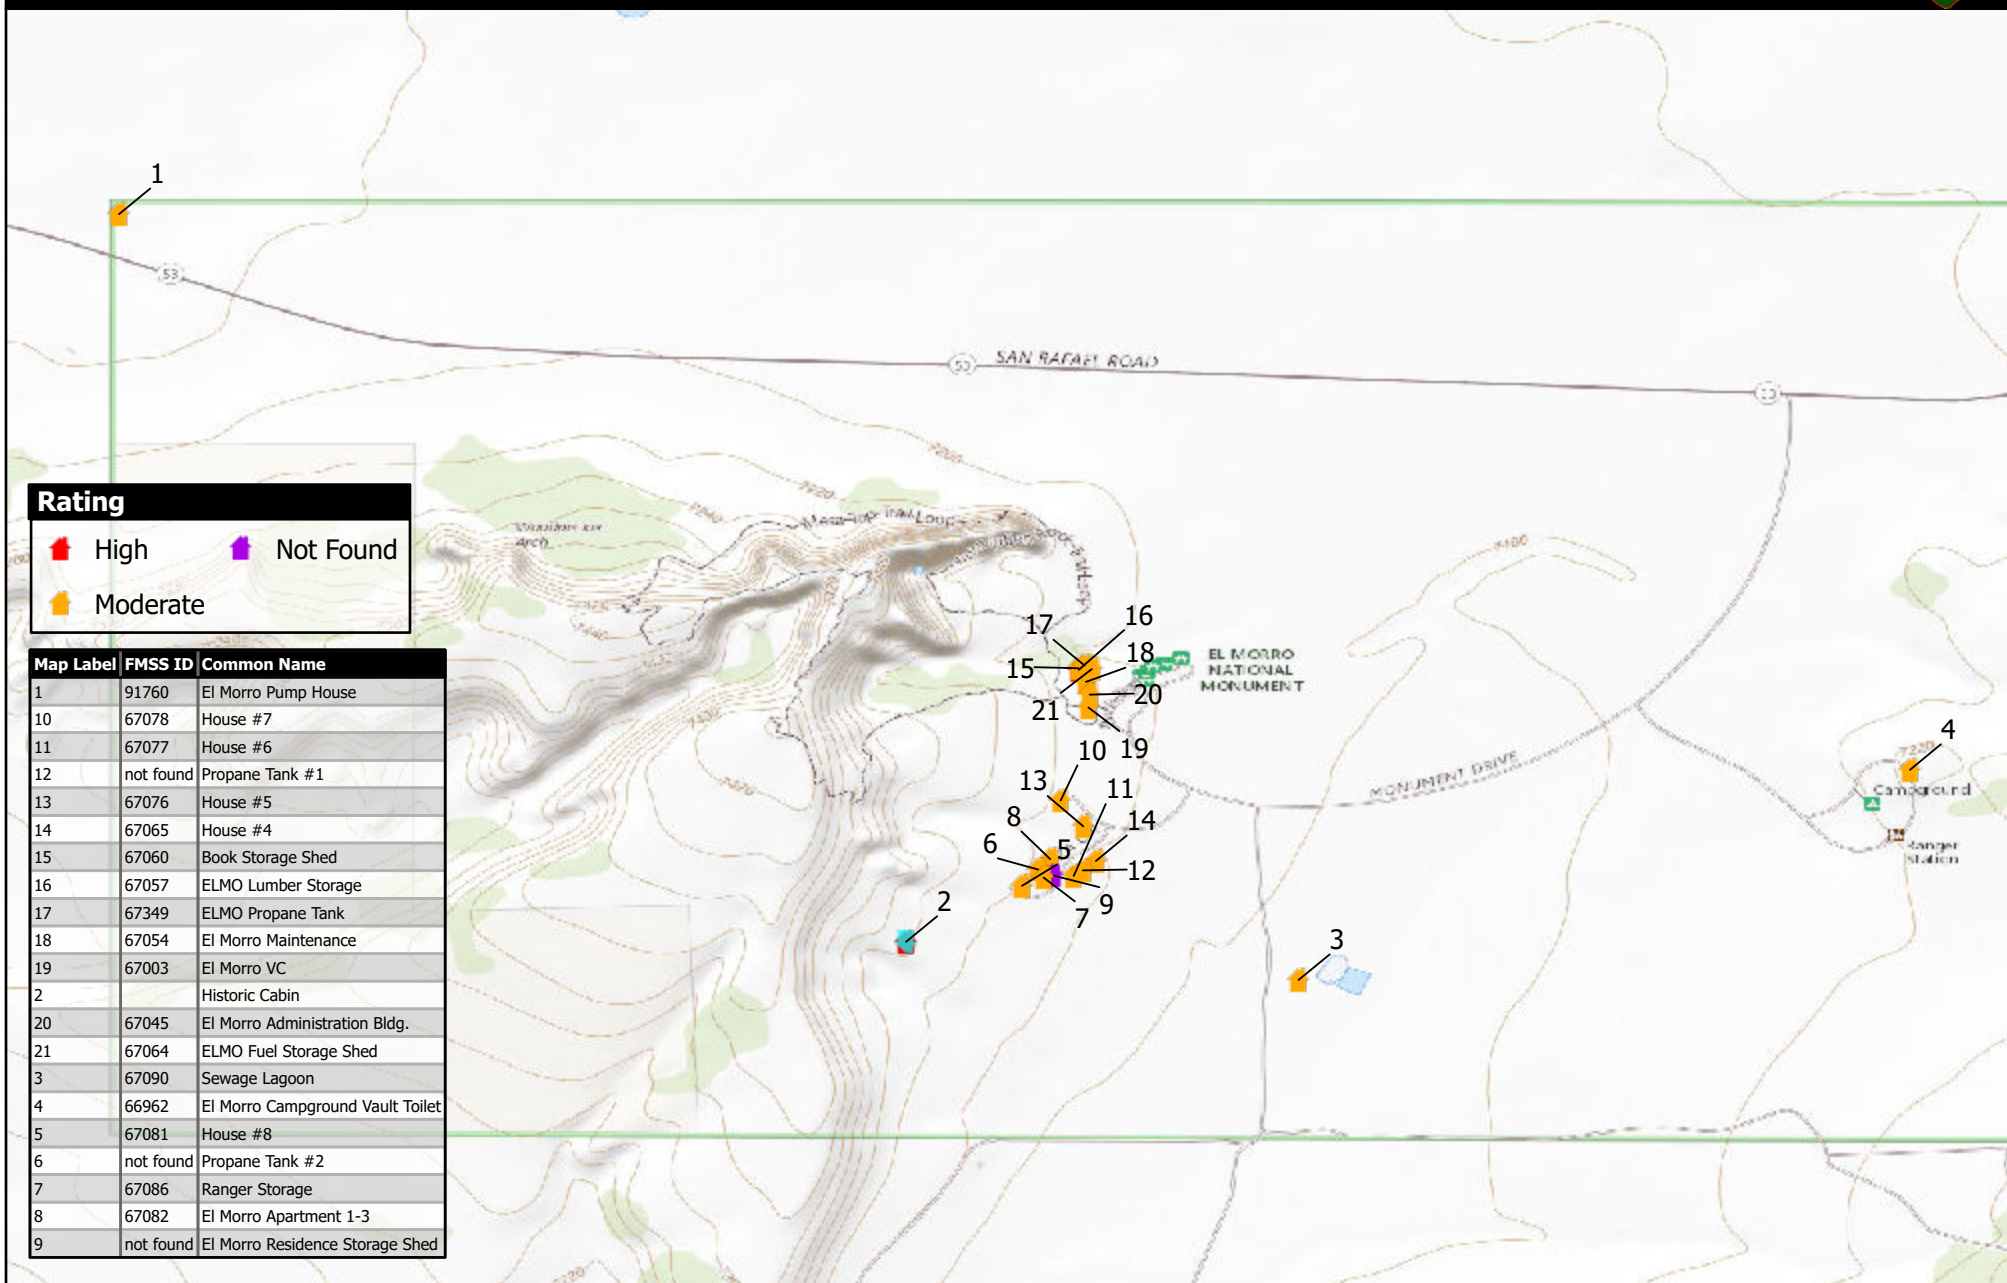

0

1

Miles

Author: sszturm
2/3/2022 10:20 AM

Intermountain Region Geographic Resources Division

March 2021

Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: ELMO - El Morro

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
1	El Morro Pump House	NPS	91760	Utility	Unknown	No	3/4/21	Unknown	46	Moderate	Unknown	Overhead Hazard: Powerline and poles above pump house.	UNR
2	Historic Cabin	NPS		Cultural Resource	NoKnown	N	5/20/18	Unknown	107	High			UNR
3	Sewage Lagoon	NPS	67090	Utility	Admin	N	3/4/21	Unknown	47	Moderate	Unknown		UNR
4	El Morro Campground Vault Toilet	NPS	66962	Toilet	Public	N	3/4/21	Unknown	57	Moderate	Unknown		UNR
5	House #8	NPS	67081	Building	Admin	Y	3/4/21	Unknown	51	Moderate	Unknown		UNR
6	Propane Tank #2	NPS	not found	Propane Tank	Admin	N	3/4/21	Unknown	48	Moderate	Unknown	Firewood: Wooden fence.	UNR
7	Ranger Storage	NPS	67086	Building	Admin	N	3/4/21	Unknown	57	Moderate	Not Designated		UNR
8	El Morro Apartment 1-3	NPS	67082	Building	Residence	Y	3/4/21	Unknown	45	Moderate	Unknown		UNR
9	El Morro Residence Storage Shed	NPS	not found	None Found	Admin	N	3/4/21	Unknown	62	None	Unknown		UNR
10	House #7	NPS	67078	Building	Residence	Y	3/4/21	Unknown	62	Moderate	Unknown	Maintenance: Grass/shrub.	UNR
11	House #6	NPS	67077	Building	Residence	Y	3/4/21	Unknown	62	Moderate	Unknown		UNR
12	Propane Tank #1	NPS	not found	Propane Tank	Admin	N	3/4/21	Unknown	58	Moderate	Unknown		UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: ELMO - El Morro

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
13	House #5	NPS	67076	Building	Residence	Y	3/4/21	Unknown	54	Moderate	Unknown		UNR
14	House #4	NPS	67065	Building	Residence	Y	3/4/21	Unknown	54	Moderate	Unknown		UNR
15	Book Storage Shed	NPS	67060	Building	Admin	N	3/4/21	Unknown	59	Moderate	Unknown		UNR
16	ELMO Lumber Storage	NPS	67057	Building	Admin	N	3/4/21	Unknown	65	High	Unknown		UNR
17	ELMO Propane Tank	NPS	67349	PropaneT ank	Admin	N	3/4/21	Unknown	46	Moderate	Unknown		UNR
18	El Morro Maintenance	NPS	67054	Building	Admin	Y	3/4/21	Unknown	48	Moderate	Unknown		UNR
19	El Morro VC	NPS	67003	Building	Public	Y	3/4/21	Unknown	52	Moderate	Unknown		UNR
20	El Morro Administration Bldg.	NPS	67045	Building	Admin	Y	3/4/21	Unknown	54	Moderate	Unknown		UNR
21	ELMO Fuel Storage Shed	NPS	67064	Building	Admin	N	3/4/21	Unknown	55	Moderate	Unknown		UNR



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: ELMO - El Morro

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours
0	ELMO Housing	Community	SiteVisit	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		6.0
		Community	SiteVisit	1	Limb trees 6 to 15 feet above ground		4.0
		Community	SiteVisit	1	Mow dead/dying grass to less than 4 inches		2.0
		Community	SiteVisit	2	Flammable ground cover should be removed or isolated		40.0
		Community	SiteVisit	2	Limb trees 6 to 15 feet above ground		40.0
1	El Morro Pump House	Individual Facility					
10	House #7	Facility In Community (ELMO Housing)					
11	House #6	Facility In Community (ELMO Housing)					
12	Propane Tank #1	Facility In Community (ELMO Housing)					



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

13	House #5	Facility In Community (ELMO Housing)					
14	House #4	Facility In Community (ELMO Housing)					
15	Book Storage Shed	Facility In Community (Visitor Center)					
16	ELMO Lumber Storage	Facility In Community (Visitor Center)					
17	ELMO Propane Tank	Facility In Community (Visitor Center)					
18	El Morro Maintenance	Facility In Community (Visitor Center)					
19	El Morro VC	Facility In Community (Visitor Center)					
2	Historic Cabin	Individual Facility	SiteVisit	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0
20	El Morro Administration Bldg.	Facility In Community (Visitor Center)					



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

21	ELMO Fuel Storage Shed	Facility In Community (Visitor Center)					
3	Sewage Lagoon	Individual Facility					
4	El Morro Campground Vault Toilet	Individual Facility	SiteVisit	1	Mow dead/dying grass to less than 4 inches		1.0
		Individual Facility	SiteVisit	2	Limb trees 6 to 15 feet above ground		4.0
5	House #8	Facility In Community (ELMO Housing)					
6	Propane Tank #2	Facility In Community (ELMO Housing)					
7	Ranger Storage	Facility In Community (ELMO Housing)					
8	El Morro Apartment 1-3	Facility In Community (ELMO Housing)					
9	El Morro Residence Storage Shed	Facility In Community (ELMO Housing)					



NPS Wildland Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: El Morro National Monument - El Morro

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
0	ELMO Housing	Community	NULL	Fuels reduction -	150.0	-	
				Engine on scene -	120.0	-	
				Install sprinkler system -	80.0	-	
1	El Morro Pump House	Individual Facility	Standalone	-		-	
10	House #7	Facility In Community (ELMO Housing)	PrepLeave	-		-	
11	House #6	Facility In Community (ELMO Housing)	PrepLeave	-		-	
12	Propane Tank #1	Facility In Community (ELMO Housing)	PrepLeave	-		-	
13	House #5	Facility In Community (ELMO Housing)	PrepLeave	-		-	
14	House #4	Facility In Community (ELMO Housing)	PrepLeave	-		-	
15	Book Storage Shed	Facility In Community (Visitor Center)	PrepLeave	-		-	
16	ELMO Lumber Storage	Facility In Community (Visitor Center)	PrepLeave	-		-	
17	ELMO Propane Tank	Facility In Community (Visitor Center)	PrepHold	-		-	
18	El Morro Maintenance	Facility In Community (Visitor Center)	PrepHold	-		-	
19	El Morro VC	Facility In Community (Visitor Center)	PrepLeave	-		-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
2	Historic Cabin	Individual Facility	PrepHold	Structure wrap -	8.0	-	
				Fuels reduction -	4.0	-	
				Handline and burnout -	12.0	-	
20	El Morro Administration Bldg.	Facility In Community (Visitor Center)	PrepHold	-		-	
21	ELMO Fuel Storage Shed	Facility In Community (Visitor Center)	PrepHold	-		-	
3	Sewage Lagoon	Individual Facility	Standalone	Burnout, no line construction necessary -	8.0	-	
4	El Morro Campground Vault Toilet	Individual Facility	PrepLeave	Fuels reduction -	8.0	-	
				Engine on scene -	12.0	-	
5	House #8	Facility In Community (ELMO Housing)	PrepHold	-		-	
6	Propane Tank #2	Facility In Community (ELMO Housing)	PrepLeave	-		-	
7	Ranger Storage	Facility In Community (ELMO Housing)	PrepHold	-		-	
8	El Morro Apartment 1-3	Facility In Community (ELMO Housing)	PrepLeave	-		-	
9	El Morro Residence Storage Shed	Facility In Community (ELMO Housing)	PrepHold	-		-	



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro Pump House

Unit - Location: ELMO - El Morro
FMSS ID: 91760
Structure Type: Utility
Structure Use: Unknown
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied?
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 2.76' **Long(WGS84):** -108° 21.8333'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Non-surfaced- gravel,dirt,grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: Overhead hazards will limit aircraft
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: Overhead Hazard: Powerline and poles above pump house.




2021_ELMO_91760_El Morro Pump House_Front.jpg



Score: 46
Rating: Moderate
Asset Priority Index (API):
N/A

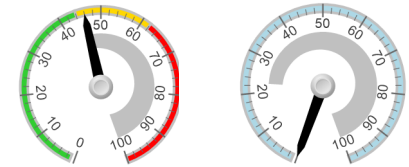

Factors Driving the Ratings

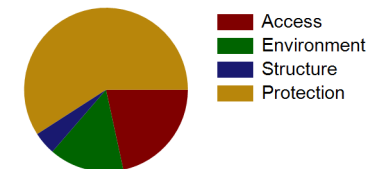

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Historic Cabin

Unit - Location: ELMO - El Morro

FMSS ID:

Structure Type: CulturalResource

Structure Use: NoKnown

Owner: NPS

Field Crew: Vaughn

Last Site Visit Date: 5/20/2018

Rating: High

Protection Level :

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 2.08551' Long(WGS84): -108° 21.1038'

Primary Access: Foot

Ingress/Egress: N/A, access by foot, boat or air only

Access Width: N/A, access by foot, boat or air only

Access Condition: N/A, access by foot, boat or air only

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: N/A,access by foot,boat,or air only

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: Adjacent to/under deck of facility

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2018_ELMO__Historic Cabin_Front.jpg


Score: 107
Rating: High




Asset Priority Index
(API):
N/A




Factors Driving the Ratings

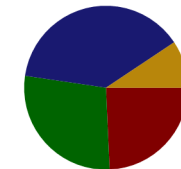

Access
Environment
Structure
Protection

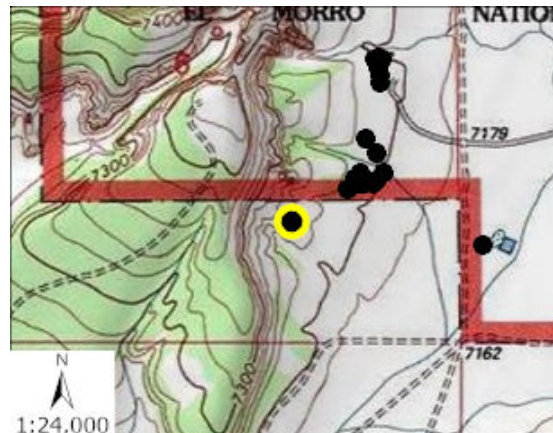

1:24,000

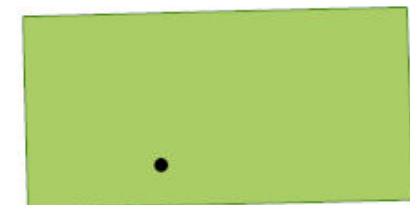

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Sewage Lagoon

Unit - Location: ELMO - El Morro

FMSS ID: 67090

Structure Type: Utility

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 2.05002' Long(WGS84): -108° 20.74'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Non-surfaced- gravel,dirt,grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Not applicable

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: 5ft to 30ft from facility

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2021_ELMO_67090_Sewage Lagoon_Front.jpg

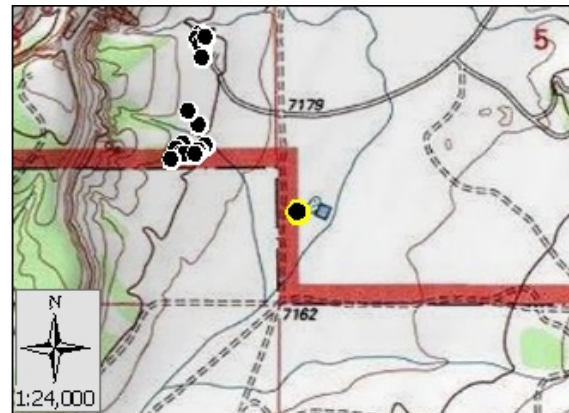


Score: 47
Rating: Moderate

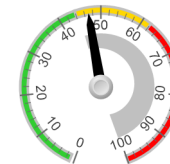

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

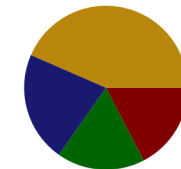

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro Campground Vault Toilet

Unit - Location: ELMO - El Morro

FMSS ID: 66962

Structure Type: Toilet

Structure Use: Public

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 2.24502' Long(WGS84): -108° 20.1733'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:



2021_ELMO_66962_El Morro Campground Vault Toilet_Front.jpg




Score: 57
Rating: Moderate

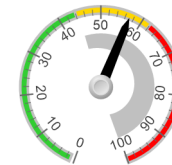

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

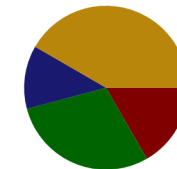

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: House #8

Unit - Location: ELMO - El Morro
FMSS ID: 67081
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021


Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.1374' **Long(WGS84):** -108° 20.9963'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_ELMO_67081_House #8_.jpg


Score: 51
Rating: Moderate

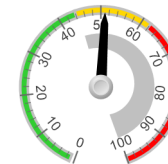


Asset Priority Index (API): 52



Factors Driving the Ratings

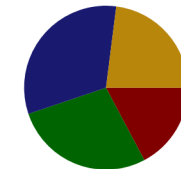

Access
Environment
Structure
Protection

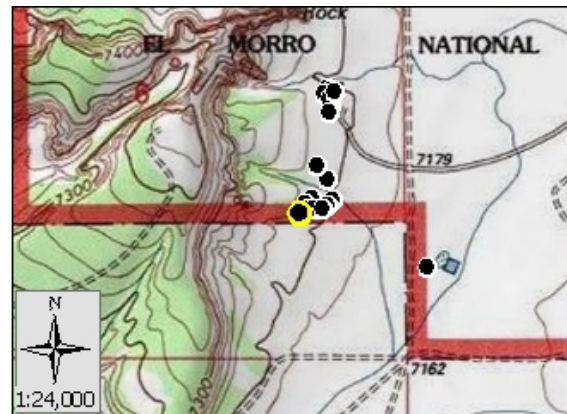

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Propane Tank #2

Unit - Location: ELMO - El Morro
FMSS ID: not found
Structure Type: PropaneTank
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021


Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.15245' **Long(WGS84):** -108° 20.9813'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Not applicable
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: Firewood: Wooden fence.



2021_ELMO_not found _Propane Tank #2_Front.jpg


Score: 48
Rating: Moderate

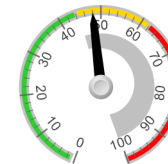


Asset Priority Index (API):
N/A



Factors Driving the Ratings

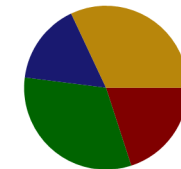

■ Access
■ Environment
■ Structure
■ Protection

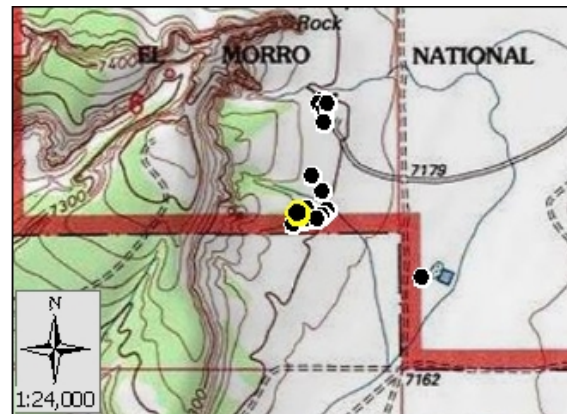

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Ranger Storage

Unit - Location: ELMO - El Morro

FMSS ID: 67086

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - ELMO Housing

Lat(WGS84): 35° 2.1451' **Long(WGS84):** -108° 20.9763'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2021_ELMO_67086_Ranger Storage_Front.jpg

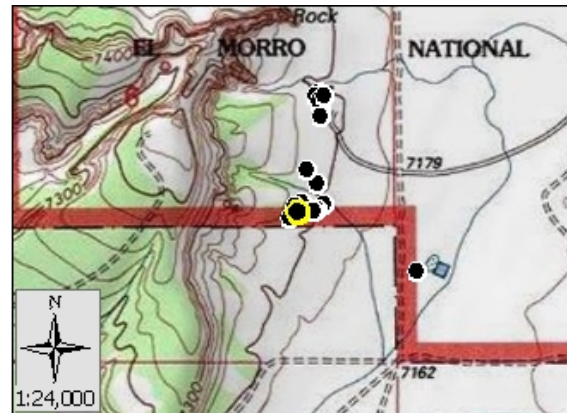


Score: 57
Rating: Moderate

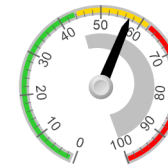


Asset Priority Index (API): 23



Factors Driving the Ratings

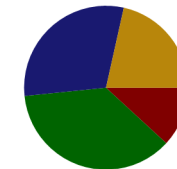

Access
Environment
Structure
Protection

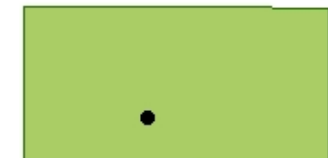

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro Apartment 1-3

Unit - Location: ELMO - El Morro

FMSS ID: 67082

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - ELMO Housing

Lat(WGS84): 35° 2.16216' Long(WGS84): -108° 20.9701'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2021_ELMO_67082_El Morro Apartment 1-3_.jpg

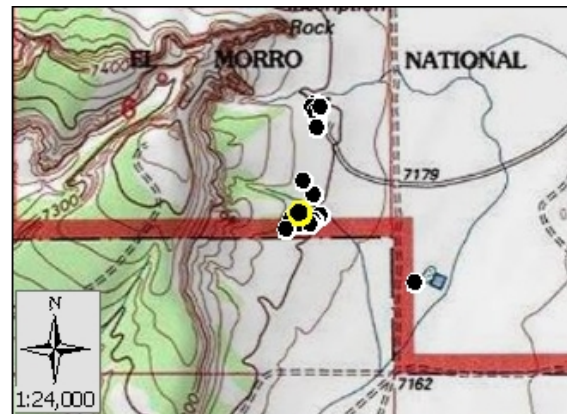


Score: 45
Rating: Moderate

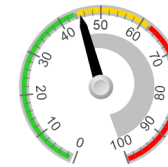

Asset Priority Index
(API):
52



Factors Driving the Ratings

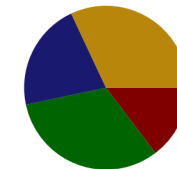

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro Residence Storage Shed

Unit - Location: ELMO - El Morro

FMSS ID: not found

Structure Type: None Found

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: None

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - ELMO Housing

Lat(WGS84): 35° 2.14668' **Long(WGS84):** -108° 20.9666'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: No defensible space

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2018_ELMO__El Morro Residence Storage Shed_x.jpg


Score: 62
Rating: None

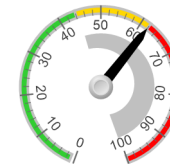


Asset Priority Index (API):
N/A



Factors Driving the Ratings

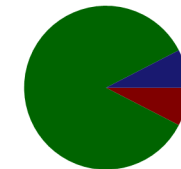

Access
Environment
Structure
Protection

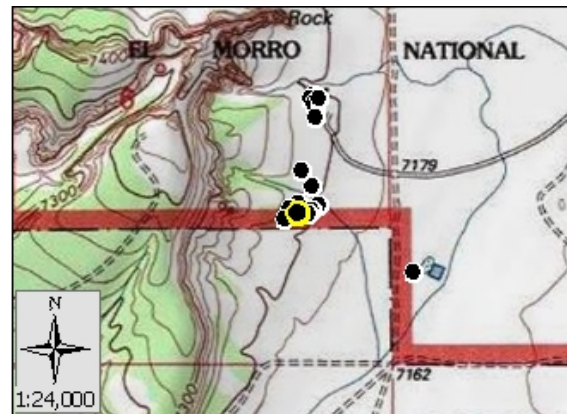

● Facility
■ NPS Boundary





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: House #7


Unit - Location: ELMO - El Morro
FMSS ID: 67078
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.21653' **Long(WGS84):** -108° 20.9606'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: Maintenance: Grass/shrub.





2021_ELMO_67078_House #7_Front.jpg

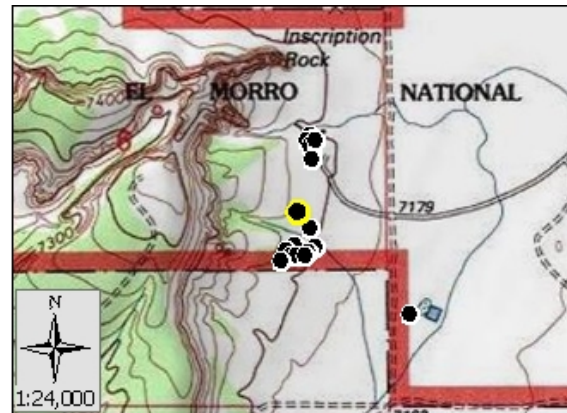

Score: 62
Rating: Moderate
Asset Priority Index (API): 52

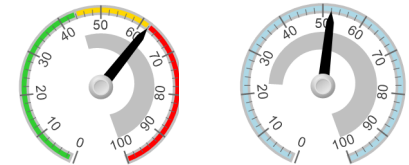

Factors Driving the Ratings

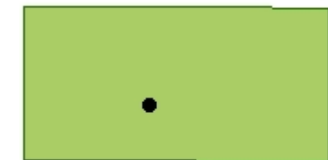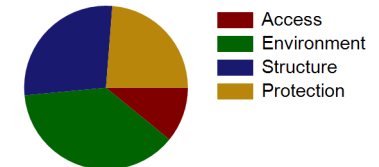

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: House #6


Unit - Location: ELMO - El Morro
FMSS ID: 67077
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.14653' **Long(WGS84):** -108° 20.9485'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_ELMO_67077_House #6_.jpg

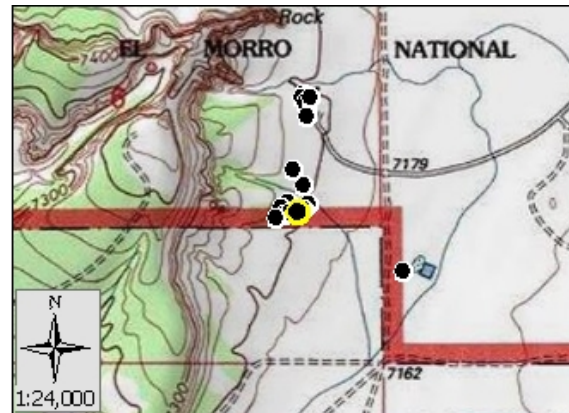

Score: 62
Rating: Moderate
Asset Priority Index (API): 52

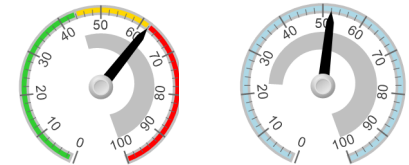

Factors Driving the Ratings

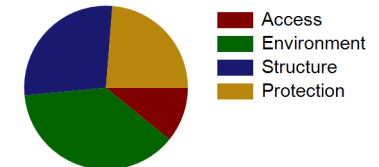

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Propane Tank #1


Unit - Location: ELMO - El Morro
FMSS ID: not found
Structure Type: PropaneTank
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.15166' **Long(WGS84):** -108° 20.94'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Not applicable
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_ELMO_not found _Propane Tank #1_Front.jpg

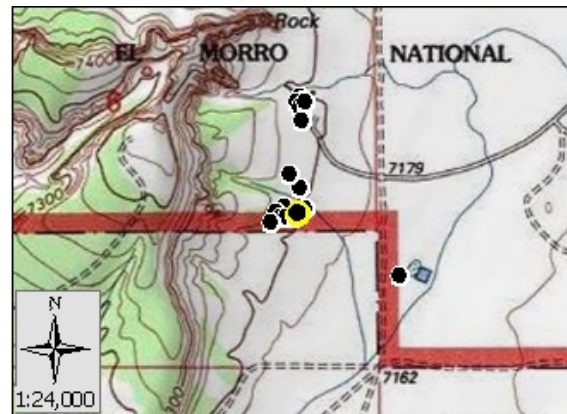


Score: 58
Rating: Moderate

Asset Priority Index (API):
N/A

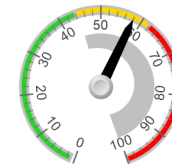

Factors Driving the Ratings

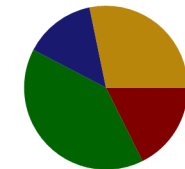

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: House #5

Unit - Location: ELMO - El Morro
FMSS ID: 67076
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021


Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.19262' **Long(WGS84):** -108° 20.9395'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible,adjacent,no veg/debris clearance
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_ELMO_67076_House #5_.jpg


Score: 54
Rating: Moderate

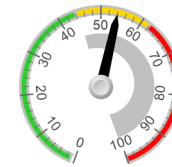


Asset Priority Index (API): 52

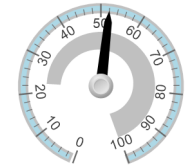

Factors Driving the Ratings

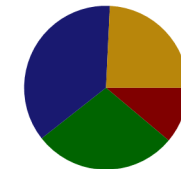

■ Access
■ Environment
■ Structure
■ Protection

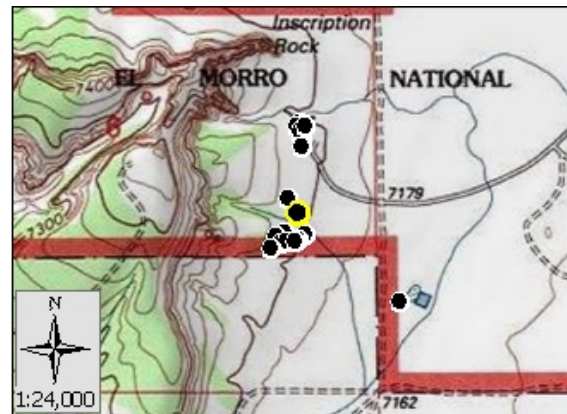

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: House #4


Unit - Location: ELMO - El Morro
FMSS ID: 67065
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - ELMO Housing
Lat(WGS84): 35° 2.16031' **Long(WGS84):** -108° 20.928'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible,adjacent,no veg/debris clearance
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_ELMO_67065_House #4_Front.jpg

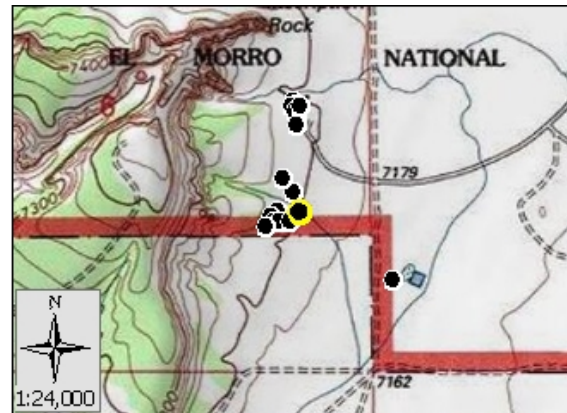

Score: 54
Rating: Moderate
Asset Priority Index (API): 52

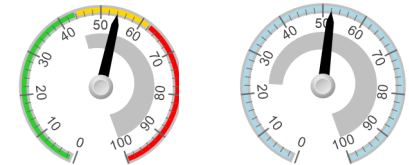

Factors Driving the Ratings

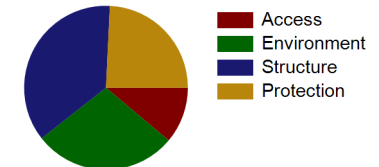

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Book Storage Shed

Unit - Location: ELMO - El Morro
FMSS ID: 67060
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021


Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 35° 2.33918' **Long(WGS84):** -108° 20.9439'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: Combustible,adjacent,no veg/debris clearance
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_ELMO_67060_Book Storage Shed_Front.jpg

Score: 59
Rating: Moderate
Asset Priority Index (API): 23

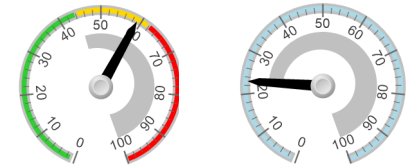

Factors Driving the Ratings

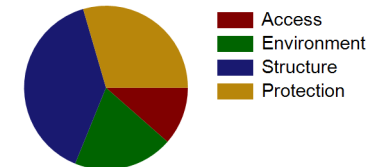

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: ELMO Lumber Storage

Unit - Location: ELMO - El Morro

FMSS ID: 67057

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: High

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 35° 2.33759' **Long(WGS84):** -108° 20.9437'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_ELMO_67057_ELMO Lumber Storage_Front.jpg


Score: 65
Rating: High

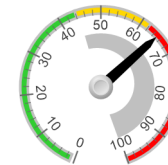


Asset Priority Index (API): 23



Factors Driving the Ratings

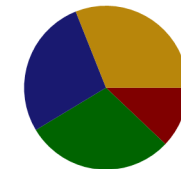

■ Access
■ Environment
■ Structure
■ Protection

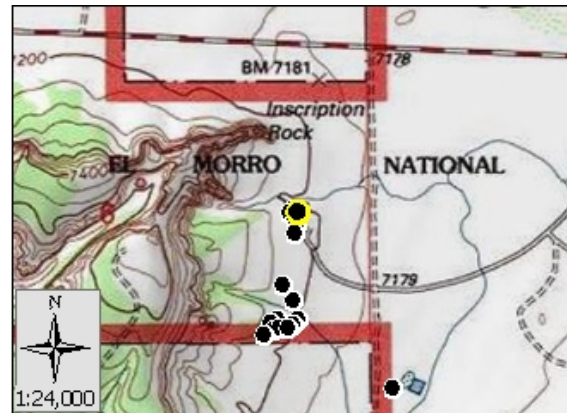

● Facility
■ NPS Boundary





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: ELMO Propane Tank


Unit - Location: ELMO - El Morro
FMSS ID: 67349
Structure Type: PropaneTank
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 35° 2.34168' **Long(WGS84):** -108° 20.9383'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Not applicable
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





2021_ELMO_67349_ELMO Propane Tank_Front.jpg

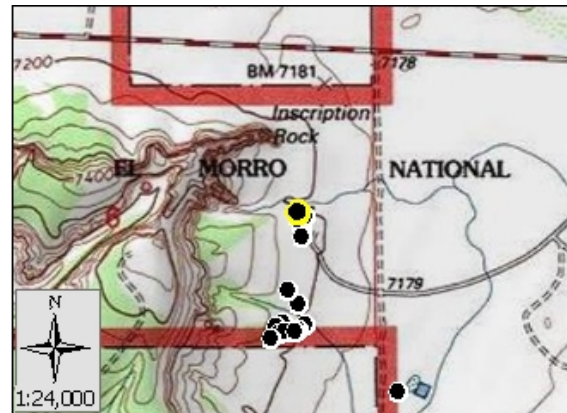

Score: 46
Rating: Moderate
Asset Priority Index (API):
N/A

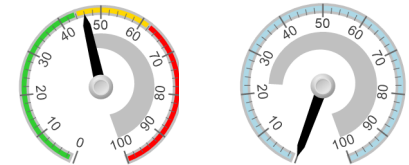

Factors Driving the Ratings

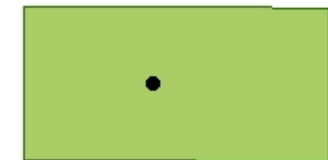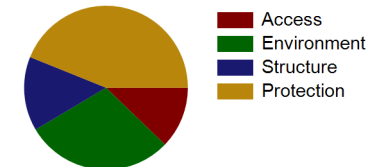

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro Maintenance

Unit - Location: ELMO - El Morro

FMSS ID: 67054

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 35° 2.32659' Long(WGS84): -108° 20.937'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:




2021_ELMO_67054_El Morro Maintenance_Front.jpg

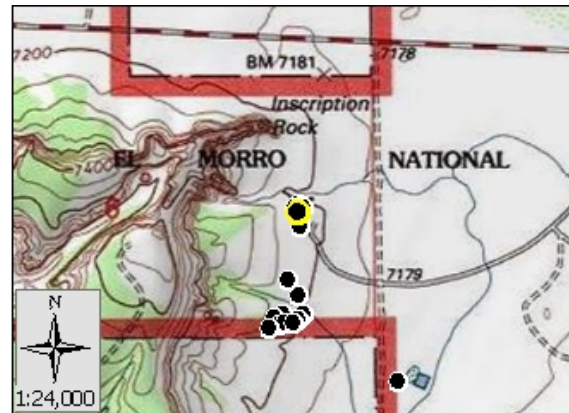


Score: 48
Rating: Moderate

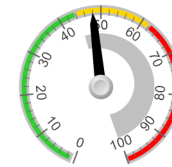

Asset Priority Index
(API):
75

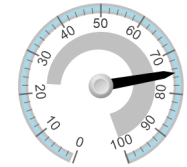

Factors Driving the Ratings

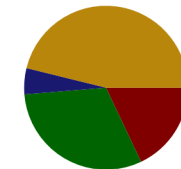

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro VC


Unit - Location: ELMO - El Morro
FMSS ID: 67003
Structure Type: Building
Structure Use: Public
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/4/2021

Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 35° 2.30279' **Long(WGS84):** -108° 20.9348'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible,adjacent,no veg/debris clearance
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_ELMO_67003_El Morro VC_.jpg

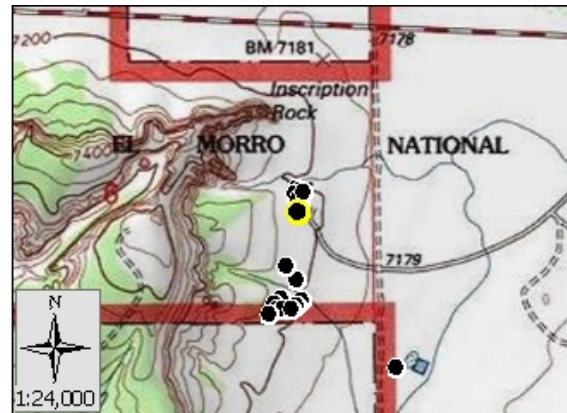

Score: 52
Rating: Moderate
Asset Priority Index (API): 100

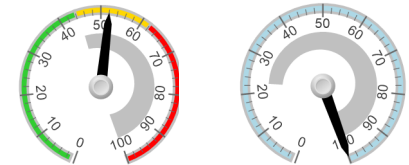

Factors Driving the Ratings

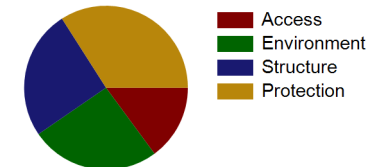

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: El Morro Administration Bldg.

Unit - Location: ELMO - El Morro

FMSS ID: 67045

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 35° 2.31466' Long(WGS84): -108° 20.9336'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:




2021_ELMO_67045_El Morro Administration Bldg._Front.jpg

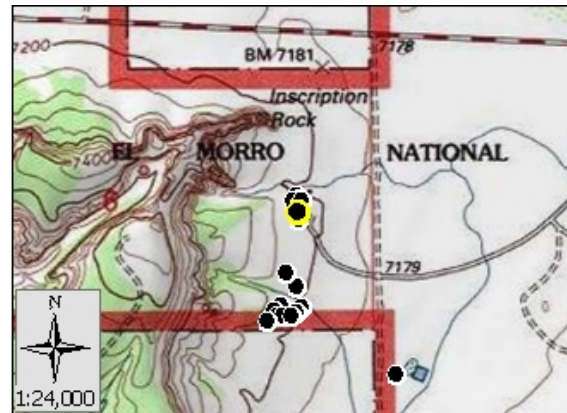


Score: 54
Rating: Moderate

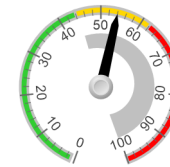

Asset Priority Index
(API):
75

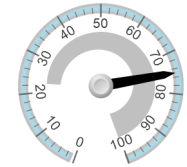

Factors Driving the Ratings

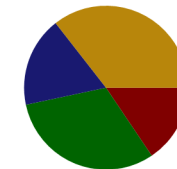

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: ELMO Fuel Storage Shed

Unit - Location: ELMO - El Morro

FMSS ID: 67064

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/4/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 35° 2.33832' Long(WGS84): -108° 20.9317'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat: Hazmat stored in structure.


Assessment Comments:



2021_ELMO_67064_ELMO Fuel Storage Shed_Front.jpg




Score: 55
Rating: Moderate

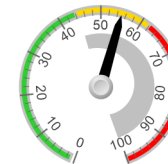


Asset Priority Index
(API):
23



Factors Driving the Ratings

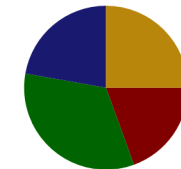

Access
Environment
Structure
Protection

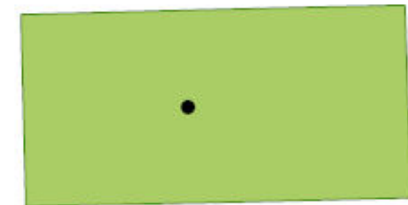

● Facility
■ NPS Boundary