


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



Walnut Canyon National Monument- Overview

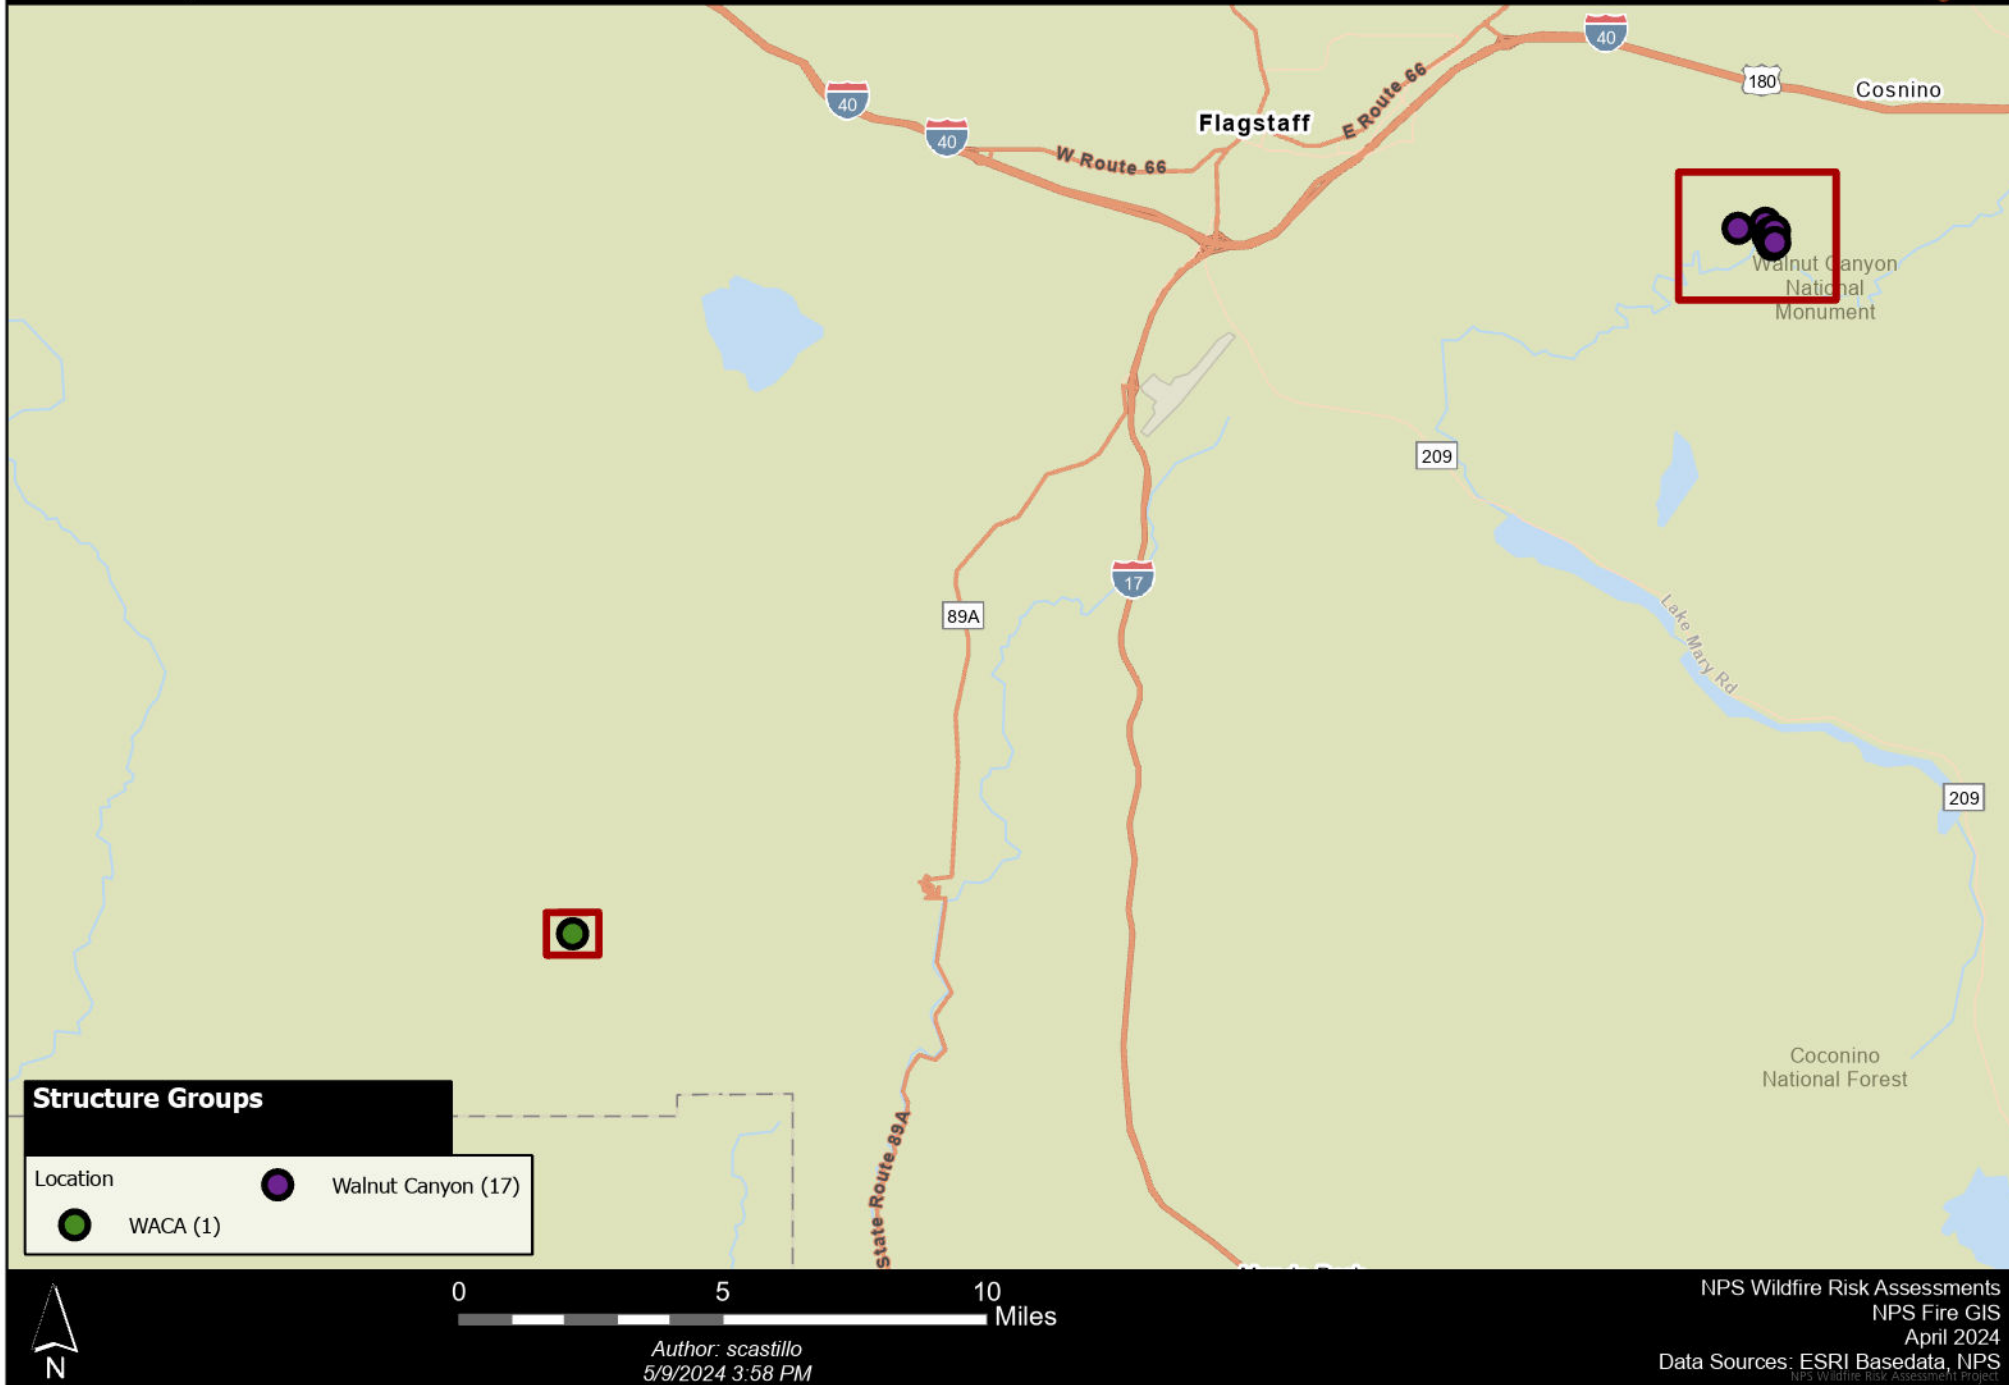

Walnut Canyon 1

WACA - Walnut Canyon National Monument

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
10	48483	WACA Pinyon Office (Formerly Res # 7)
11	48482	WACA Ponderosa House (Res #6)
12	113346	WACA Residence # 1 Detached Garage
13	48480	WACA Residence # 2
14	48480	WACA Residence # 2
15	48480	WACA Residence # 2
16	45499	WACA Visitor Center
17	46816	WACA WNPA Shed
18	not found	Water Tower
2	48497	Q-1 Housing
3	search not	Q-1 Housing Garage
4	search not	Visitors center picnic restrooms
5	46819	WACA CCC Restroom
6	51280	WACA Entrance Station
7	46810	WACA Historic Ranger Cabin (107)
8	46811	WACA Maintenance Shop
9	100371	WACA New Pumphouse (Constructed Fall 2005)



Author: scastillo
5/9/2024 3:44 PM

0 0.25 0.5 0.75 Miles
Scale: 1:18,000

NPS Wildfire Risk Assessments
NPS Fire GIS
February 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project

Walnut Canyon 2

WACA - Walnut Canyon National Monument

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
1	13317	CSTL Old Shop Bld



Rating
Rating
⬆ Not Surveyed



Author: scastillo
5/9/2024 3:52 PM

0 500 Feet
Scale: 1:3,840

NPS Wildfire Risk Assessments
NPS Fire GIS
April 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WACA - Walnut Canyon

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
2	Q-1 Housing	NPS	48497	Building	Residence	Y	12/20/20	Unknown	89	High	Not Designated	no B photo due to fence	UNR
3	Q-1 Housing Garage	NPS	search not found	Building	Residence	Y	12/20/20	Unknown	72	High	Not Designated		UNR
4	Visitors center picnic restrooms	NPS	search not found	Building	Public	N	12/20/20	Unknown	57	Moderate	Not Designated		UNR
5	WACA CCC Restroom	NPS	46819	Cultural Resource	Public	N	12/20/20	Unknown	111	High	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
6	WACA Entrance Station	NPS	51280	Building	Admin	N	12/20/20	Unknown	58	Moderate	Not Designated		UNR
7	WACA Historic Ranger Cabin (107)	NPS	46810	Cultural Resource	Residence	N	12/20/20	Unknown	102	High	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WACA - Walnut Canyon

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
8	WACA Maintenance Shop	NPS	46811	Building	Admin	Y	12/20/20	Unknown	50	Moderate	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
9	WACA New Pumphouse (Constructed Fall 2005)	NPS	100371	Building	Admin	N	12/20/20	Unknown	72	High	Not Designated		UNR
10	WACA Pinyon Office (Formerly Res # 7)	NPS	48483	Building	Admin	Y	12/20/20	Unknown	53	Moderate	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
11	WACA Ponderosa House (Res #6)	NPS	48482	Building	Residence	Y	12/20/20	Unknown	52	Moderate	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WACA - Walnut Canyon

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
12	WACA Residence # 1 Detached Garage	NPS	113346	Building	Admin	Y	12/20/20	Unknown	89	High	Not Designated		UNR
13	WACA Residence # 2	NPS	48480	Building	Residence	Y	12/20/20	Unknown	71	High	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
14	WACA Residence # 2	NPS	48480	Building	Residence	Y	12/20/20	Unknown	71	High	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
15	WACA Residence # 2	NPS	48480	Building	Admin	N	12/20/20	Unknown	51	Moderate	Not Designated		UNR
16	WACA Visitor Center	NPS	45499	Building	Public	Y	12/20/20	Unknown	60	Moderate	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WACA - Walnut Canyon

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
17	WACA WNPA Shed	NPS	46816	Building	Admin	N	12/20/20	Unknown	56	Moderate	Not Designated		UNR
18	Water Tower	NPS	not found	Utility	Admin	N	12/20/20	Unknown	52	Moderate	Not Designated		UNR



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: WACA - Walnut Canyon

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours
2	Q-1 Housing	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		4.0
		Individual Facility	Initial	1	Open crown spacing 10 to 30 feet depending on slope		4.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris		1.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope		16.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		5.0
3	Q-1 Housing Garage	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		2.0
4	Visitors center picnic restrooms	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		6.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

4	Visitors center picnic restrooms	Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		8.0
5	WACA CCC Restroom	Individual Facility	Initial	1	Open crown spacing 10 to 30 feet depending on slope		1.0
		Individual Facility	Initial	1	Remove dead or dying component of shrubs and trees		1.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		2.0
6	WACA Entrance Station	Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		6.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope		8.0
7	WACA Historic Ranger Cabin (107)	Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		2.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris		2.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		6.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		6.0
8	WACA Maintenance Shop	Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		6.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

9	WACA New Pumphouse (Constructed Fall 2005)	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		6.0
10	WACA Pinyon Office (Formerly Res # 7)	Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		1.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris		2.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		4.0
11	WACA Ponderosa House (Res #6)	Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		1.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris		2.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		3.0
12	WACA Residence # 1 Detached Garage	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		2.0
		Individual Facility	Initial	1	Limb trees 6 to 15 feet above ground		2.0



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

12	WACA Residence # 1 Detached Garage	Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		5.0
15	WACA Residence # 2	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		2.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris		1.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		3.0
		Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		6.0
		Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		1.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris		1.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope		8.0
		Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		0.5



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

15	WACA Residence # 2	Individual Facility	Initial	1	Remove dead or dying component of shrubs and trees		1.0
16	WACA Visitor Center	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		3.0
		Individual Facility	Initial	1	Remove dead or dying component of shrubs and trees		2.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		4.0
17	WACA WNPA Shed	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		1.0
18	Water Tower	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		4.0



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: Walnut Canyon National Monument - Walnut Canyon

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
Q-1 Housing	Individual Facility	PrepLeave	-		-	
			Fuels reduction -	16.0	-	
			Install sprinkler system -	6.0	-	
Q-1 Housing Garage	Individual Facility	PrepLeave	Fuels reduction -	6.0	-	
Visitors center picnic restrooms	Individual Facility	PrepLeave	Fuels reduction -	10.0	-	
			Install sprinkler system -	2.0	-	
			-		-	
WACA CCC Restroom	Individual Facility	PrepLeave	Fuels reduction -	3.0	-	
			Structure wrap -	1.0	-	
WACA Entrance Station	Individual Facility	PrepLeave	Fuels reduction -	4.0	-	
			-		-	
			-		-	
			Structure wrap -	1.0	-	
WACA Historic Ranger Cabin (107)	Individual Facility	PrepHold	Structure wrap -	12.0	-	
			Fuels reduction -	16.0	-	
WACA Maintenance Shop	Individual Facility	PrepLeave	Install sprinkler system -	4.0	-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
WACA Maintenance Shop	Individual Facility	PrepLeave	Fuels reduction -	8.0	-	
WACA New Pumphouse (Constructed Fall 2005)	Individual Facility	PrepLeave	Fuels reduction -	6.0	-	
WACA Pinyon Office (Formerly Res # 7)	Individual Facility	PrepLeave	Fuels reduction -	10.0	-	
			Install sprinkler system -	4.0	-	
WACA Ponderosa House (Res #6)	Individual Facility	PrepLeave	Install sprinkler system -	4.0	-	
			Fuels reduction -	10.0	-	
WACA Residence # 1 Detached Garage	Individual Facility	PrepLeave	Fuels reduction -	8.0	-	
			Install sprinkler system -	2.0	-	
WACA Residence # 2	Individual Facility	PrepLeave	Install sprinkler system -	4.0	-	
			Fuels reduction -	6.0	-	
WACA Residence # 2	Individual Facility	PrepLeave	Install sprinkler system -	4.0	-	
			Fuels reduction -	10.0	-	
			-		-	
WACA Residence # 2	Individual Facility	PrepLeave	Fuels reduction -	4.0	-	
			Install sprinkler system -	3.0	-	
WACA Visitor Center	Individual Facility	PrepLeave	Install sprinkler system -	4.0	-	
			Fuels reduction -	12.0	-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
WACA Visitor Center	Individual Facility	PrepLeave	-		-	
WACA WNPA Shed	Individual Facility	PrepLeave	Fuels reduction -	4.0	-	
					-	
Water Tower	Individual Facility	PrepLeave	Fuels reduction -	6.0	-	



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Q-1 Housing

Unit - Location: WACA - Walnut Canyon

FMSS ID: 48497

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4225' **Long(WGS84):** -111° 30.5926'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: 5ft to 30ft from facility

Propane Tanks: Present and fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments: no B photo due to fence




2020_WACA_48497_Q-1 Housing_Z.jpg


Score: 89
Rating: High




Asset Priority Index (API):
N/A

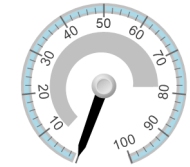

Factors Driving the Ratings

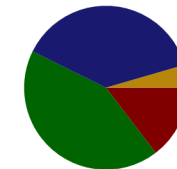

■ Access
■ Environment
■ Structure
■ Protection

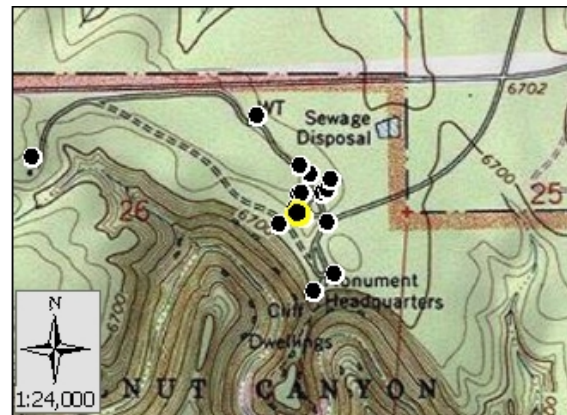

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Q-1 Housing Garage

Unit - Location: WACA - Walnut Canyon
FMSS ID: search not found
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/20/2020


Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 10.4308' **Long(WGS84):** -111° 30.6019'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_WACA_search not found _Q-1 Housing Garage_Z.jpg



Score: 72
Rating: High

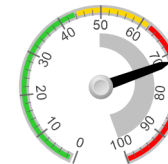

Asset Priority Index (API):
N/A



Factors Driving the Ratings

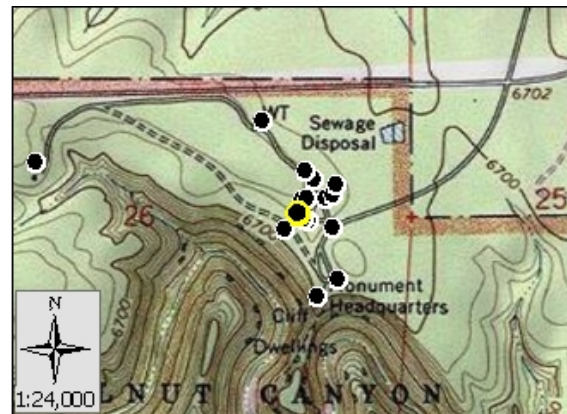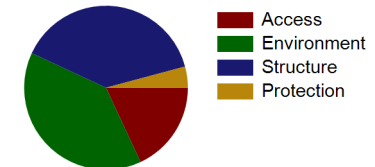

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Visitors center picnic restrooms

Unit - Location: WACA - Walnut Canyon

FMSS ID: search not found

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.325' Long(WGS84): -111° 30.5232'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2020_WACA_search not found _Visitors center picnic restrooms_Front.jpg

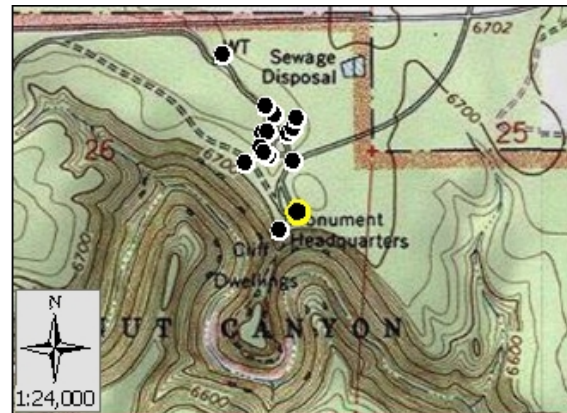


Score: 57
Rating: Moderate

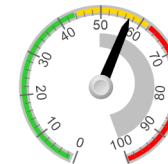

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

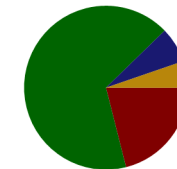

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA CCC Restroom

Unit - Location: WACA - Walnut Canyon

FMSS ID: 46819

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 35° 10.5156' Long(WGS84): -111° 31.1268'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Other than all season

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: No defensible space

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



2020_WACA_46819_WACA CCC Restroom_Z.jpg


Score: 111
Rating: High

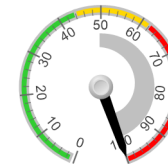

Asset Priority Index
(API):
40



Factors Driving the Ratings

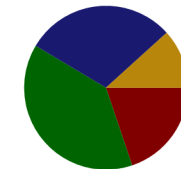

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Entrance Station

Unit - Location: WACA - Walnut Canyon

FMSS ID: 51280

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4081' Long(WGS84): -111° 30.5351'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2020_WACA_51280_WACA Entrance Station_P_.jpg

Score: 58
Rating: Moderate

Asset Priority Index
(API):
30

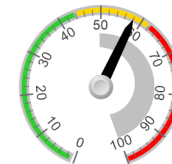

Factors Driving the Ratings

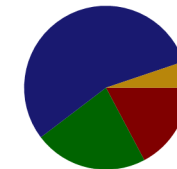

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Historic Ranger Cabin (107)

Unit - Location: WACA - Walnut Canyon

FMSS ID: 46810

Structure Type: CulturalResource

Structure Use: Residence

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.5156' Long(WGS84): -111° 31.1268'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Other than all season

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300ft from facility w/o turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



WACA-46810-WACA Historic Ranger Cabin (107)-Front.jpg


Score: 102
Rating: High

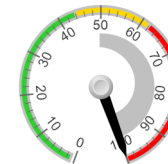

Asset Priority Index
(API):
31



Factors Driving the Ratings

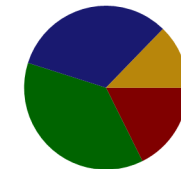

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Maintenance Shop

Unit - Location: WACA - Walnut Canyon

FMSS ID: 46811

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4793' **Long(WGS84):** -111° 30.5285'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.




WACA-46811-WACA Maintenance Shop-Front.jpg

Score: 50
Rating: Moderate


Asset Priority Index (API):
43

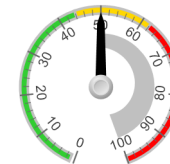

Factors Driving the Ratings

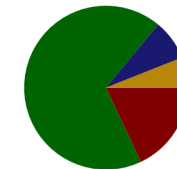

Access
Environment
Structure
Protection

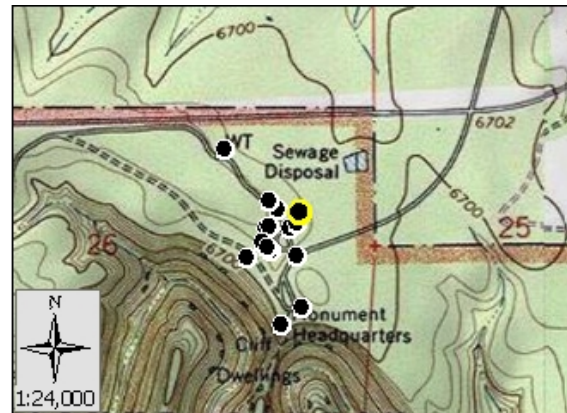

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA New Pumphouse (Constructed Fall 2005)

Unit - Location: WACA - Walnut Canyon

FMSS ID: 100371

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.407' Long(WGS84): -111° 30.6316'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Other than all season

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope >40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



WACA-100371-WACA New Pumphouse (Constructed Fall 2005)-Front.jpg

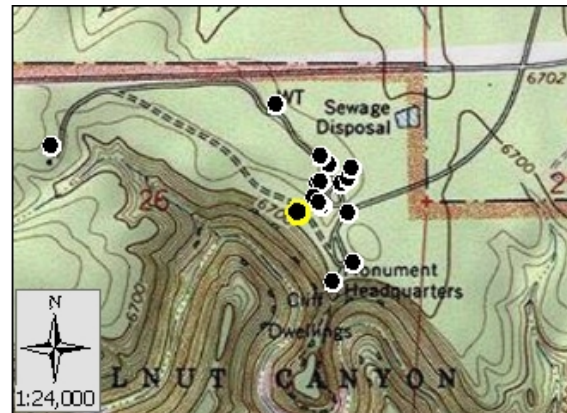


Score: 72
Rating: High

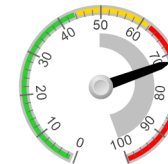

Asset Priority Index
(API):
20



Factors Driving the Ratings

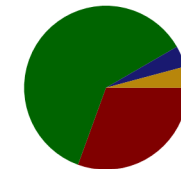

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Pinyon Office (Formerly Res # 7)

Unit - Location: WACA - Walnut Canyon

FMSS ID: 48483

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4996' **Long(WGS84):** -111° 30.5895'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and little to no fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



WACA-48483-WACA Pinyon Office (Formerly Res # 7)-
Front.jpg

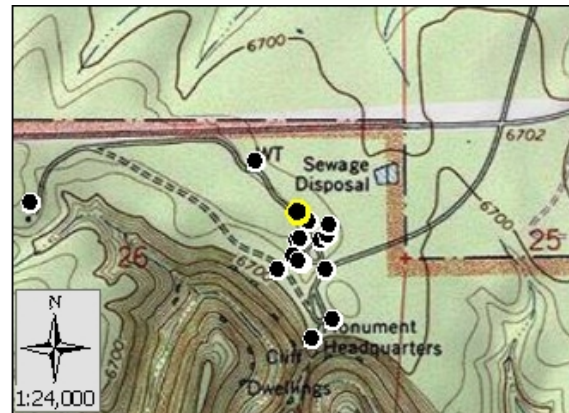


Score: 53
Rating: Moderate

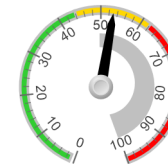

Asset Priority Index (API): 43



Factors Driving the Ratings

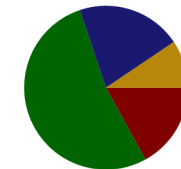

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Ponderosa House (Res #6)

Unit - Location: WACA - Walnut Canyon

FMSS ID: 48482

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4861' **Long(WGS84):** -111° 30.5718'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and little to no fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



WACA-48482-WACA Ponderosa House (Res #6)-Front.jpg


Score: 52
Rating: Moderate

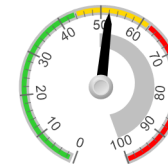


Asset Priority Index (API): 36



Factors Driving the Ratings

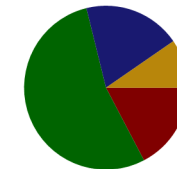

■ Access
■ Environment
■ Structure
■ Protection

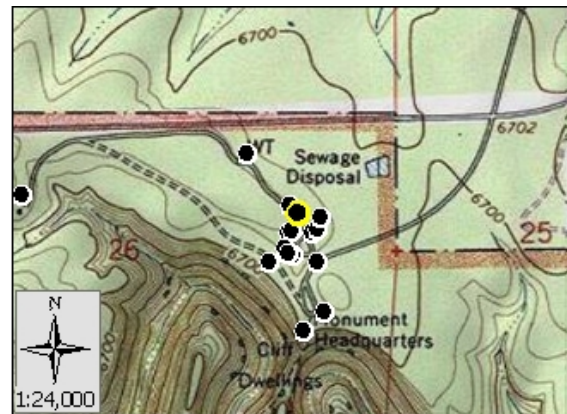



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Residence # 1 Detached Garage

Unit - Location: WACA - Walnut Canyon
FMSS ID: 113346
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/20/2020


Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 10.4182' **Long(WGS84):** -111° 30.5842'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: 5ft to 30ft from facility
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_WACA_113346_WACA Residence # 1 Detached Garage_Z.jpg



Score: 89
Rating: High

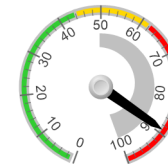

Asset Priority Index (API):
7



Factors Driving the Ratings

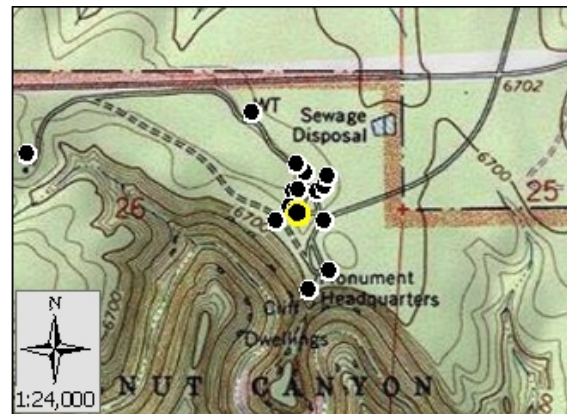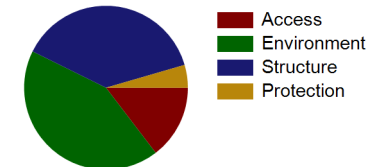

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Residence # 2

Unit - Location: WACA - Walnut Canyon

FMSS ID: 48480

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4567' **Long(WGS84):** -111° 30.5874'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



2020_WACA_48480_WACA Residence # 2_Z.jpg


Score: 71
Rating: High

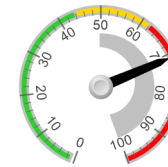


Asset Priority Index (API): 36



Factors Driving the Ratings

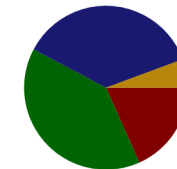

Access
Environment
Structure
Protection

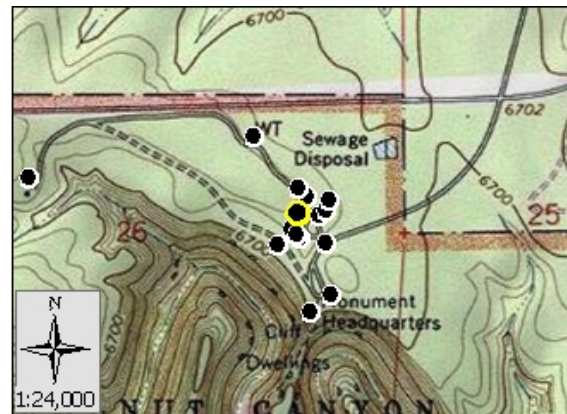



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Residence # 2

Unit - Location: WACA - Walnut Canyon

FMSS ID: 48480

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.4543' Long(WGS84): -111° 30.5953'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



2020_WACA_48480_WACA Residence # 2_Z.jpg


Score: 71
Rating: High

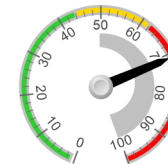


Asset Priority Index
(API):
36



Factors Driving the Ratings

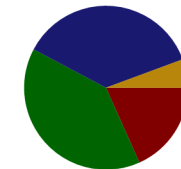

Access
Environment
Structure
Protection

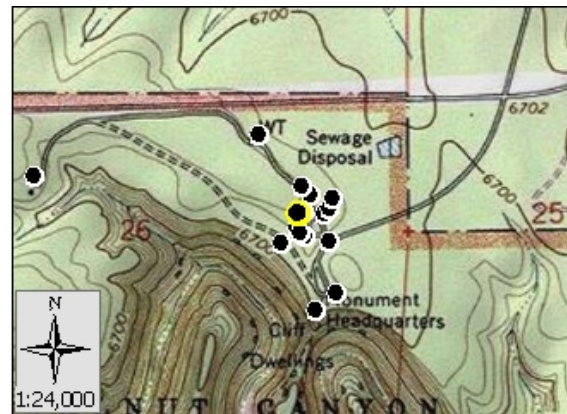

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Residence # 2

Unit - Location: WACA - Walnut Canyon

FMSS ID: 48480

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.462' **Long(WGS84):** -111° 30.5345'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat: 5Gal LPG tanks adjacent, acetalline torch inside open bay.


Assessment Comments:



WACA-48480-WACA Residence # 2-Front.jpg




Score: 51
Rating: Moderate

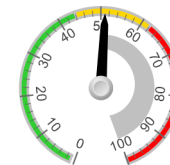

Asset Priority Index (API): 36



Factors Driving the Ratings

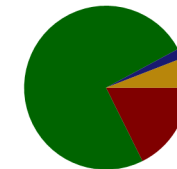

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA Visitor Center

Unit - Location: WACA - Walnut Canyon

FMSS ID: 45499

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 10.2959' **Long(WGS84):** -111° 30.5643'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope >40%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, 6in to 30in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.



WACA-45499-WACA Visitor Center-Front.jpg


Score: 60
Rating: Moderate

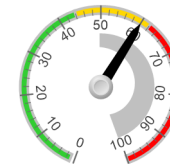



Asset Priority Index (API): 78



Factors Driving the Ratings

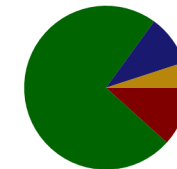

■ Access
■ Environment
■ Structure
■ Protection

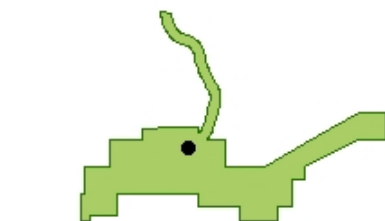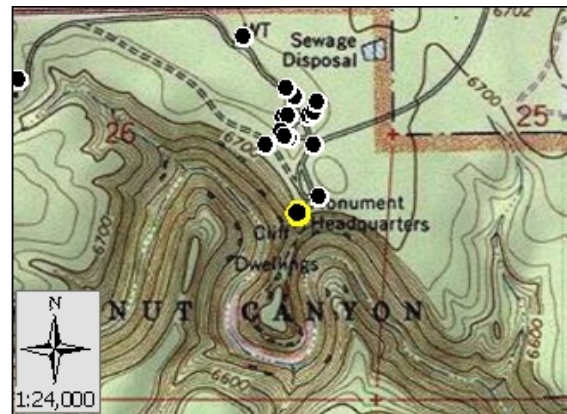

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WACA WNPA Shed

Unit - Location: WACA - Walnut Canyon
FMSS ID: 46816
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: castillo
Last Site Visit Date: 12/20/2020


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 10.4548' **Long(WGS84):** -111° 30.5471'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





WACA-46816-WACA WNPA Shed-Front.jpg

Score: 56
Rating: Moderate
Asset Priority Index (API):
7

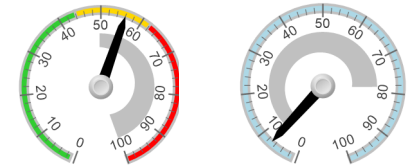

Factors Driving the Ratings

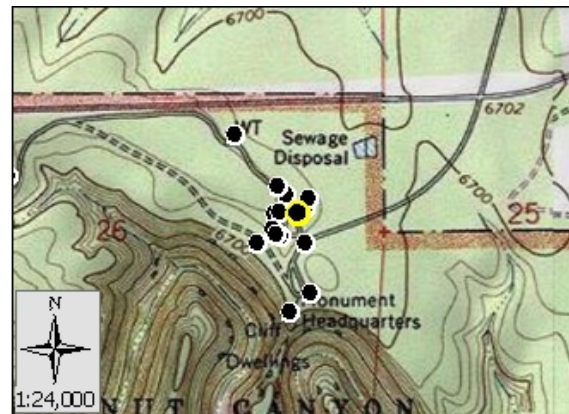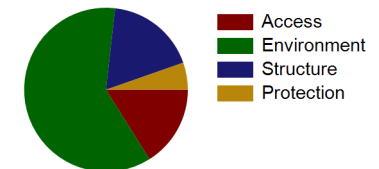

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Water Tower

Unit - Location: WACA - Walnut Canyon

FMSS ID: not found

Structure Type: Utility

Structure Use: Admin

Owner: NPS

Field Crew: castillo

Last Site Visit Date: 12/20/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 35° 10.5834' **Long(WGS84):** -111° 30.6769'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Other than all season

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Not applicable

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




WACA--Water Tower-Front.jpg

Score: 52
Rating: Moderate


Asset Priority Index (API):
N/A

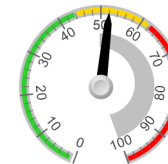

Factors Driving the Ratings

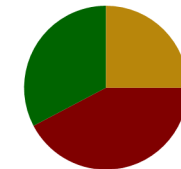

- Access
- Environment
- Structure
- Protection

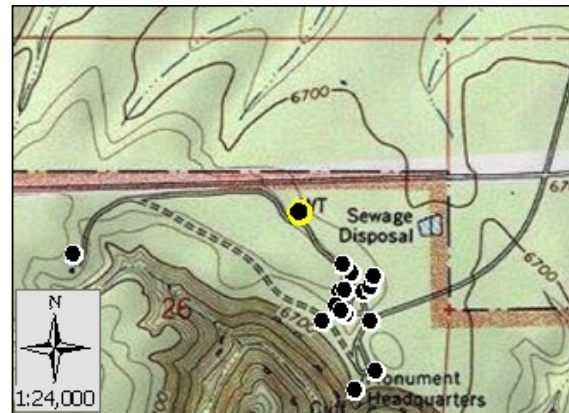

- Facility
- NPS Boundary