



Fort Davis Historic Site
FODA - Fort Davis National Historic Site

National Park Service
U.S. Department of the Interior

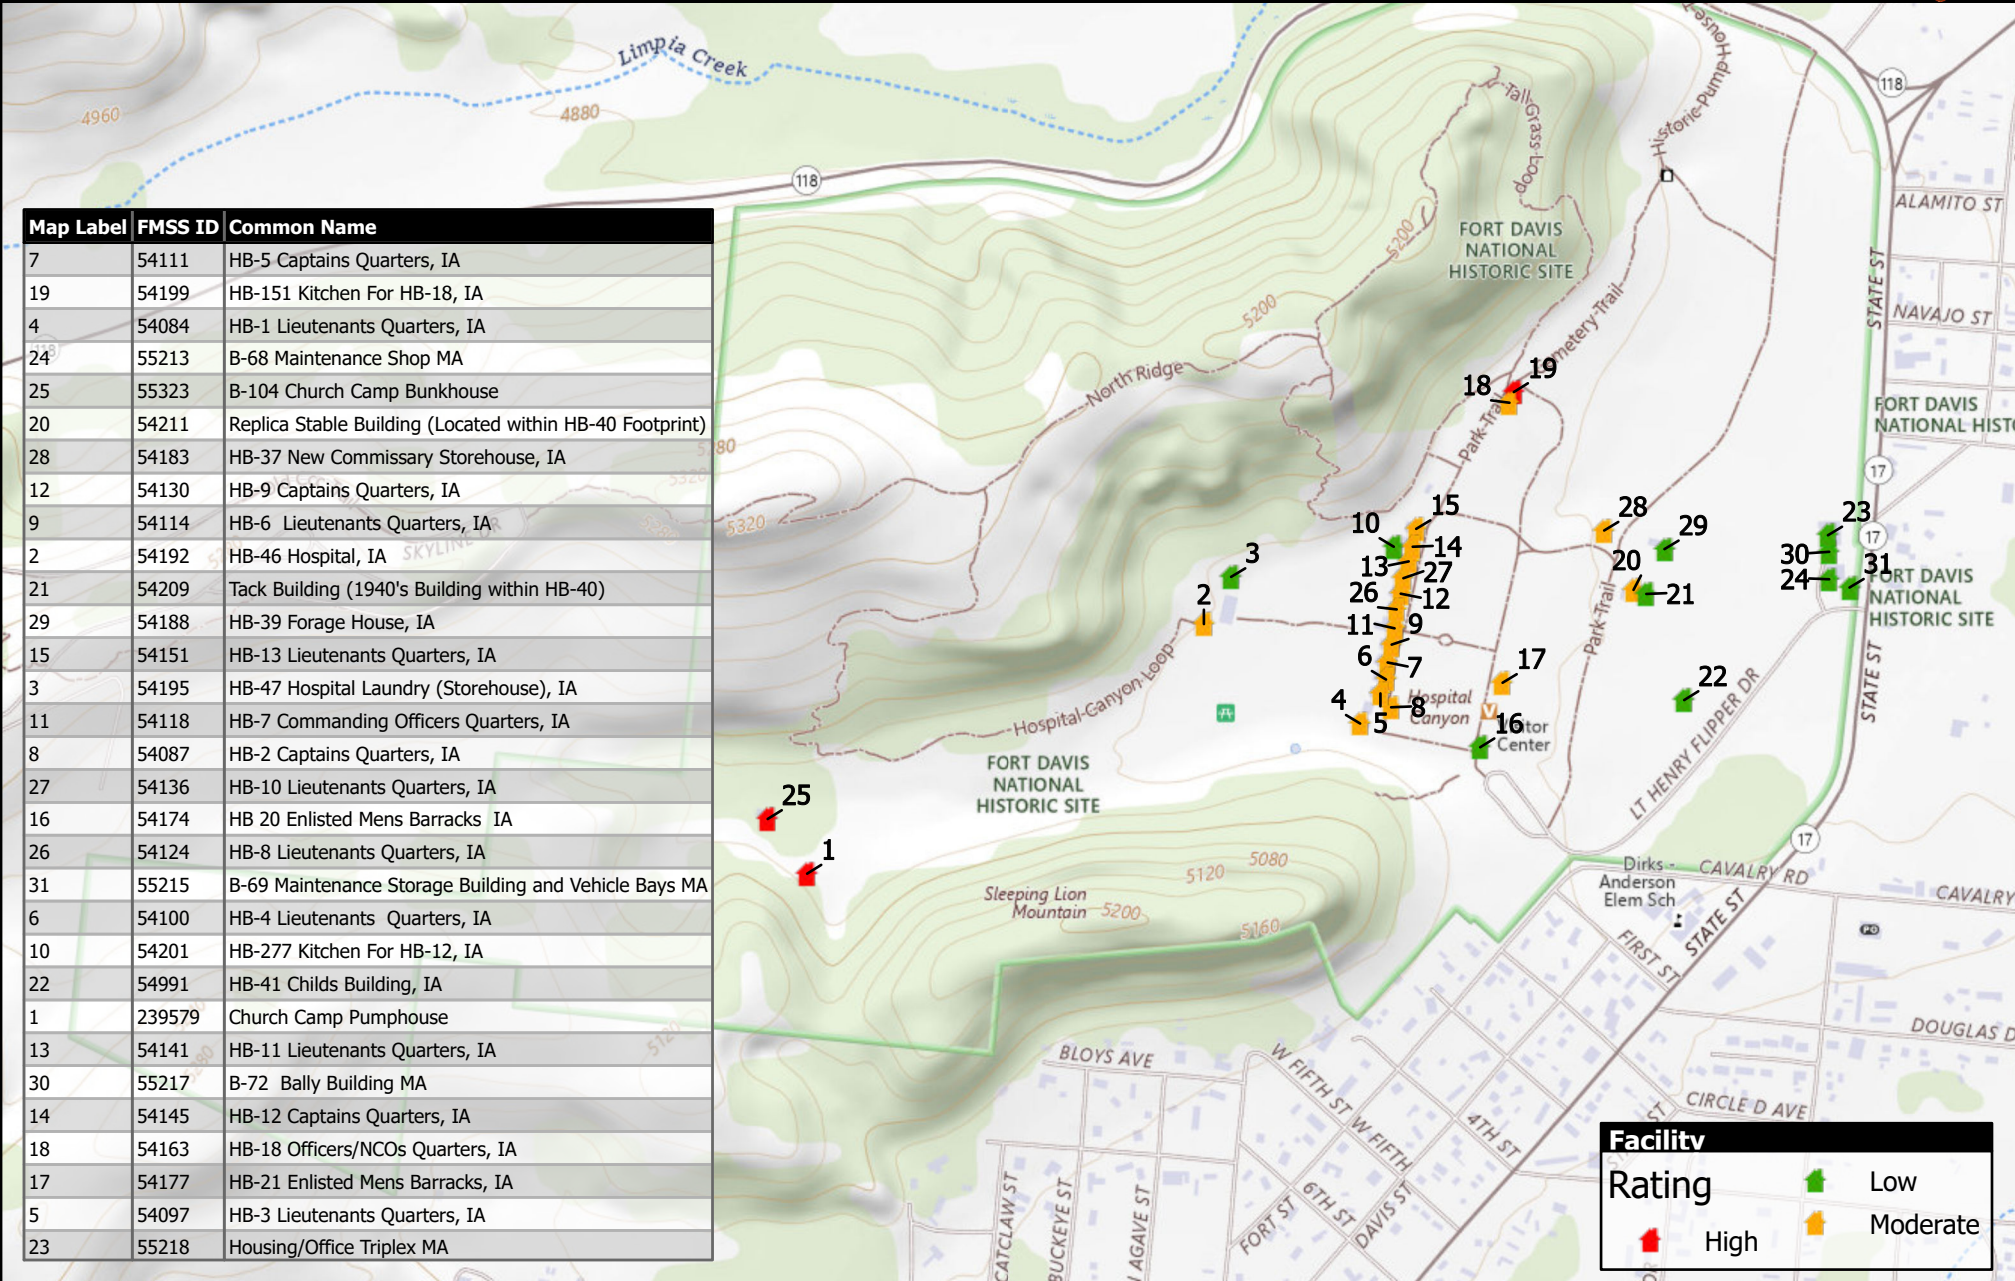

Author: sszturm
5/29/2024 10:08 AM



NPS Wildfire Risk Assessments
NPS Fire GIS
May 2024
Data Source: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: B-104 Church Camp Bunkhouse

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 55323

Structure Type: Building

Structure Use: Other

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 30° 35.7795' Long(WGS84): -103° 54.1205'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Non-surfaced- gravel,dirt,grade<5%

Bridge Condition: Flammable, load limit will limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Combination of fire resisitant and combustible

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat: Debris pile within 60 ft radius of structure.

Assessment Comments:



FODA_55323_B-104 Church Camp Bunkhouse.jpg



Score: 78
Rating: High

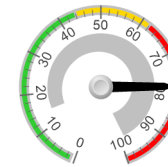

Asset Priority Index
(API):
30



Factors Driving the Ratings

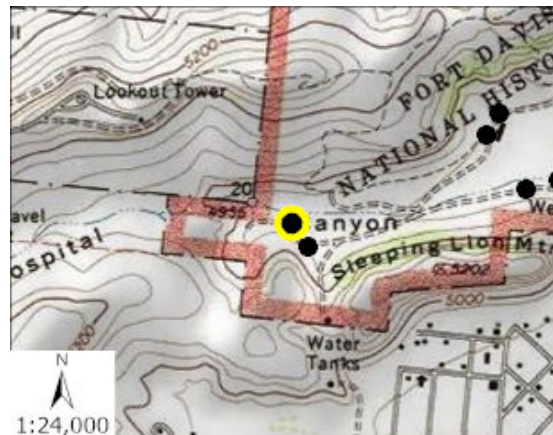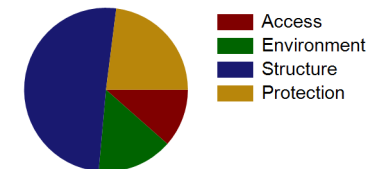

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Church Camp Pumphouse

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 239579

Structure Type: Building

Structure Use: Other

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 30° 35.7392' Long(WGS84): -103° 54.0868'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Non-surfaced- gravel,dirt,grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope >40%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards


Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT

Triage Category:


Hazmat: Building may be storage for flammable materials

Assessment Comments:

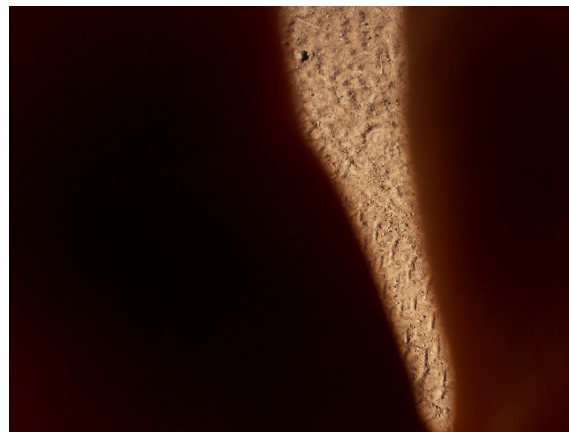

FODA_239579_Church Camp Pumphouse.jpg


Score: 98
Rating: High

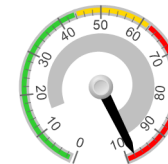


Asset Priority Index
(API):
7



Factors Driving the Ratings

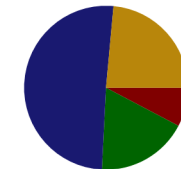

Access
Environment
Structure
Protection

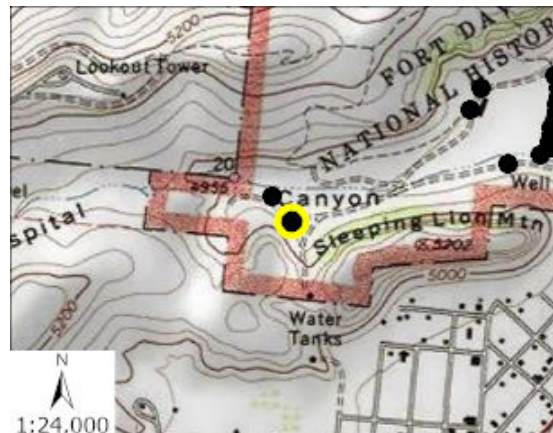

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Housing/Office Triplex MA

Unit - Location: FODA - Fort Davis Historic Site
FMSS ID: 55218
Structure Type: Building
Structure Use: Residence
Owner: NPS
Field Crew: S Castillo
Last Site Visit Date: 2/12/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Visitor Center Area
Lat(WGS84): 30° 35.9883' **Long(WGS84):** -103° 53.2133'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: >100ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: Combustible,adjacent,no veg/debris clearance
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: PROPANE
Assessment Comments:




FODA_55218_Housing Office Triplex MA.jpg


Score: 21
Rating: Low

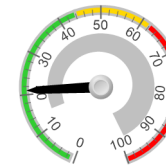



Asset Priority Index (API): 40

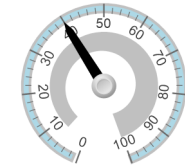

Factors Driving the Ratings

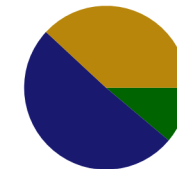

■ Access
■ Environment
■ Structure
■ Protection

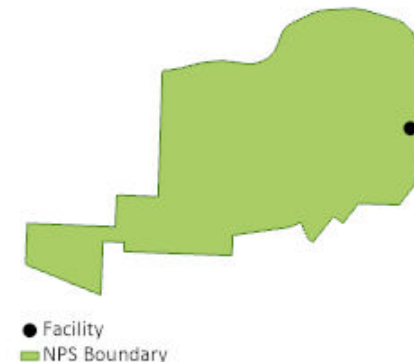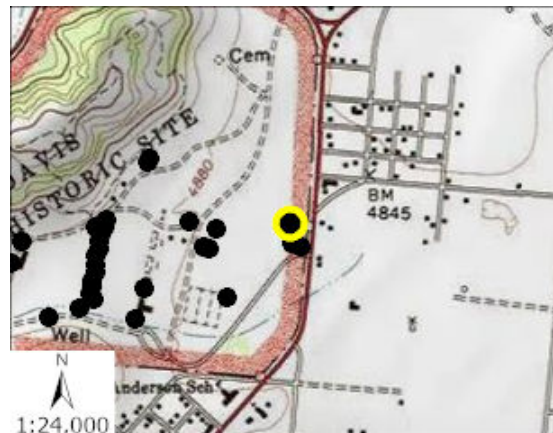



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: B-72 Bally Building MA

Unit - Location: FODA - Fort Davis Historic Site
FMSS ID: 55217
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: S Castillo
Last Site Visit Date: 2/12/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Visitor Center Area
Lat(WGS84): 30° 35.9763' **Long(WGS84):** -103° 53.2121'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: >100ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



FODA_55217_B-72 Bally Building MA.jpg


Score: 19
Rating: Low

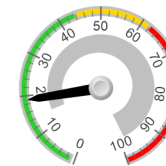


Asset Priority Index (API): 52



Factors Driving the Ratings

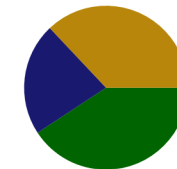

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

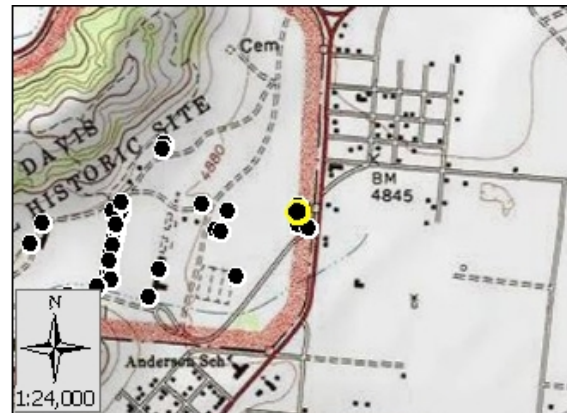

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: B-68 Maintenance Shop MA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 55213

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Visitor Center Area

Lat(WGS84): 30° 35.9559' Long(WGS84): -103° 53.2121'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:

Score: 15
Rating: Low


Asset Priority Index
(API):
40

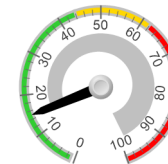

Factors Driving the Ratings

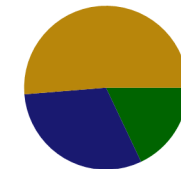

Access
Environment
Structure
Protection

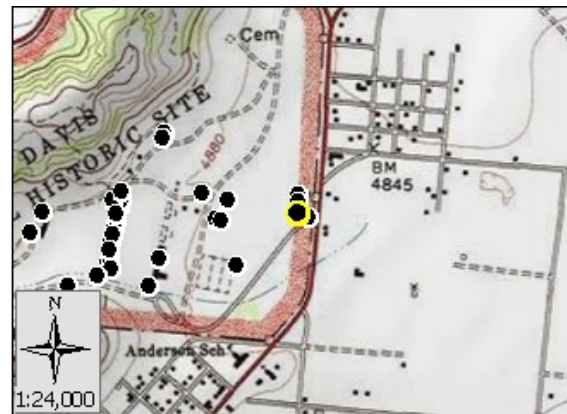

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: B-69 Maintenance Storage Building and Vehicle Bays MA


Unit - Location: FODA - Fort Davis Historic Site
FMSS ID: 55215
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: S Castillo
Last Site Visit Date: 2/12/2021

Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Visitor Center Area
Lat(WGS84): 30° 35.9499' **Long(WGS84):** -103° 53.1947'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



FODA_55215_B-69 Maintenance Storage Building and Vehicle Bays MA_D.jpg

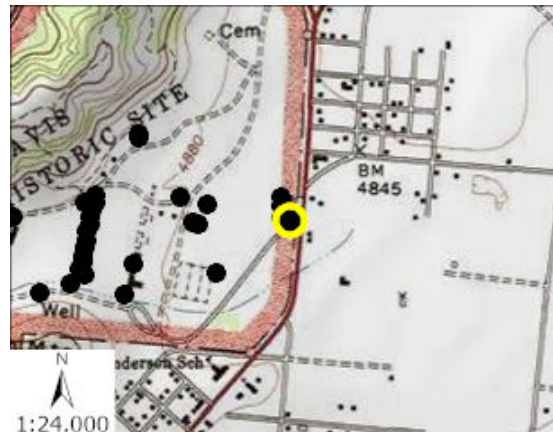



Score: 17
Rating: Low

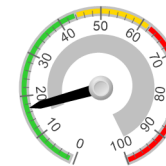

Asset Priority Index (API): 23



Factors Driving the Ratings

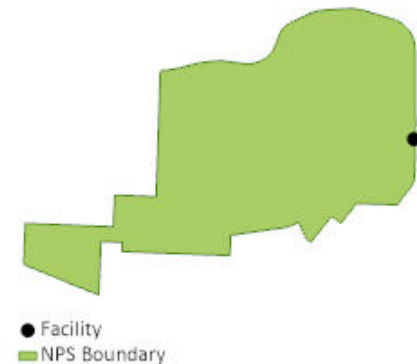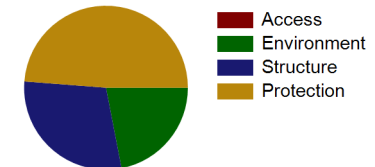



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-46 Hospital, IA

Unit - Location: FODA - Fort Davis Historic Site
FMSS ID: 54192
Structure Type: Other
Structure Use: Other
Owner: NPS
Field Crew: S Castillo
Last Site Visit Date: 2/12/2021


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Officers Row and Barracks
Lat(WGS84): 30° 35.9229' **Long(WGS84):** -103° 53.7473'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Non-surfaced- gravel,dirt,grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Combination of fire resisitant and combustible
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: None
Assessment Comments:






FODA_54192_HB-46 Hospital, IA.jpg

Score: 45
Rating: Moderate
Asset Priority Index (API): 80

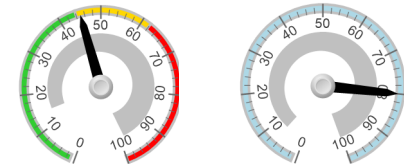

Factors Driving the Ratings

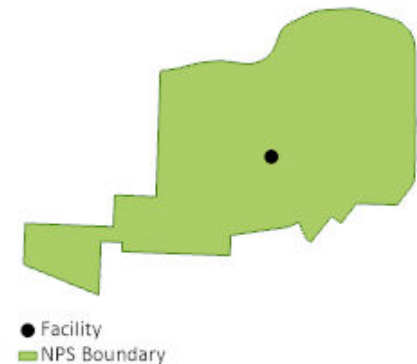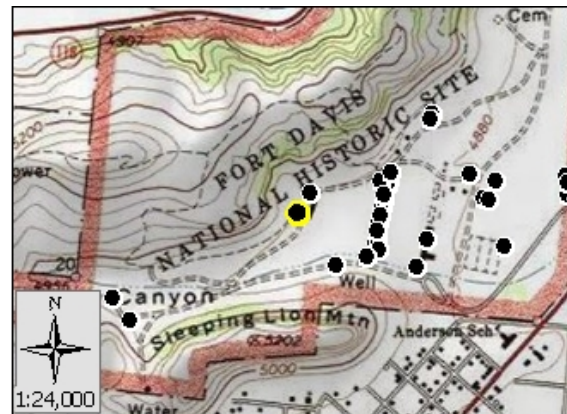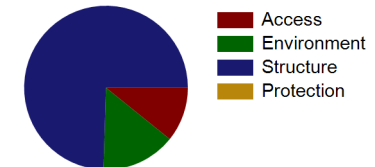



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-47 Hospital Laundry (Storehouse), IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54195

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9577' Long(WGS84): -103° 53.7239'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat: None

Assessment Comments:



FODA_54195_HB-47 Hospital Laundry (Storehouse), IA.jpg


Score: 40
Rating: Low

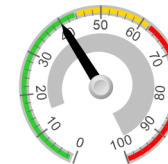


Asset Priority Index
(API):
63



Factors Driving the Ratings

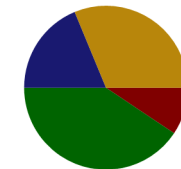

Access
Environment
Structure
Protection

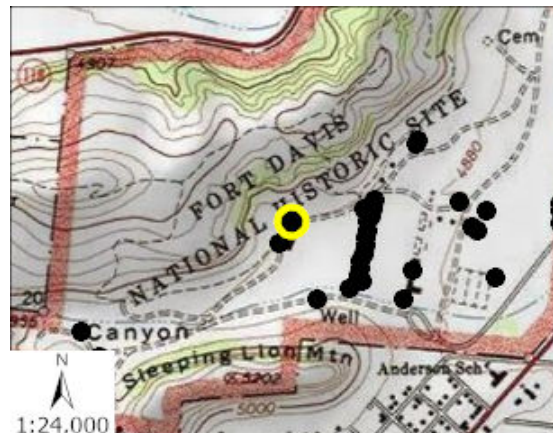

1:24,000



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-1 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54084

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8497' **Long(WGS84):** -103° 53.6135'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 54
Rating: Moderate


Asset Priority Index (API):
93

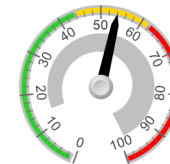

Factors Driving the Ratings

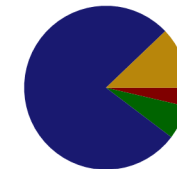

■ Access
■ Environment
■ Structure
■ Protection

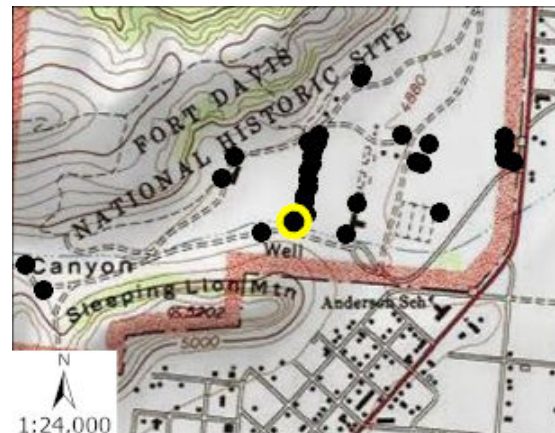

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-3 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54097

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8719' Long(WGS84): -103° 53.5961'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate


Asset Priority Index
(API):
87

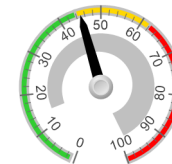

Factors Driving the Ratings

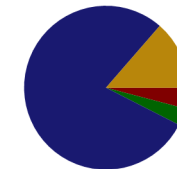

Access
Environment
Structure
Protection

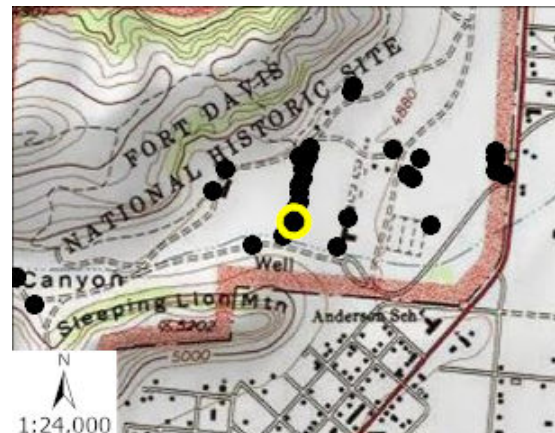

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-4 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54100

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8821' Long(WGS84): -103° 53.5913'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate


Asset Priority Index
(API):
87

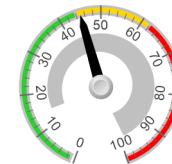

Factors Driving the Ratings

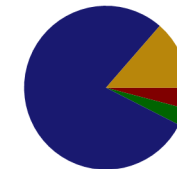

Access
Environment
Structure
Protection

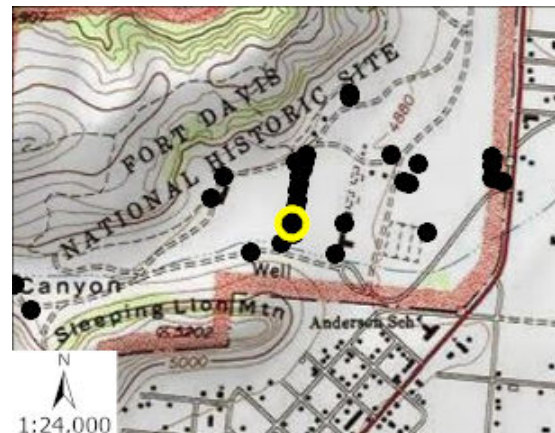

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-5 Captains Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54111

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8947' **Long(WGS84):** -103° 53.5901'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate


Asset Priority Index (API):
80

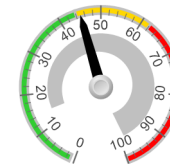

Factors Driving the Ratings

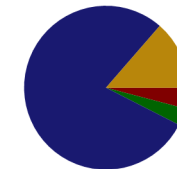

■ Access
■ Environment
■ Structure
■ Protection

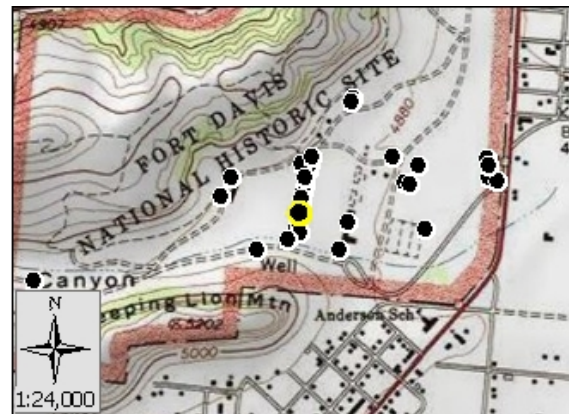

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-2 Captains Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54087

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8617' **Long(WGS84):** -103° 53.5871'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 57
Rating: Moderate

Asset Priority Index (API): 80

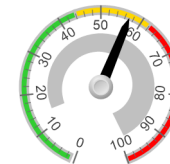

Factors Driving the Ratings

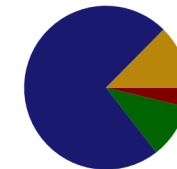

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-6 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54114

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9079' Long(WGS84): -103° 53.5865'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate


Asset Priority Index
(API):
80

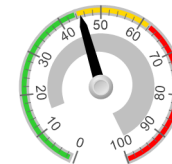

Factors Driving the Ratings

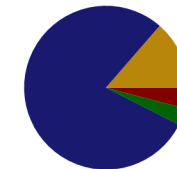

Access
Environment
Structure
Protection

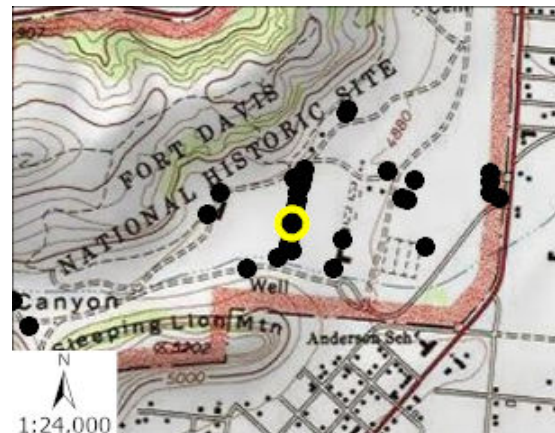

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-277 Kitchen For HB-12, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54201

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.98' **Long(WGS84):** -103° 53.5847'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.



FODA_54201_HB-277 Kitchen For HB-12, IA.jpg


Score: 31
Rating: Low

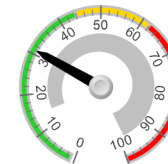


Asset Priority Index (API): 80



Factors Driving the Ratings

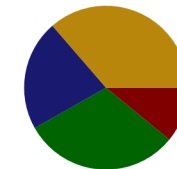

■ Access
■ Environment
■ Structure
■ Protection

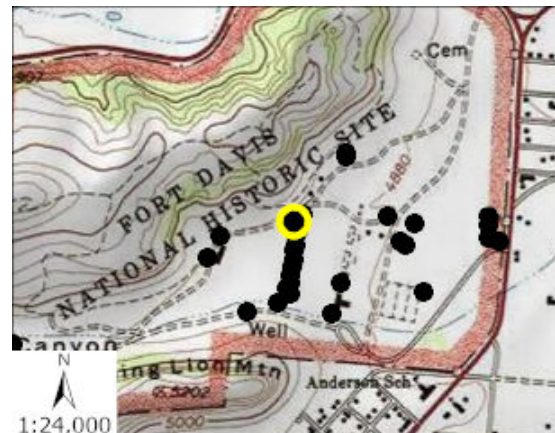

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-7 Commanding Officers Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54118

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9199' **Long(WGS84):** -103° 53.5841'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate



Asset Priority Index (API): 80

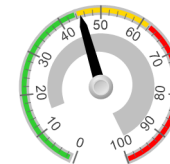

Factors Driving the Ratings

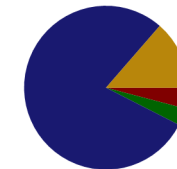

Access
Environment
Structure
Protection

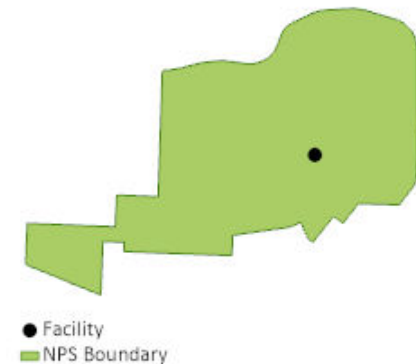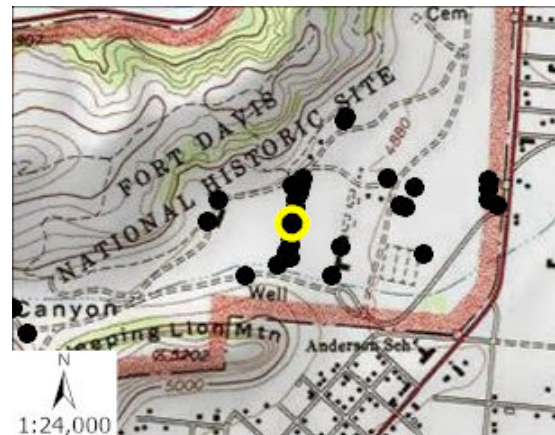



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-8 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54124

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9337' Long(WGS84): -103° 53.5823'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and fuels clearance

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area


Additional Obstacles: None

Triage Category:




Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 46
Rating: Moderate
Asset Priority Index (API): 80

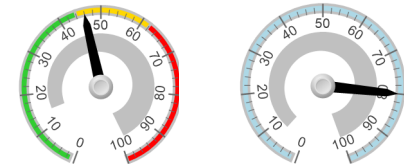

Factors Driving the Ratings

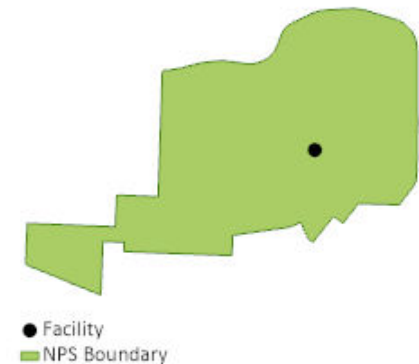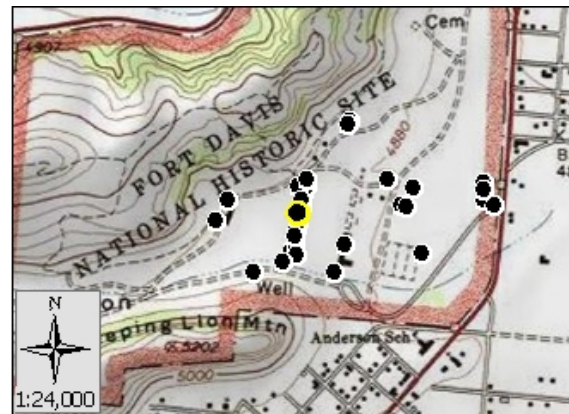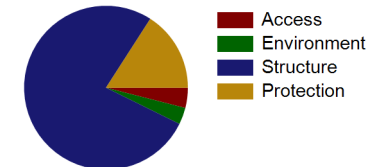



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-9 Captains Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54130

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9454' Long(WGS84): -103° 53.5788'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate


Asset Priority Index
(API):
80

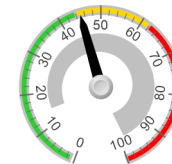

Factors Driving the Ratings

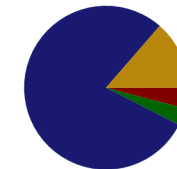

Access
Environment
Structure
Protection

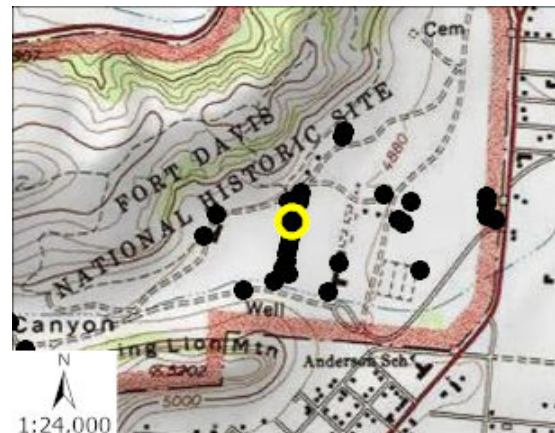

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-10 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54136

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9568' Long(WGS84): -103° 53.5767'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate



Asset Priority Index
(API):
80

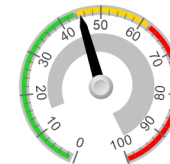

Factors Driving the Ratings

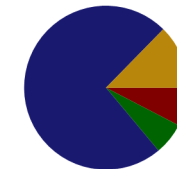

Access
Environment
Structure
Protection

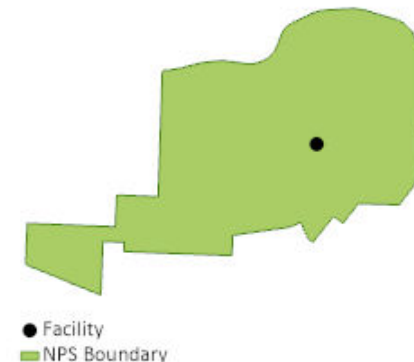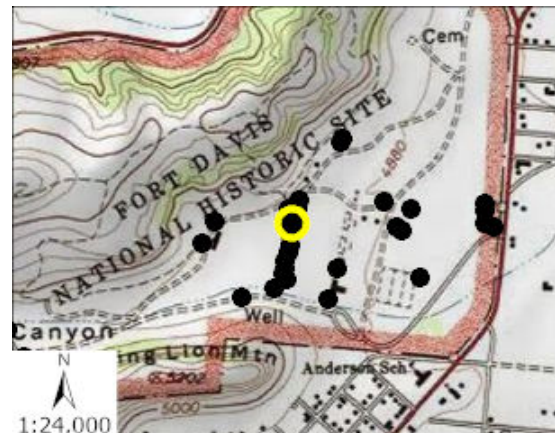



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-11 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54141

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9691' **Long(WGS84):** -103° 53.5721'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 45
Rating: Moderate


Asset Priority Index (API):
87

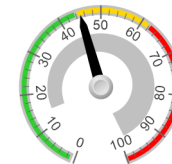

Factors Driving the Ratings

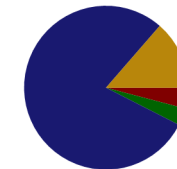

■ Access
■ Environment
■ Structure
■ Protection

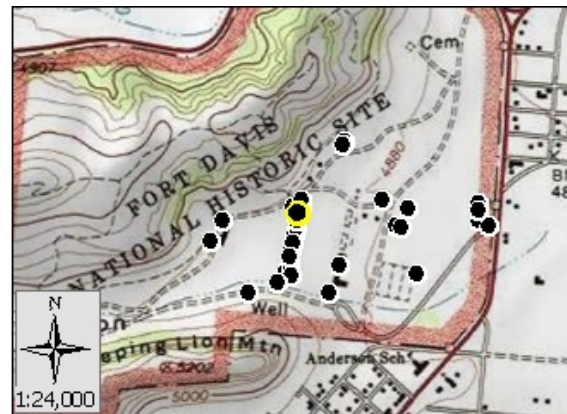

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-12 Captains Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54145

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9799' **Long(WGS84):** -103° 53.5685'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate. This structure is closer to the unmaintained portion of the park and would require extra attention in the event a fire were to threaten it.

Score: 57
Rating: Moderate


Asset Priority Index
(API):
80

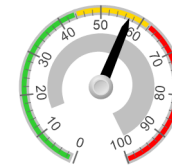

Factors Driving the Ratings

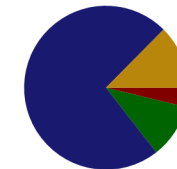

Access
Environment
Structure
Protection

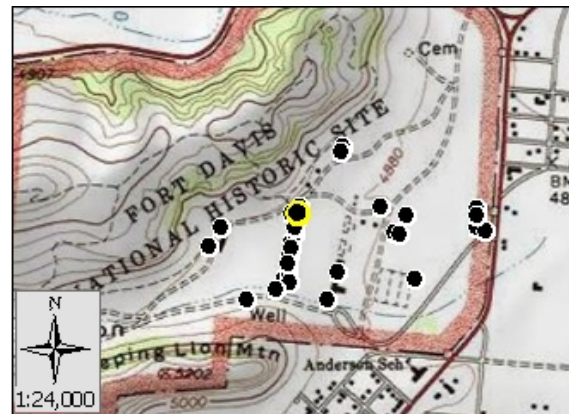

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-13 Lieutenants Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54151

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9931' **Long(WGS84):** -103° 53.5655'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.

Score: 57
Rating: Moderate



Asset Priority Index (API):
80

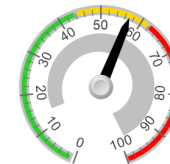

Factors Driving the Ratings

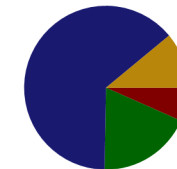

Access
Environment
Structure
Protection

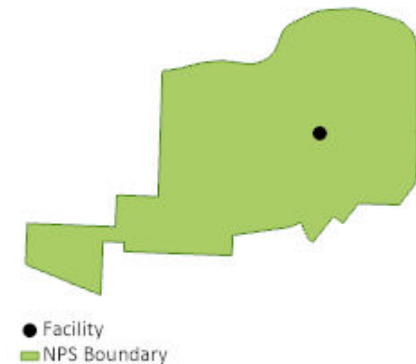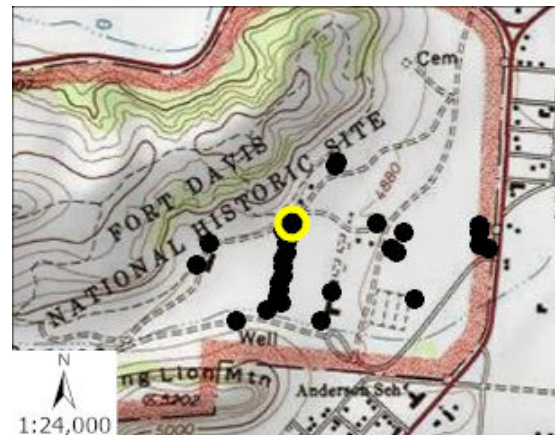



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB 20 Enlisted Mens Barracks IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54174

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8323' Long(WGS84): -103° 53.5109'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate. There are two fire hydrants adjacent to this structure.



FODA_54174_HB 20 Enlisted Mens Barracks IA.jpg


Score: 42
Rating: Low

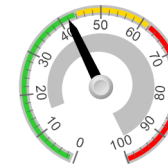


Asset Priority Index
(API):
100



Factors Driving the Ratings

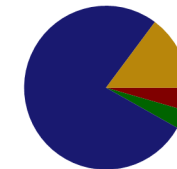

Access
Environment
Structure
Protection

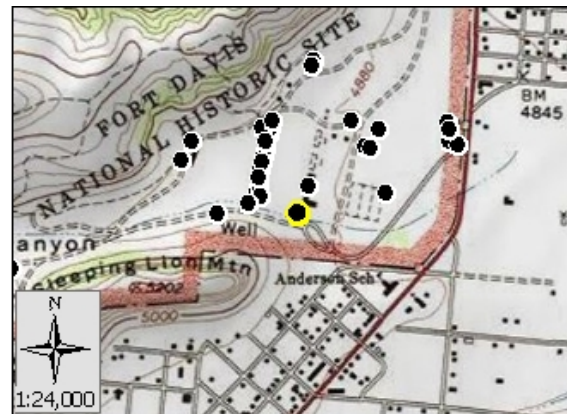

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-21 Enlisted Mens Barracks, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54177

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.8797' Long(WGS84): -103° 53.4917'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat: N/A


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.




FODA_54177_HB-21 Enlisted Mens Barracks, IA.jpg

Score: 45
Rating: Moderate


Asset Priority Index
(API):
87

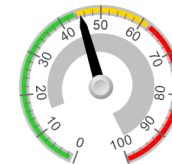

Factors Driving the Ratings

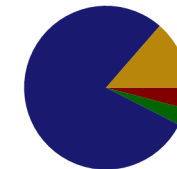

Access
Environment
Structure
Protection

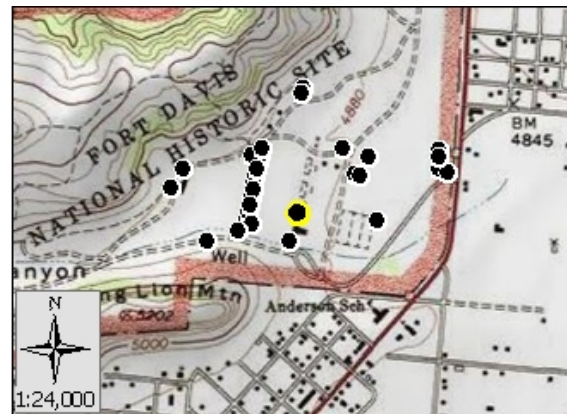

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-18 Officers/NCOs Quarters, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54163

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 36.0861' **Long(WGS84):** -103° 53.4857'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.




FODA_54163_HB-18 Officers NCOs Quarters, IA.jpg

Score: 57
Rating: Moderate



Asset Priority Index (API):
72

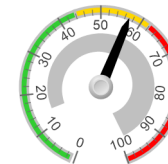

Factors Driving the Ratings

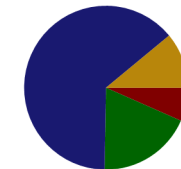

■ Access
■ Environment
■ Structure
■ Protection

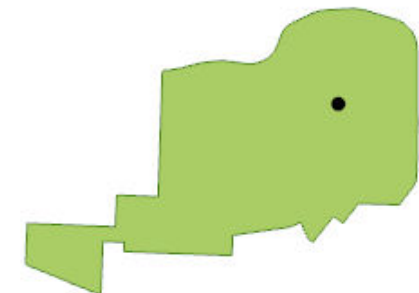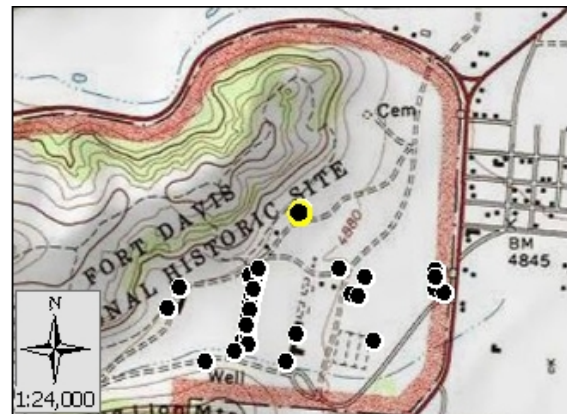

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-151 Kitchen For HB-18, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54199

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 36.0939' **Long(WGS84):** -103° 53.4821'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.




FODA_54199_HB-151 Kitchen For HB-18, IA.jpg


Score: 71
Rating: High

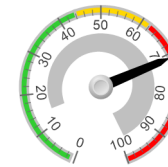


Asset Priority Index (API): 72

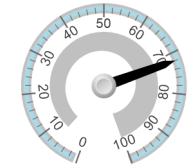

Factors Driving the Ratings

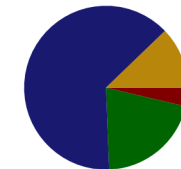

■ Access
■ Environment
■ Structure
■ Protection

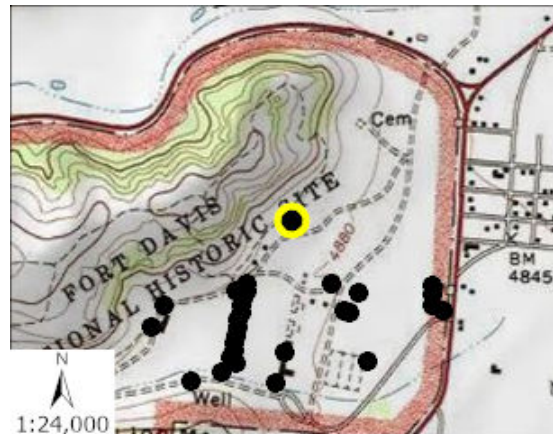

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-37 New Commissary Storehouse, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54183

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9919' **Long(WGS84):** -103° 53.4047'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.




FODA_54183_HB-37 New Commissary Storehouse, IA.jpg


Score: 45
Rating: Moderate

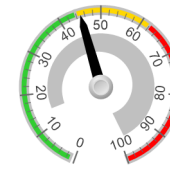


Asset Priority Index (API): 80

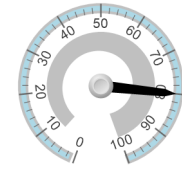

Factors Driving the Ratings

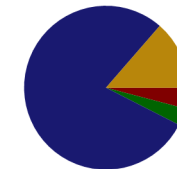

■ Access
■ Environment
■ Structure
■ Protection

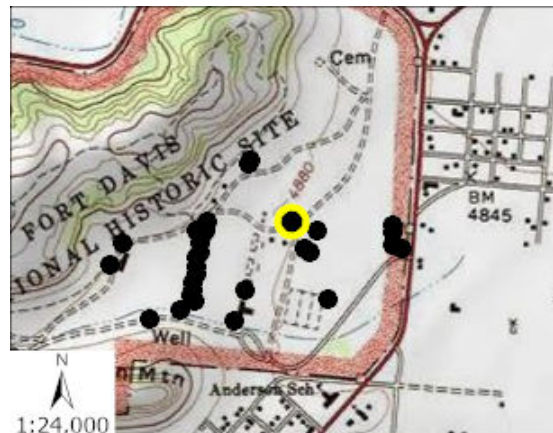

1:24,000



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Replica Stable Building (Located within HB-40 Footprint)

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54211

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9481' **Long(WGS84):** -103° 53.3795'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.



FODA_54211_Replica Stable Building (Located within HB-40 Footprint).jpg


Score: 51
Rating: Moderate

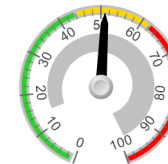


Asset Priority Index (API): 46



Factors Driving the Ratings

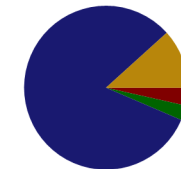

Access
Environment
Structure
Protection

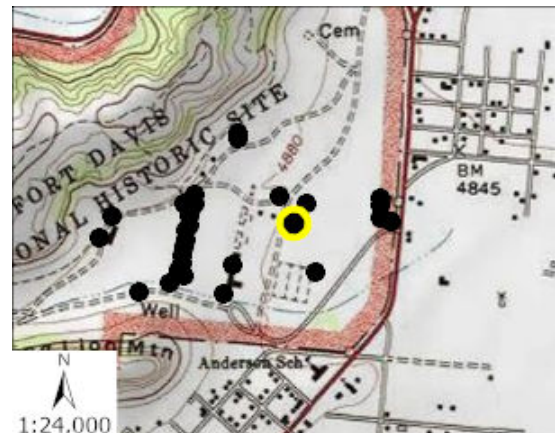

1:24,000



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Tack Building (1940's Building within HB-40)

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54209

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9451' **Long(WGS84):** -103° 53.3687'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.



FODA_54209_Tack Building (1940's Building within HB-40).jpg


Score: 44
Rating: Low

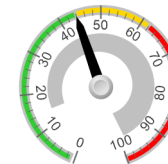


Asset Priority Index (API): 52



Factors Driving the Ratings

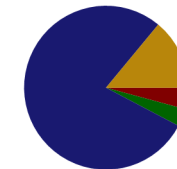

■ Access
■ Environment
■ Structure
■ Protection

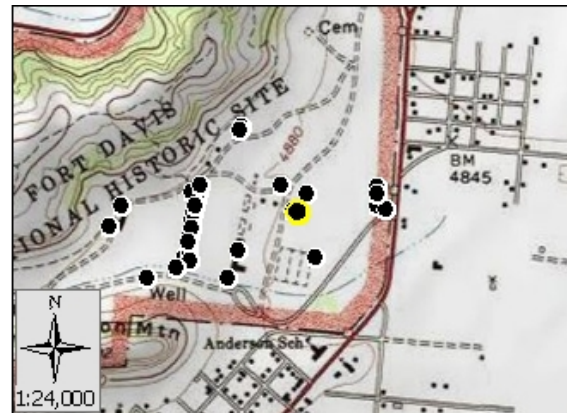

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-39 Forage House, IA

Unit - Location: FODA - Fort Davis Historic Site

FMSS ID: 54188

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: S Castillo

Last Site Visit Date: 2/12/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Officers Row and Barracks

Lat(WGS84): 30° 35.9781' Long(WGS84): -103° 53.3531'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Limited or dependent on electricity

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: This structure is a historical building surrounded by a well maintained lawn. Current maintenance practices are adequate.



FODA_54188_HB-39 Forage House, IA.jpg


Score: 42
Rating: Low

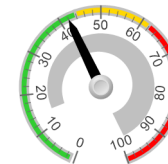


Asset Priority Index
(API):
76



Factors Driving the Ratings

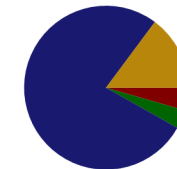

Access
Environment
Structure
Protection

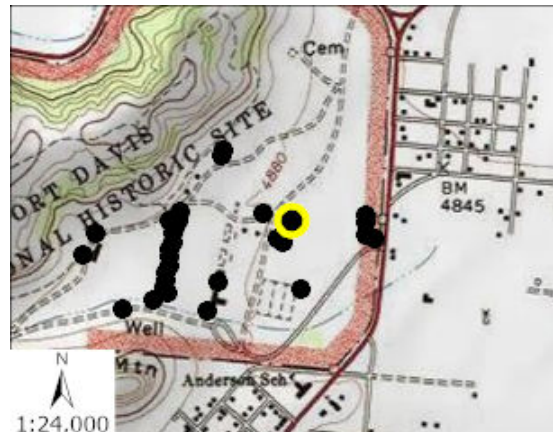

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HB-41 Childs Building, IA

Unit - Location: FODA - Fort Davis Historic Site
FMSS ID: 54991
Structure Type: CulturalResource
Structure Use: Public
Owner: NPS
Field Crew: S Castillo
Last Site Visit Date: 2/12/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Officers Row and Barracks
Lat(WGS84): 30° 35.8671' **Long(WGS84):** -103° 53.3363'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: >100ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



FODA_54991_HB-41 Childs Building, IA.jpg



Score: 19
Rating: Low

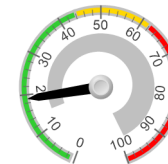

Asset Priority Index (API): 37



Factors Driving the Ratings

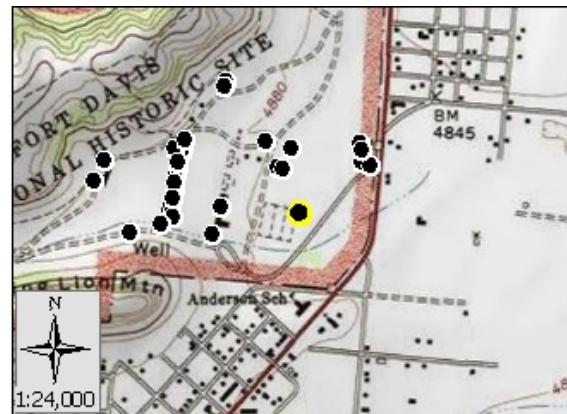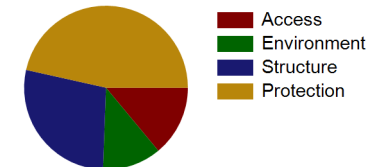

● Facility
 ■ NPS Boundary

