


NPS Wildfire Risk Assessments Assessment Locations

John Day Fossil Beds National Monument

National Park Service
U.S. Department of the Interior

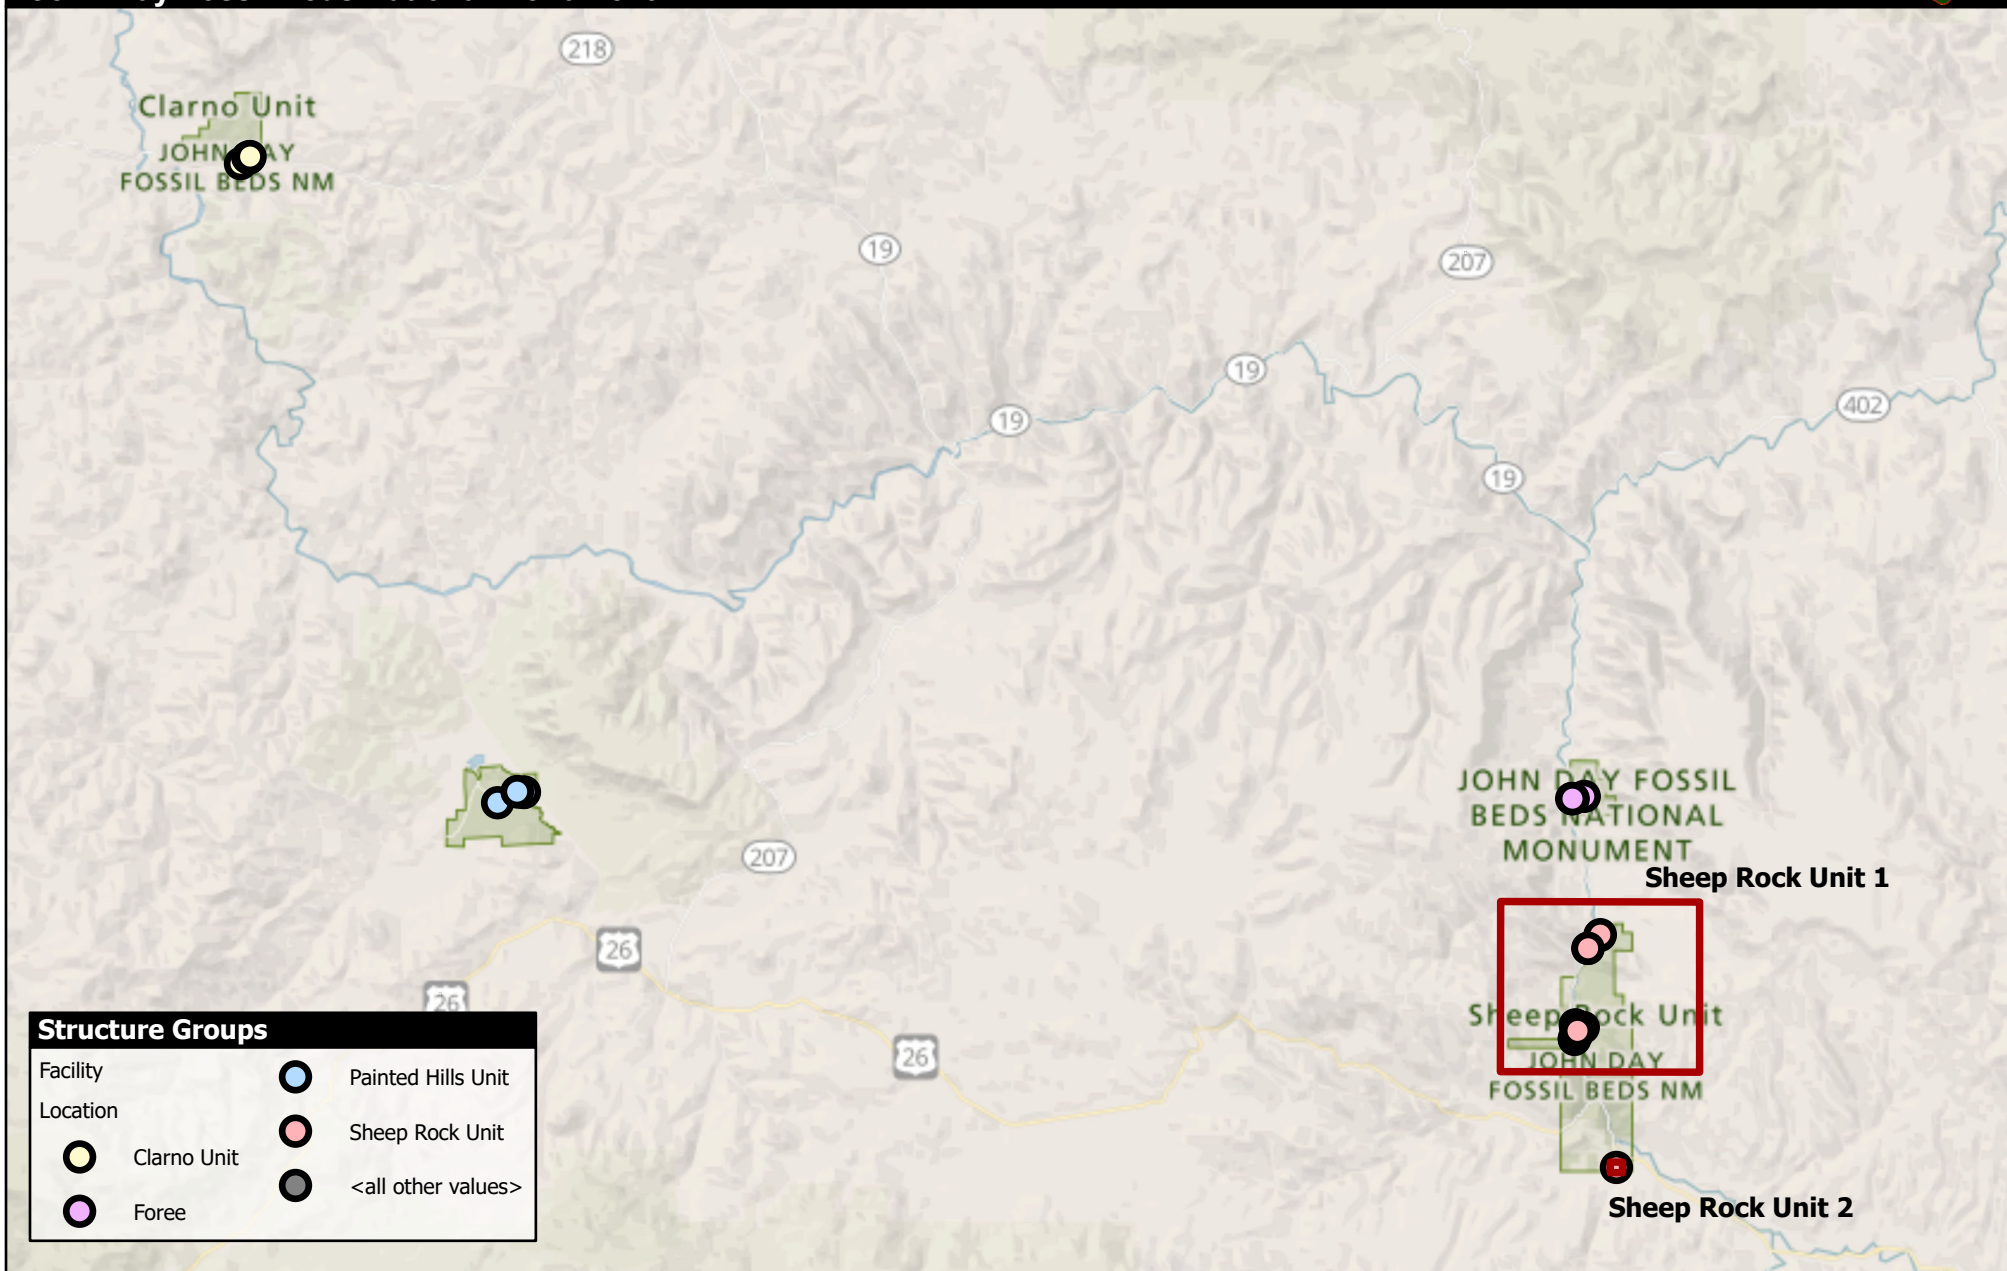

Structure Groups

Facility		Painted Hills Unit
Location		Clarno Unit
		Sheep Rock Unit
		Foree
		<all other values>



0 15 30 Miles

Author: sszturm
9/7/2022 9:37 AM


Intermountain Region Geographic Resources Division
February 2018
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project


Clarno Unit

JODA - John Day Fossil Beds National Monument

National Park Service
U.S. Department of the Interior

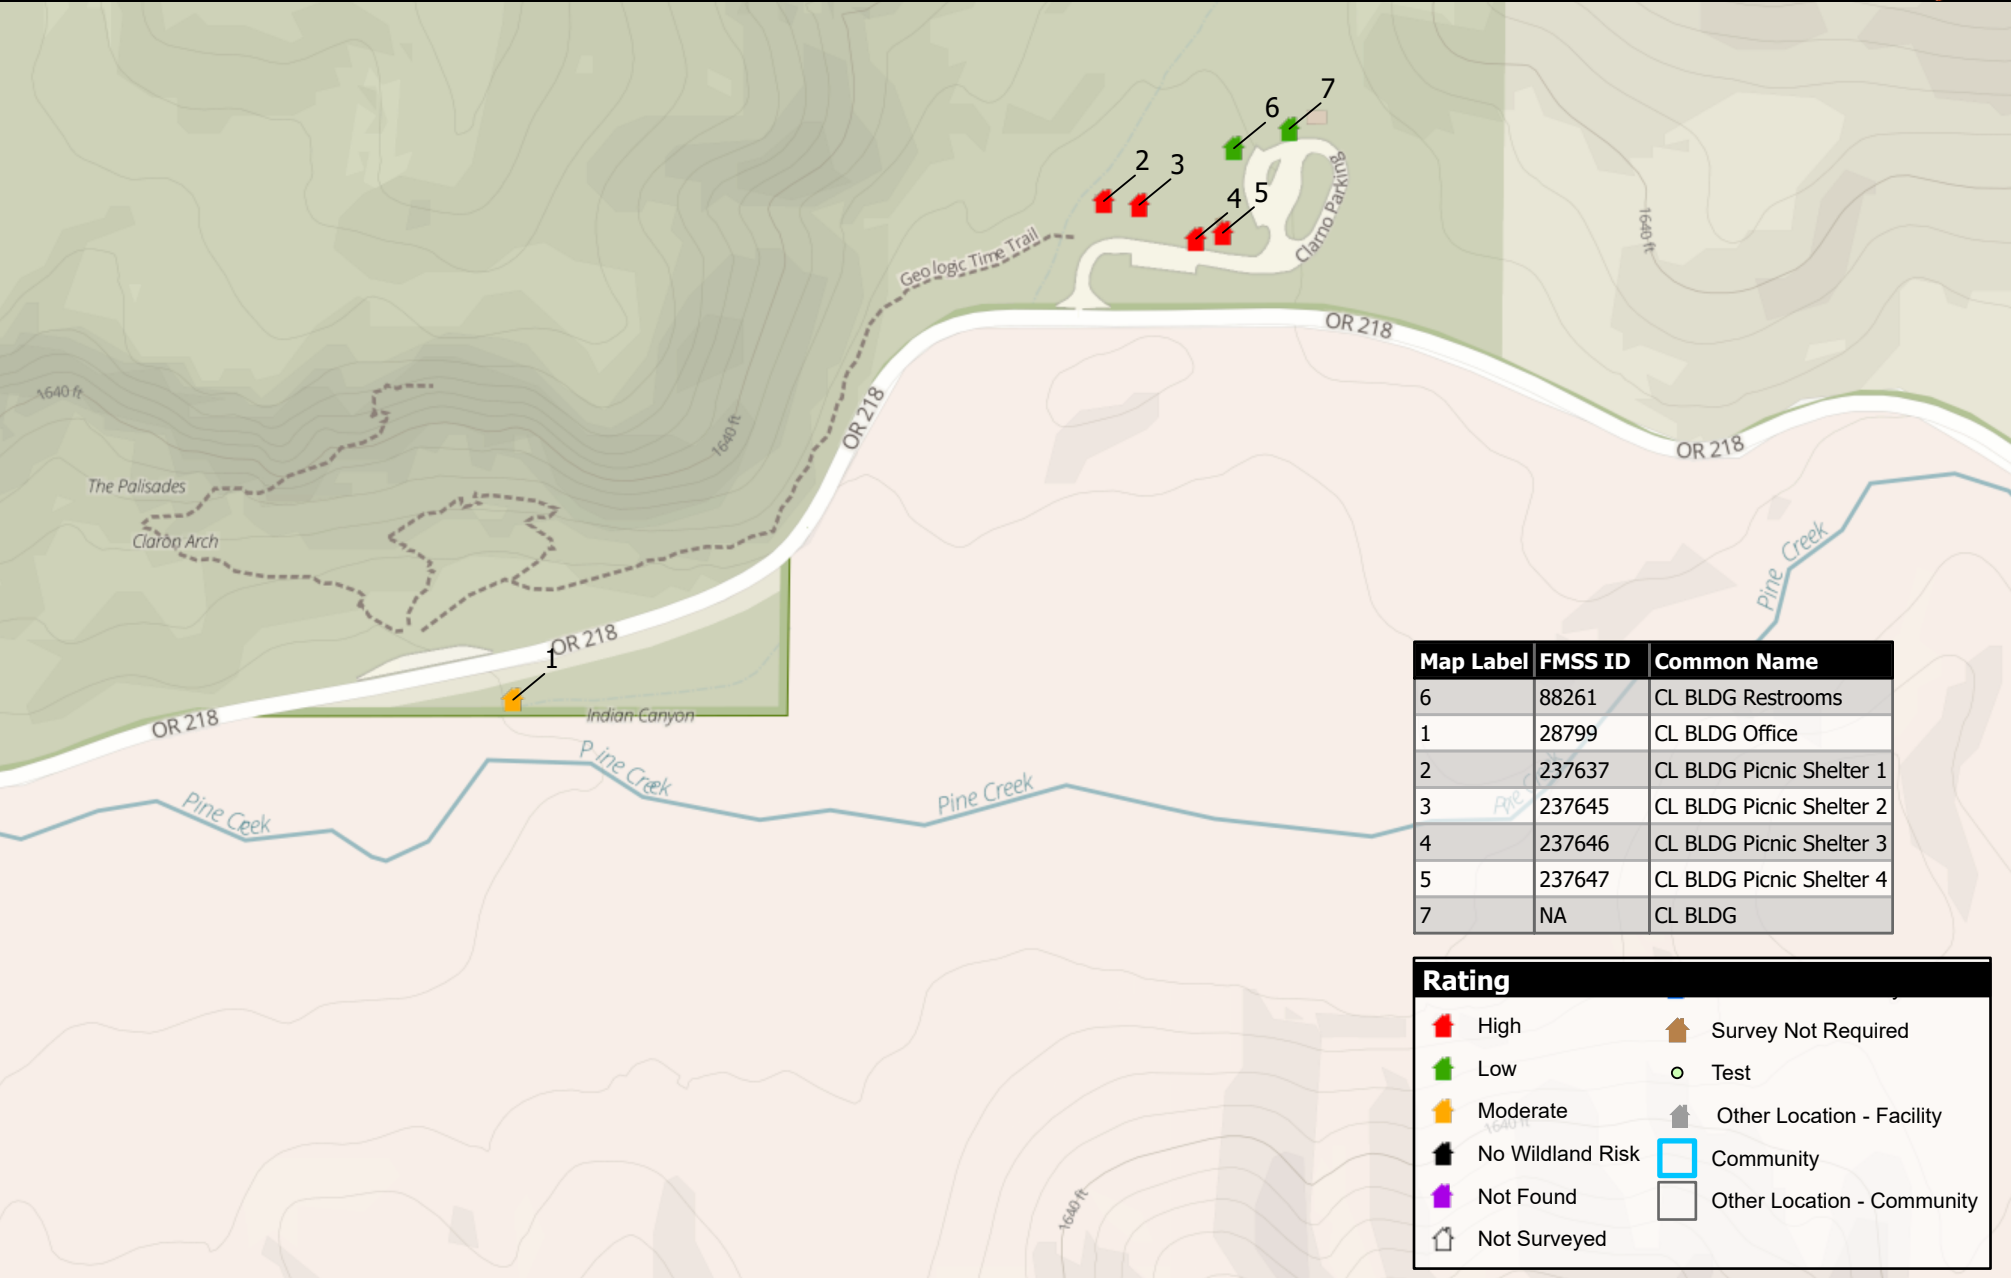

Author: sszturm
9/7/2022 9:16 AM



NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: CL BLDG Office


Unit - Location: JODA - Clarno Unit
FMSS ID: 28799
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Szturm
Last Site Visit Date: 7/25/2022

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? Yes - Clarno
Lat(WGS84): 44° 54.6765' **Long(WGS84):** -120° 24.8907'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Open or deck
Fences/Decks: Combustible but separated from facility
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: None visible
Assessment Comments:




2022_JODA_28799_CL BLDG Office_Front.jpg

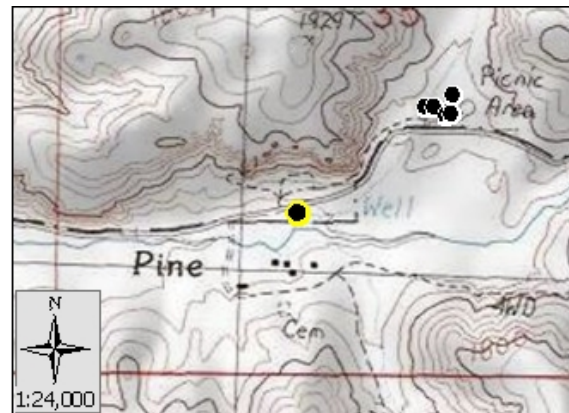

Score: 50
Rating: Moderate
Asset Priority Index (API): 92

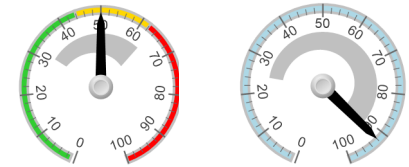

Factors Driving the Ratings

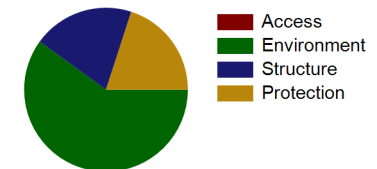



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: CL BLDG Picnic Shelter 1


Unit - Location: JODA - Clarno Unit
FMSS ID: 237637
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: Szturm
Last Site Visit Date: 7/26/2022

Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Clarno
Lat(WGS84): 44° 54.8275' **Long(WGS84):** -120° 24.638'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: None
Assessment Comments:




2022_JODA_237637_CL BLDG Picnic Shelter 1_Front.jpg

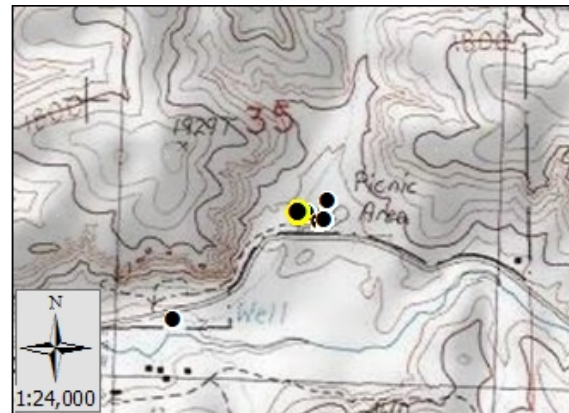


Score: 63
Rating: High

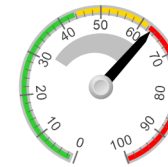

Asset Priority Index (API): 25

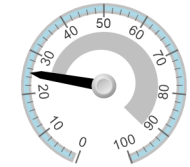

Factors Driving the Ratings

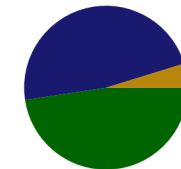

Access
Environment
Structure
Protection



● Facility

■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: CL BLDG Picnic Shelter 2


Unit - Location: JODA - Clarno Unit
FMSS ID: 237645
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: Szturm
Last Site Visit Date: 8/11/2022

Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Clarno
Lat(WGS84): 44° 54.8264' **Long(WGS84):** -120° 24.6228'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: None
Assessment Comments:




2022_JODA_237645_CL BLDG Picnic Shelter 2_Front.jpg

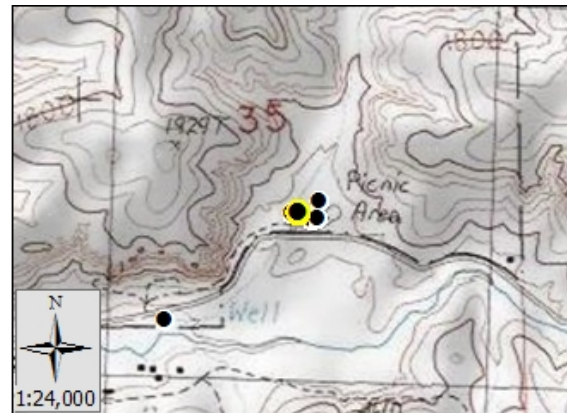


Score: 63
Rating: High

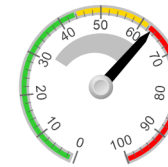

Asset Priority Index (API): 25

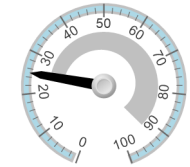

Factors Driving the Ratings

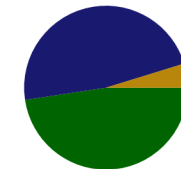

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: CL BLDG Picnic Shelter 3

Unit - Location: JODA - Clarno Unit

FMSS ID: 237646

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: Szturm

Last Site Visit Date: 7/26/2022

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Clarno

Lat(WGS84): 44° 54.8161' Long(WGS84): -120° 24.5986'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat: None


Assessment Comments:




2022_JODA_237646_CL BLDG Picnic Shelter 3_Front.jpg

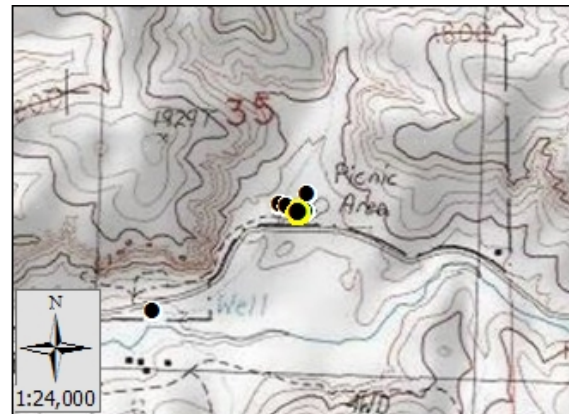


Score: 63
Rating: High

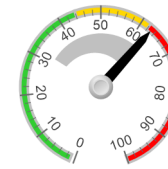

Asset Priority Index
(API):
25

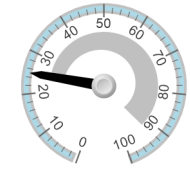

Factors Driving the Ratings

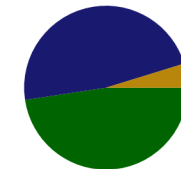

Access
Environment
Structure
Protection



● Facility

■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: CL BLDG Picnic Shelter 4

Unit - Location: JODA - Clarno Unit
FMSS ID: 237647
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: Szturm
Last Site Visit Date: 7/26/2022


Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Clarno
Lat(WGS84): 44° 54.8179' **Long(WGS84):** -120° 24.5871'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: None
Assessment Comments:




2022_JODA_237647_CL BLDG Picnic Shelter 4_Front.jpg


Score: 63
Rating: High

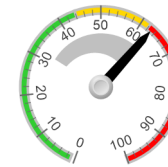


Asset Priority Index (API): 25

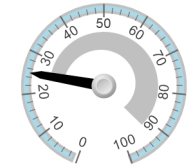

Factors Driving the Ratings

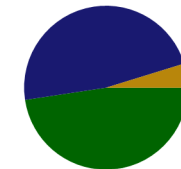

■ Access
■ Environment
■ Structure
■ Protection

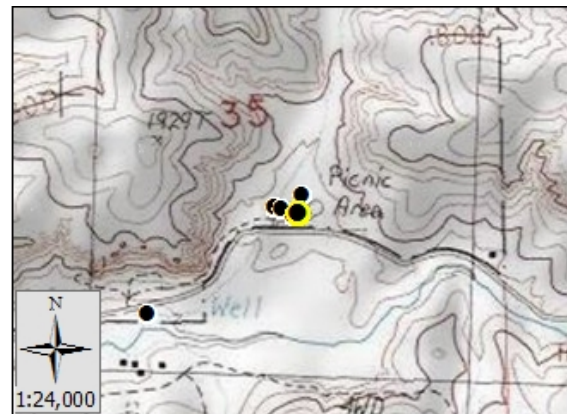

● Facility

■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: CL BLDG

Unit - Location: JODA - Clarno Unit

FMSS ID: NA

Structure Type: Building

Structure Use: Unknown

Owner: NPS

Field Crew: Szturm

Last Site Visit Date: 7/25/2022

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Clarno

Lat(WGS84): 44° 54.8494' **Long(WGS84):** -120° 24.5586'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat: None

Assessment Comments:



2022_JODA_88261_CL BLDG Restrooms_Front.jpg


Score: 38
Rating: Low

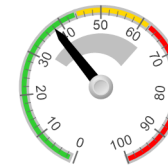

Asset Priority Index (API):
N/A



Factors Driving the Ratings

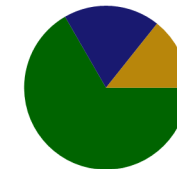

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: JODA - Clarno Unit

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
1	CL BLDG Office	NPS	28799	Building	Admin	Y	7/25/22	Unknown	50	Moderate	Not Designated		UNR
2	CL BLDG Picnic Shelter 1	NPS	237637	Shade	Public	N	7/26/22	Unknown	63	High	Not Designated		UNR
3	CL BLDG Picnic Shelter 2	NPS	237645	Shade	Public	N	8/11/22	Unknown	63	High	Not Designated		UNR
4	CL BLDG Picnic Shelter 3	NPS	237646	Shade	Public	N	7/26/22	Unknown	63	High	Not Designated		UNR
5	CL BLDG Picnic Shelter 4	NPS	237647	Shade	Public	N	7/26/22	Unknown	63	High	Not Designated		UNR
6	CL BLDG Restrooms	NPS	88261	Toilet	Public	N	7/25/22	Unknown	32	Low	Not Designated		UNR
6	CL BLDG	NPS	NA	Building	Unknown	N	7/25/22	Unknown	38	Low	Not Designated		UNR



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: John Day Fossil Beds National Monument - Clarno Unit

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
0	Clarno	Community	NULL	911 response, engine(s) on scene, NPS assistance -	40.0	-	
				Fuels reduction -	40.0	-	
1	CL BLDG Office	Facility In Community (Clarno)	PrepLeave	Engine on scene - One engine could patrol this area and the picnic area.	6.0	-	
				911 response, engine(s) on scene, NPS assistance -	40.0	-	
				Fuels reduction -	40.0	-	
2	CL BLDG Picnic Shelter 1	Facility In Community (Clarno)	PrepLeave	-		-	
3	CL BLDG Picnic Shelter 2	Facility In Community (Clarno)	PrepLeave	-		-	
4	CL BLDG Picnic Shelter 3	Facility In Community (Clarno)	PrepLeave	-		-	
				-		-	
5	CL BLDG Picnic Shelter 4	Facility In Community (Clarno)	PrepLeave	-		-	
6	CL BLDG	Facility In Community (Clarno)	Standalone	-		-	
						-	



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: JODA - Clarno Unit

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours	Date
0	Clarno	Community	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		10.0	8/16/22
		Community	Initial	2	Flammable ground cover should be removed or isolated		15.0	8/16/22
		Community	Initial	3	Remove heavy ground fuels such as logs and stumps		15.0	8/16/22
1	CL BLDG Office	Facility In Community (Clarno)	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		5.0	8/16/22
		Facility In Community (Clarno)	Initial	1	Mow dead/dying grass to less than 4 inches		1.0	8/16/22
		Facility In Community (Clarno)	Initial	2	Flammable ground cover should be removed or isolated		10.0	8/16/22
		Facility In Community (Clarno)	Initial	3	Remove heavy ground fuels such as logs and stumps		10.0	8/16/22
2	CL BLDG Picnic Shelter 1	Facility In Community (Clarno)						



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

3	CL BLDG Picnic Shelter 2	Facility In Community (Clarno)						
4	CL BLDG Picnic Shelter 3	Facility In Community (Clarno)						8/16/22
		Facility In Community (Clarno)						8/16/22
5	CL BLDG Picnic Shelter 4	Facility In Community (Clarno)						
6	CL BLDG	Facility In Community (Clarno)						
6	CL BLDG Restrooms	Facility In Community (Clarno)						