


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



REDW- Redwoods National and State Parks Overview

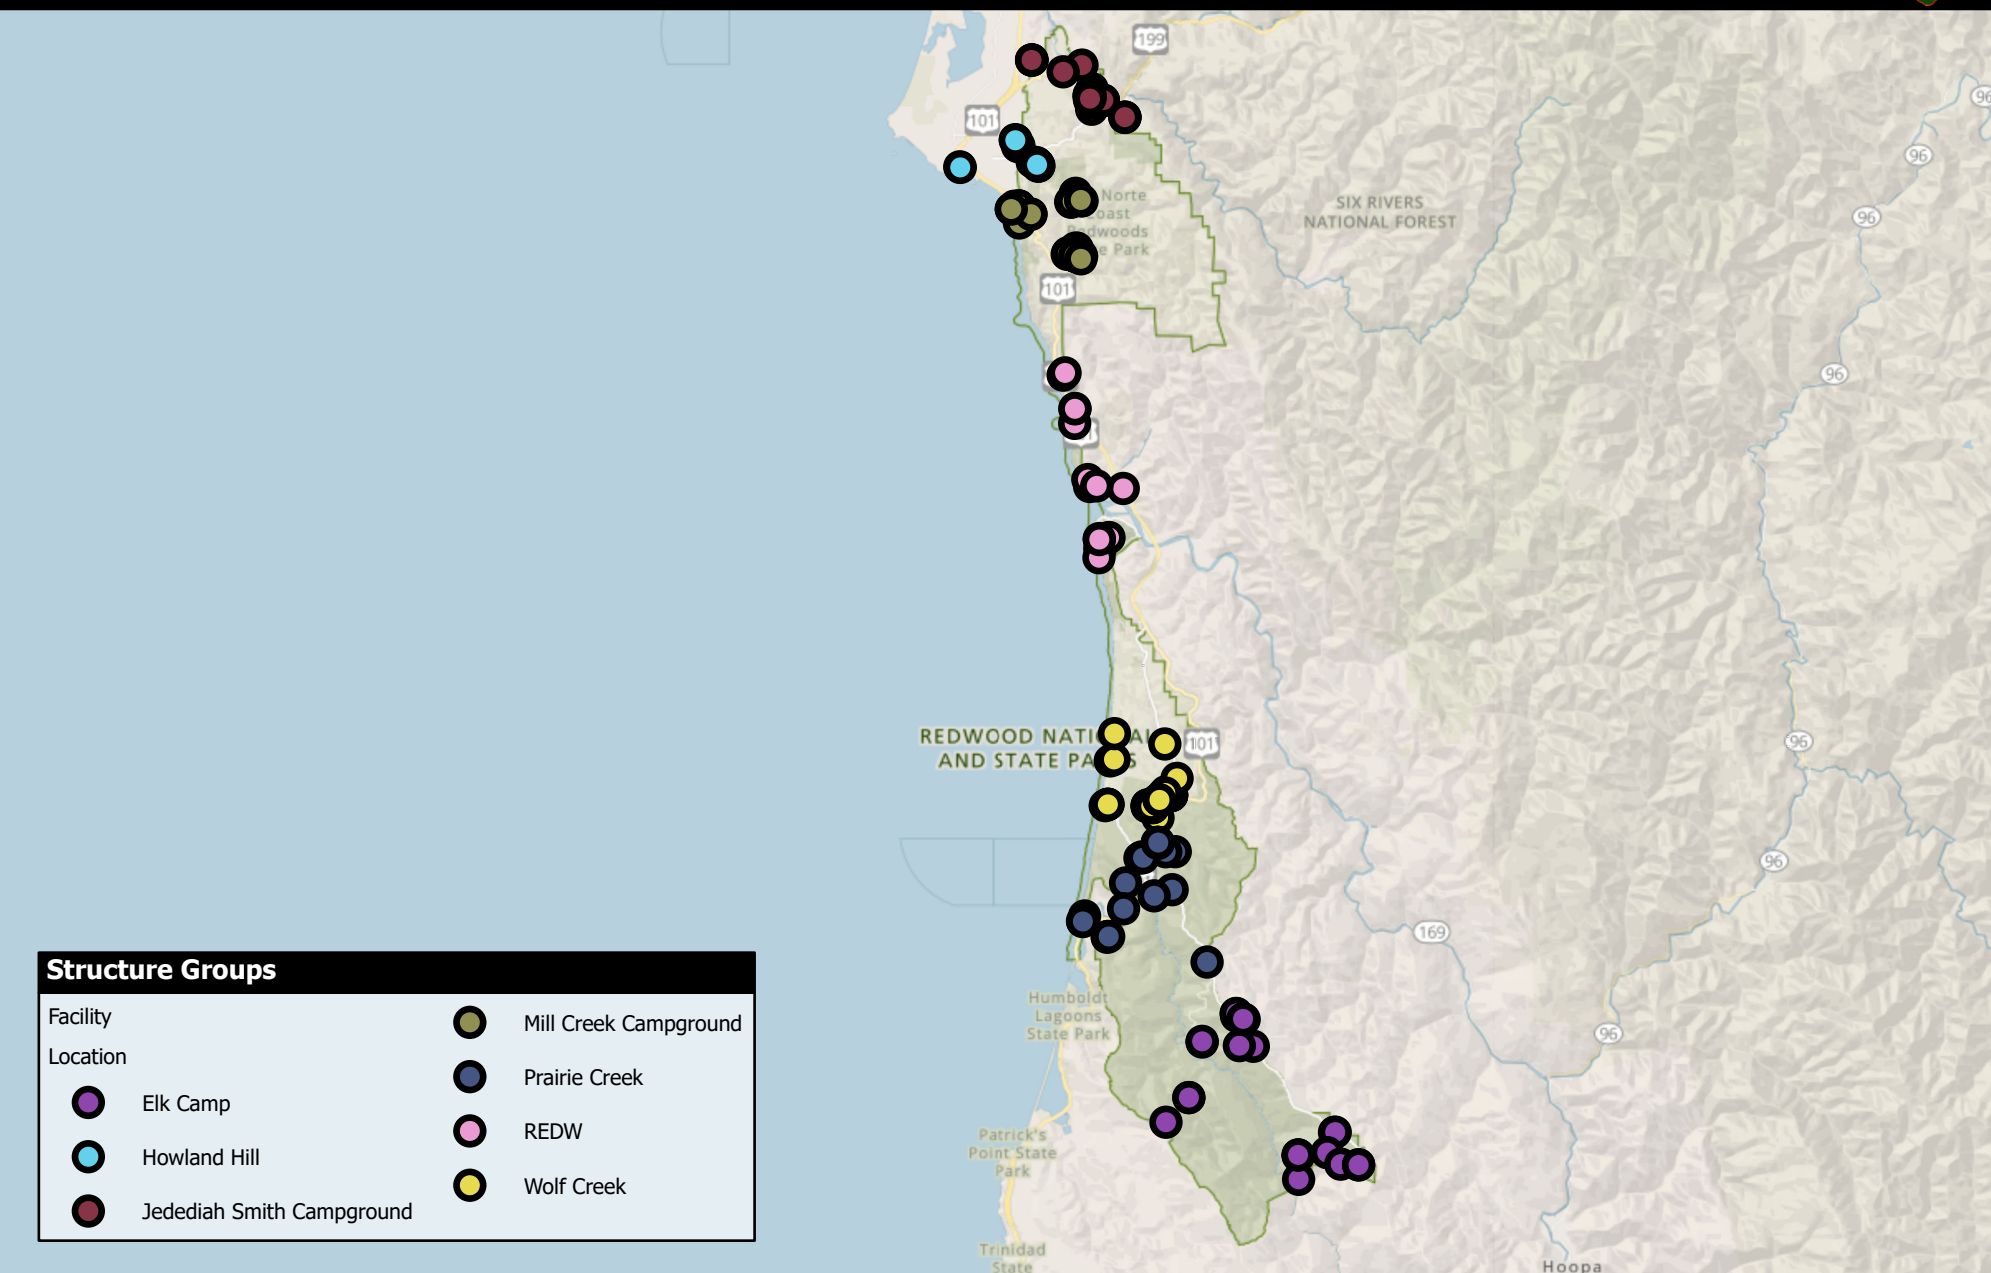

Structure Groups

Facility		Mill Creek Campground	
Location		Prairie Creek	
	Elk Camp		REDW
	Howland Hill		Wolf Creek
	Jedediah Smith Campground		



0 3 6
Miles

Author: sszturm
5/1/2023 2:07 PM

Intermountain Region Geographic Resources Division
April 2023
Data Sources: ESRI Basedata, NPS Park Data


NPS Wildfire Risk Assessment Project

NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



REDW- Elk Camp Overview

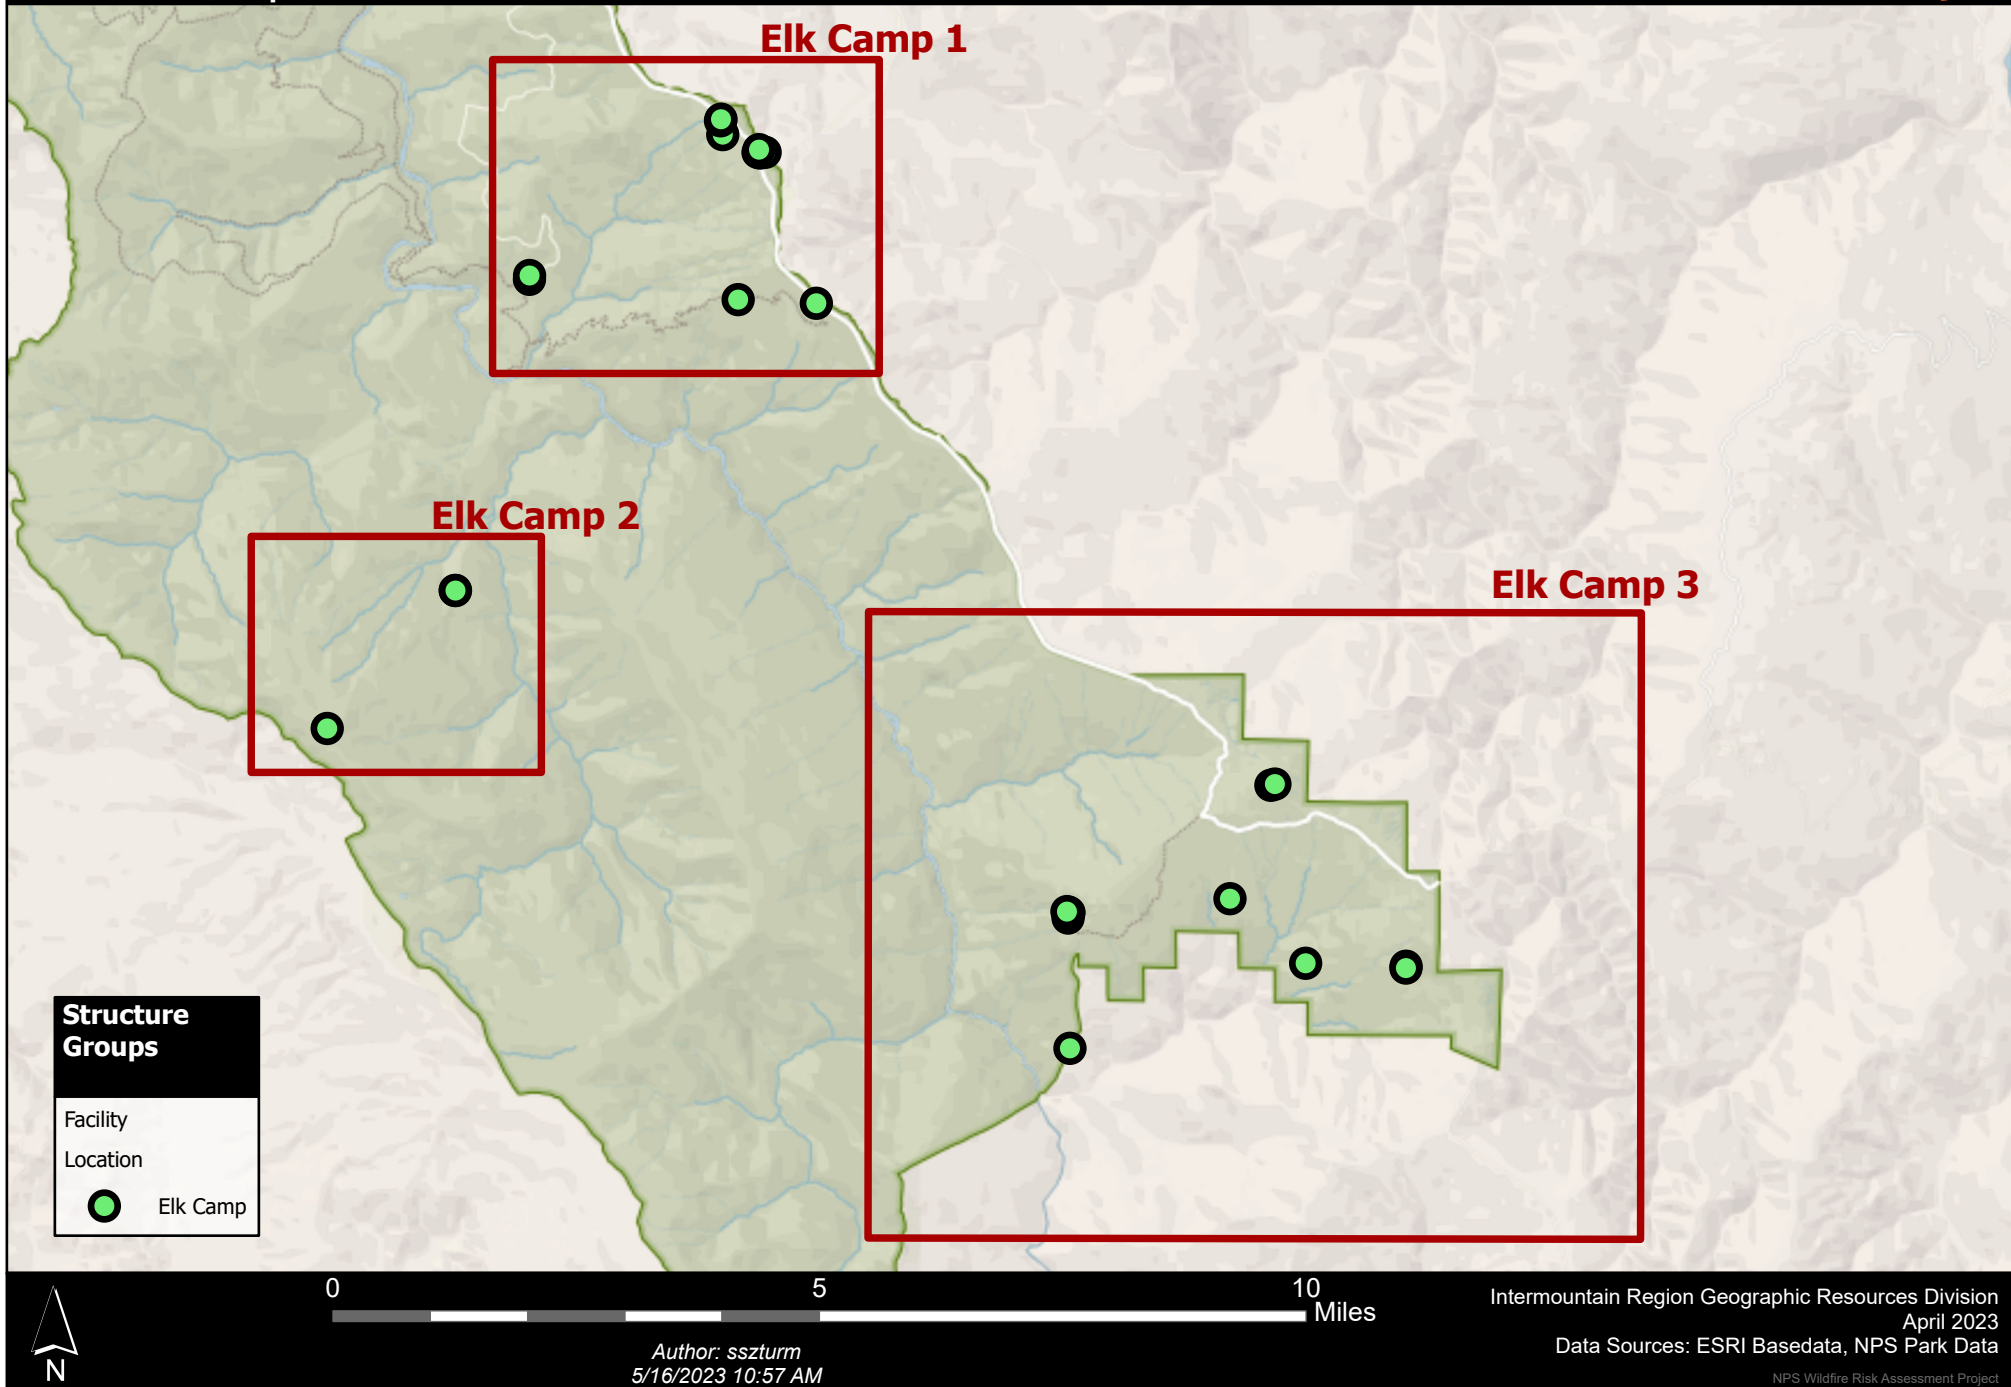

Elk Camp 1

REDW - Redwood National Park and State Parks


National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
233	11097	Dolason Vault Toilet VT-12, 6720
234		Tall Trees Grove Sheltered Waiting Area
235	11134	Elk Camp / Lane Ranch Residence, 6700
236	11108	Dolason Barn, LCS# 21070
240	NA	Elk Camp CDF- Fueling Station
241	NA	Elk Camp CDF - 3 Bay Garage
242	NA	Elk Camp CDF Station House
252	NA	Elk Camp CDF - Pumphouse
253	NA	Elk Camp CDF - Kitchen
254	11087	Tall Trees Vault Toilet VT-10, 6416

Rating

Rating	Private - Not Surveyed
High	Survey Not Required
Low	Test
Moderate	Other Location - Facility
No Wildland Risk	Community
Not Found	Other Location - Community
Not Surveyed	

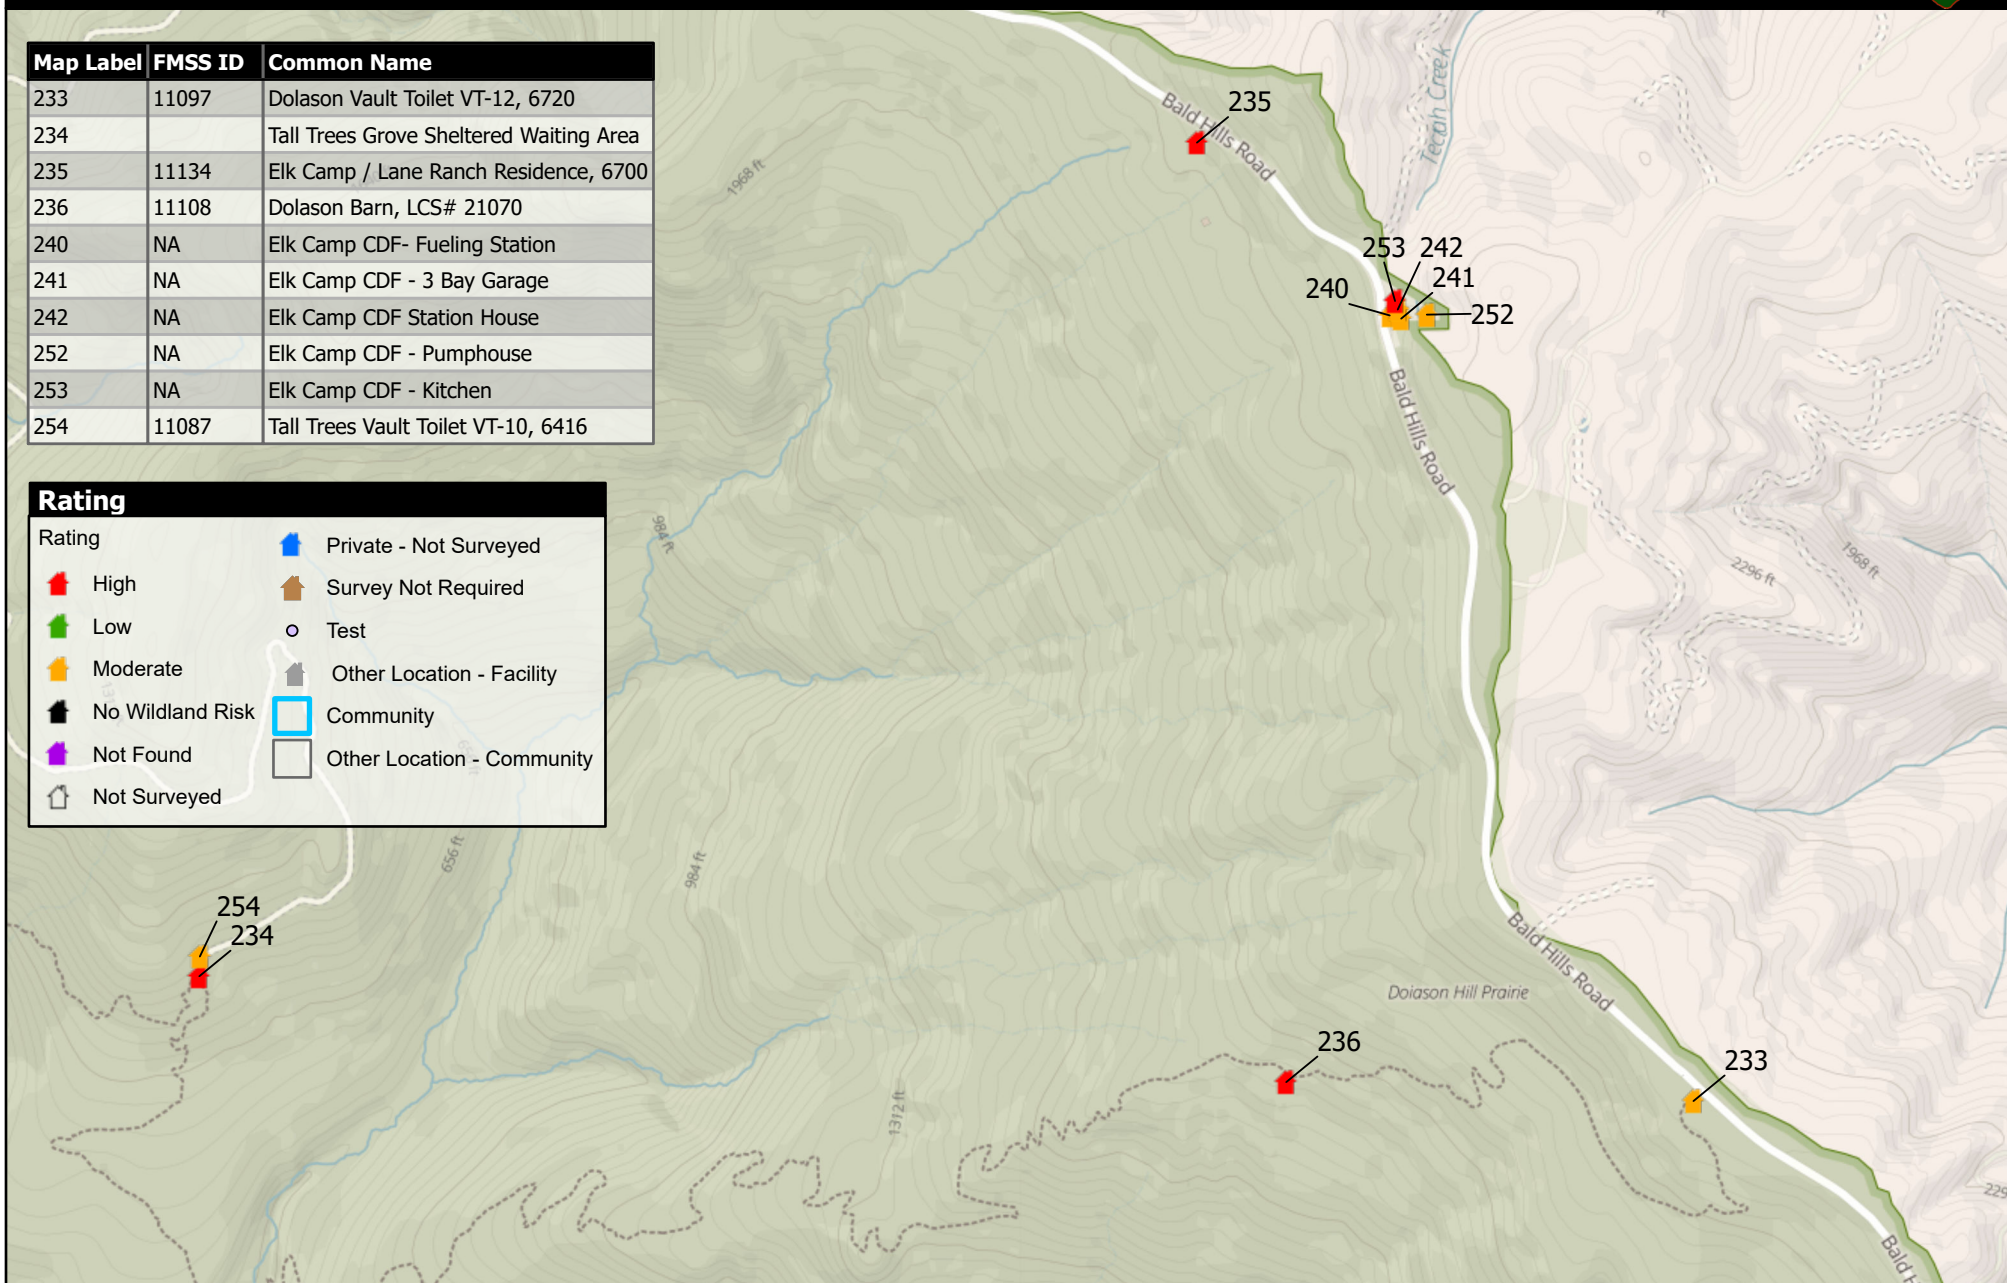

Author: sszturm
5/16/2023 11:15 AM


0 0.25 0.5 0.75 1 Miles

Scale: 1:24,000


NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project

Elk Camp 2

REDW - Redwood National Park and State Parks

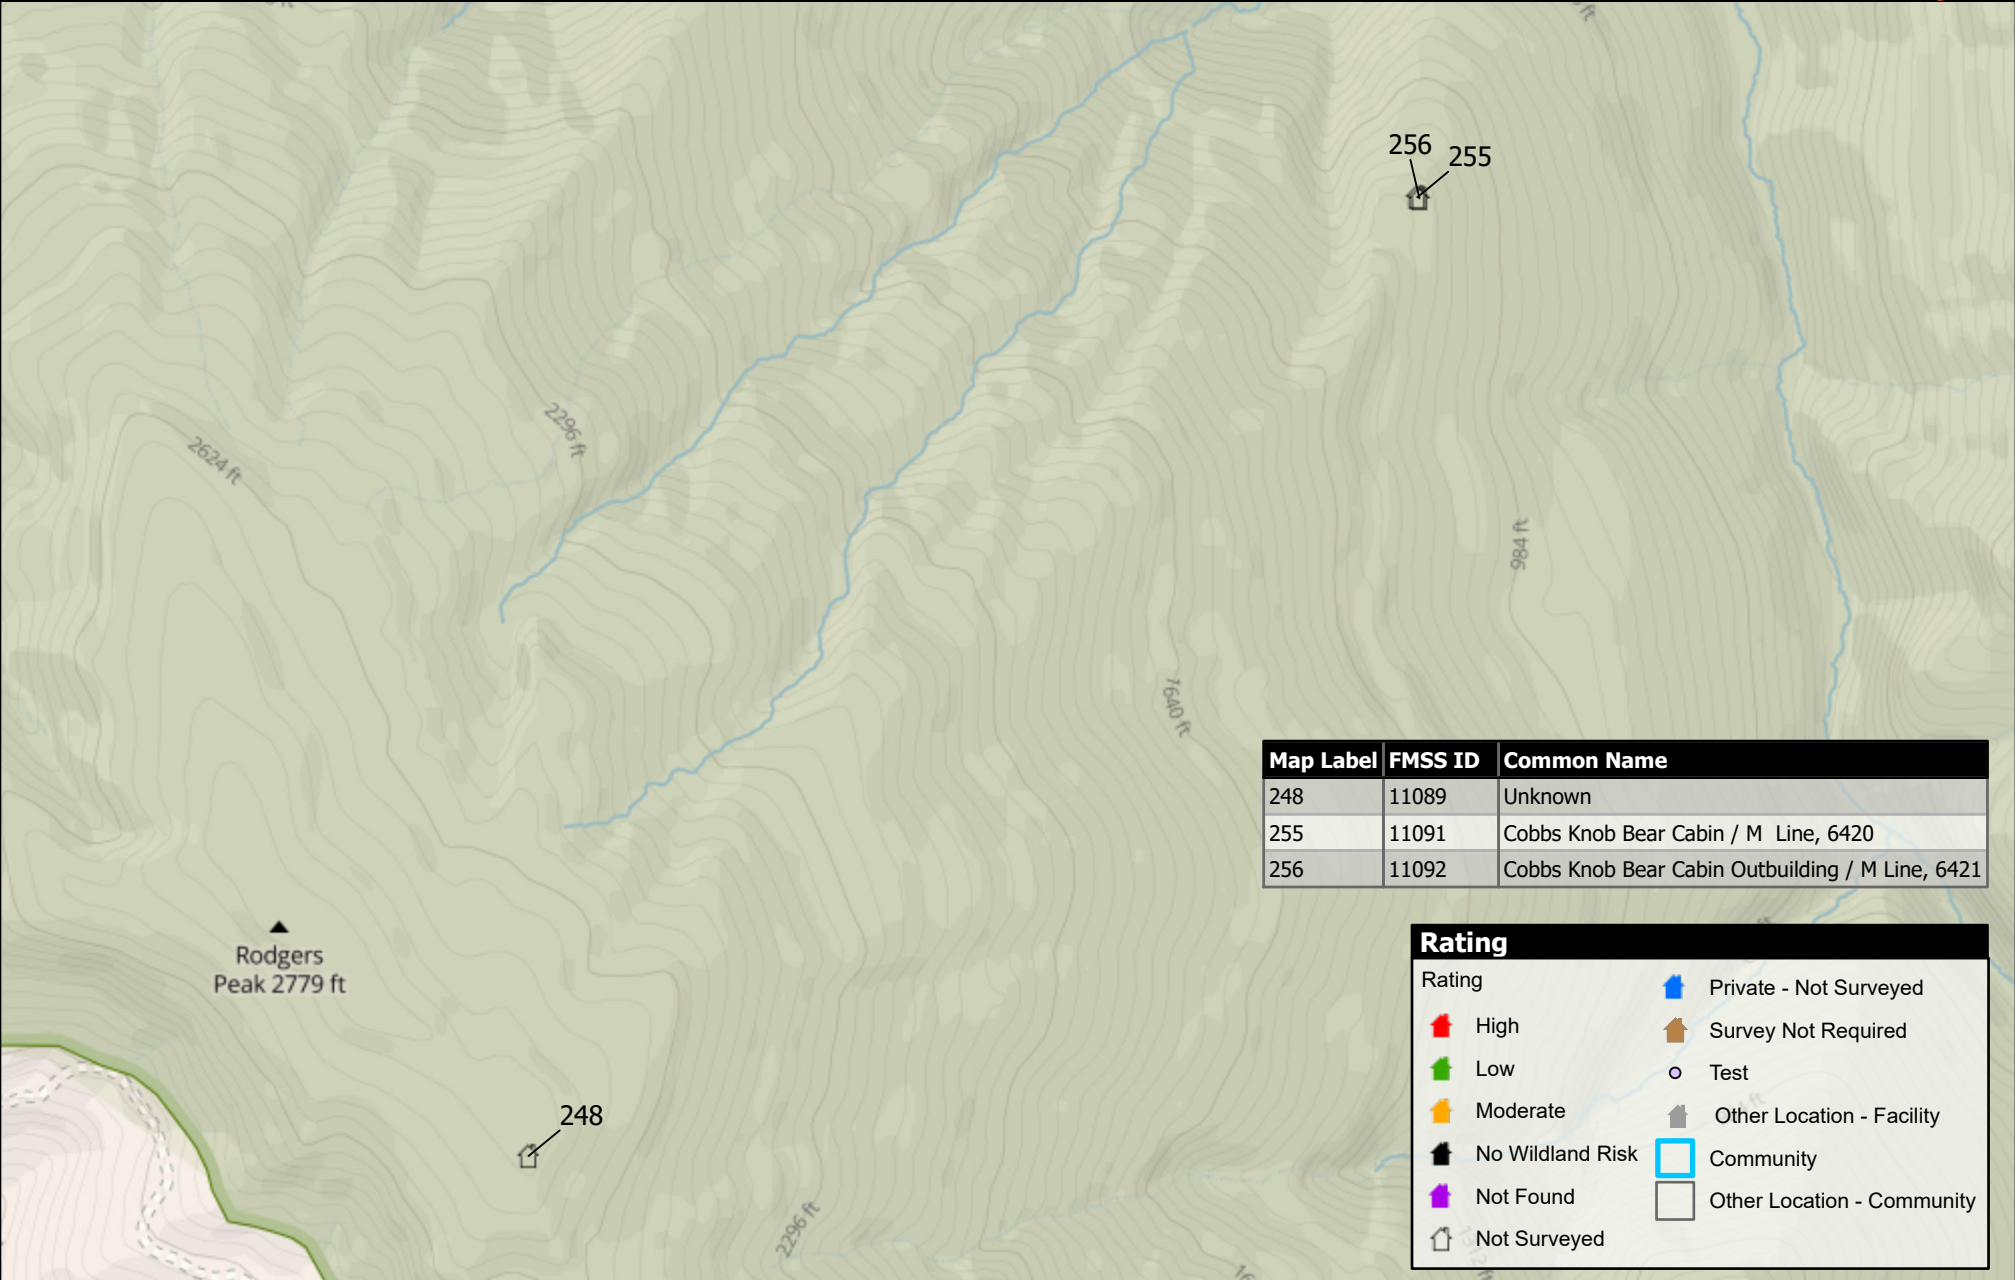

Author: sszturm
5/16/2023 11:22 AM



Elk Camp 3


REDW - Redwood National Park and State Parks

National Park Service
U.S. Department of the Interior



Rating

- | | |
|------------------|----------------------------|
| Rating | Private - Not Surveyed |
| High | Survey Not Required |
| Low | Test |
| Moderate | Other Location - Facility |
| No Wildland Risk | Community |
| Not Found | Other Location - Community |
| Not Surveyed | |

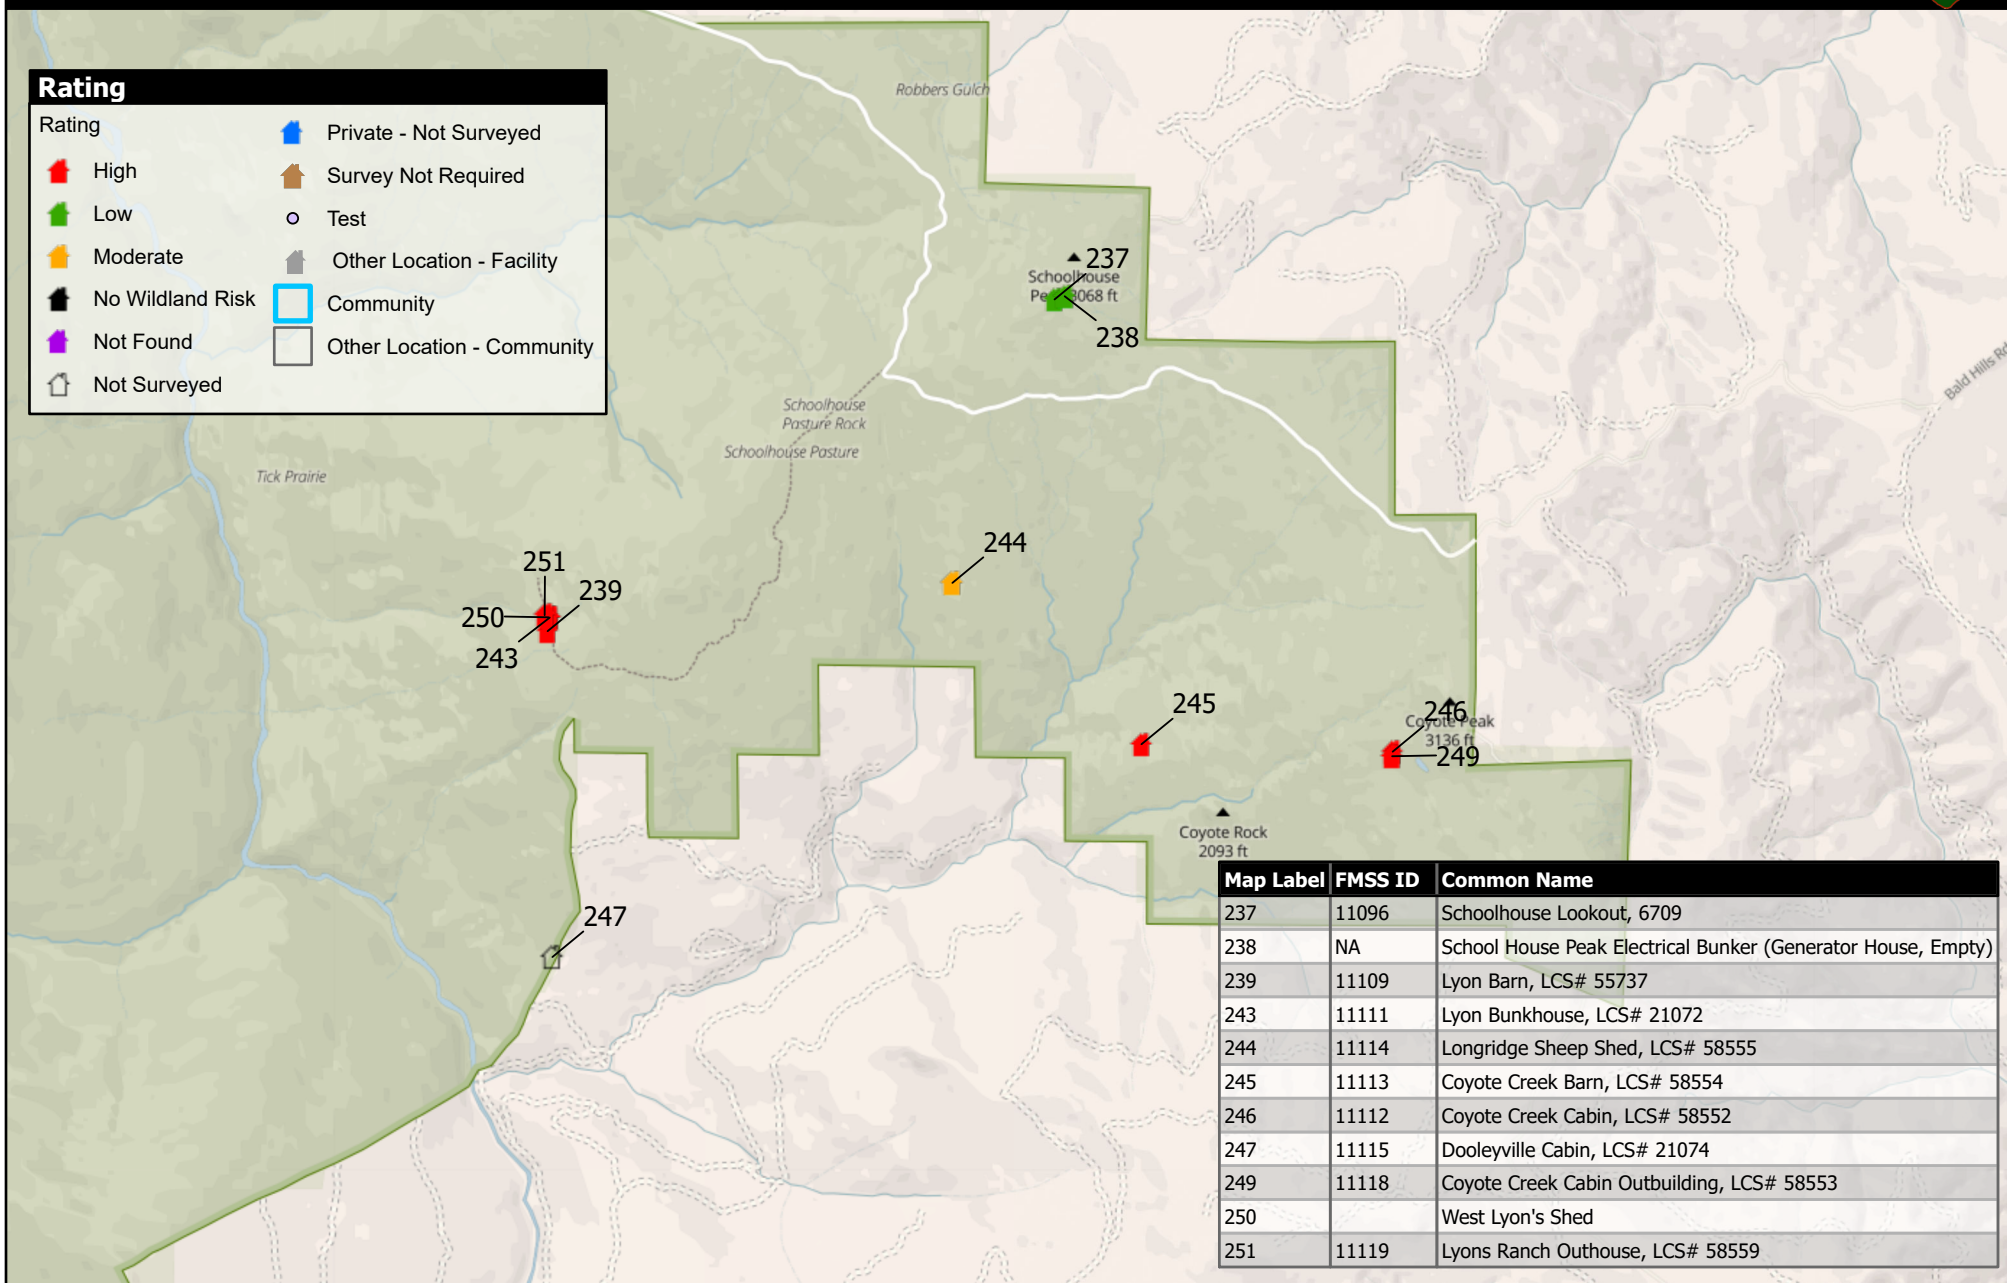

Author: sszturm
5/16/2023 11:02 AM

0

4 Miles

Scale: 1:50,000

NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Dolason Vault Toilet VT-12, 6720

Unit - Location: REDW - Elk Camp

FMSS ID: 11097, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: J Doke, May 9, 2017

Coordinates (DDM): 41° 12.31697328' N 123° 57.03341418' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 233

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Dolason Trailhead Vault Toilet, VT-12, 6720

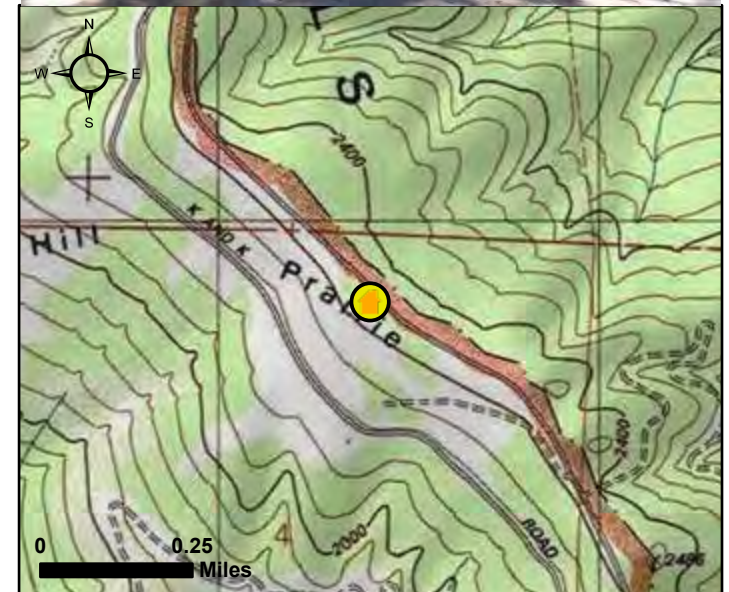



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Tall Trees Grove Sheltered Waiting Area

Unit - Location: REDW - Elk Camp

FMSS ID: , **Local ID:**

Structure Type, Use: Shade/Picnic Structure, Public

Owner: National Park Service

Field Crew, Visit Date: S Hartsburg, May 9, 2017

Coordinates (DDM): 41° 12.47747658' N 123° 59.59049568' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 234

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Firewood: None

Water Supply: Limited or dependent on electricity

Propane: None

Overhead Hazards: No overhead hazards

Comments: Tall Trees Grove Sheltered Waiting Area





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Elk Camp / Lane Ranch Residence, 6700

Unit - Location: REDW - Elk Camp

FMSS ID: 11134, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , May 9, 2017

Coordinates (DDM): 41° 13.551' N 123° 57.883' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 235

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Elk Camp/Lane Ranch Residence

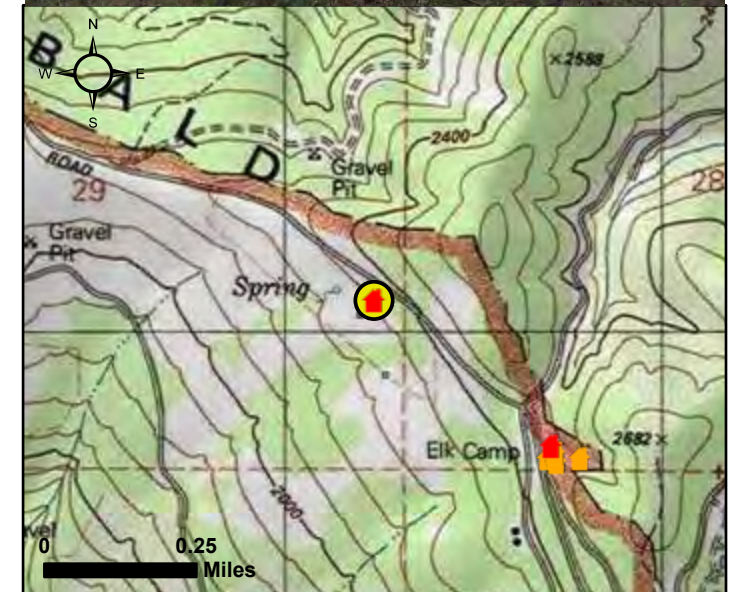



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Dolason Barn, LCS# 21070

Unit - Location: REDW - Elk Camp

FMSS ID: 11108, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Hartsburg, May 9, 2017

Coordinates (DDM): 41° 12.34145730' N 123° 57.73031082' W

Rating: High

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 236

Primary Access: Foot

Ingress Egress: N/A, access by foot, boat, or air only

Access Width: N/A, access by foot, boat, or air only

Access Condition: N/A, access by foot, boat, or air only

Bridge Condition: N/A, access by foot, boat, or air only

Access and Turnarounds: N/A, access by foot, boat, or air only

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass/tundra, northern hardwood litter

Fuel Load: Moderate

Defensible Space: 100 ft treated

Topography: Slope 21% to 30%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Dolason Barn, 6701

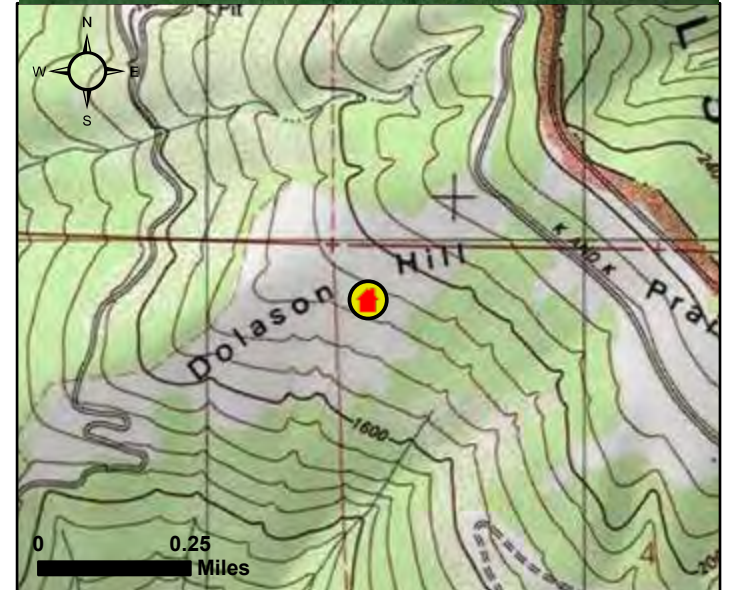



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Schoolhouse Lookout, 6709
Unit - Location: REDW - Elk Camp
FMSS ID: 11096, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: S Szturm , March 31, 2023
Coordinates (DDM): 41° 09.083' N 123° 52.982' W

Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 4 yrs
Map Label: 237

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass/tundra,northern hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Greater than 100ft treated
Topography: Slope 31% to 40%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: Reliable water source nearby
Propane: Present and little to no fuels clearance
Overhead Hazards: No overhead hazards
Comments: Schoolhouse Peak Lookout, 6709





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: School House Peak Electrical Bunker (Generator House, Empty)

Unit - Location: REDW - Elk Camp

FMSS ID: NA, **Local ID:**

Structure Type, Use: Building, No known use

Owner: National Park Service

Field Crew, Visit Date: S Szturm, March 31, 2023

Coordinates (DDM): 41° 09.091' N 123° 52.946' W

Rating: Low

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 238

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass/tundra,northern hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Greater than 100ft treated

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: Present and little to no fuels clearance

Overhead Hazards: No overhead hazards

Comments: School House Peak Electrical Bunker
(Generator House, Empty)

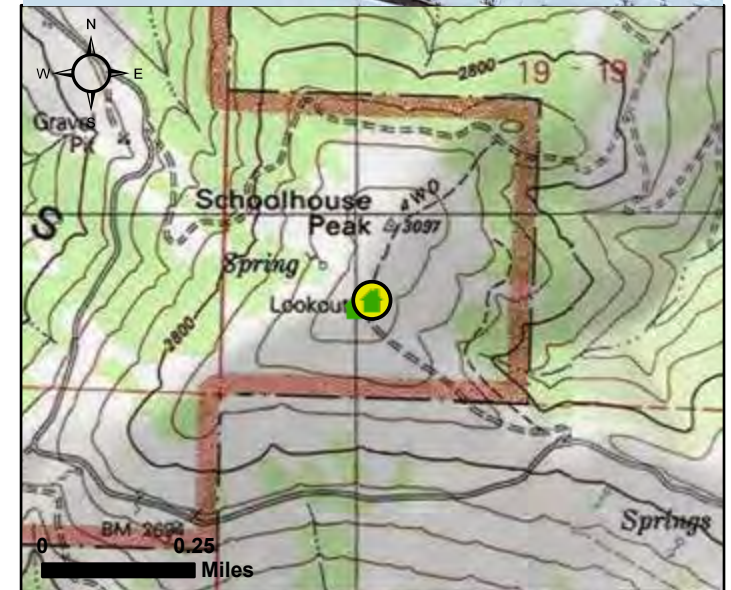



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Lyon Barn, LCS# 55737

Unit - Location: REDW - Elk Camp

FMSS ID: 11109, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: J Doke, May 9, 2017

Coordinates (DDM): 41° 08.19225204' N 123° 54.78975204' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 239

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Lyons Ranch Barn, 6702

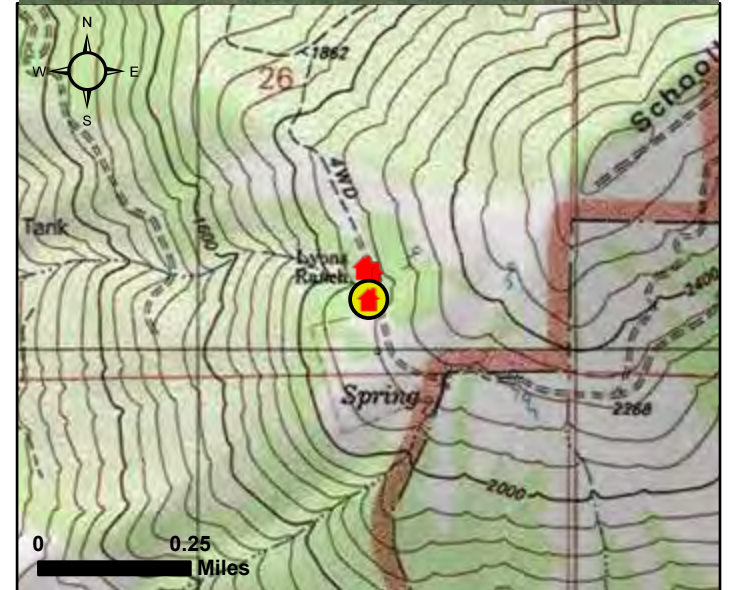




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Elk Camp CDF- Fueling Station
Unit - Location: REDW - Elk Camp
FMSS ID: NA, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: S Szturm , April 6, 2023
Coordinates (DDM): 41° 13.328' N 123° 57.553' W

Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 4 yrs
Map Label: 240

Primary Access: Road
Ingress Egress: 2 or more roads in/out
Access Width: 2 lanes (Greater than 24')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope 31% to 40%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Wood or open sided
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards
Comments: Elk Camp CDF- Fueling Station

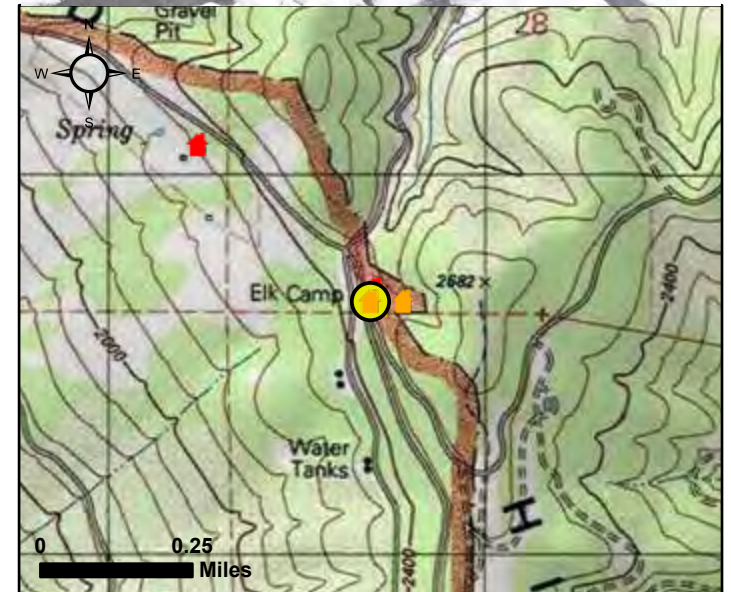



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Elk Camp CDF - 3 Bay Garage

Unit - Location: REDW - Elk Camp

FMSS ID: NA, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: S Szturm , April 6, 2023

Coordinates (DDM): 41° 13.324' N 123° 57.534' W

Rating: Moderate

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 4 yrs

Map Label: 241

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Limited or dependent on electricity

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments: Elk Camp CDF - 3 Bay Garage

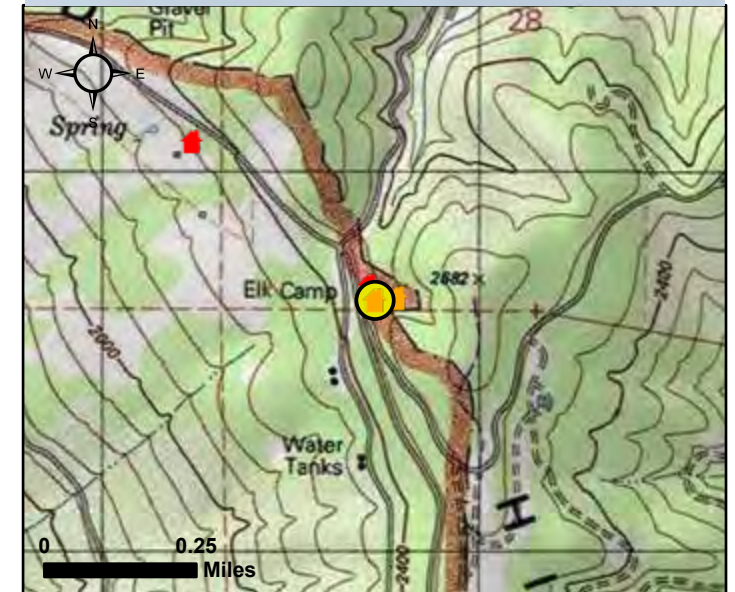




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Elk Camp CDF Station House
Unit - Location: REDW - Elk Camp
FMSS ID: NA, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: S Szturm , April 6, 2023
Coordinates (DDM): 41° 13.336' N 123° 57.539' W

Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: No,
Revisit Interval: 4 yrs
Map Label: 242

Primary Access: Road
Ingress Egress: 2 or more roads in/out
Access Width: 2 lanes (Greater than 24')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope 31% to 40%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Wood or open sided
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards
Comments: Elk Camp CDF Station House

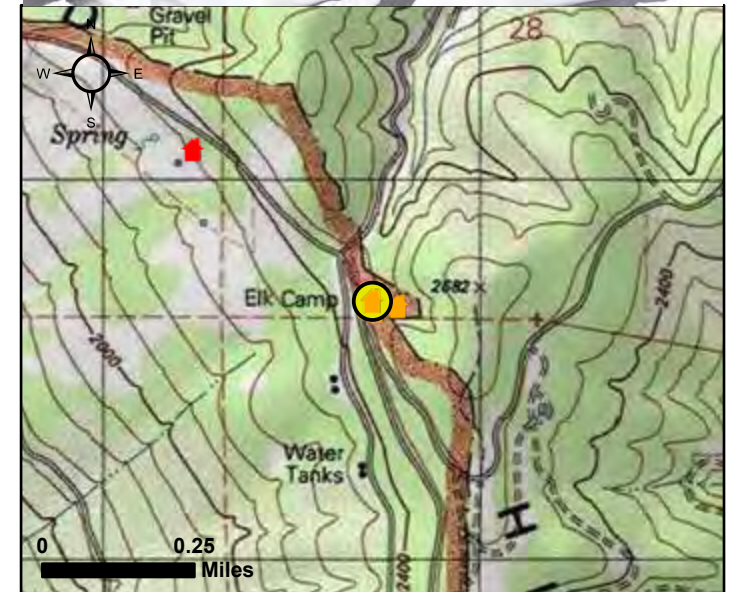



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Lyon Bunkhouse, LCS# 21072

Unit - Location: REDW - Elk Camp

FMSS ID: 11111, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Hartsburg, May 9, 2017

Coordinates (DDM): 41° 08.22901848' N 123° 54.78158766' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 243

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Lyon's Bunkhouse is an historic structure

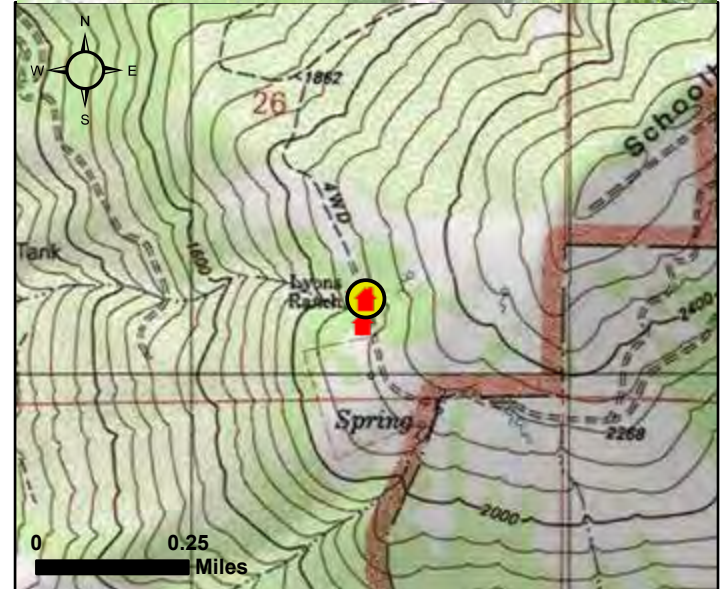



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Longridge Sheep Shed, LCS# 58555

Unit - Location: REDW - Elk Camp

FMSS ID: 11114, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Hartsburg, May 9, 2017

Coordinates (DDM): 41° 08.32213566' N 123° 53.34669630' W

Rating: Moderate

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 244

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass/tundra,northern hardwood litter

Fuel Load: Moderate

Defensible Space: 100 ft treated

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Shed is an historic structure

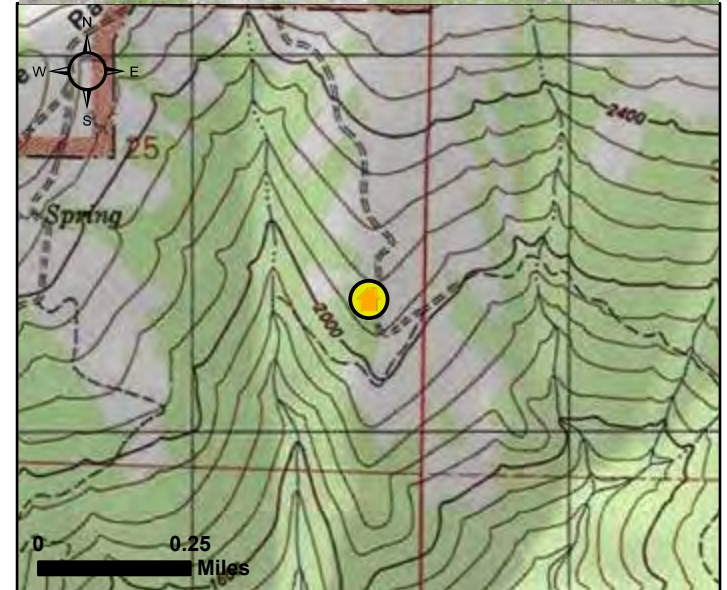



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Coyote Creek Barn, LCS# 58554

Unit - Location: REDW - Elk Camp

FMSS ID: 11113, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: J Doke, May 9, 2017

Coordinates (DDM): 41° 07.88865210' N 123° 52.67225904' W

Rating: High

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 245

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass/tundra, northern hardwood litter

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Coyote Creek Barn, 6706

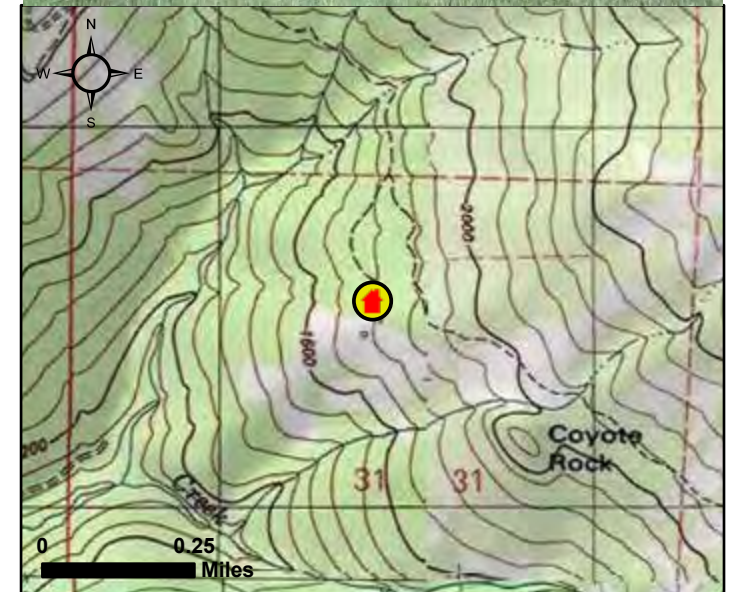



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Coyote Creek Cabin, LCS# 58552

Unit - Location: REDW - Elk Camp

FMSS ID: 11112, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Hartsburg, May 9, 2017

Coordinates (DDM): 41° 07.86896358' N 123° 51.77708406' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 246

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass/tundra,northern hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 31% to 40%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck



Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Cabin is historic.

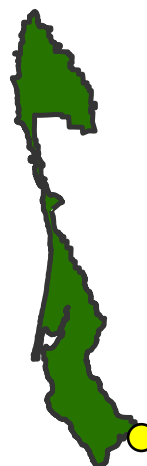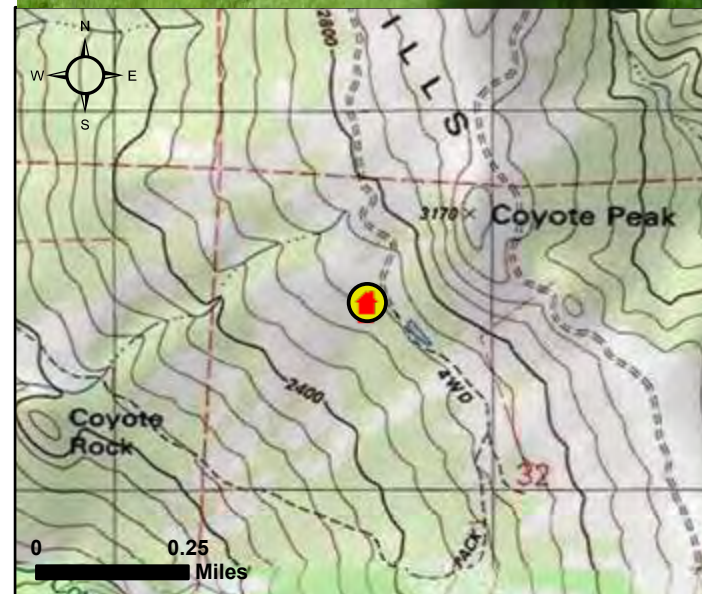



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Dooleyville Cabin, LCS# 21074

Unit - Location: REDW - Elk Camp

FMSS ID: 11115, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: ,

Coordinates (DDM): 41° 07.31772210' N 123° 54.77292216' W

Rating: Not Surveyed

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied:

In Community: No,

Revisit Interval: yrs

Map Label: 247

Primary Access:

Ingress Egress:

Access Width:

Access Condition:

Bridge Condition:

Access and Turnarounds:

Facility Number or Sign:

Fuel Type:

Fuel Load:

Defensible Space:

Topography:

Roof Material:

Siding Material: Wood or open sided

Foundation:

Firewood:


Water Supply:

Propane:

Overhead Hazards:

Comments: Dooleyville Cabin, 6708

NO PHOTO AVAILABLE

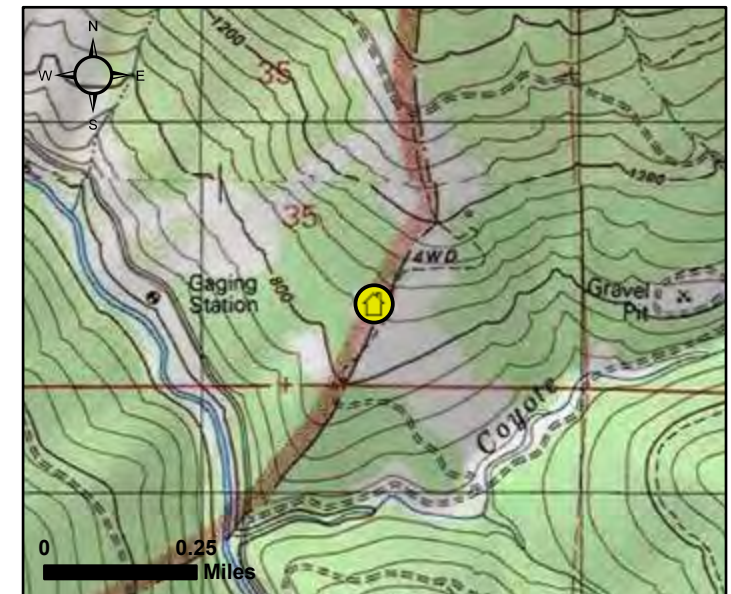



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Unknown

Unit - Location: REDW - Elk Camp

FMSS ID: 11089, **Local ID:**

Structure Type, Use: , Unknown

Owner: National Park Service

Field Crew, Visit Date: ,

Coordinates (DDM): 41° 09.46476300' N 124° 01.39290408' W

Rating: Not Surveyed

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied:

In Community: No,

Revisit Interval: yrs

Map Label: 248

Primary Access:

Ingress Egress:

Access Width:

Access Condition:

Bridge Condition:

Access and Turnarounds:

Facility Number or Sign:

Fuel Type:

Fuel Load:

Defensible Space:

Topography:

Roof Material:

Siding Material:

Foundation:

Firewood:

Water Supply:

Propane:


Overhead Hazards:

Comments: Rodgers Peak Repeater, 6418

NO PHOTO AVAILABLE



Elk Camp - 248

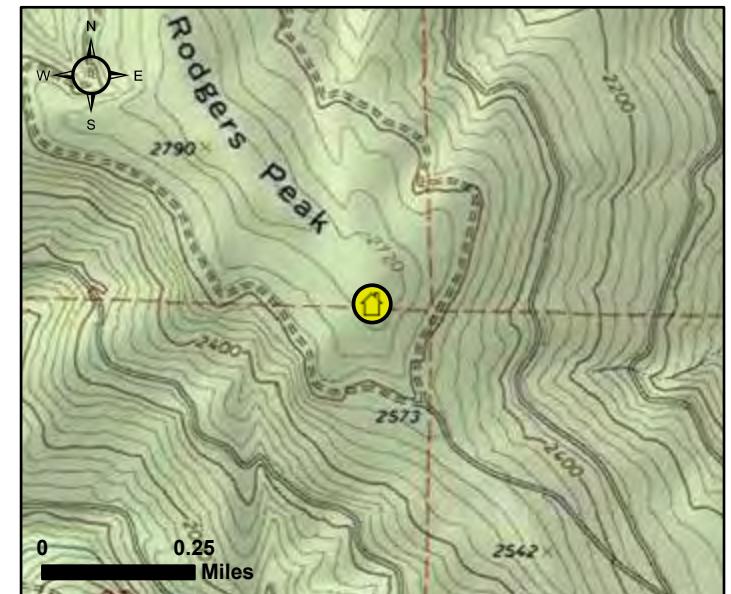



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Coyote Creek Cabin Outbuilding, LCS# 58553

Unit - Location: REDW - Elk Camp

FMSS ID: 11118, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: J Doke, May 9, 2017

Coordinates (DDM): 41° 07.85642850' N 123° 51.77829282' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 249

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 21% to 30%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Coyote Creek Cabin Outbuilding, LCS# 58553

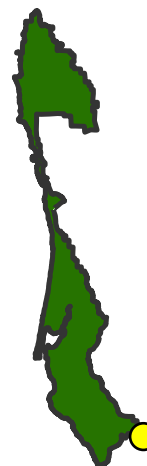



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: West Lyons Shed

Unit - Location: REDW - Elk Camp

FMSS ID: , **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Hartsburg, May 9, 2017

Coordinates (DDM): 41° 08.22959430' N 123° 54.78547812' W

Rating: High

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 250

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: West Lyon's Shed

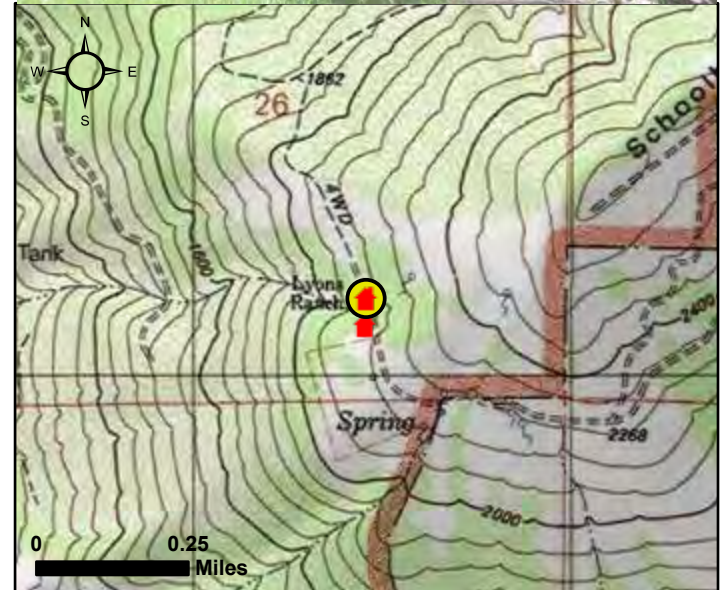



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Lyons Ranch Outhouse, LCS# 58559

Unit - Location: REDW - Elk Camp

FMSS ID: 11119, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: J Doke, May 9, 2017

Coordinates (DDM): 41° 08.23564536' N 123° 54.79961940' W

Rating: High

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 251

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Other than all season

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: No defensible space

Topography: Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Open or deck

Firewood: None

Water Supply: No reliable water source nearby

Propane: None


Overhead Hazards: No overhead hazards

Comments: Lyon's Ranch Outhouse, LCS#58559



2017-05-09 16:01

Lat: 41.137114 Lon: -123.913175

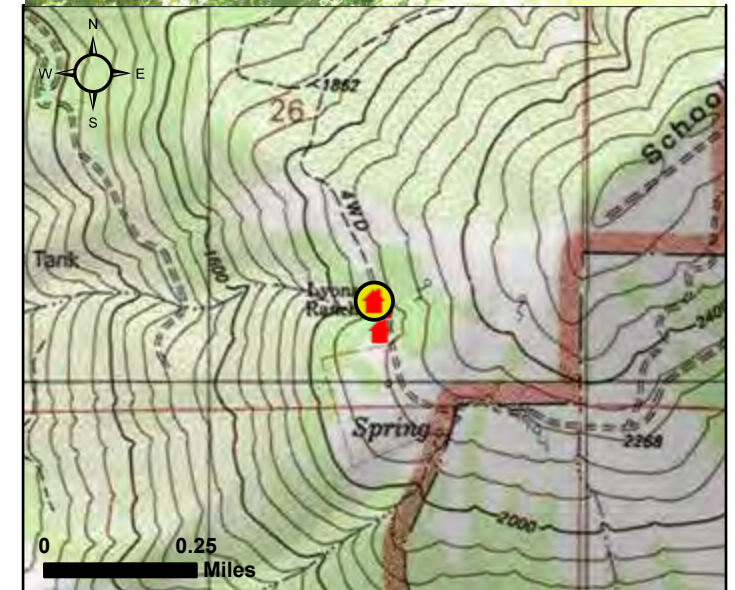




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Elk Camp CDF - Pumphouse
Unit - Location: REDW - Elk Camp
FMSS ID: NA, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: S Szturm ,
Coordinates (DDM): 41° 13.329' N 123° 57.490' W

Rating: Moderate
ProtectionLevel: Not Designated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 4 yrs
Map Label: 252

Primary Access:
Ingress Egress:
Access Width:
Access Condition:
Bridge Condition:
Access and Turnarounds:
Facility Number or Sign:
Fuel Type:
Fuel Load:
Defensible Space:
Topography:
Roof Material:
Siding Material:
Foundation:
Firewood:
Water Supply:
Propane:
Overhead Hazards:
Comments:

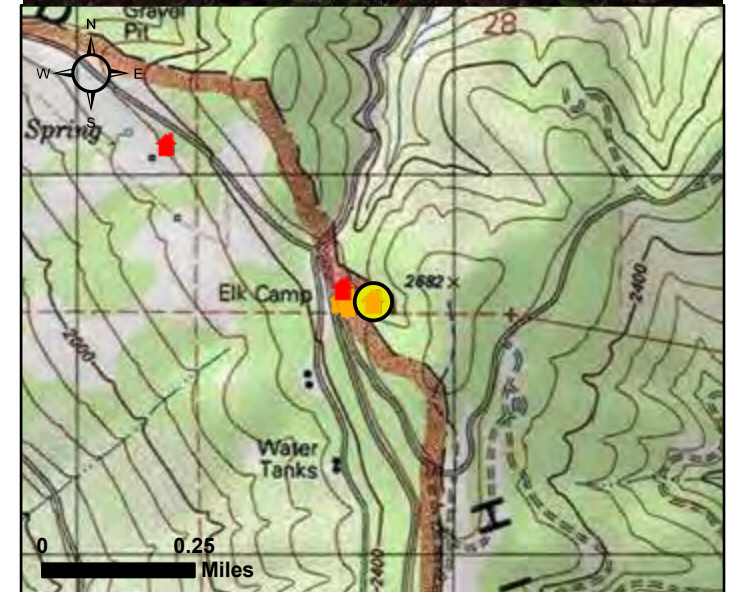



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Elk Camp CDF - Kitchen

Unit - Location: REDW - Elk Camp

FMSS ID: NA, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: S Szturm , April 6, 2023

Coordinates (DDM): 41° 13.347' N 123° 57.544' W

Rating: High

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 4 yrs

Map Label: 253

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeGreater than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 31% to 40%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: Greater than 30 ft from facility

Water Supply: Limited or dependent on electricity

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments: Elk Camp CDF - Bunkhouse

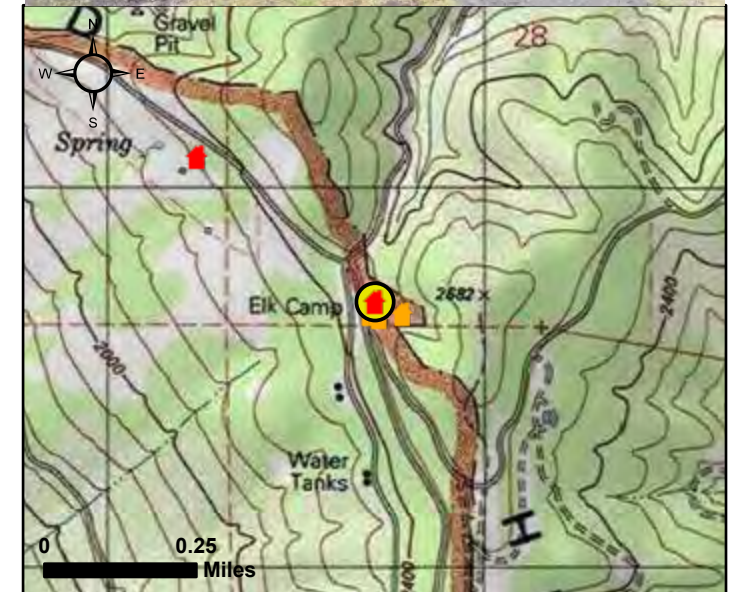



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Tall Trees Vault Toilet VT-10, 6416

Unit - Location: REDW - Elk Camp

FMSS ID: 11087, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: J Doke, May 9, 2017

Coordinates (DDM): 41° 12.50314272' N 123° 59.58941244' W

Rating: Moderate

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 254

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Limited or dependent on electricity

Propane: None

Overhead Hazards: No overhead hazards

Comments: Tall Trees Vault Toilet VT-10. 6416

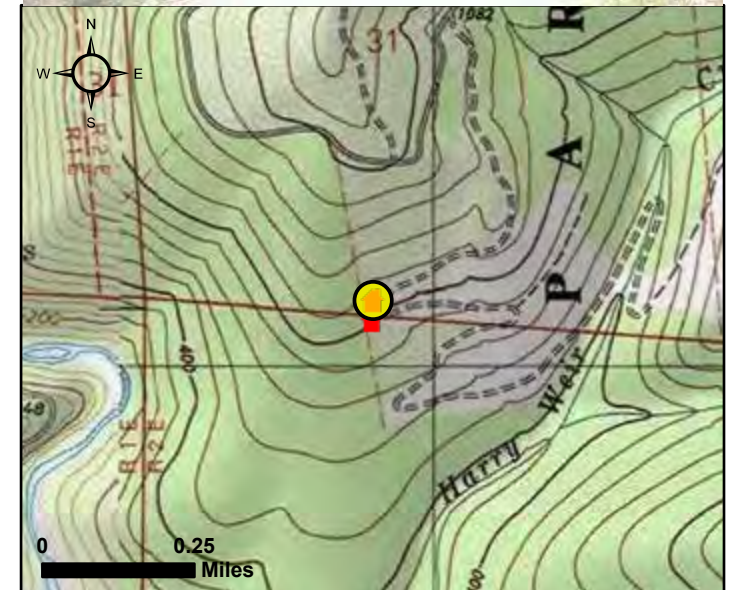



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Cobbs Knob Bear Cabin / M Line, 6420

Unit - Location: REDW - Elk Camp

FMSS ID: 11091, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: ,

Coordinates (DDM): 41° 10.39108068' N 124° 00.25241376' W

Rating: Not Surveyed

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied:

In Community: No,

Revisit Interval: yrs

Map Label: 255

Primary Access:

Ingress Egress:

Access Width:

Access Condition:

Bridge Condition:

Access and Turnarounds:

Facility Number or Sign:

Fuel Type:

Fuel Load:

Defensible Space:

Topography:

Roof Material:

Siding Material: Wood or open sided

Foundation:

Firewood:


Water Supply:

Propane:

Overhead Hazards:

Comments: EXCESS per FMSS

NO PHOTO AVAILABLE

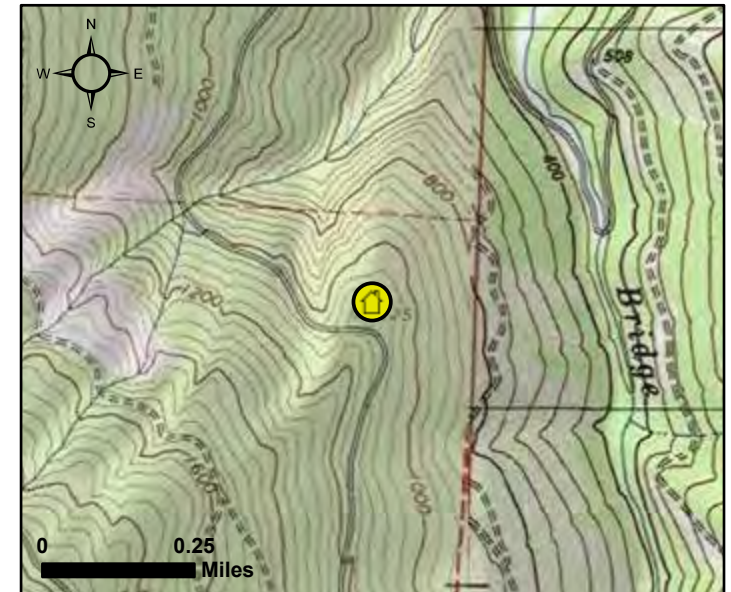



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Cobbs Knob Bear Cabin Outbuilding / M Line, 6421
Unit - Location: REDW - Elk Camp
FMSS ID: 11092, **Local ID:**
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: ,
Coordinates (DDM): 41° 10.38997440' N 124° 00.24957348' W

Rating: Not Surveyed
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied:
In Community: No,
Revisit Interval: yrs
Map Label: 256

Primary Access:
Ingress Egress:
Access Width:
Access Condition:
Bridge Condition:
Access and Turnarounds:
Facility Number or Sign:
Fuel Type:
Fuel Load:
Defensible Space:
Topography:
Roof Material:
Siding Material: Wood or open sided
Foundation:
Firewood:
Water Supply:
Propane:
Overhead Hazards:
Comments: EXCESS per FMSS

NO PHOTO AVAILABLE

