


NPS Wildfire Risk Assessments Assessment Locations

COLM - Colorado National Monument Overview

National Park Service
U.S. Department of the Interior

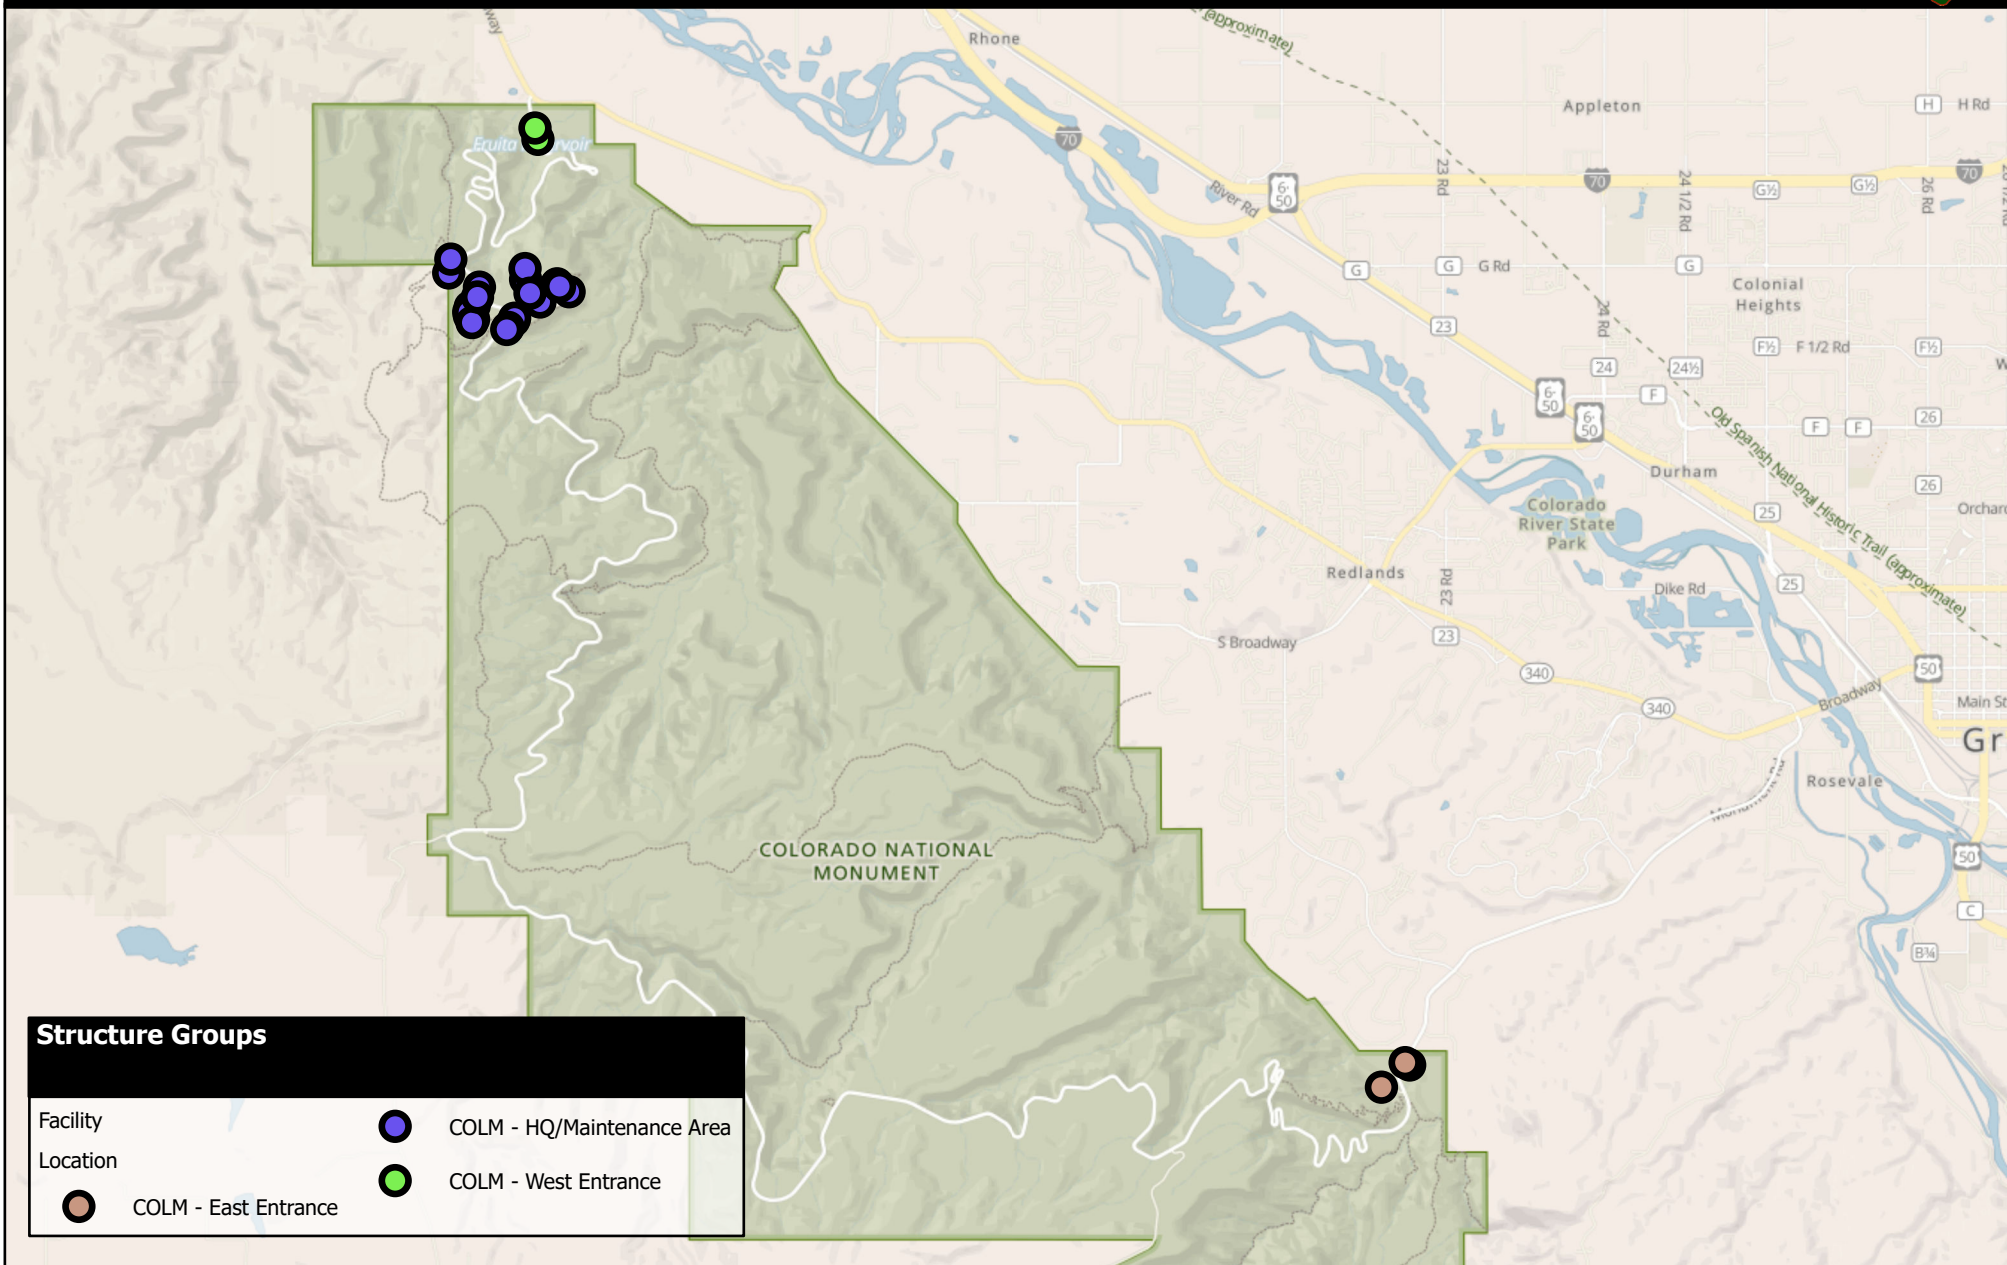

Structure Groups

Facility		COLM - HQ/Maintenance Area
Location		COLM - West Entrance
		COLM - East Entrance



0 4 8 Miles


Author: sszturm
1/4/2023 8:31 AM

Intermountain Region Geographic Resources Division
May 2021
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

COLM - East Entrance
COLM - Colorado National Monument

National Park Service
U.S. Department of the Interior

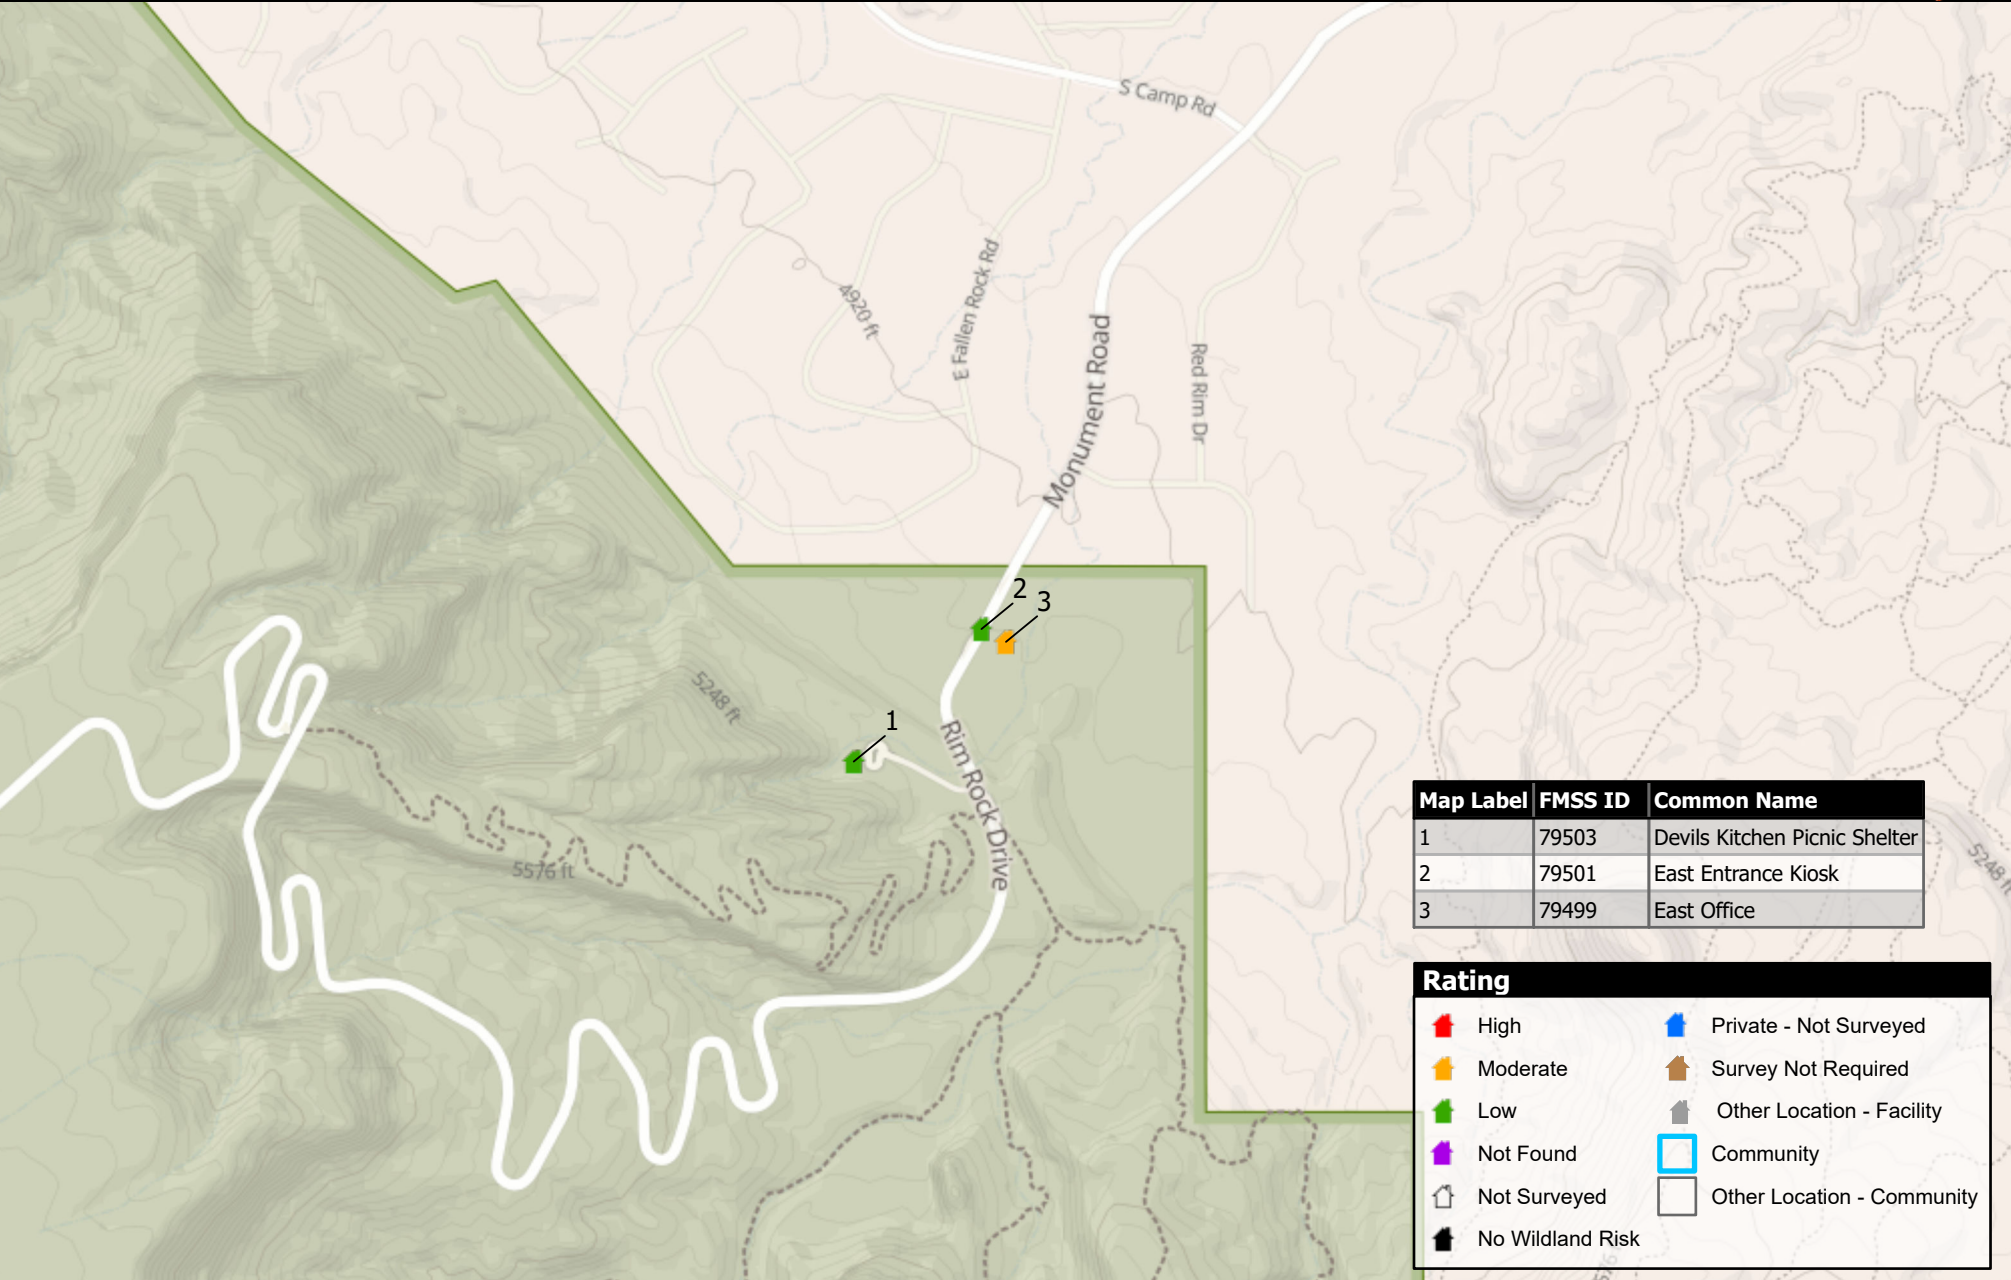


Map Label	FMSS ID	Common Name
1	79503	Devils Kitchen Picnic Shelter
2	79501	East Entrance Kiosk
3	79499	East Office

Rating	
High	Private - Not Surveyed
Moderate	Survey Not Required
Low	Other Location - Facility
Not Found	Community
Not Surveyed	Other Location - Community
No Wildland Risk	



Author: sszturm
1/4/2023 7:49 AM



NPS Wildfire Risk Assessments
NPS Fire GIS
August 2022
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Devils Kitchen Picnic Shelter

Unit - Location: COLM - COLM - East Entrance

FMSS ID: 79503

Structure Type: CulturalResource

Structure Use: Public

Owner: NPS

Field Crew: NW CO FIRE

Last Site Visit Date: 6/30/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 39° 1.96781' Long(WGS84): -108° 38.0286'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: No reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2021_COLM_79503_Devils Kitchen Picnic Shelter_Front.jpg




Score: 28
Rating: Low

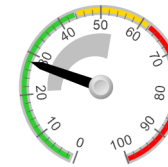

Asset Priority Index
(API):
83

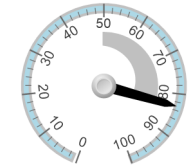

Factors Driving the Ratings

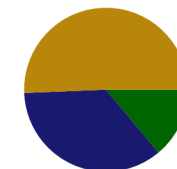

Access
Environment
Structure
Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: East Entrance Kiosk

Unit - Location: COLM - COLM - East Entrance
FMSS ID: 79501
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: NW CO FIRE
Last Site Visit Date: 6/30/2021


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied?
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 39° 2.09977' **Long(WGS84):** -108° 37.8646'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: Fire Hydrant near E shop. East direction. Buried gas line in area. South of building



2021_COLM_79501_East Entrance Kiosk_Front.jpg


Score: 21
Rating: Low

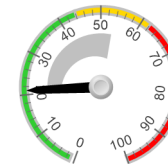



Asset Priority Index (API): 65



Factors Driving the Ratings

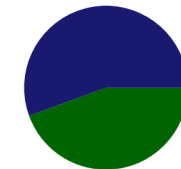

■ Access
■ Environment
■ Structure
■ Protection

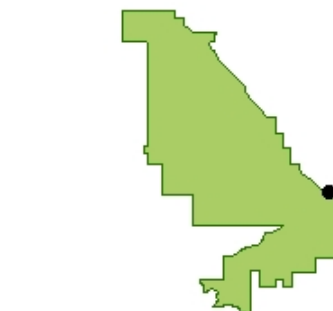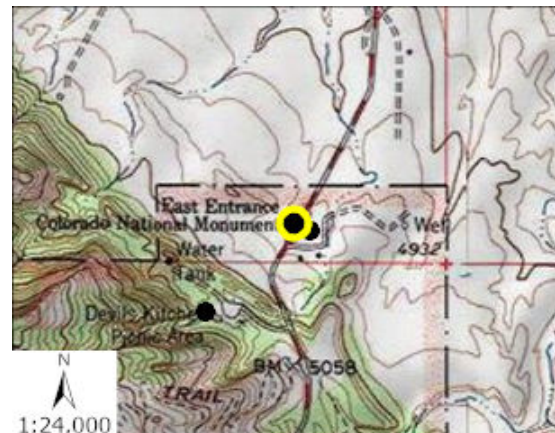

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: East Office

Unit - Location: COLM - COLM - East Entrance

FMSS ID: 79499

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: NW CO Fire

Last Site Visit Date: 6/30/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 39° 2.08714' **Long(WGS84):** -108° 37.8333'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, 6in to 30in masonry exposed

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT


Triage Category:

Hazmat: flammable cabinet


Assessment Comments: Used by LE for Parking. Seasonal RV Parking




2021_COLM_79499_East Office_Front.jpg

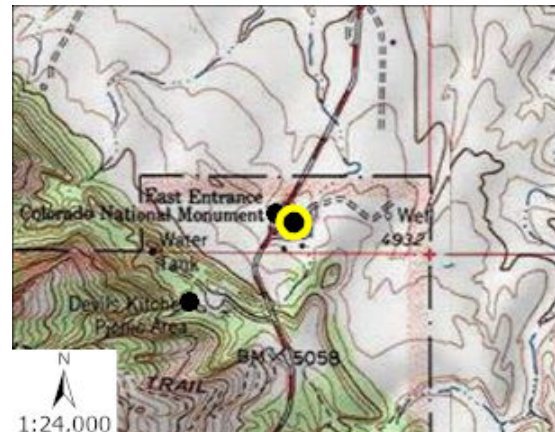


Score: 53
Rating: Moderate

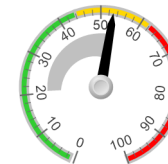

Asset Priority Index (API): 50

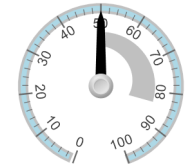

Factors Driving the Ratings

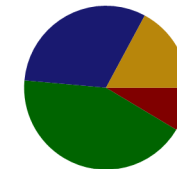

■ Access
■ Environment
■ Structure
■ Protection



● Facility
■ NPS Boundary