


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



Aztec Ruins National Monument

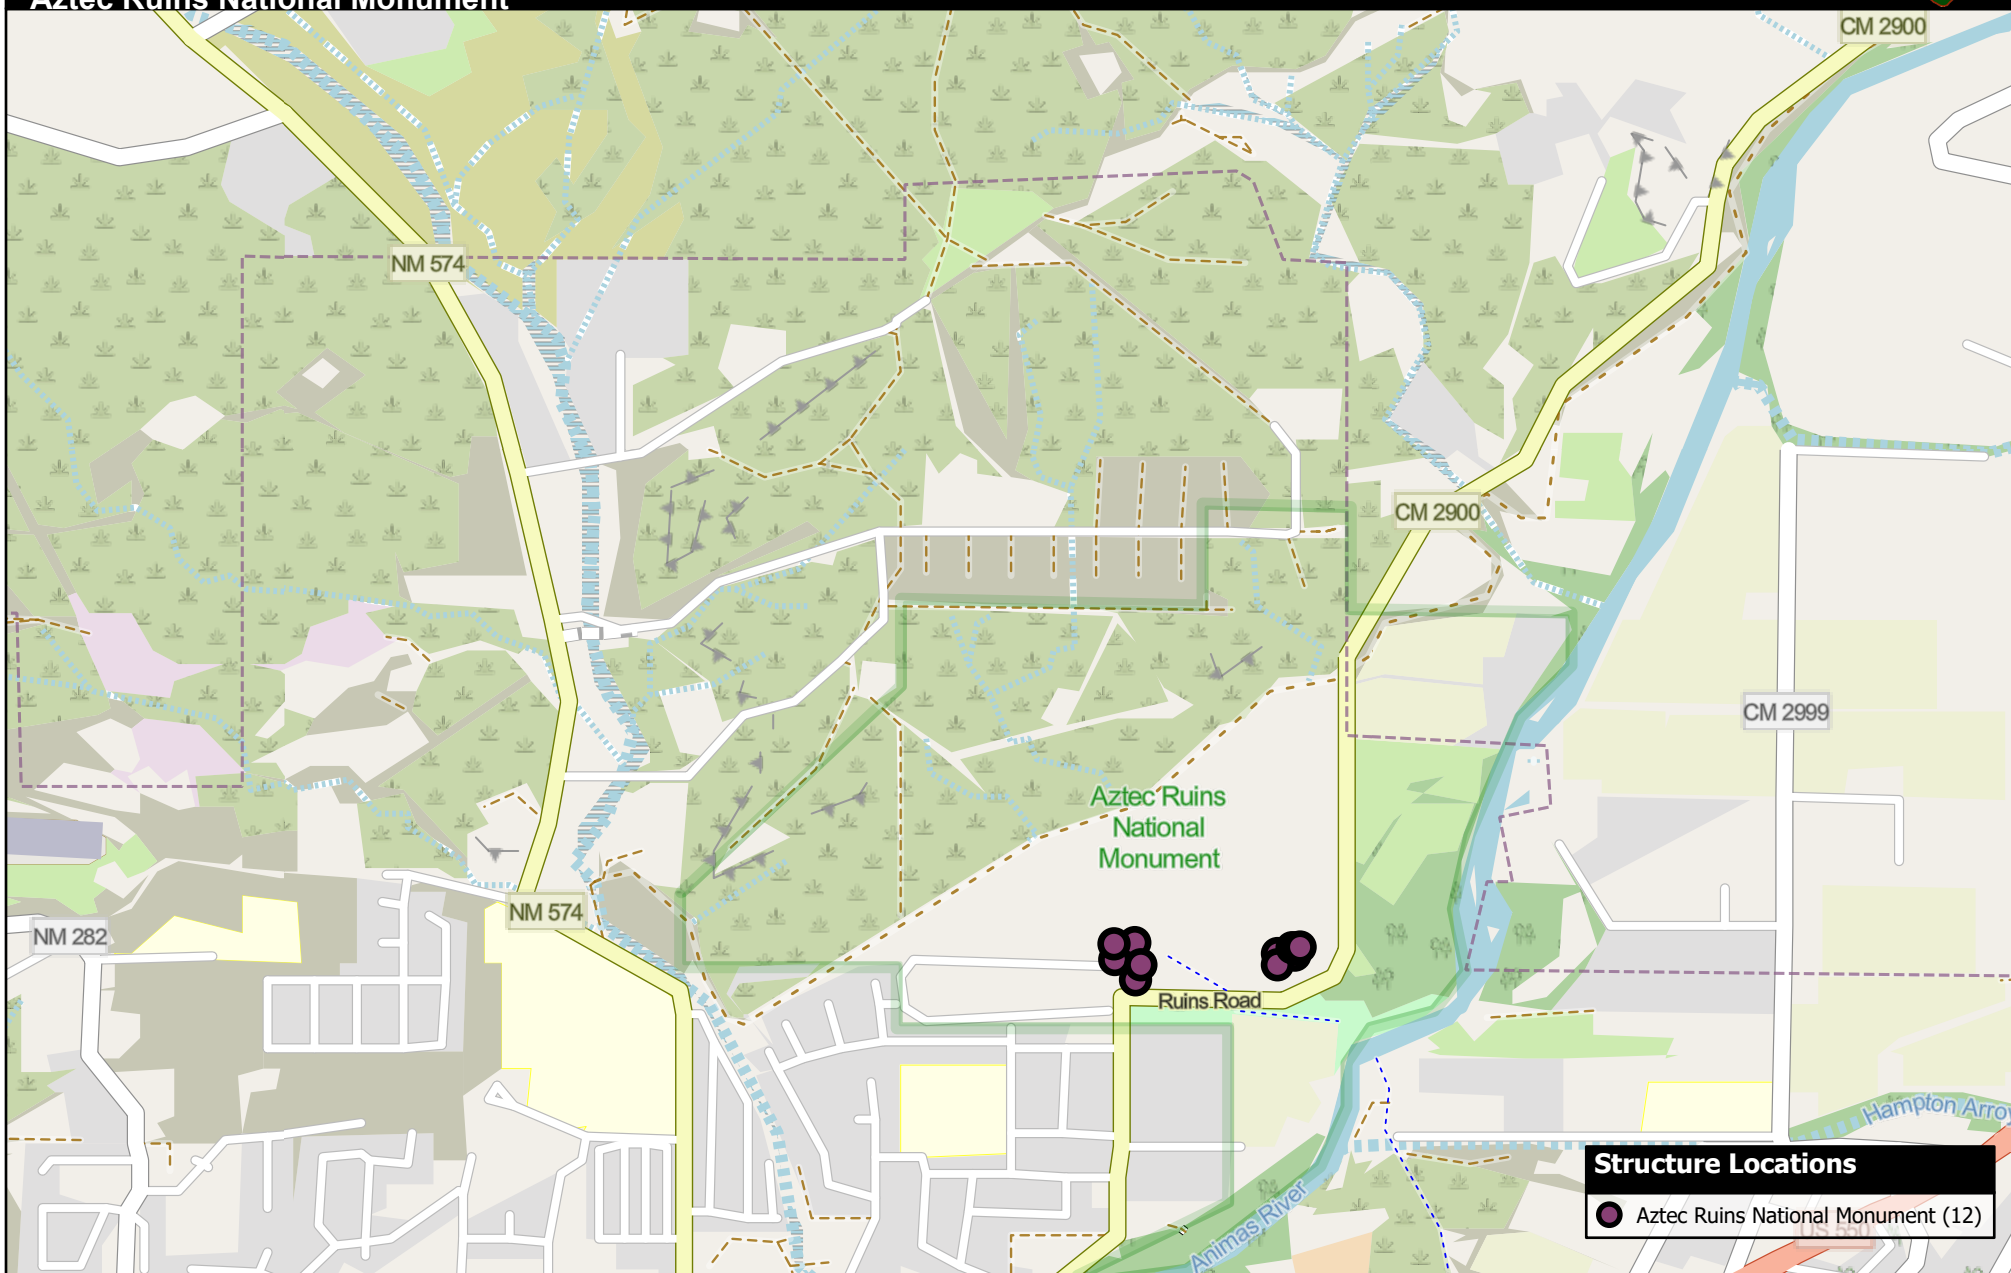


0 1 Miles

Author: sszturm
2/7/2022 9:46 AM

Intermountain Region Geographic Resources Division
March 2021
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

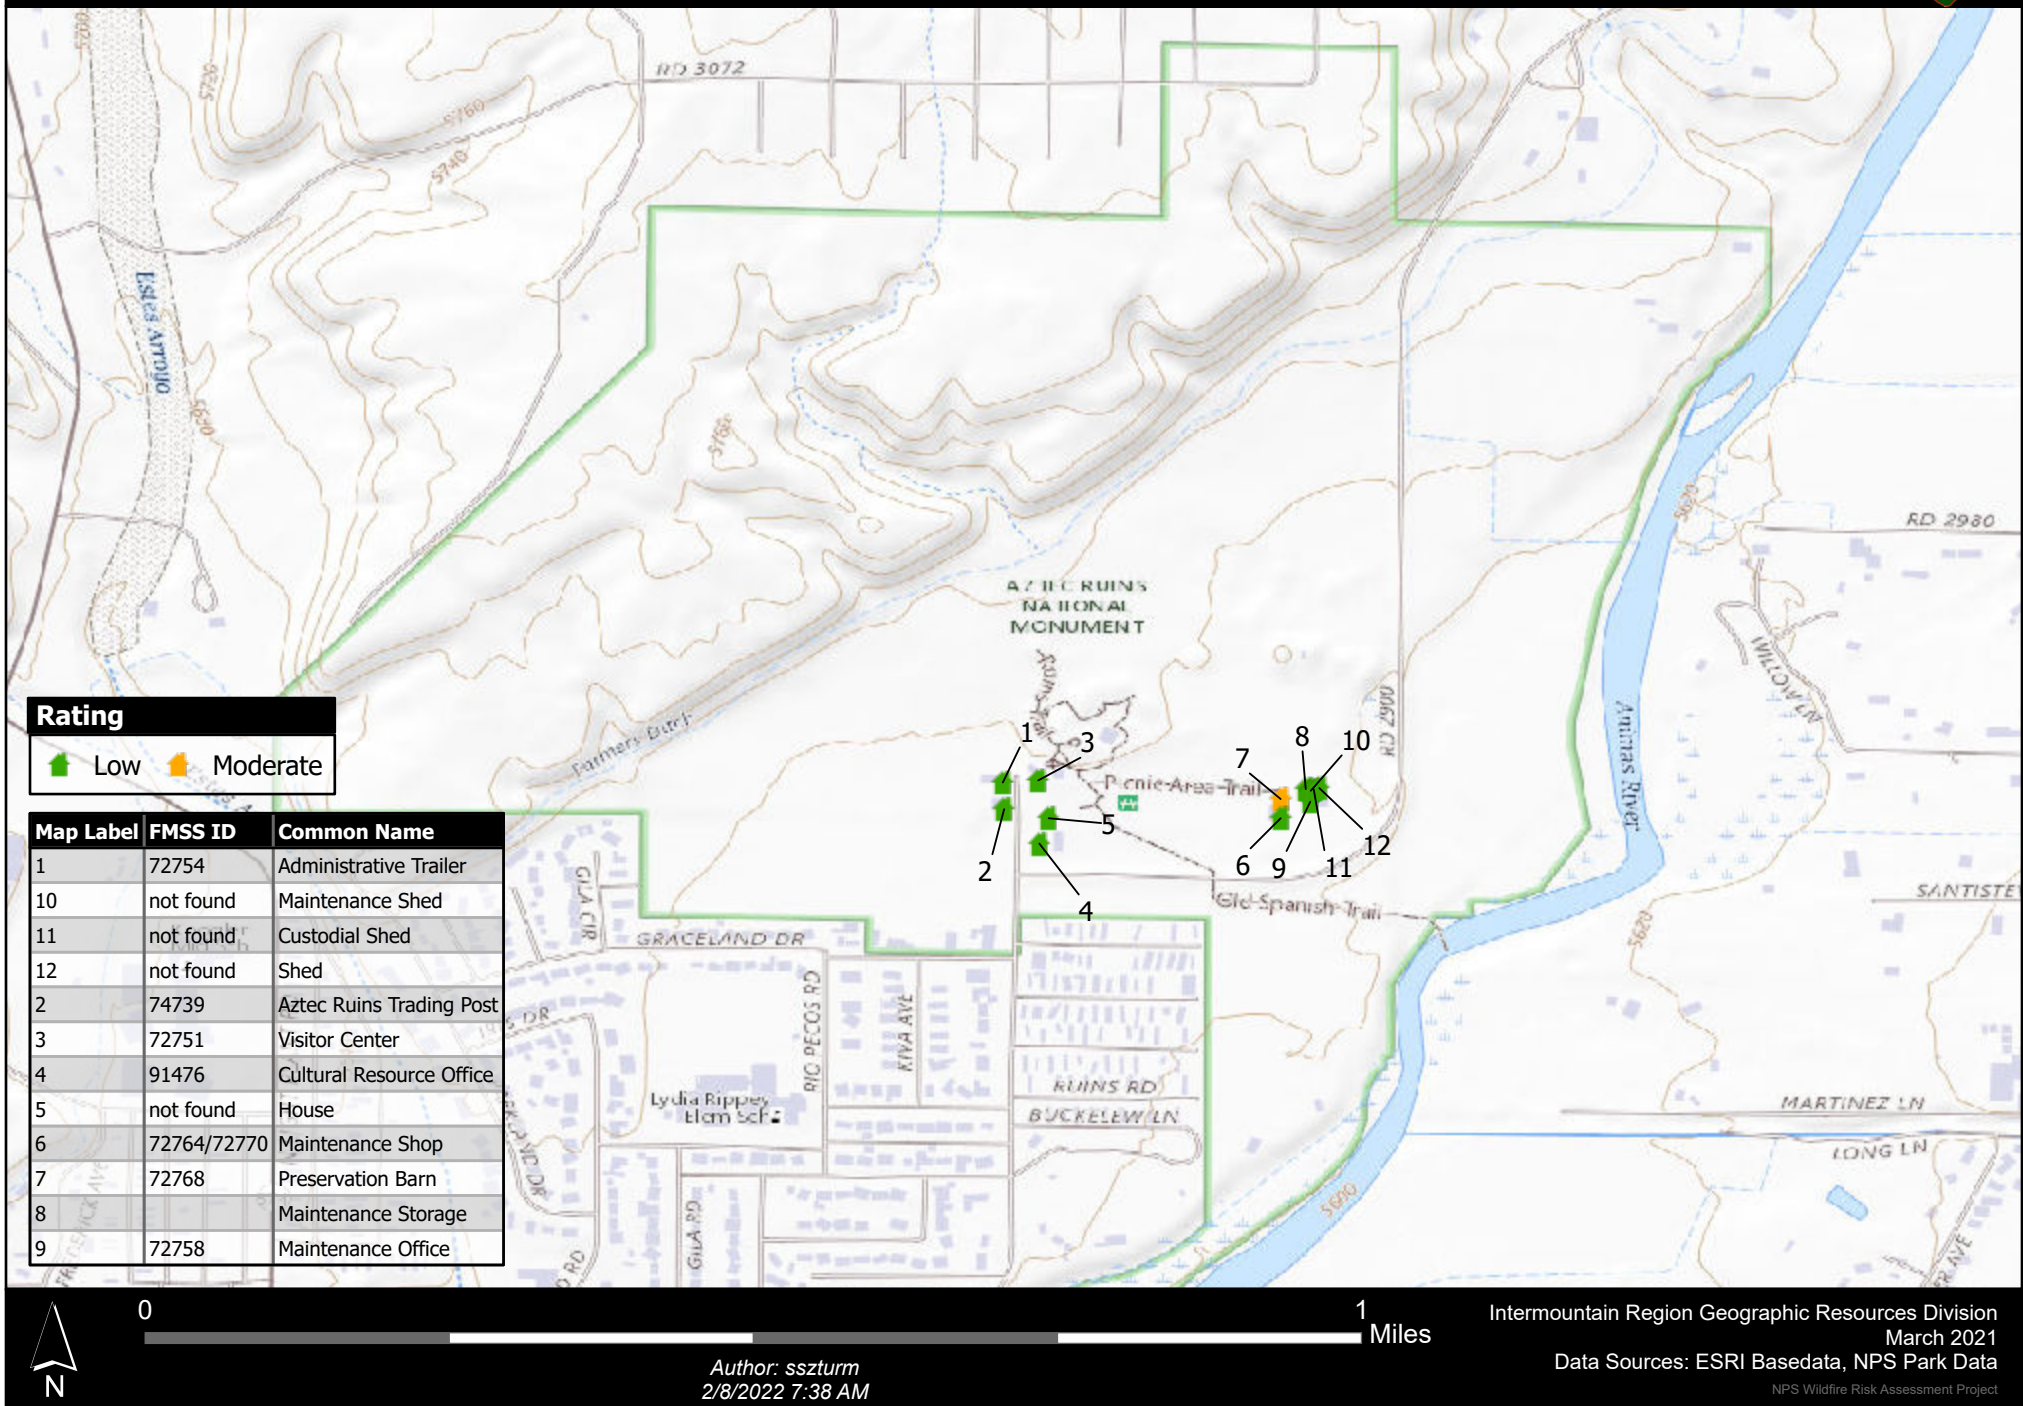



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Administrative Trailer

Unit - Location: AZRU - Aztec Ruins National Monument
FMSS ID: 72754
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/18/2021


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 36° 50.0688' **Long(WGS84):** -108° 0.0493816'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,tundra,northern hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible but separated from facility
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_AZRU_72754_Administrative Trailer_Front.jpg


Score: 25
Rating: Low

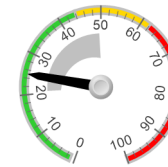


Asset Priority Index (API): 30

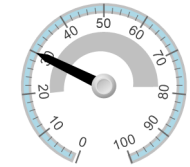

Factors Driving the Ratings

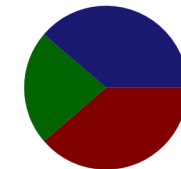

■ Access
■ Environment
■ Structure
■ Protection

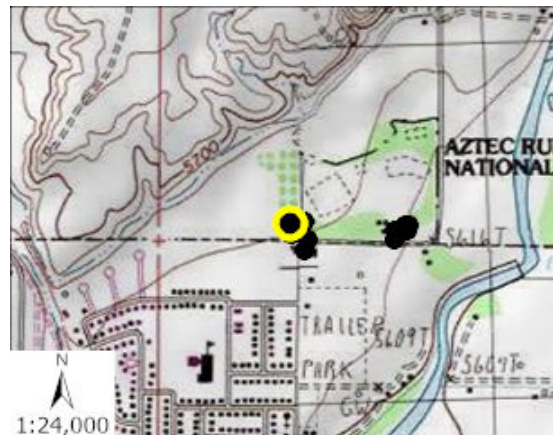

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Aztec Ruins Trading Post

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: 74739

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.0498' **Long(WGS84):** -108° 0.0484299'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Powerlines at entrance




2021_AZRU_74739_Aztec Ruins Trading Post_Front.jpg


Score: 25
Rating: Low

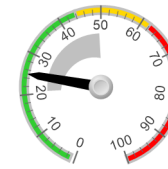

Asset Priority Index (API): 55

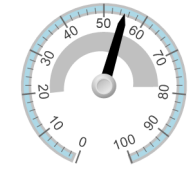

Factors Driving the Ratings

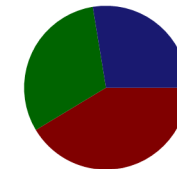

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Visitor Center

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: 72751

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.0703' **Long(WGS84):** -108° 0.0242026'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU_72751_Visitor Center_Front.jpg


Score: 21
Rating: Low

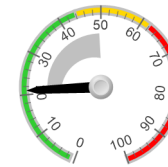



Asset Priority Index (API):
78

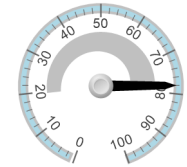

Factors Driving the Ratings

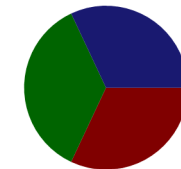

■ Access
■ Environment
■ Structure
■ Protection

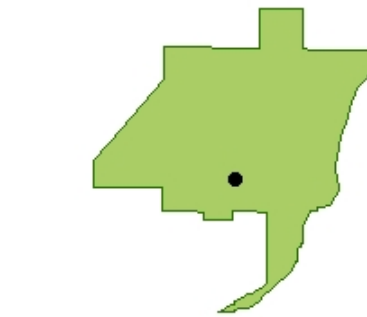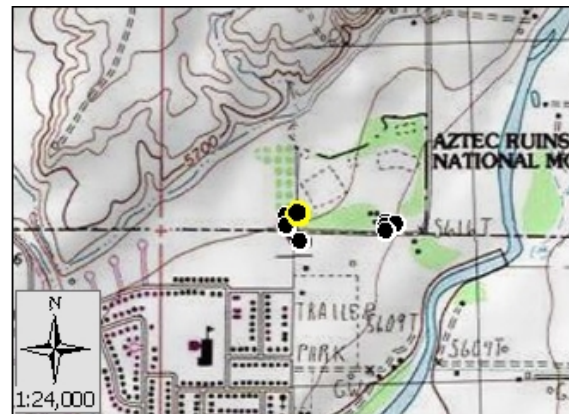

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Cultural Resource Office

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: 91476

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.0252' **Long(WGS84):** -108° 0.0233077'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_AZRU_91476_Cultural Resource Office_Front.jpg


Score: 25
Rating: Low

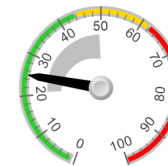


Asset Priority Index (API): 42



Factors Driving the Ratings

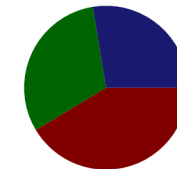

■ Access
■ Environment
■ Structure
■ Protection

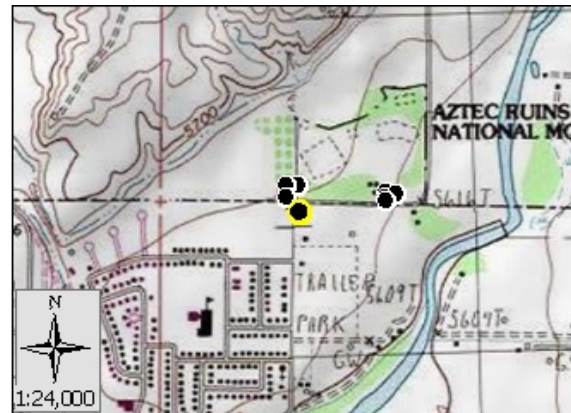



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: House

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: not found

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level :

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.0434' **Long(WGS84):** -108° 0.0168163'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU_not found _House_Front.jpg


Score: 22
Rating: Low

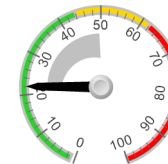


Asset Priority Index (API):
N/A

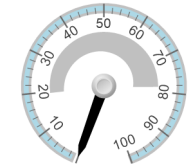

Factors Driving the Ratings

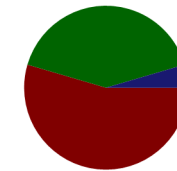

Access
Environment
Structure
Protection

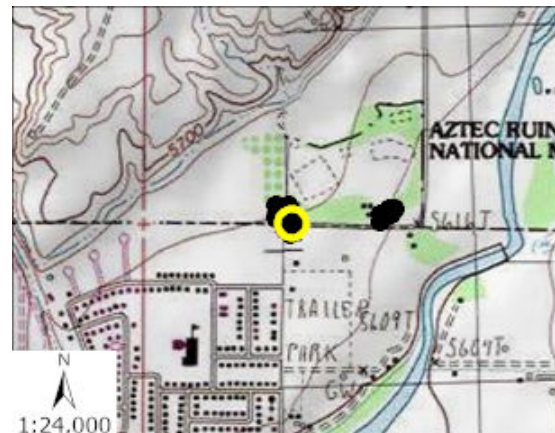

1:24,000



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance Shop

Unit - Location: AZRU - Aztec Ruins National Monument
FMSS ID: 72764/72770
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/18/2021


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 36° 50.0434' **Long(WGS84):** -107° 59.8513'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: Adjacent to/under deck of facility
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_AZRU_72764/72770_Maintenance Shop_Front.jpg


Score: 28
Rating: Low

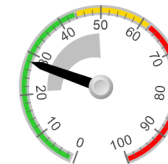



Asset Priority Index (API):
N/A

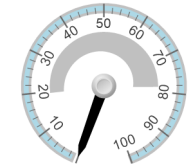

Factors Driving the Ratings

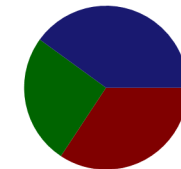

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

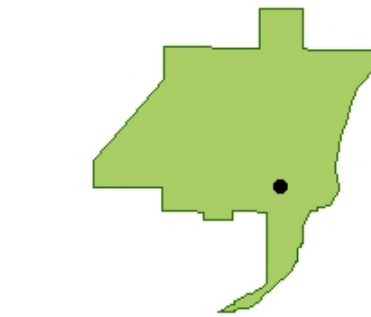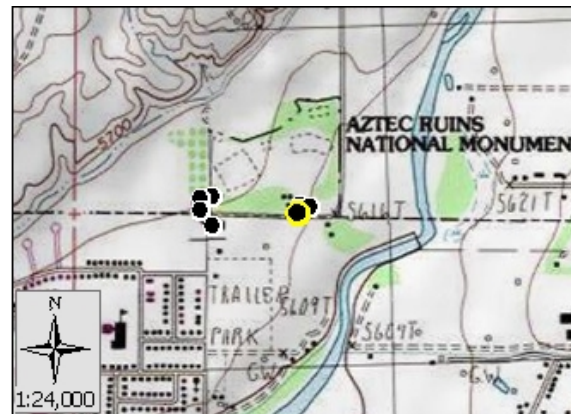

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Preservation Barn

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: 72768

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.057' **Long(WGS84):** -107° 59.8512'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: Adjacent to/under deck of facility

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU_72768_Preservation Barn_Front.jpg


Score: 49
Rating: Moderate

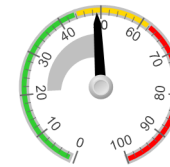



Asset Priority Index (API): 20

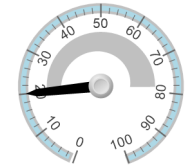

Factors Driving the Ratings

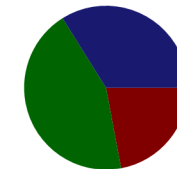

■ Access
■ Environment
■ Structure
■ Protection

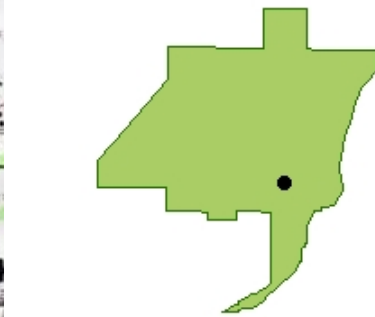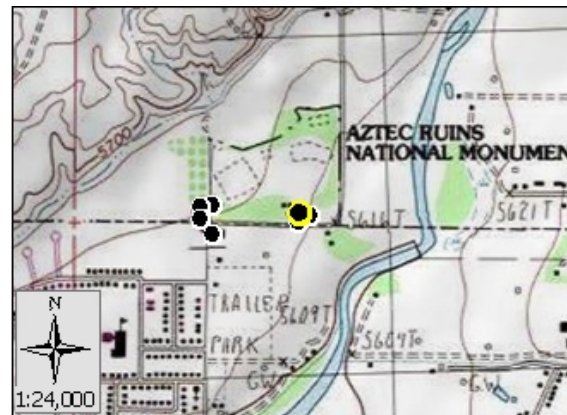

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance Storage

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID:

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level :

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 36° 50.0641' **Long(WGS84):** -107° 59.8334'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU__Maintenance Storage_Front.jpg


Score: 31
Rating: Low

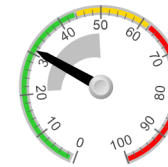


Asset Priority Index (API):
N/A

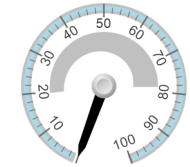

Factors Driving the Ratings

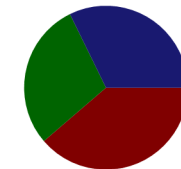

■ Access
■ Environment
■ Structure
■ Protection

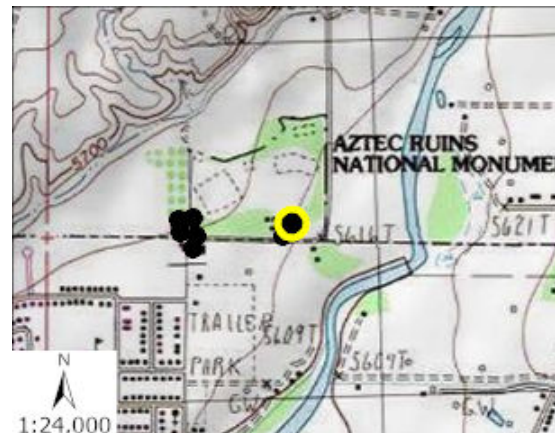



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance Office

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: 72758

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 36° 50.0552' **Long(WGS84):** -107° 59.8302'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU_72758_Maintenance Office_Front.jpg


Score: 22
Rating: Low

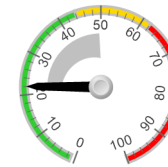


Asset Priority Index (API): 42

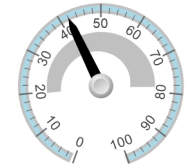

Factors Driving the Ratings

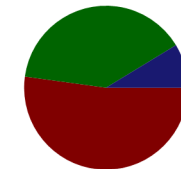

■ Access
■ Environment
■ Structure
■ Protection

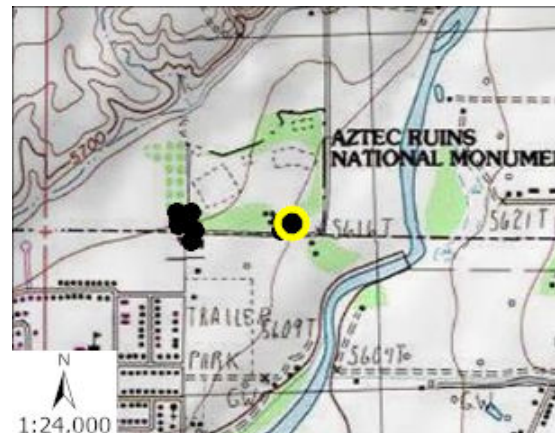

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance Shed

Unit - Location: AZRU - Aztec Ruins National Monument
FMSS ID: not found
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/18/2021


Rating: Low
Protection Level :
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 36° 50.0629' **Long(WGS84):** -107° 59.8297'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Wood or open sided
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_AZRU_not found _Maintenance Shed_Front.jpg


Score: 32
Rating: Low

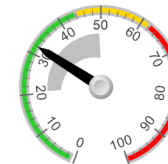


Asset Priority Index (API):
N/A

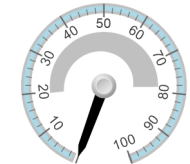

Factors Driving the Ratings

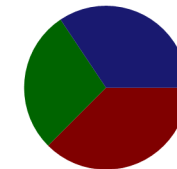

■ Access
■ Environment
■ Structure
■ Protection

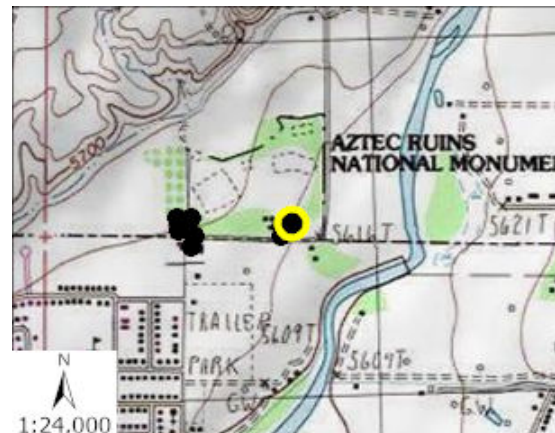



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Custodial Shed

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: not found

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level :

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.0638' **Long(WGS84):** -107° 59.8277'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: Adjacent to/under deck of facility

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU_not found _Custodial Shed_Front.jpg


Score: 35
Rating: Low

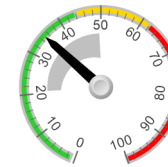


Asset Priority Index (API):
N/A

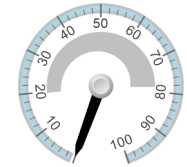

Factors Driving the Ratings

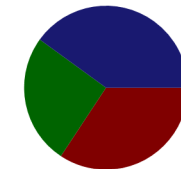

■ Access
■ Environment
■ Structure
■ Protection

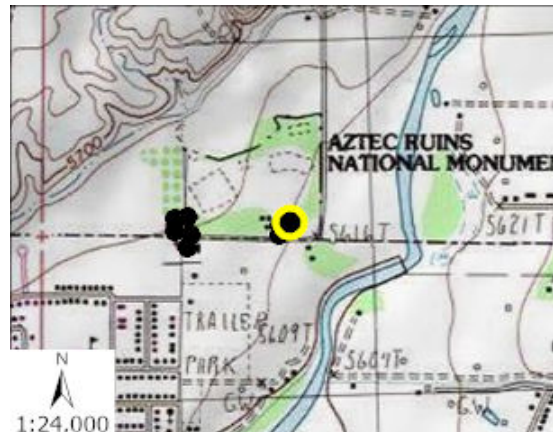



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Shed

Unit - Location: AZRU - Aztec Ruins National Monument

FMSS ID: not found

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/18/2021

Rating: Low

Protection Level :

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 36° 50.0649' **Long(WGS84):** -107° 59.8238'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2021_AZRU_not found _Shed_Front.jpg


Score: 32
Rating: Low

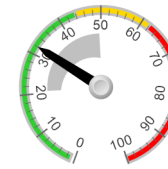


Asset Priority Index (API):
N/A

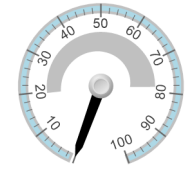

Factors Driving the Ratings

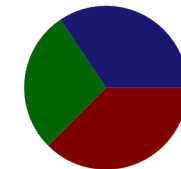

■ Access
■ Environment
■ Structure
■ Protection

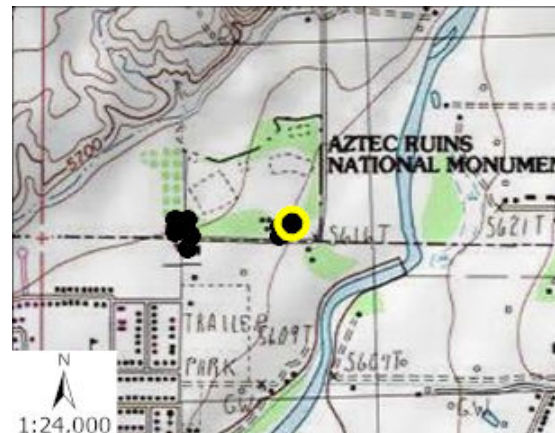

1:24,000



● Facility
■ NPS Boundary