


NPS Wildfire Risk Assessments Assessment Locations


National Park Service
U.S. Department of the Interior



SACN - St. Croix National Scenic Riverway - Overview

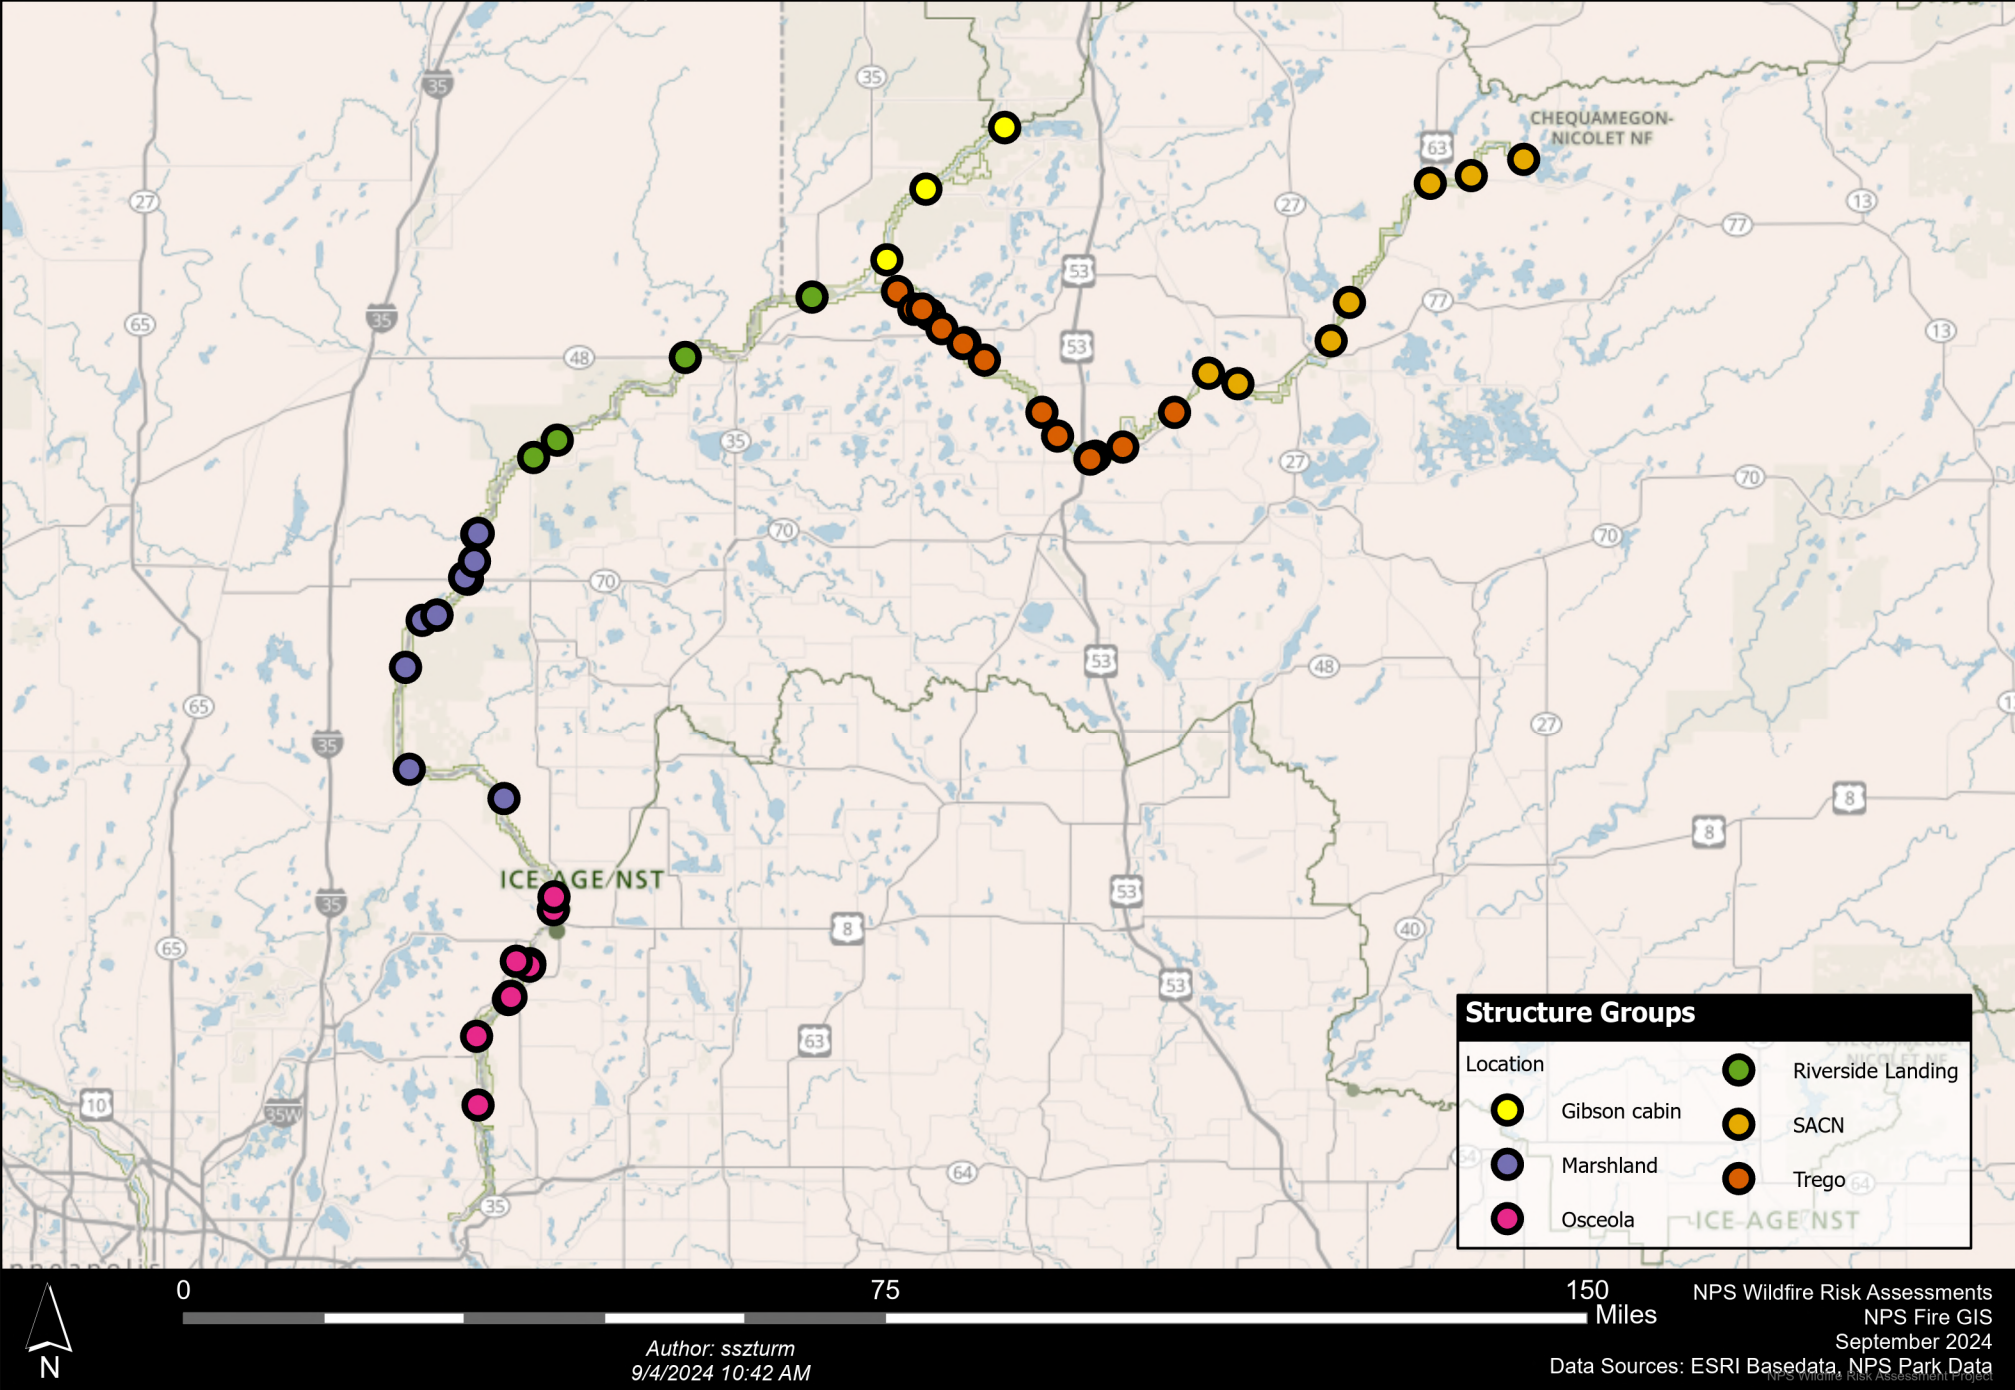


SACN - Trego - Overview

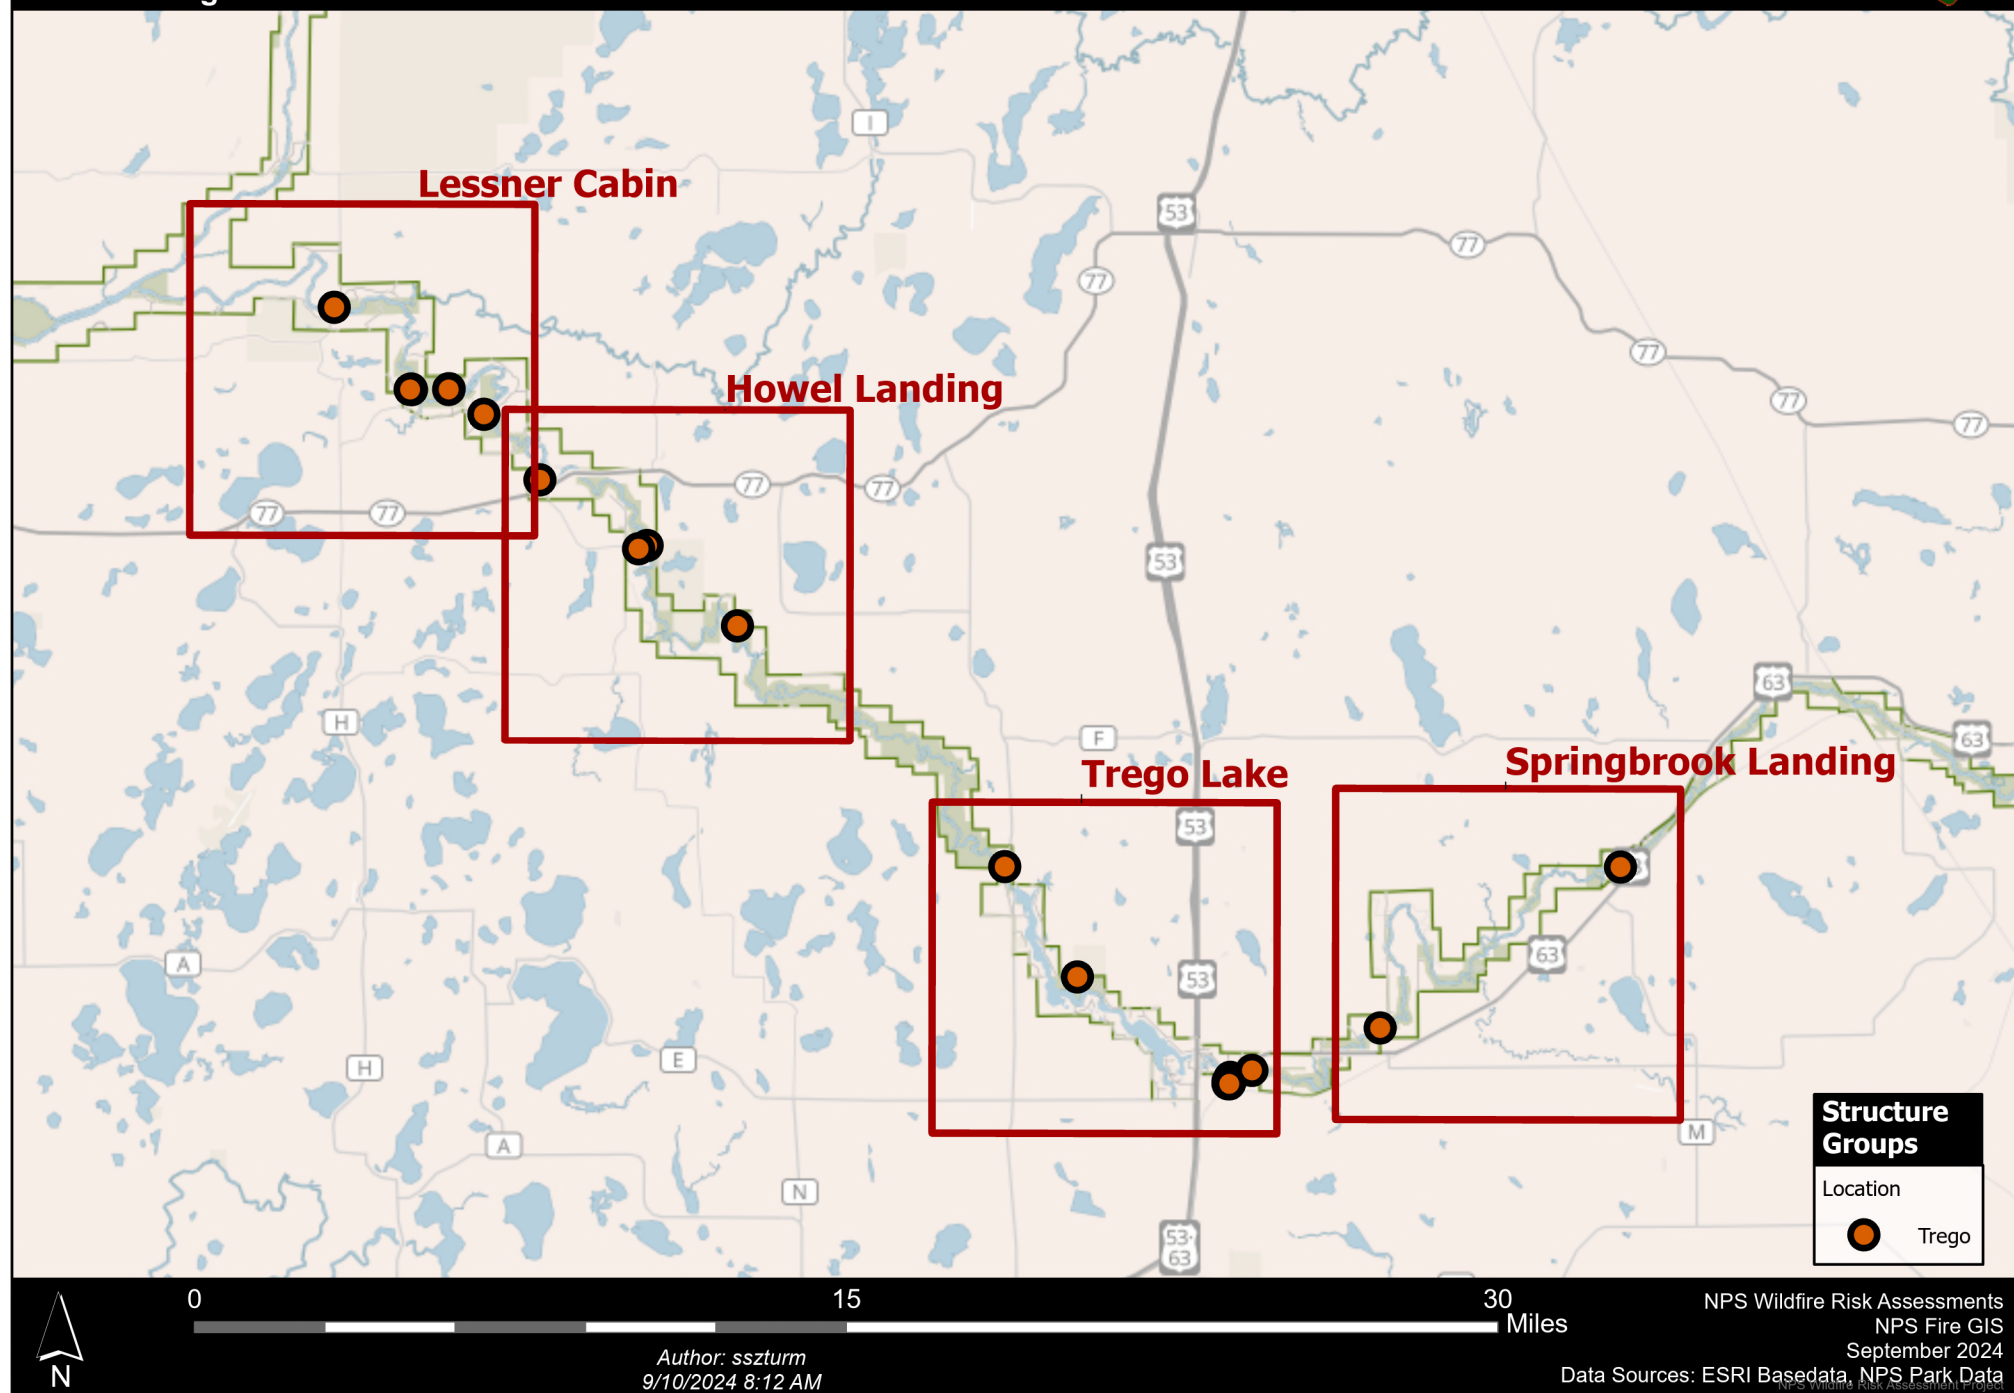

Howel Landing

SACN - Saint Croix National Scenic River

National Park Service
U.S. Department of the Interior

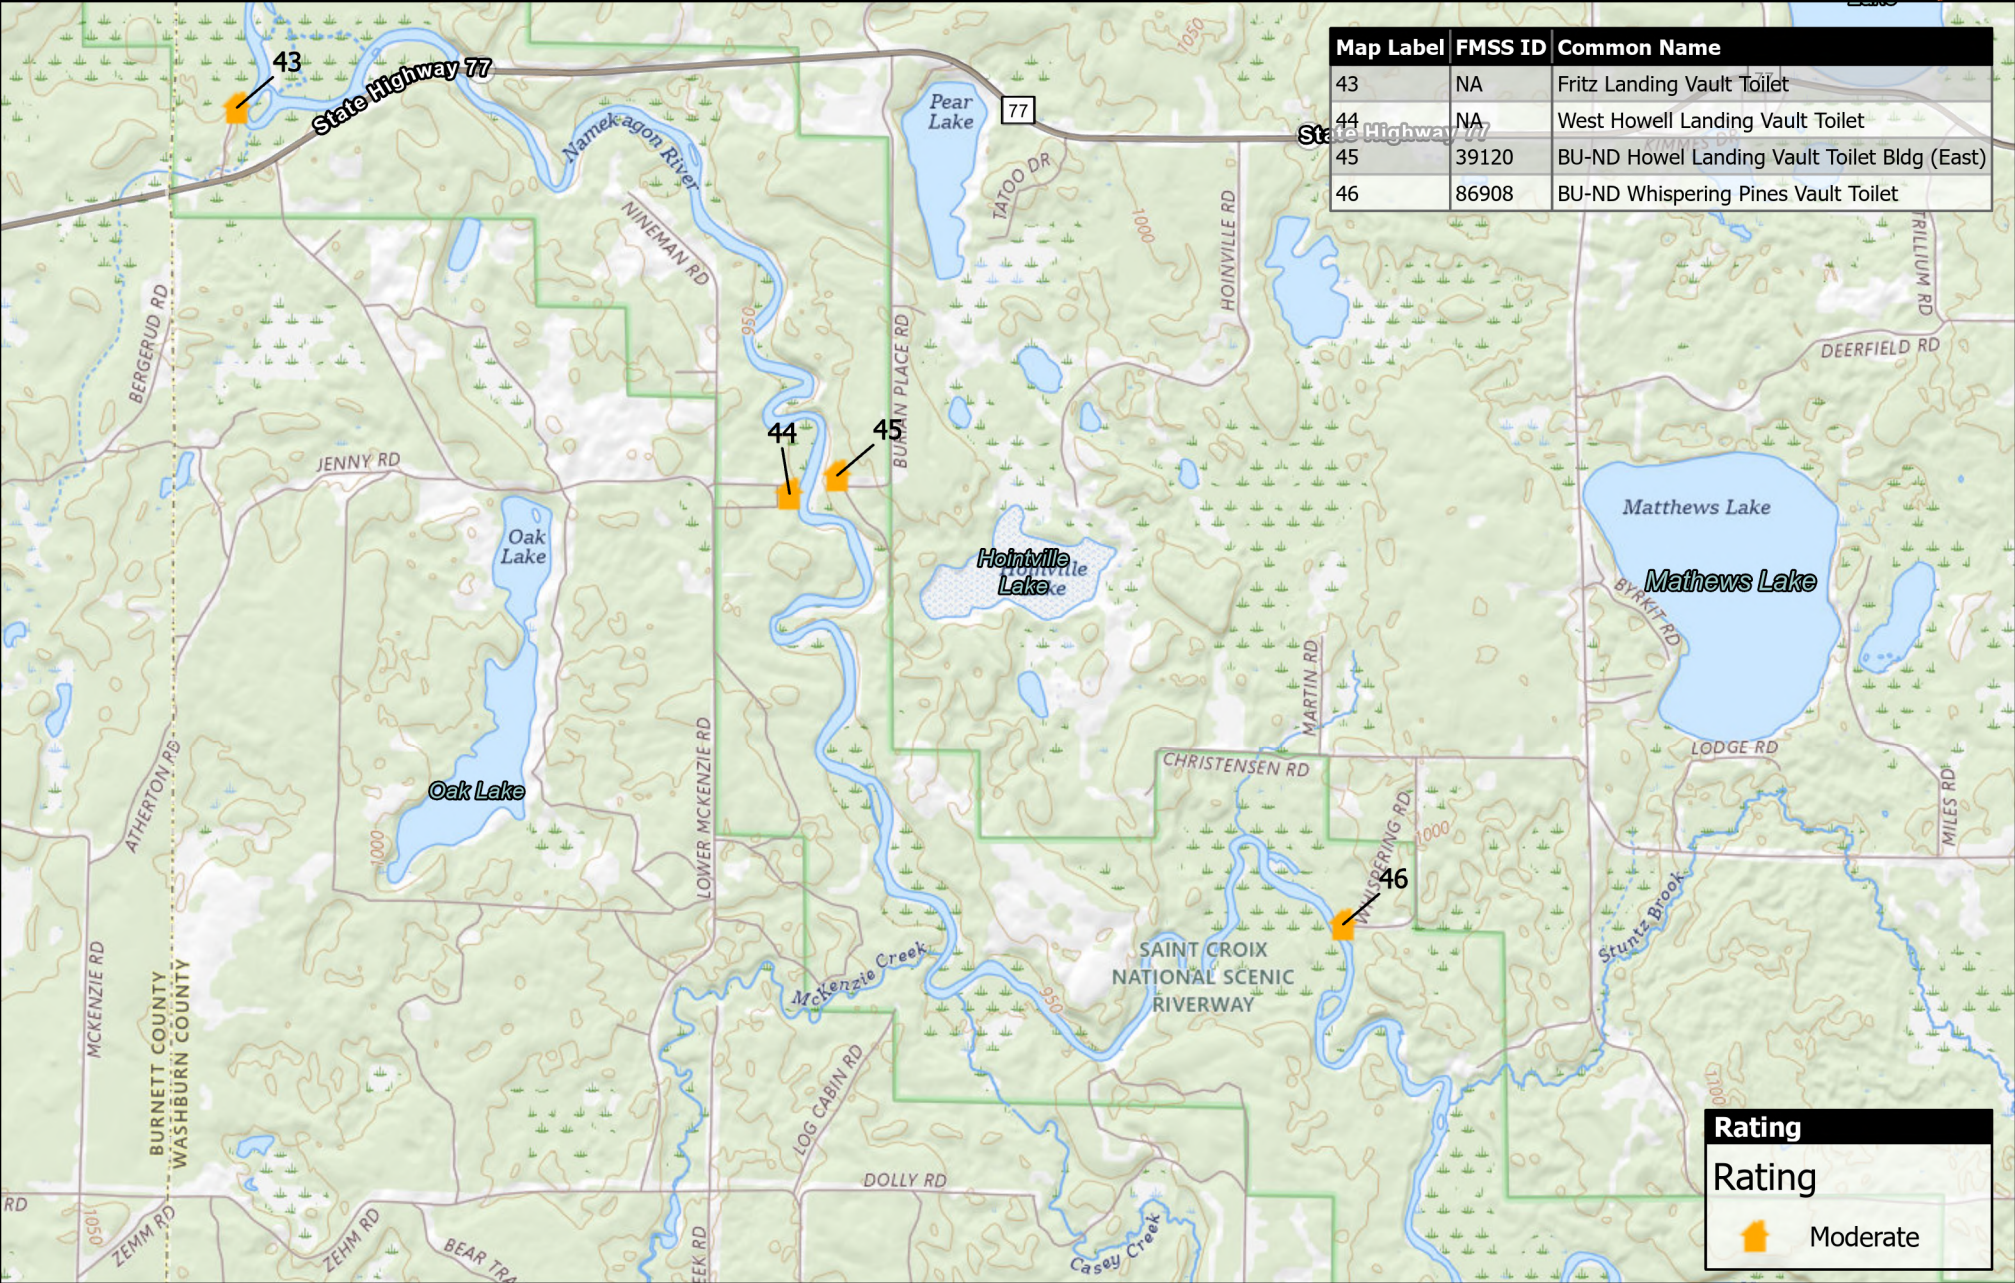

Author: sszturm
9/10/2024 8:00 AM


0

4 Miles

NPS Wildfire Risk Assessments
NPS Fire GIS
September 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project

Lessner Cabin

SACN - Saint Croix National Scenic River

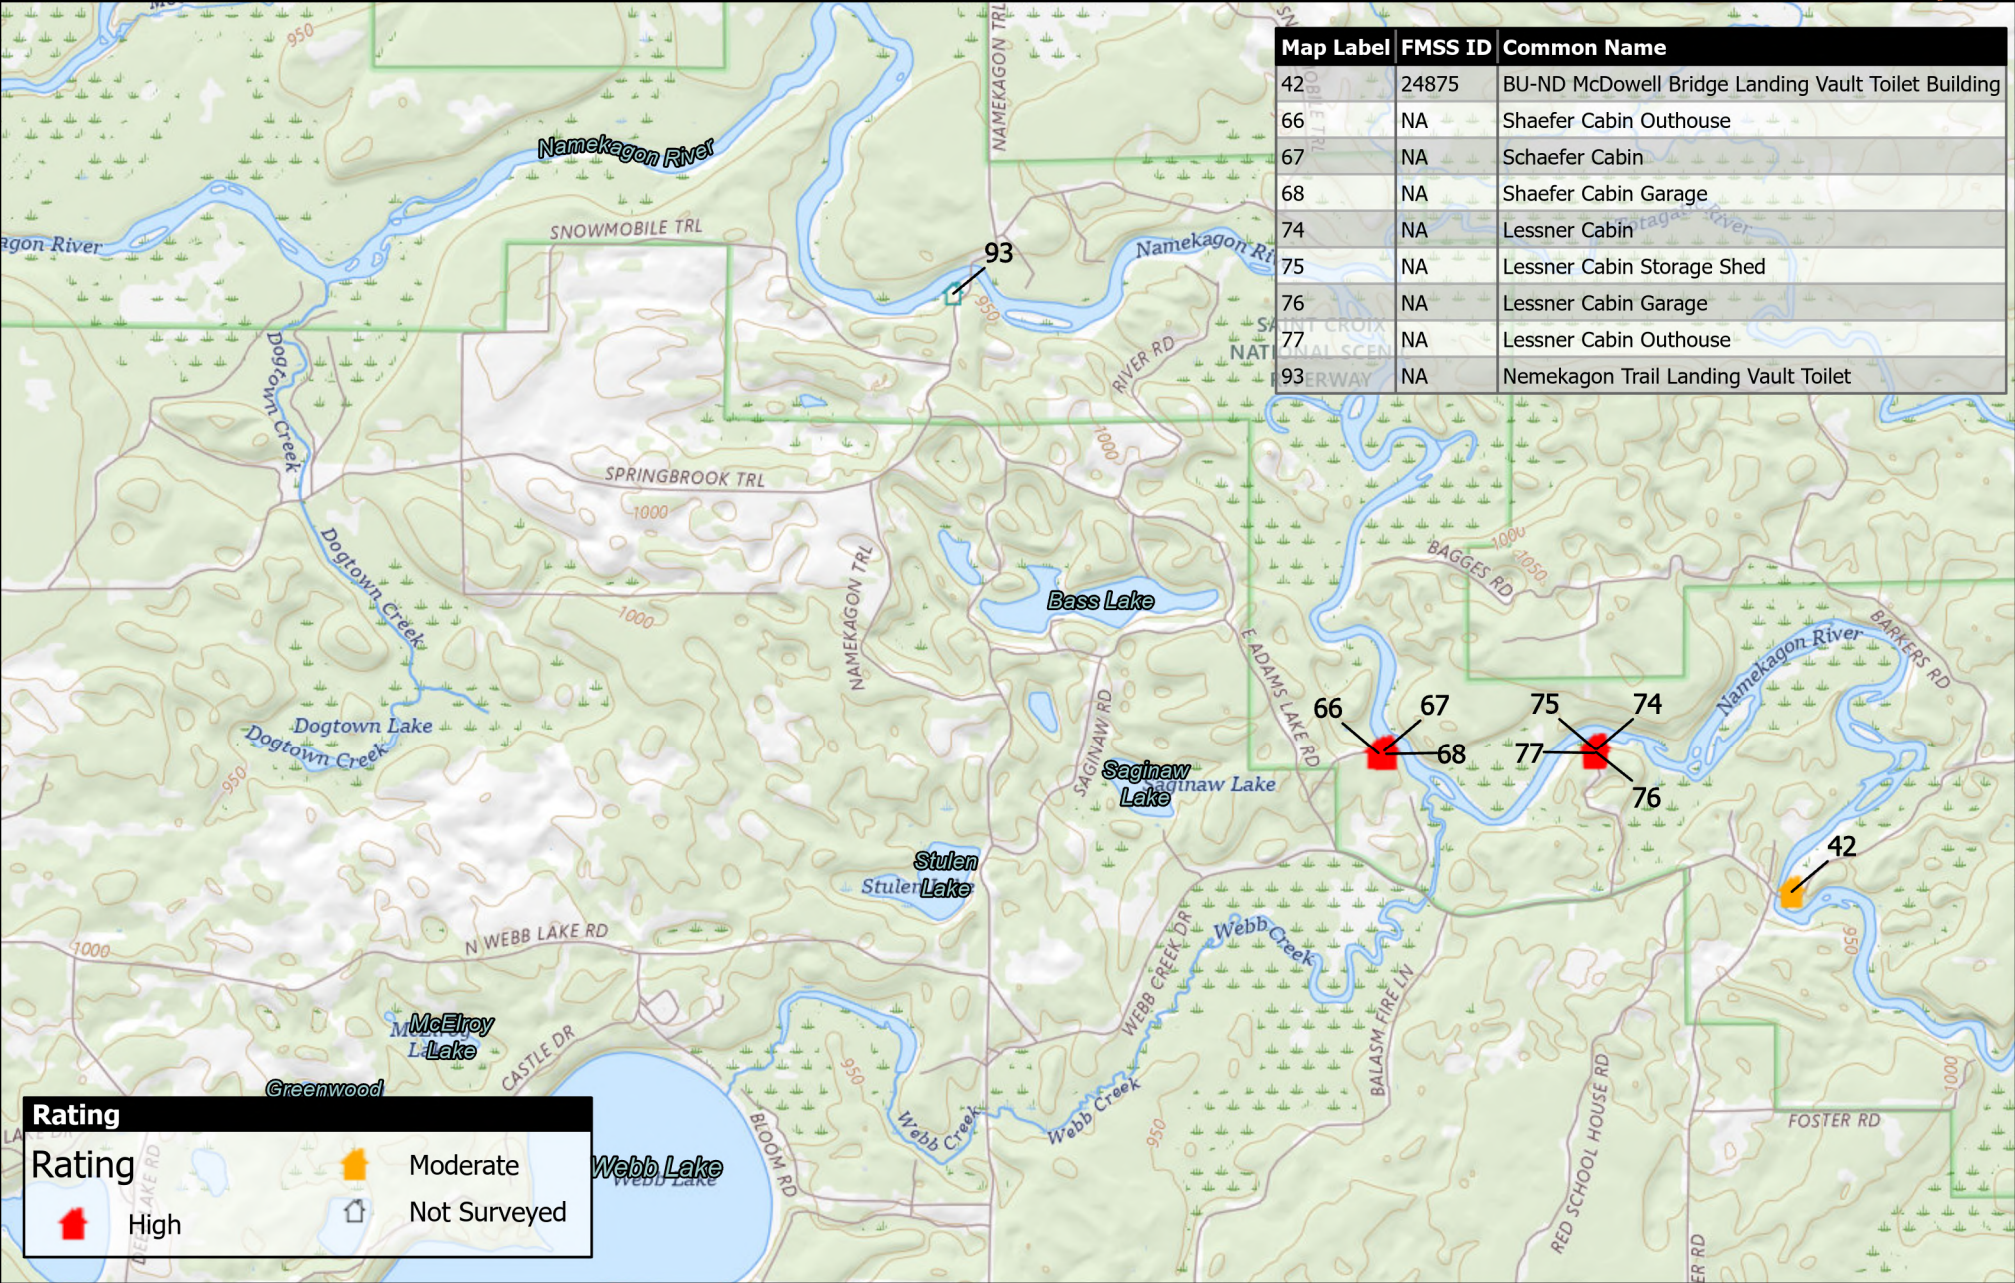

Author: sszturm
9/10/2024 8:28 AM




Springbrook Landing

SACN - Saint Croix National Scenic River

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
49	39114	BU-ND Earl Park Vault Toilet Building
73	NA	Springbrook Landing Vault Toilet

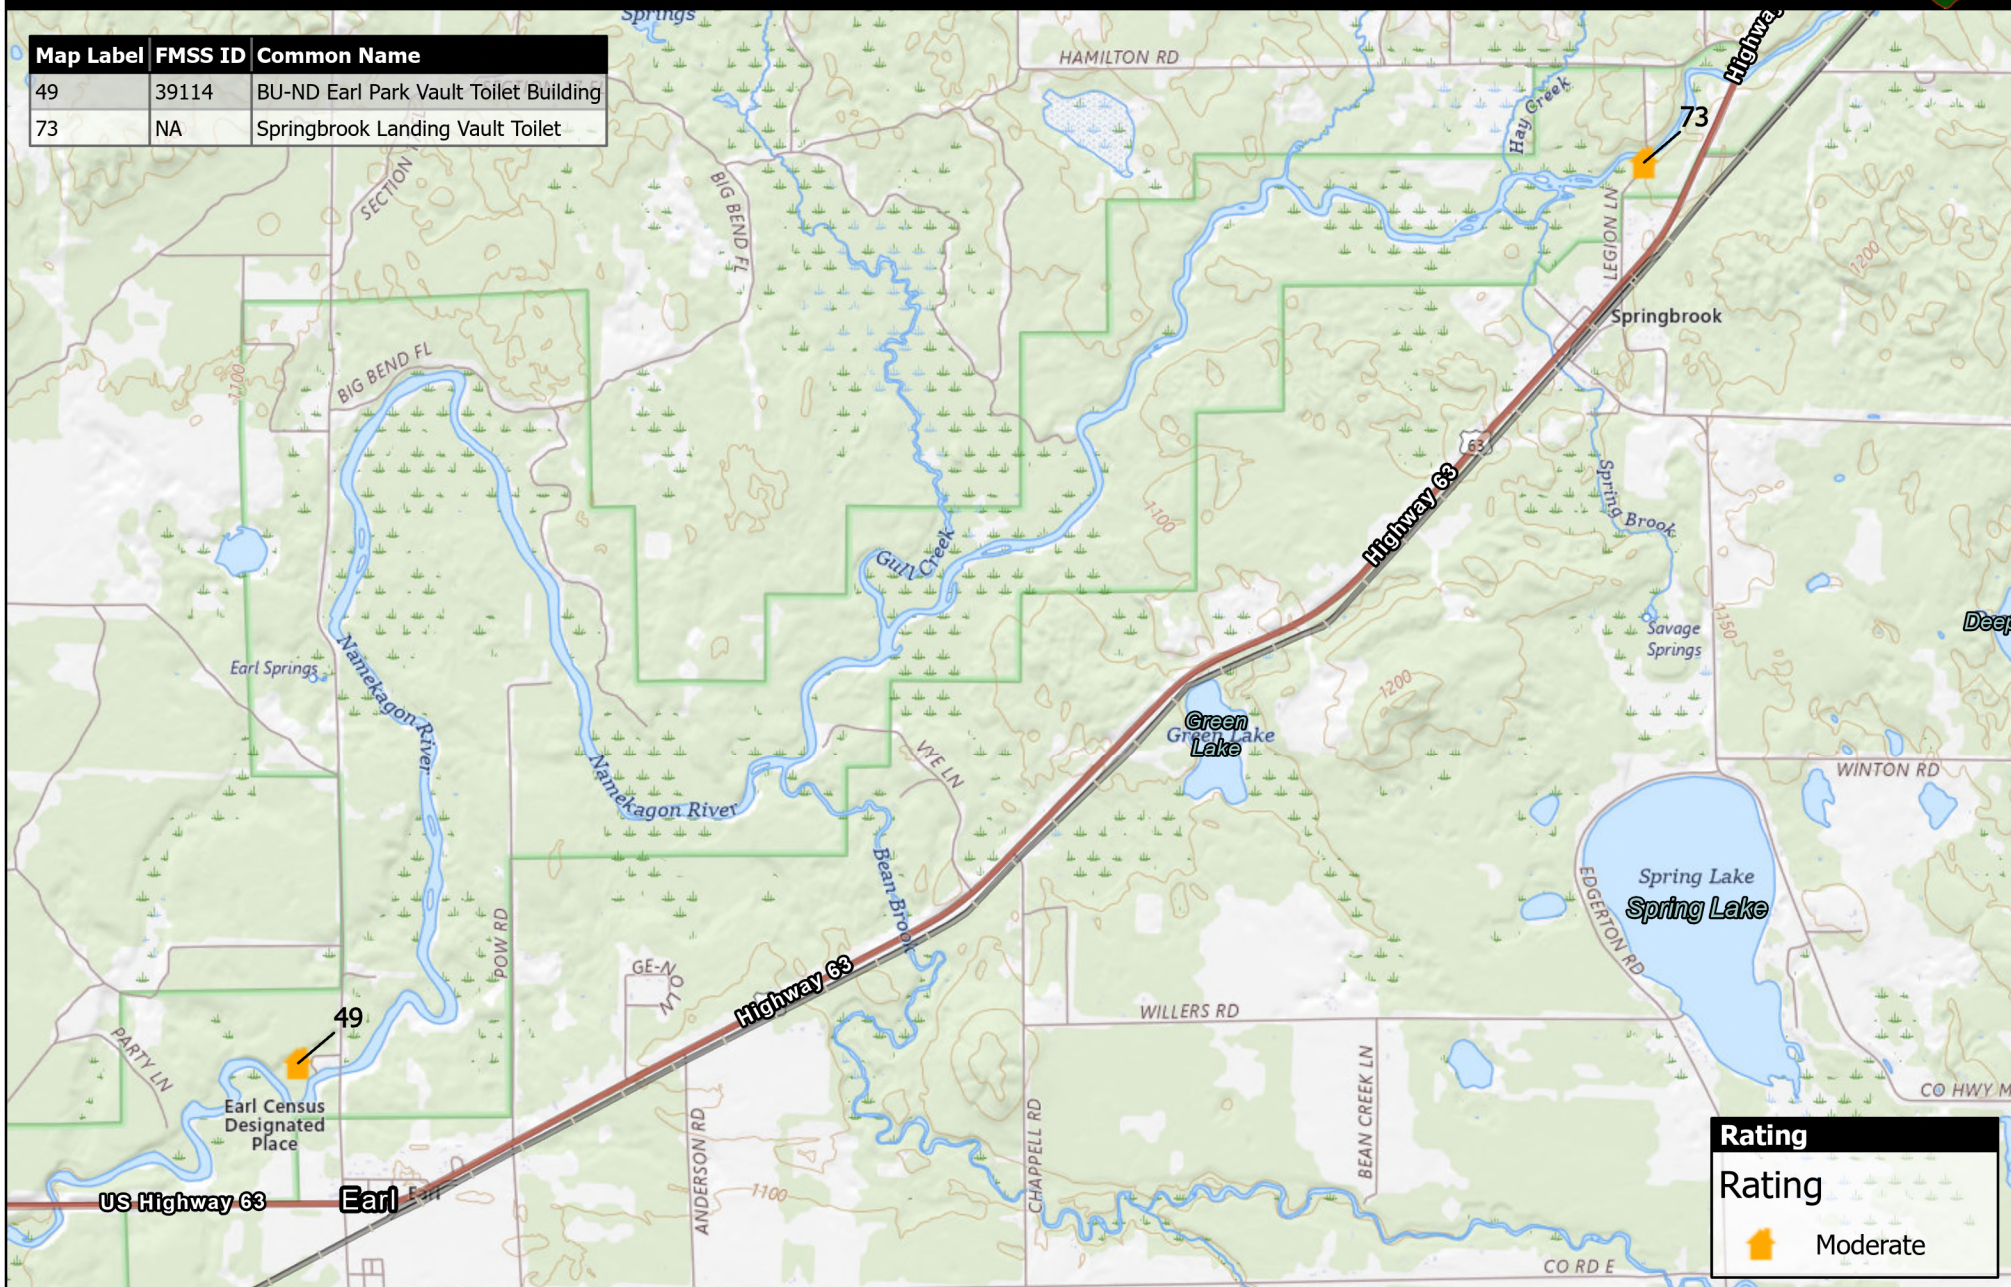

Rating

Rating

Moderate



Author: sszturm
9/10/2024 8:13 AM

0

4 Miles

NPS Wildfire Risk Assessments
NPS Fire GIS
September 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project

SACN - Saint Croix National Scenic River



0

NPS Wildfire Risk Assessments
NPS Fire GIS
September 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: QMIS #00ND001 ND Namekagon Quarters Building

Unit - Location: SACN - Trego

FMSS ID: 24827, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 54.238' N 91° 48.988' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Namekagon Visitor Center

Revisit Interval: 4 yrs

Map Label: 64

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None



Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.

08/10/2020 - No treatment needed on this structure.

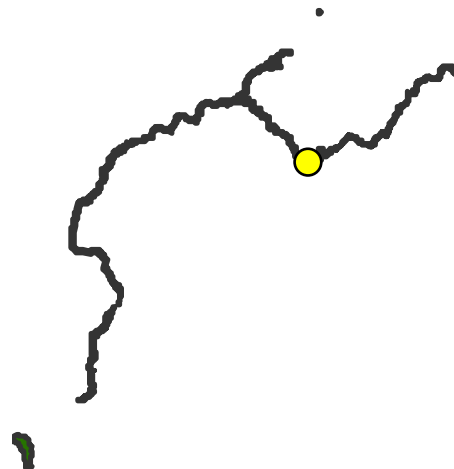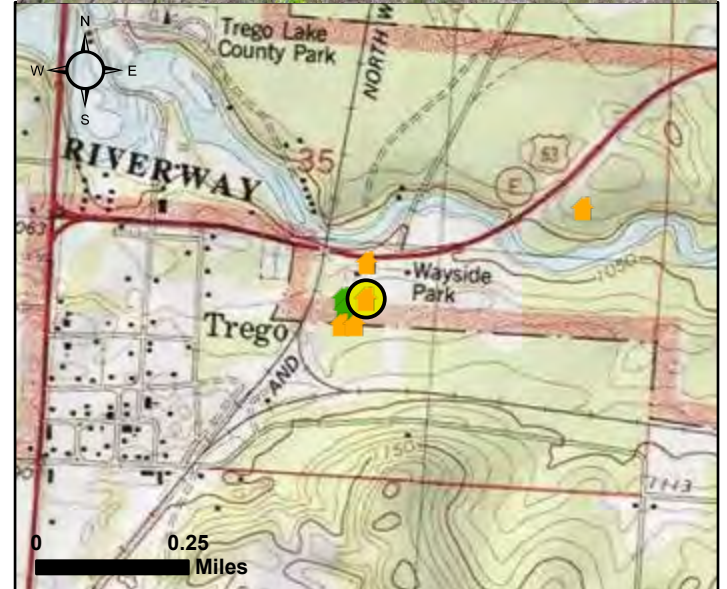



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND McDowell Bridge Landing Vault Toilet Building

Unit - Location: SACN - Trego

FMSS ID: 24875, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 46° 03.491' N 92° 03.892' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 42

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A



Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.

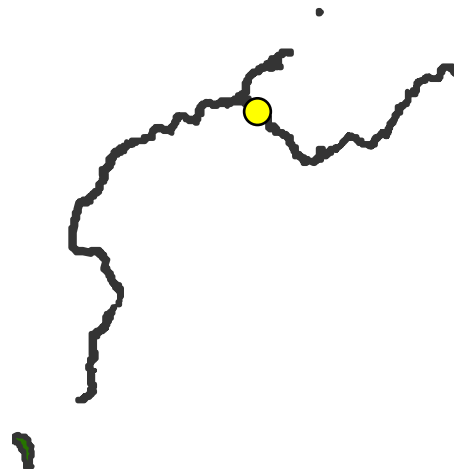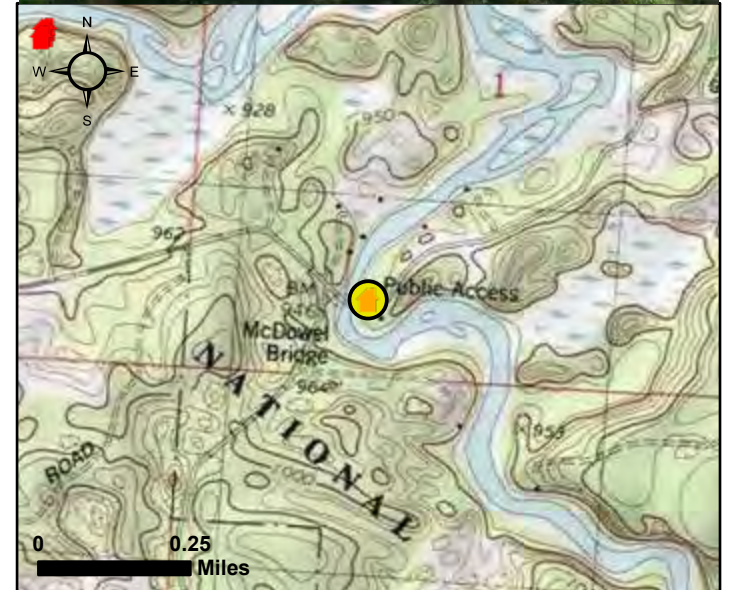



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Namekagon Maintenance Gas Storage

Unit - Location: SACN - Trego

FMSS ID: 24820, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 6, 2023

Coordinates (DDM): 45° 54.235' N 91° 49.037' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Namekagon Visitor Center

Revisit Interval: 4 yrs

Map Label: 58

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy. 08/10/2020-30ft treatment completed. Veg cut and chipped around the west side of the building.

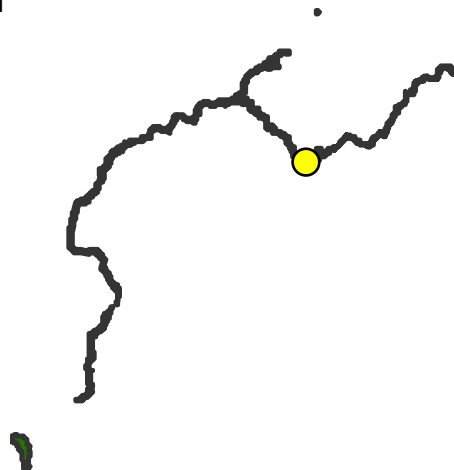



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Whispering Pines Vault Toilet

Unit - Location: SACN - Trego

FMSS ID: 86908, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 46° 00.563' N 91° 58.831' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 46

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy. 08/08/2020-30ft treatment completed. Many oaks in the area that were left due to oak wilt.

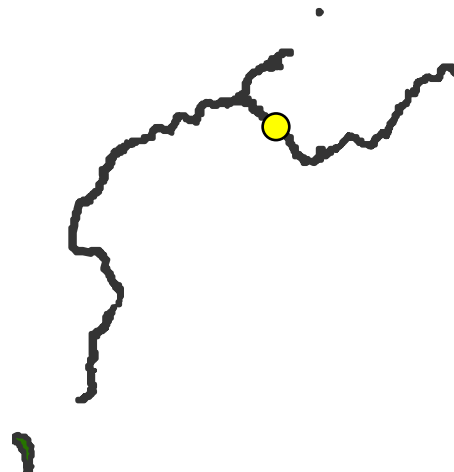



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Earl Park Vault Toilet Building

Unit - Location: SACN - Trego

FMSS ID: 39114, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 54.974' N 91° 45.998' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 49

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None


Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.

08/10/2020- 30ft treatment completed

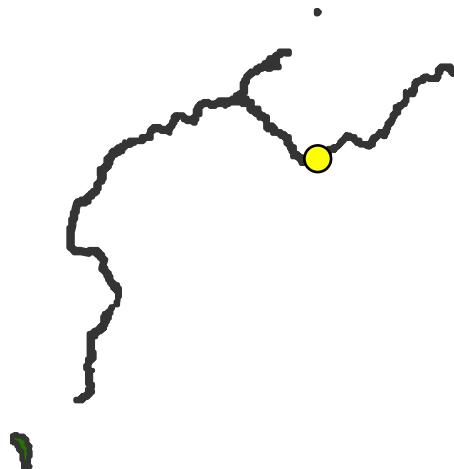




NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Howel Landing Vault Toilet Bldg (East)
Unit - Location: SACN - Trego
FMSS ID: 39120, **Local ID:**
Structure Type, Use: Toilet, Public
Owner: National Park Service
Field Crew, Visit Date: S Szturm , July 6, 2023
Coordinates (DDM): 46° 01.676' N 92° 00.634' W

Rating: Moderate
ProtectionLevel: Full,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 4 yrs
Map Label: 45

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy. 08/09/2020 30ft treatment completed. There is a lot of oak in this area that could not be cut due to oak wilt restrictions. Also a lot of poison ivy.

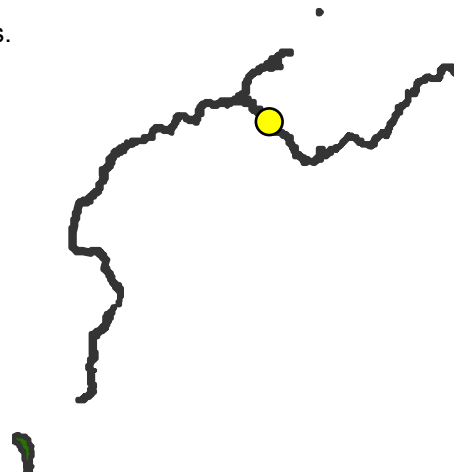

Trego - 45





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Namekagon Maintenance Shop

Unit - Location: SACN - Trego

FMSS ID: 24819, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 6, 2023

Coordinates (DDM): 45° 54.220' N 91° 49.030' W

Rating: Low

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Namekagon Visitor Center

Revisit Interval: 4 yrs

Map Label: 59

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: None


Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.

08/10/20- No 30ft treatment needed on this structure

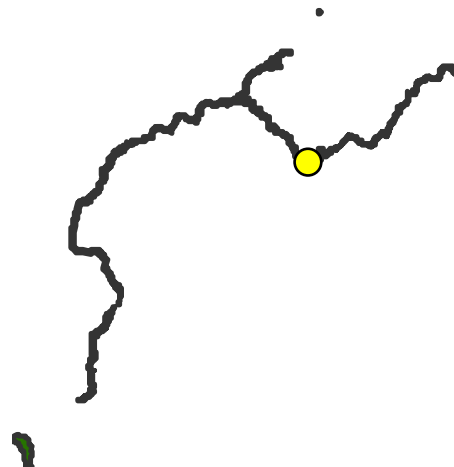



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Namekagon Visitor Center Building

Unit - Location: SACN - Trego

FMSS ID: 24813, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 54.289' N 91° 48.993' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes,

Revisit Interval: 4 yrs

Map Label: 63

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: None



Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.

Facilit backs into side of a hill. The area around the facility is planted with native plants and not mowed. 08/10/2020-30ft treatment completed grass has been mowed to 30ft mark, large red pine limbed up & reprod on northwest corner of the building has been thinned.

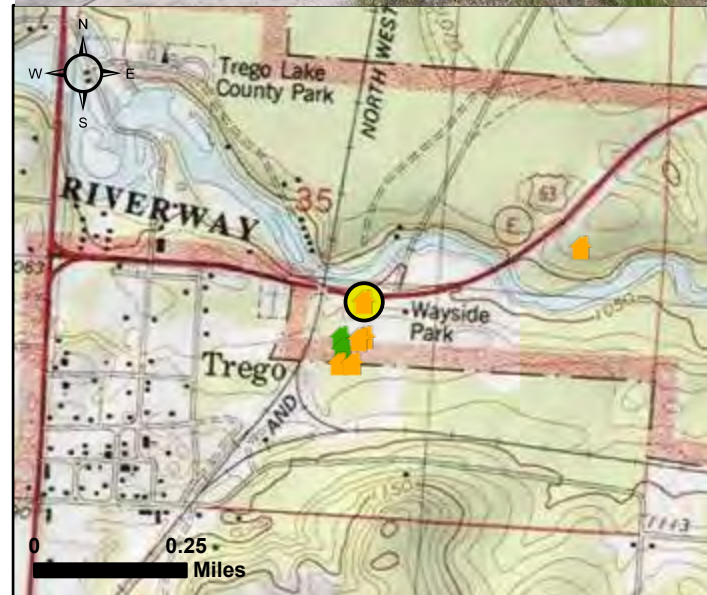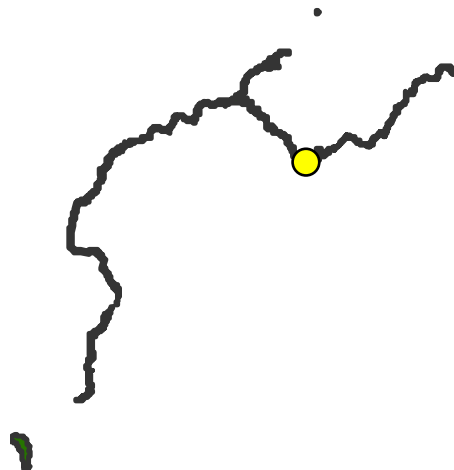



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND County K Vault Toilet Building

Unit - Location: SACN - Trego

FMSS ID: 39117, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 57.214' N 91° 53.494' W

Rating: Low

Protection Level: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 47

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30 in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy. 08/09/2020-30ft treatment completed. Vegetation removed and chipped. Pines limbed up. Wet area on east side of building 15ft away.

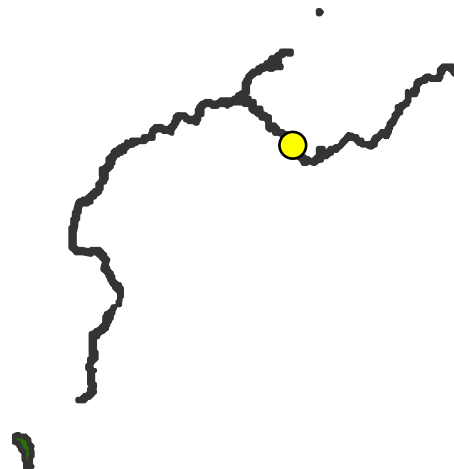



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Fritz Landing Vault Toilet

Unit - Location: SACN - Trego

FMSS ID: NA, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 46° 02.585' N 92° 02.775' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 43

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None



Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

<FNT style="Bold Italic">Comments:</FNT>

08/08/2020-30's; treatment completed. A lot of dead and down beyond the 30ft mark.

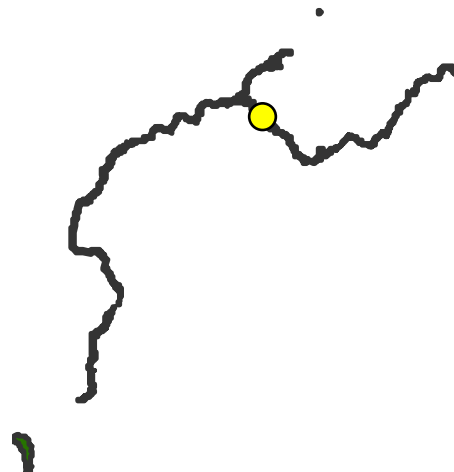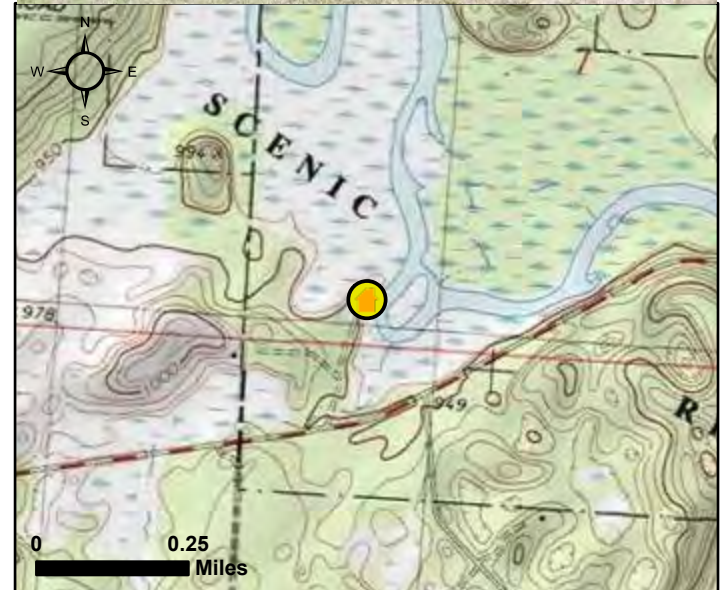



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: West Howell Landing Vault Toilet

Unit - Location: SACN - Trego

FMSS ID: NA, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 46° 01.631' N 92° 00.805' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 44

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: 08/09/2020-30ft treatment completed, Access to area is with chipper is difficult, you must use an access road (back to straitened up the chipper) to get in between the bollards. Many oaks left in the 30ft range(oak wilt restrictions)

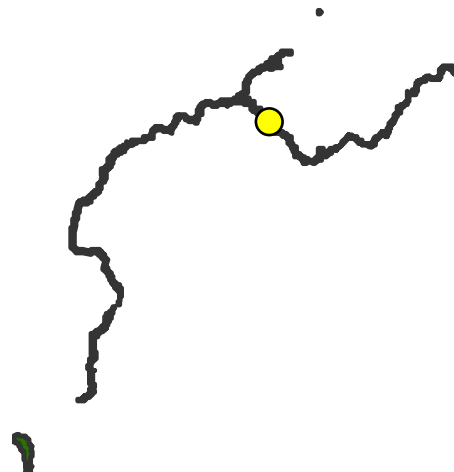



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Trego Lake Trail Vault Toilet

Unit - Location: SACN - Trego

FMSS ID: NA, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 55.683' N 91° 52.043' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 48

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: 08/09/2020-30ft treatment completed, Ground cedar is in the area, it is a good carpet shading the ground.

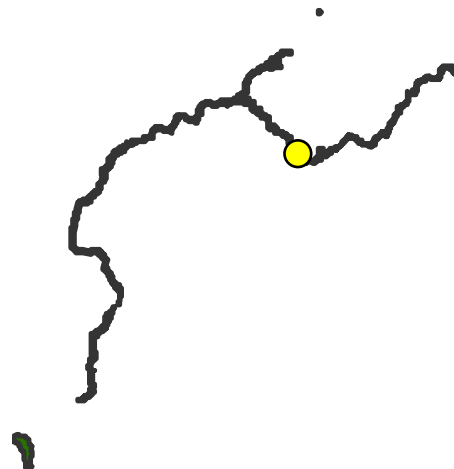



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Nemekagon Fire Cache

Unit - Location: SACN - Trego

FMSS ID: NA, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 54.234' N 91° 49.000' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Namekagon Visitor Center

Revisit Interval: 4 yrs

Map Label: 62

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Closed, 6in to 30in masonry exposed



Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: Overhead hazards will limit aircraft

Comments: 08/10/2020- No treatment needed on this structure

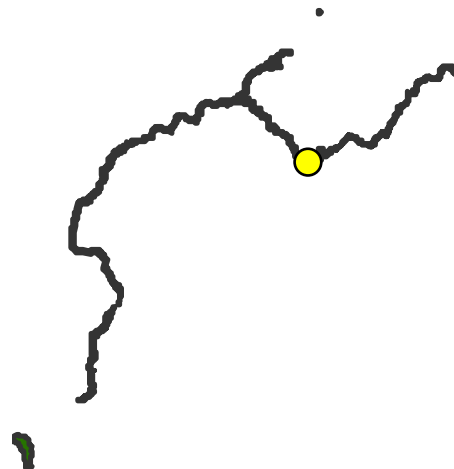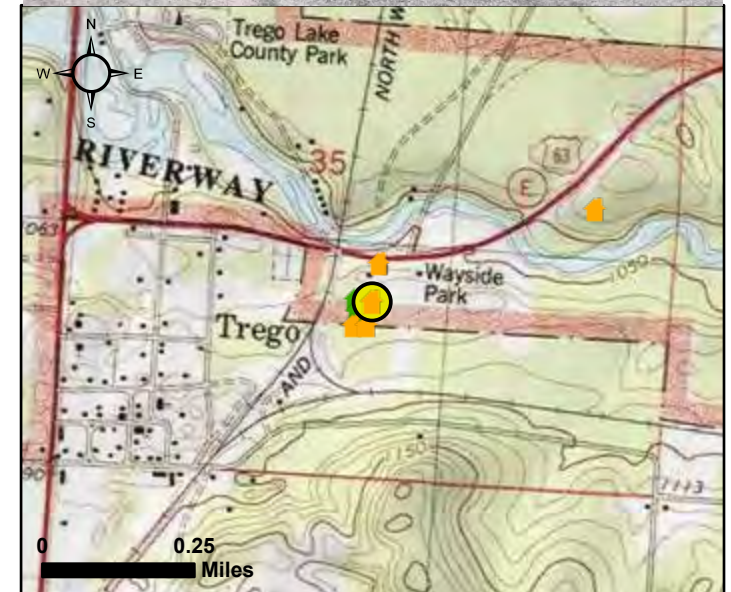



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Trego Nature Trail Vault Toilet

Unit - Location: SACN - Trego

FMSS ID: NA, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 54.385' N 91° 48.558' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 72

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A



Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: 08/10/2020 - 30ft treatment completed around the structure

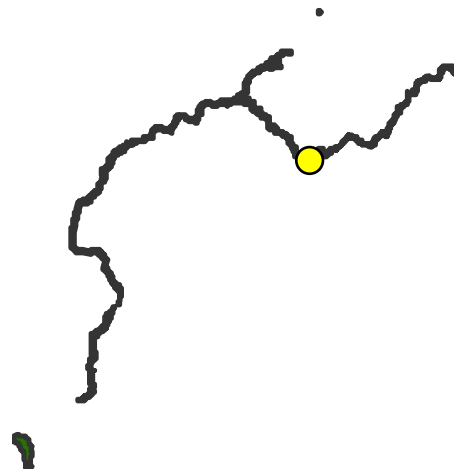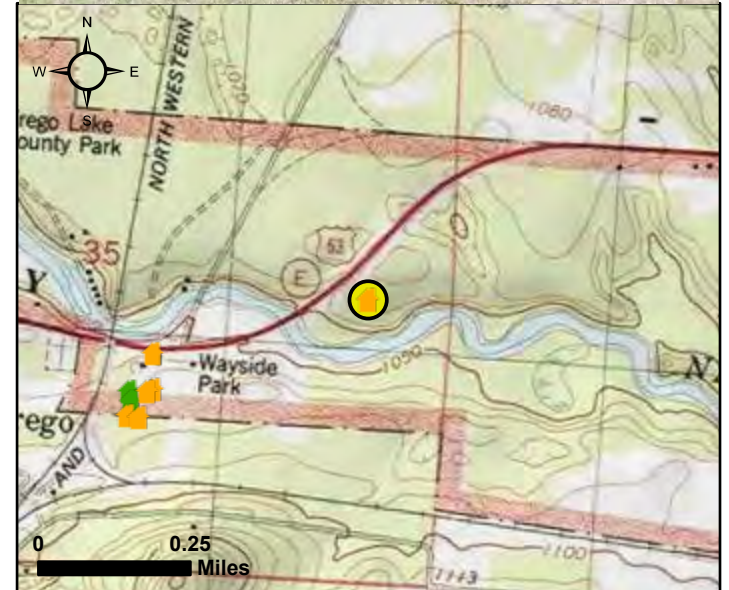



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Springbrook Landing Vault Toilet

Unit - Location: SACN - Trego

FMSS ID: NA, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: S Szturm , July 6, 2023

Coordinates (DDM): 45° 57.207' N 91° 41.200' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 4 yrs

Map Label: 73

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A



Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: 08/10/20- 30ft treatment completed.

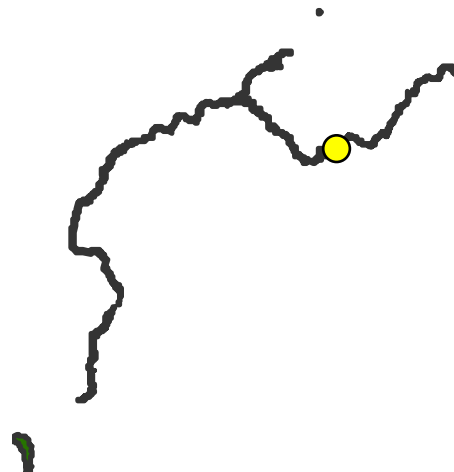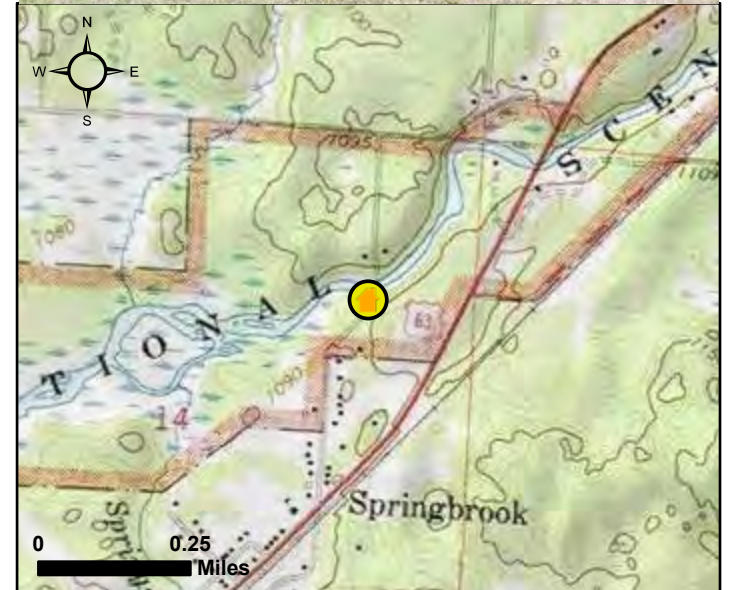



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Nemekagon Maintenance Storage Garage

Unit - Location: SACN - Trego

FMSS ID: 24822, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 6, 2023

Coordinates (DDM): 45° 54.199' N 91° 49.037' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Namekagon Visitor Center

Revisit Interval: 6 yrs

Map Label: 57

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: 08/10/2020-30ft treatment completed around the south & west side of the building.

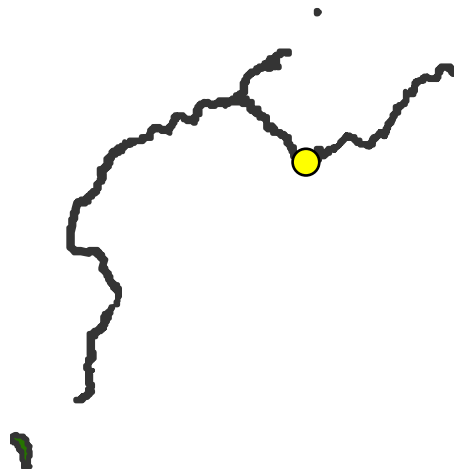



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: BU-ND Namekagon Maintenance East Cold Storage

Unit - Location: SACN - Trego

FMSS ID: 24821, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo , July 6, 2023

Coordinates (DDM): 45° 54.198' N 91° 49.011' W

Rating: Moderate

ProtectionLevel: Full,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Namekagon Visitor Center

Revisit Interval: 4 yrs

Map Label: 61

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments: Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.

08/10/2020- No treatment needed on this structure.

