


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



CARE - Capitol Reef National Park - Overview

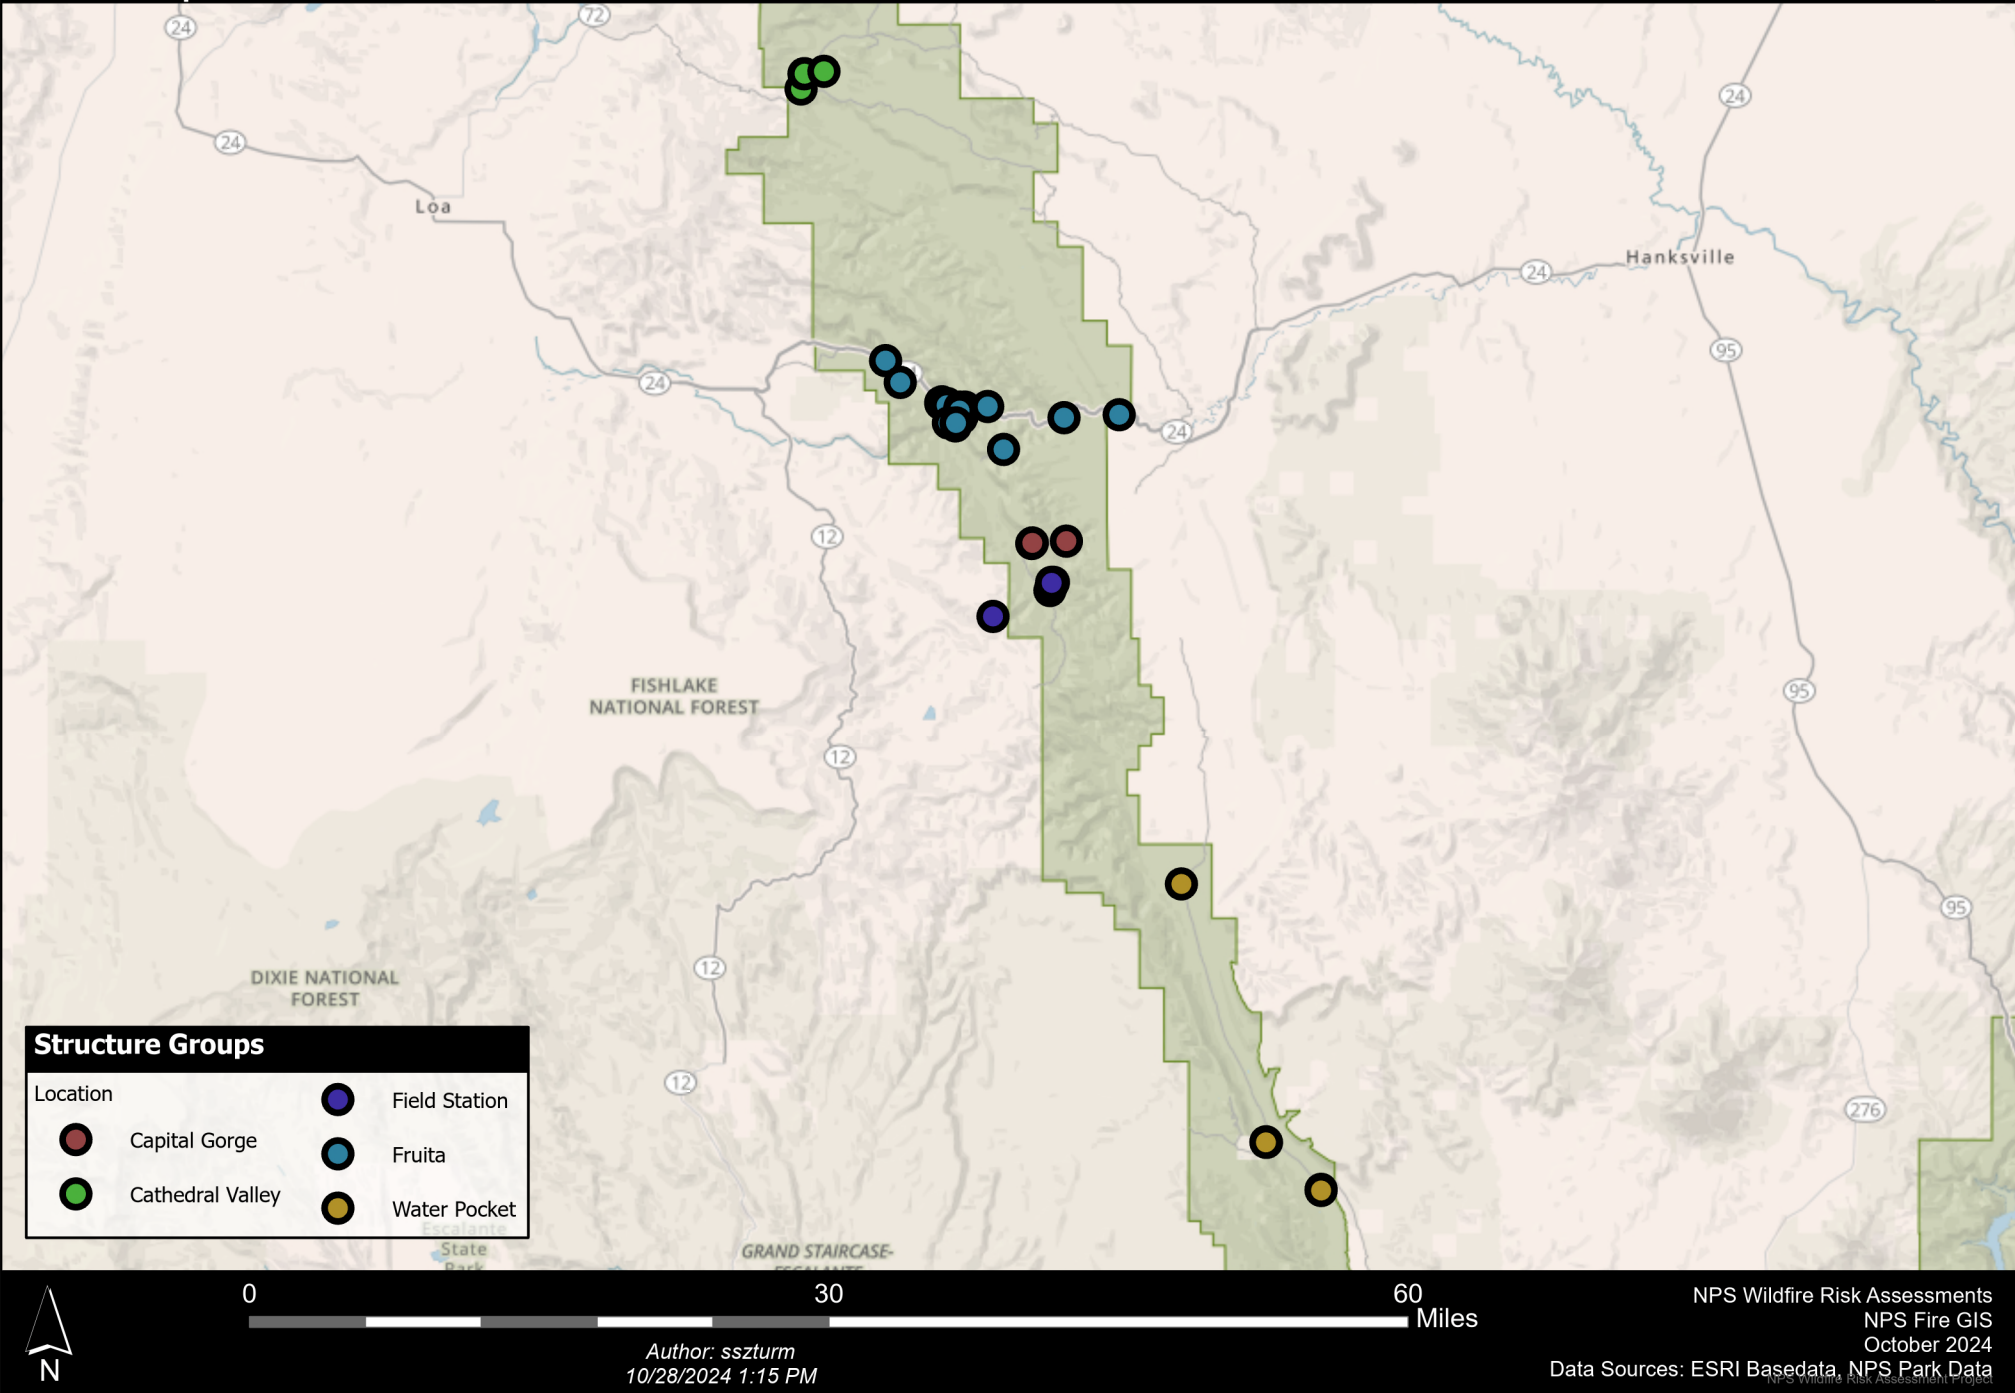


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



CARE - Water Pocket - Overview

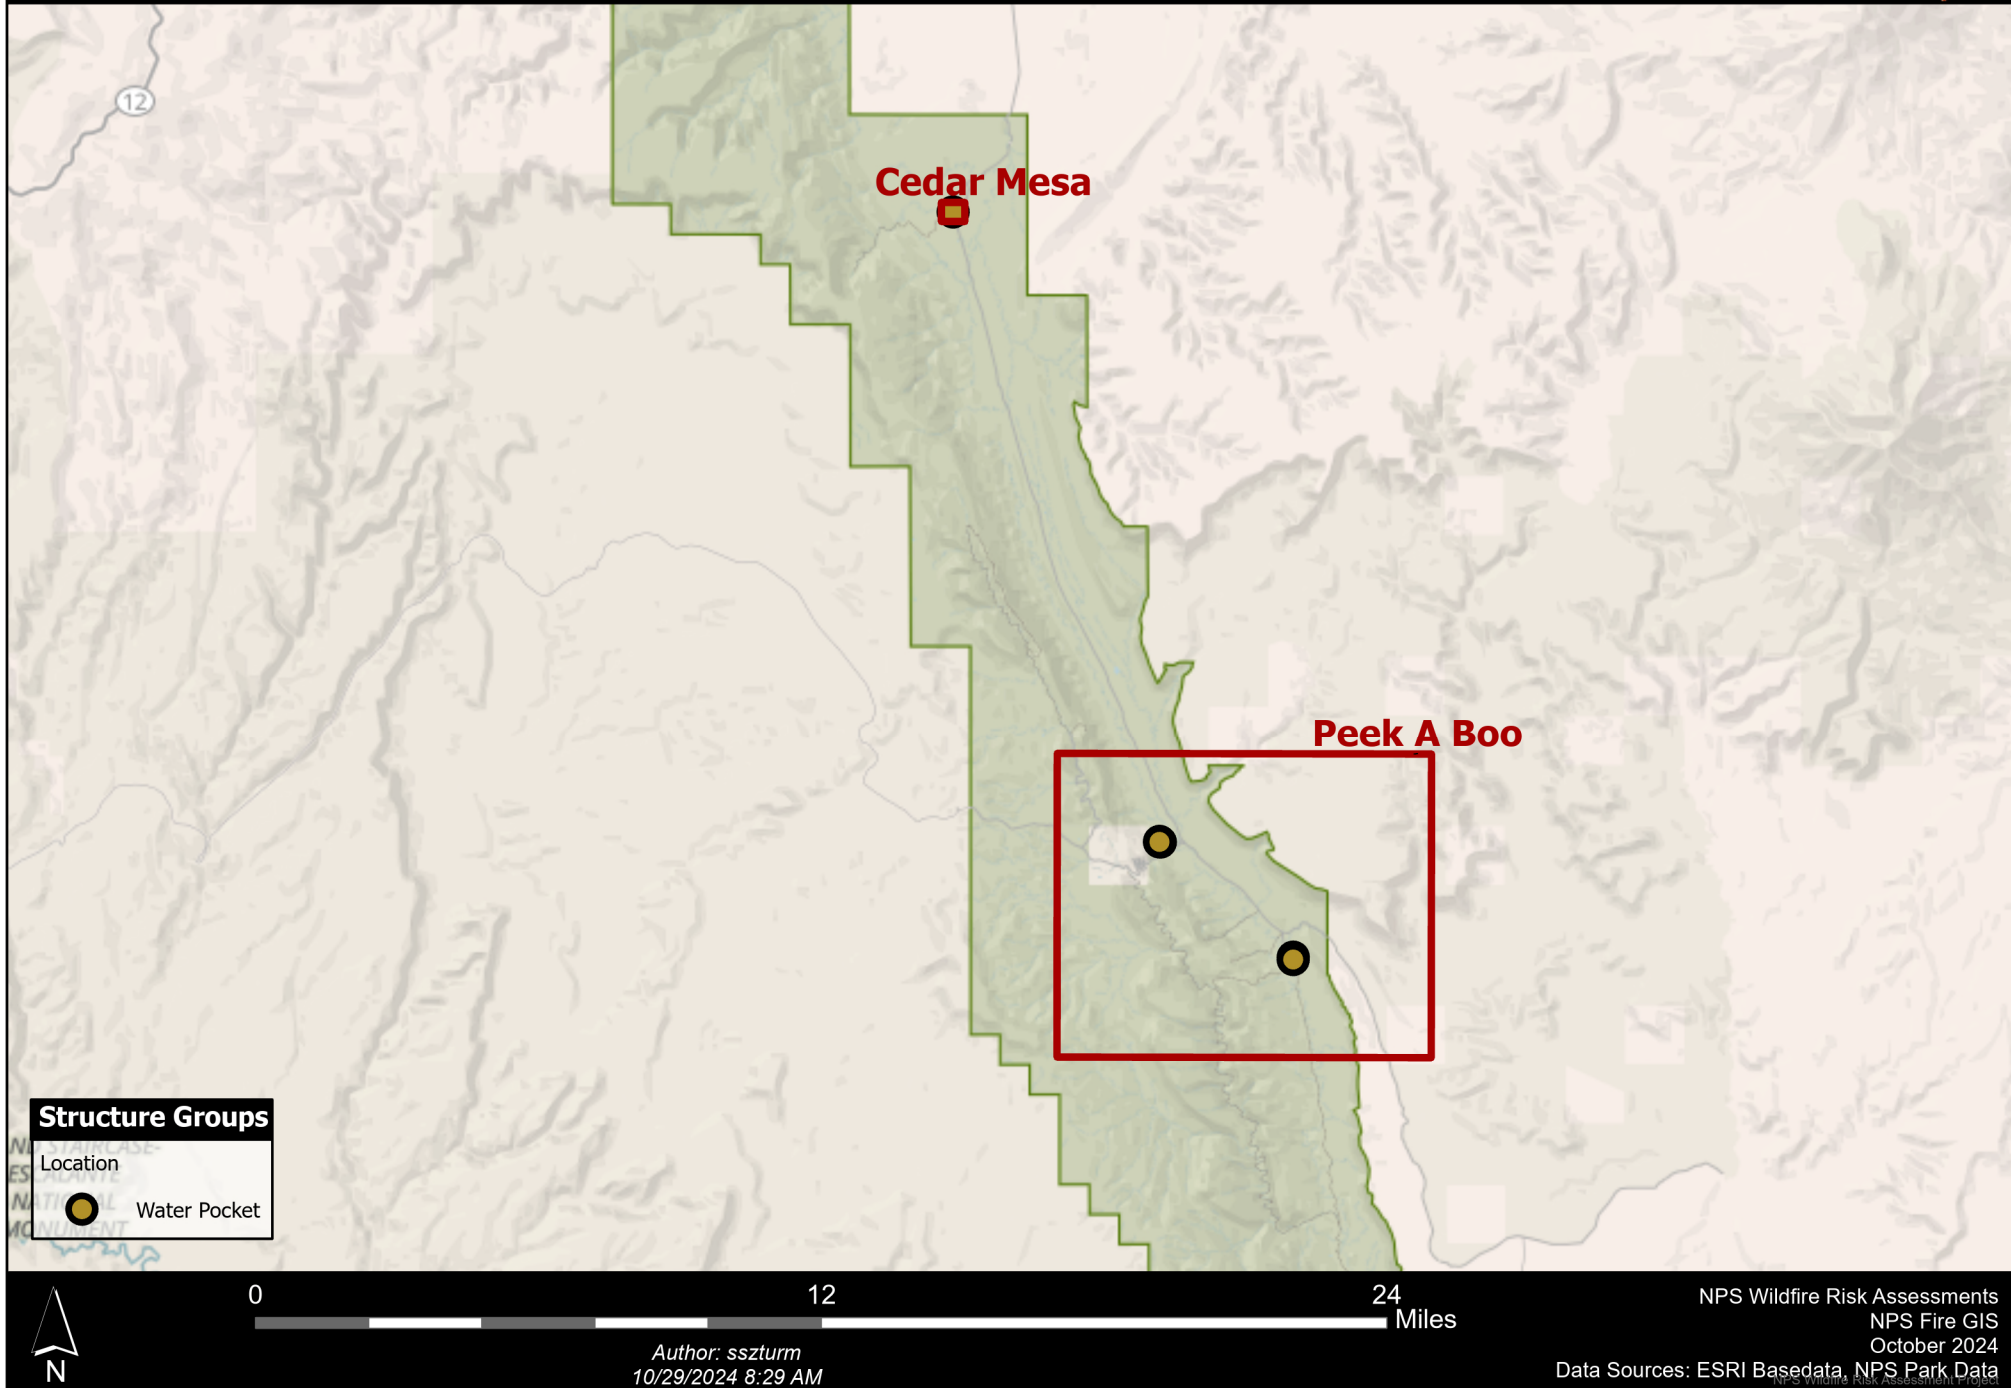




Rating

Rating

Moderate


Map Label	FMSS ID	Common Name
81	70689	Cedar Mesa Vault Toilet

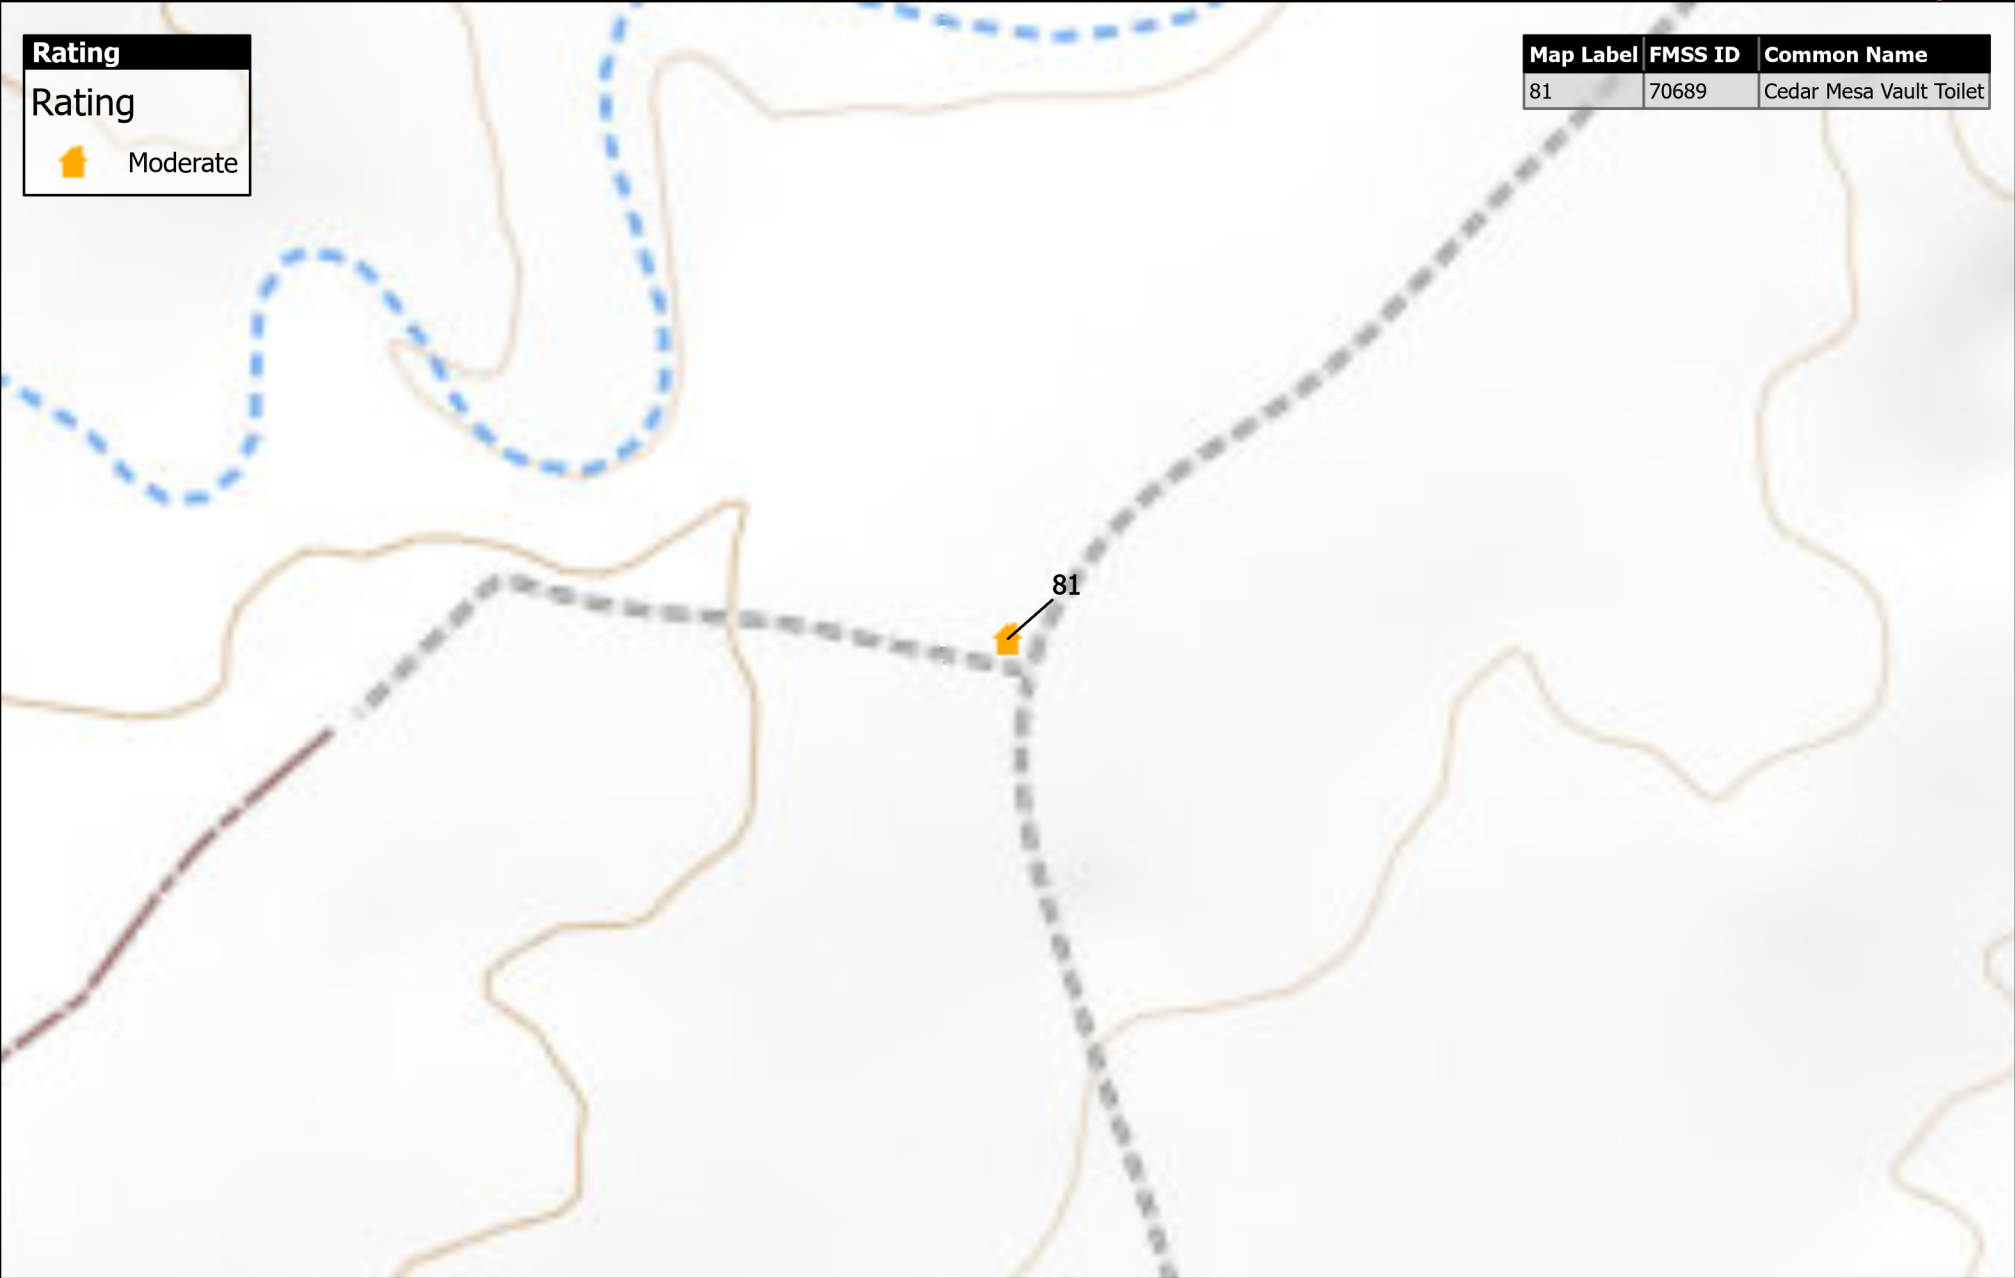

Author: sszturm
10/29/2024 8:23 AM



Peek A Boo
CARE - Capitol Reef National Park

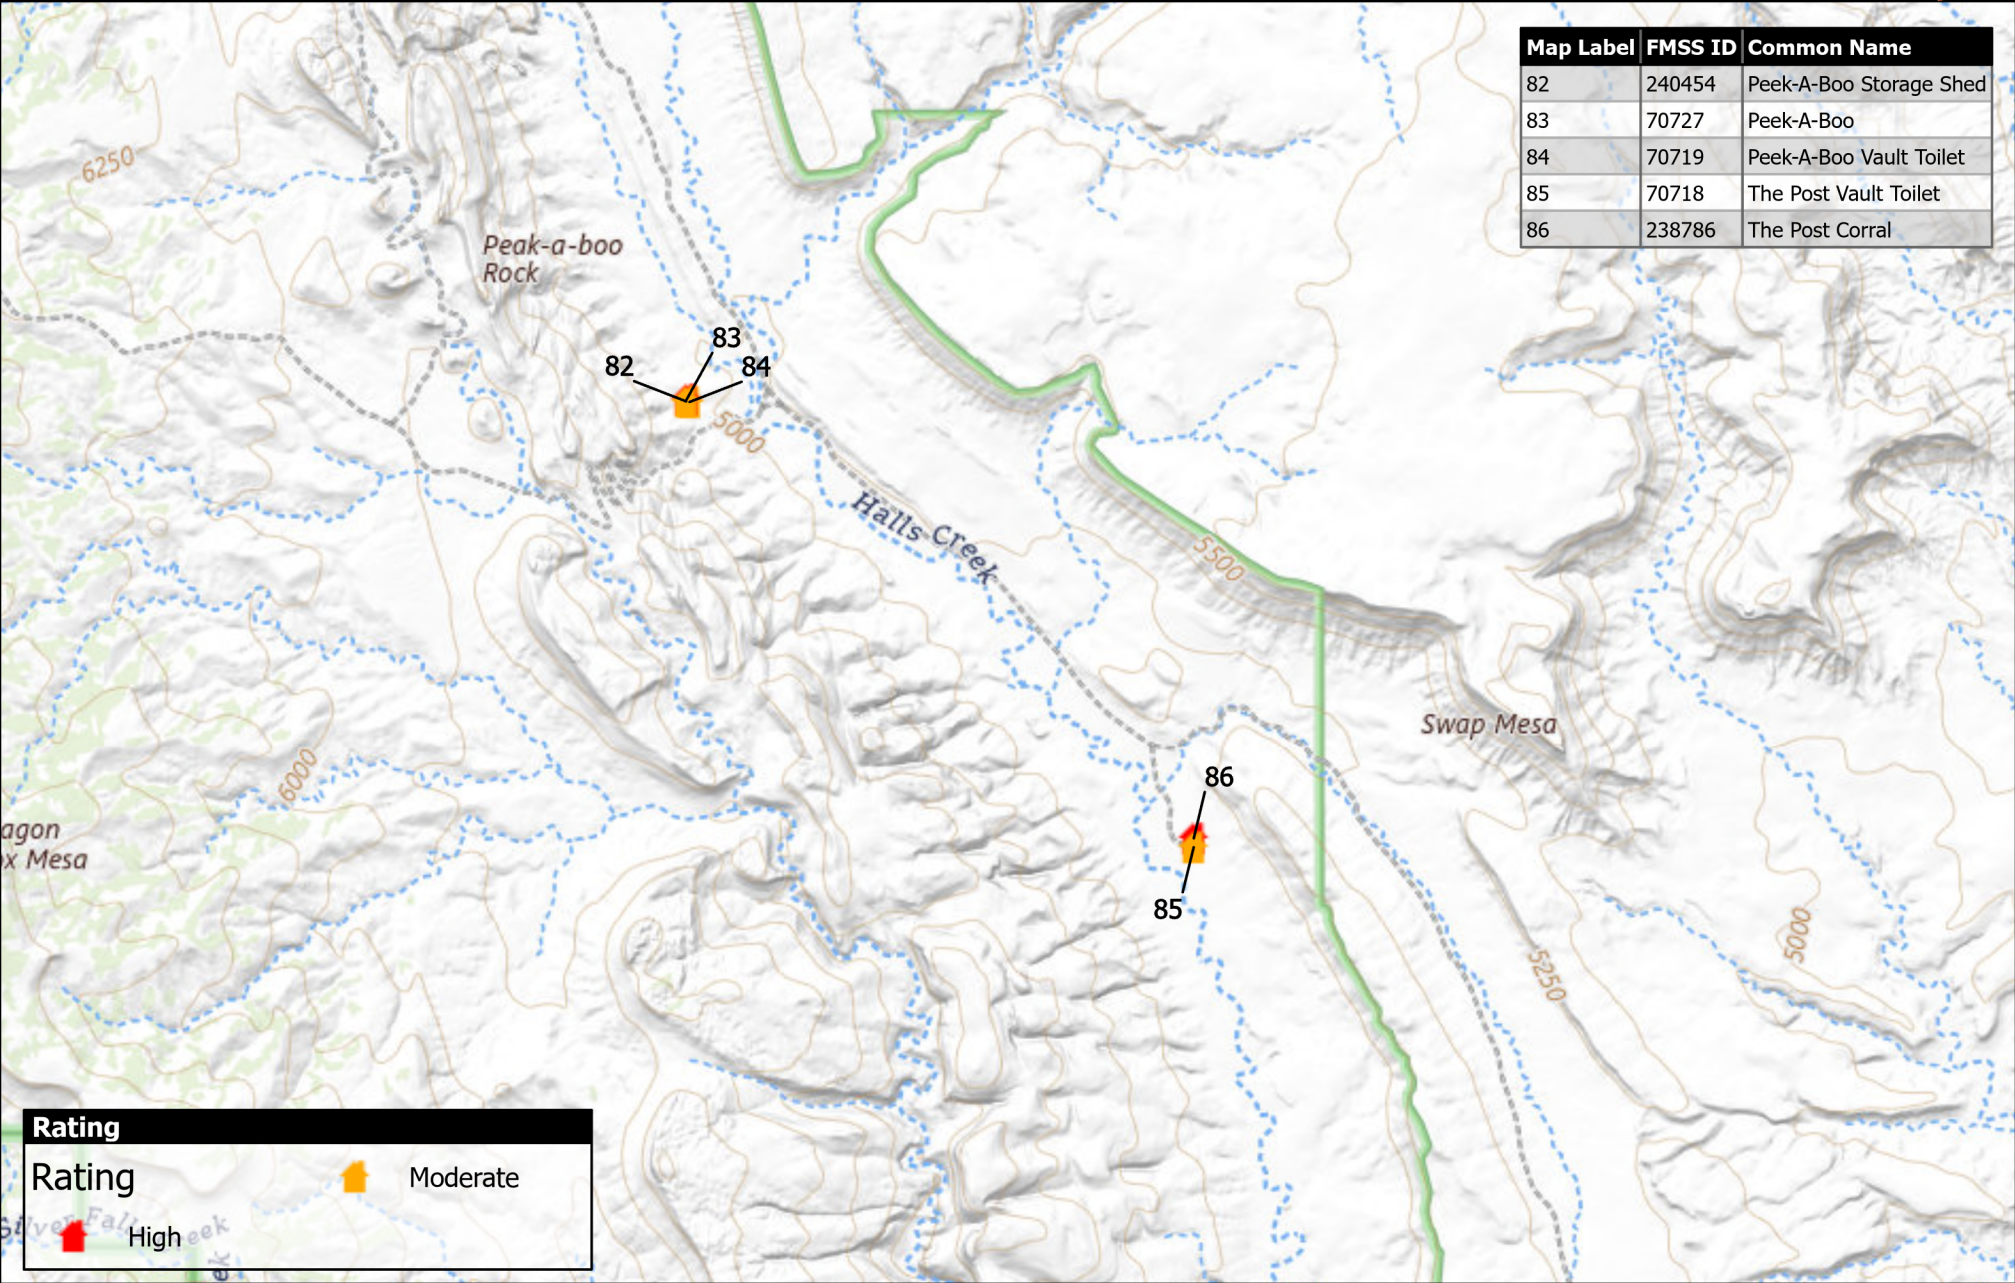

Rating

Rating

High

Moderate



Author: sszturm
10/29/2024 8:21 AM





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Cedar Mesa Vault Toilet

Unit - Location: CARE - Water Pocket

FMSS ID: 70689, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 30, 2021

Coordinates (DDM): 38° 00.43768950' N 111° 04.95199800' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 8 yrs

Map Label: 81

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None



Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

NO PHOTO AVAILABLE

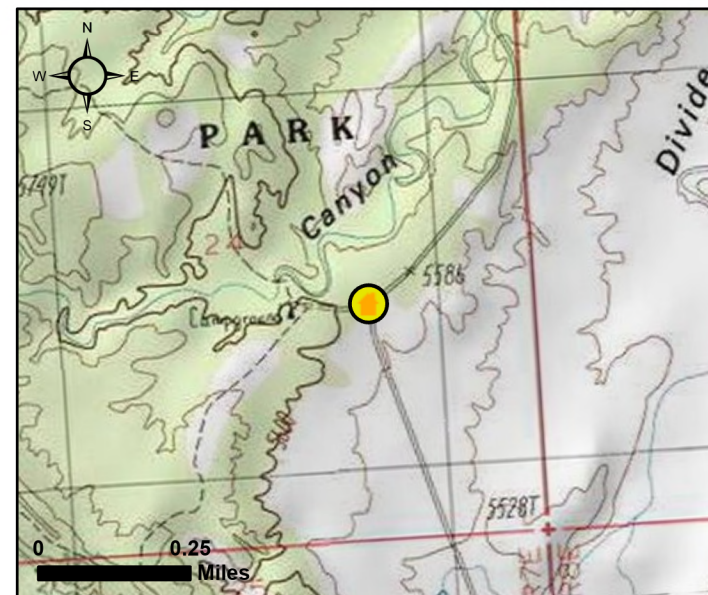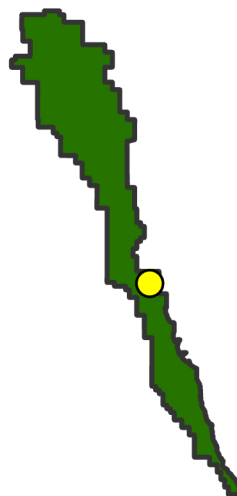



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Peek-A-Boo Vault Toilet

Unit - Location: CARE - Water Pocket

FMSS ID: 70719, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 30, 2021

Coordinates (DDM): 37° 51.29356938' N 111° 01.13886240' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 8 yrs

Map Label: 84

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None



Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

NO PHOTO AVAILABLE

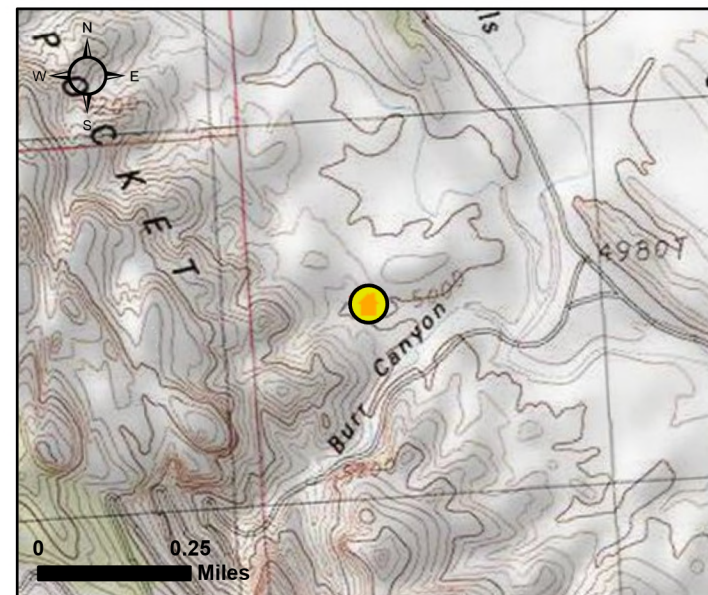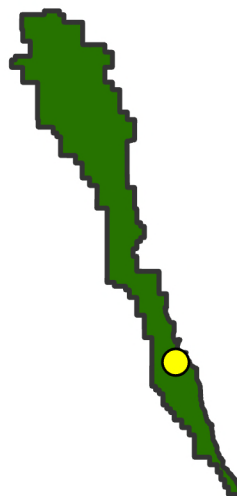



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Peek-A-Boo

Unit - Location: CARE - Water Pocket

FMSS ID: 70727, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 30, 2021

Coordinates (DDM): 37° 51.30297234' N 111° 01.15302444' W

Rating: High

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 8 yrs

Map Label: 83

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Less than 30 ft treated

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: 5ft to 30ft from facility



Water Supply: No reliable water source nearby

Propane: Adjacent to facility and no fuels clearance

Overhead Hazards: No overhead hazards

Comments:

NO PHOTO AVAILABLE

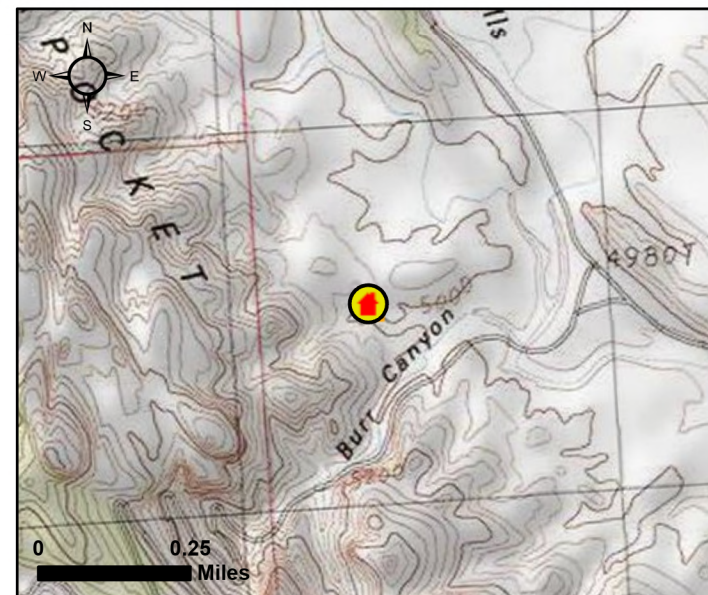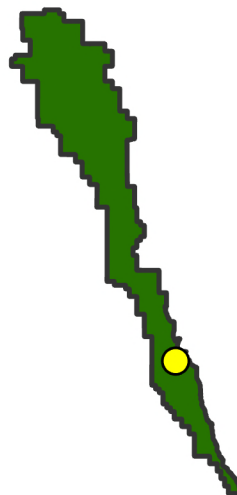



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Peek-A-Boo Storage Shed

Unit - Location: CARE - Water Pocket

FMSS ID: 240454, **Local ID:**

Structure Type, Use: Other, Unknown

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 30, 2021

Coordinates (DDM): 37° 51.29585664' N 111° 01.15495560' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 8 yrs

Map Label: 82

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: Adjacent to/under deck of facility



Water Supply: No reliable water source nearby

Propane: Adjacent to facility and no fuels clearance

Overhead Hazards: No overhead hazards

Comments:

NO PHOTO AVAILABLE

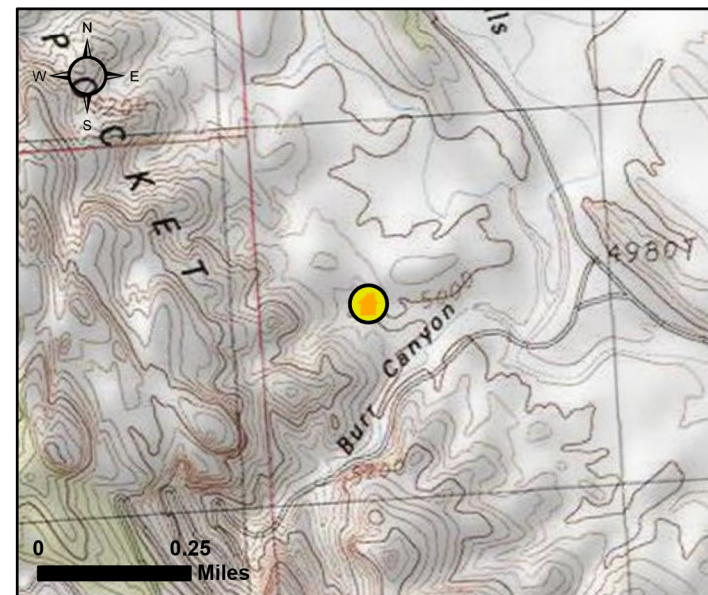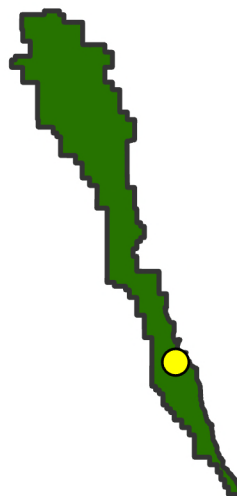



NPS Wildland Fire Risk Assessment - Facility Assessment



For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: The Post Corral
Unit - Location: CARE - Water Pocket
FMSS ID: 238786, **Local ID:**
Structure Type, Use: Cultural Resource, Unknown
Owner: National Park Service
Field Crew, Visit Date: Castillo, March 30, 2021
Coordinates (DDM): 37° 49.62143172' N 110° 58.69397520' W

Rating: High
ProtectionLevel: Not Designated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 8 yrs
Map Label: 86

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%
Bridge Condition: Less than 300 ft with no turnaround
Access and Turnarounds: Less than 300 ft with no turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, Less than 6in masonry exposed
Firewood: None
Water Supply: No reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments:

NO PHOTO AVAILABLE

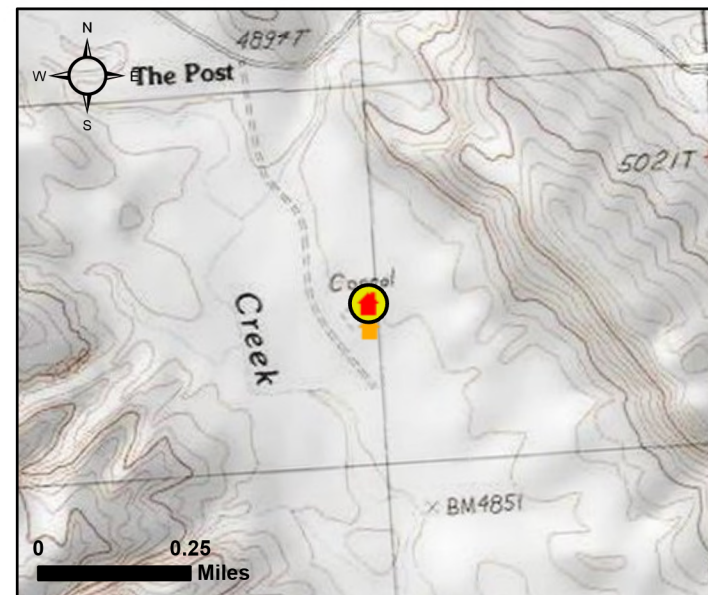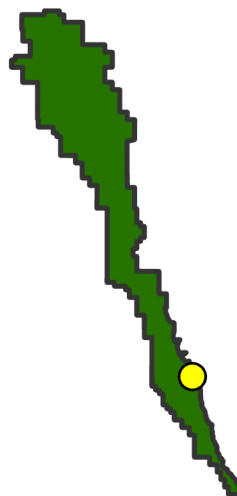



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: The Post Vault Toilet

Unit - Location: CARE - Water Pocket

FMSS ID: 70718, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 30, 2021

Coordinates (DDM): 37° 49.58736474' N 110° 58.69429710' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 8 yrs

Map Label: 85

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A

Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

NO PHOTO AVAILABLE

