


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



ARCH - Arches National Park - Overview

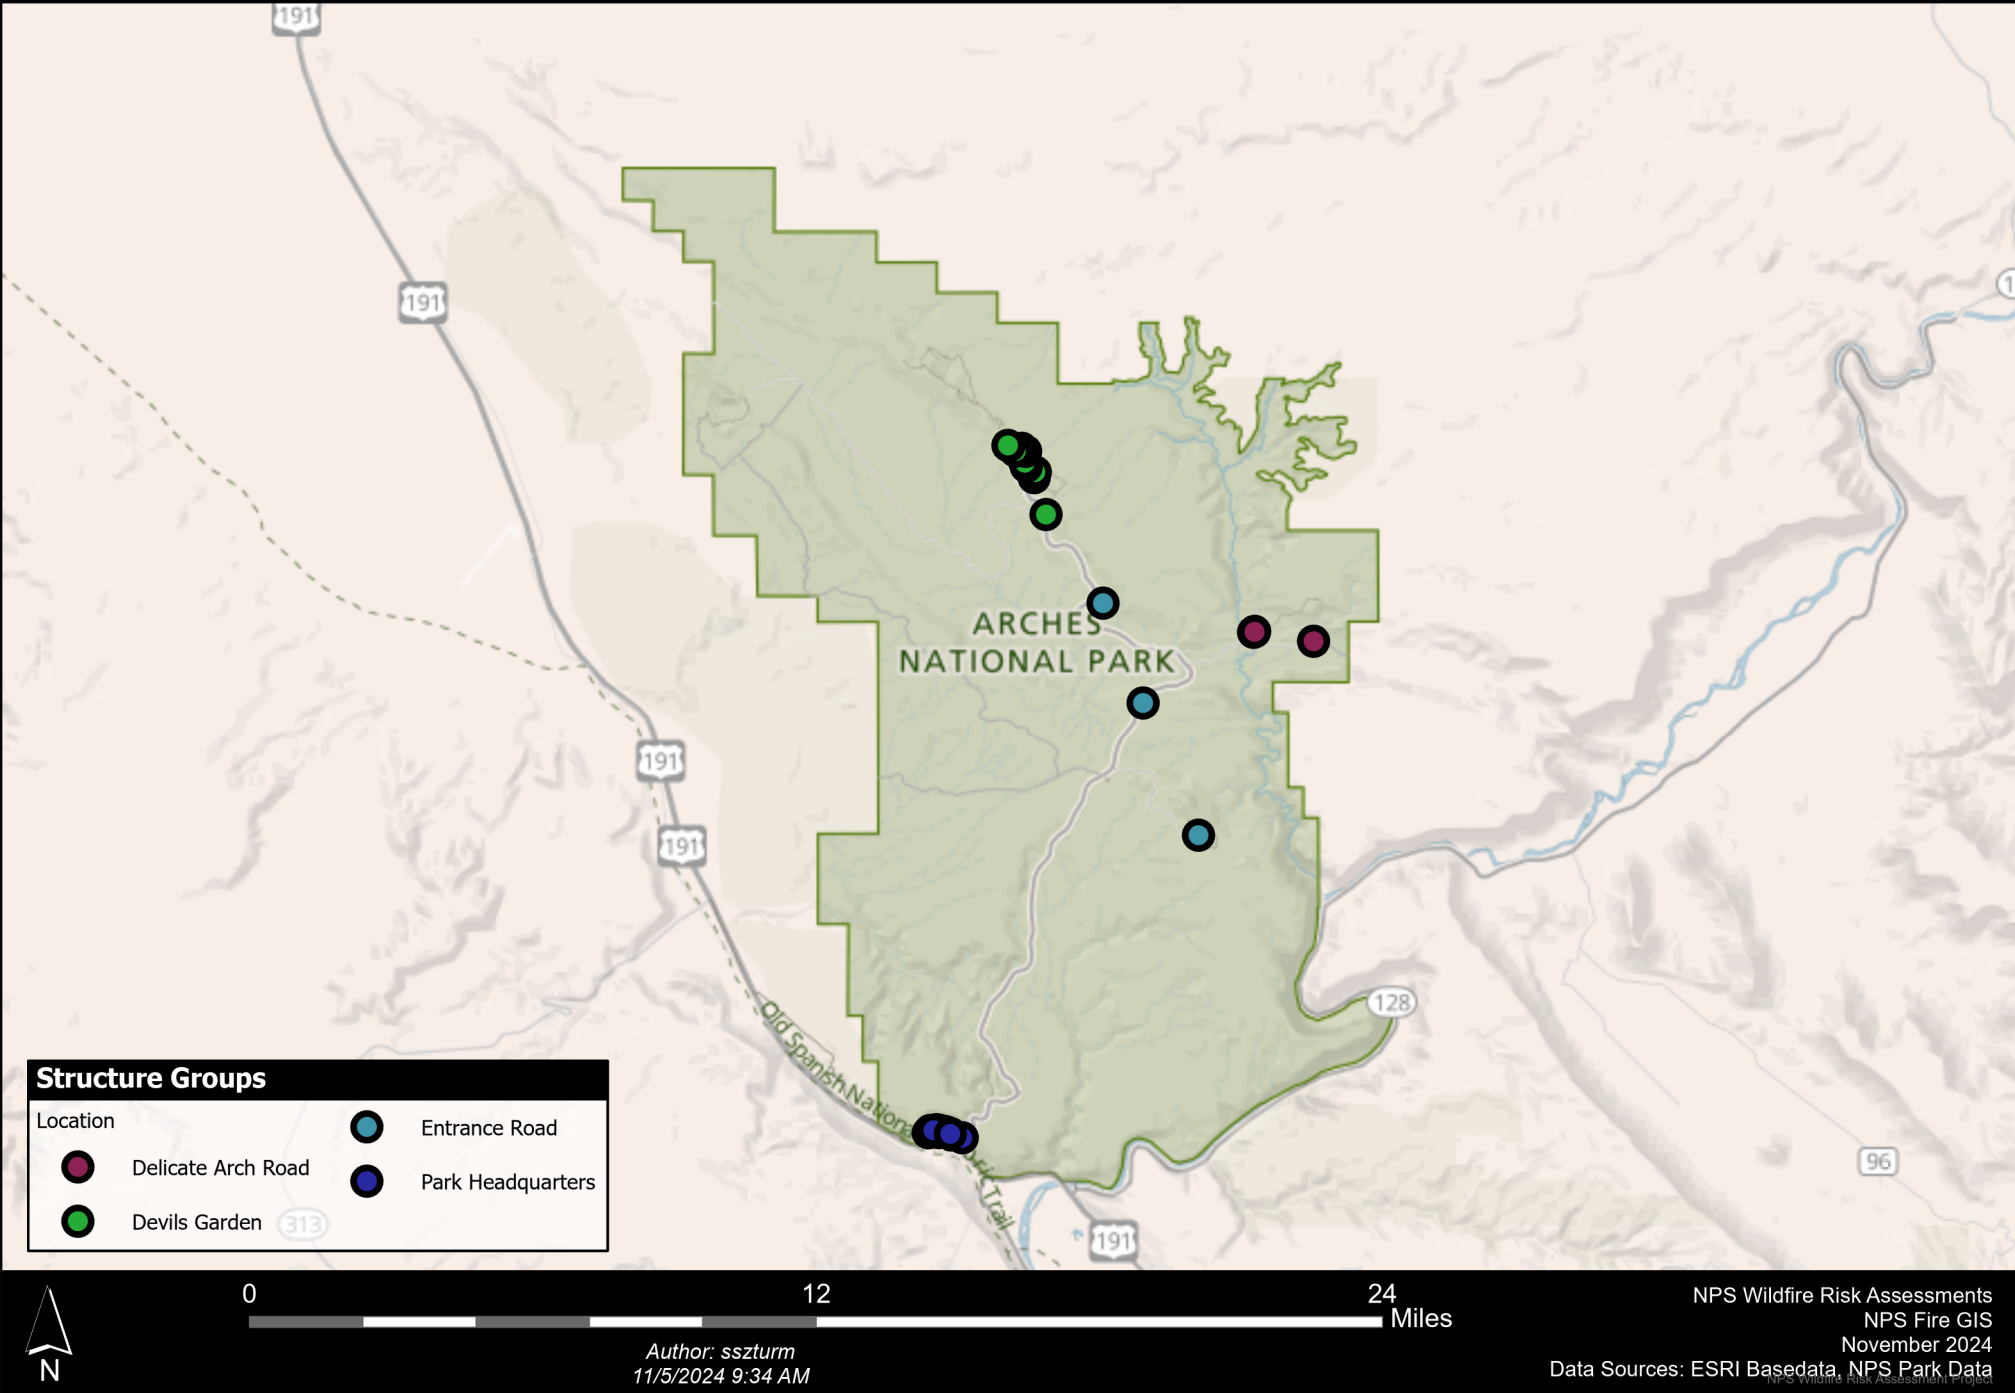


Park Headquarters

ARCH - Arches National Park

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
26	63468	New Visitor Center
27	63470	Rock House
29	63489	Well House 2
30	63481	Four-plex, 7A, 7B, 7C, and 7D
31	63480	Quarters 3
33	63486	Quarters 3 Garage
34	63478	Quarters 5 AB5Q
35	67044	Quarters 10, AB10Q
36	63479	House (AB6Q)
39	63473	Maintenance Shop
37	63475	Maintenance Flammable Storage
40	63474	SAR Cache (AB50)
32	88943	Entrance Station
25	63476	50,000 Water Tank
28	63469	Old Library (AB11)
38	not found	Recycle Shed

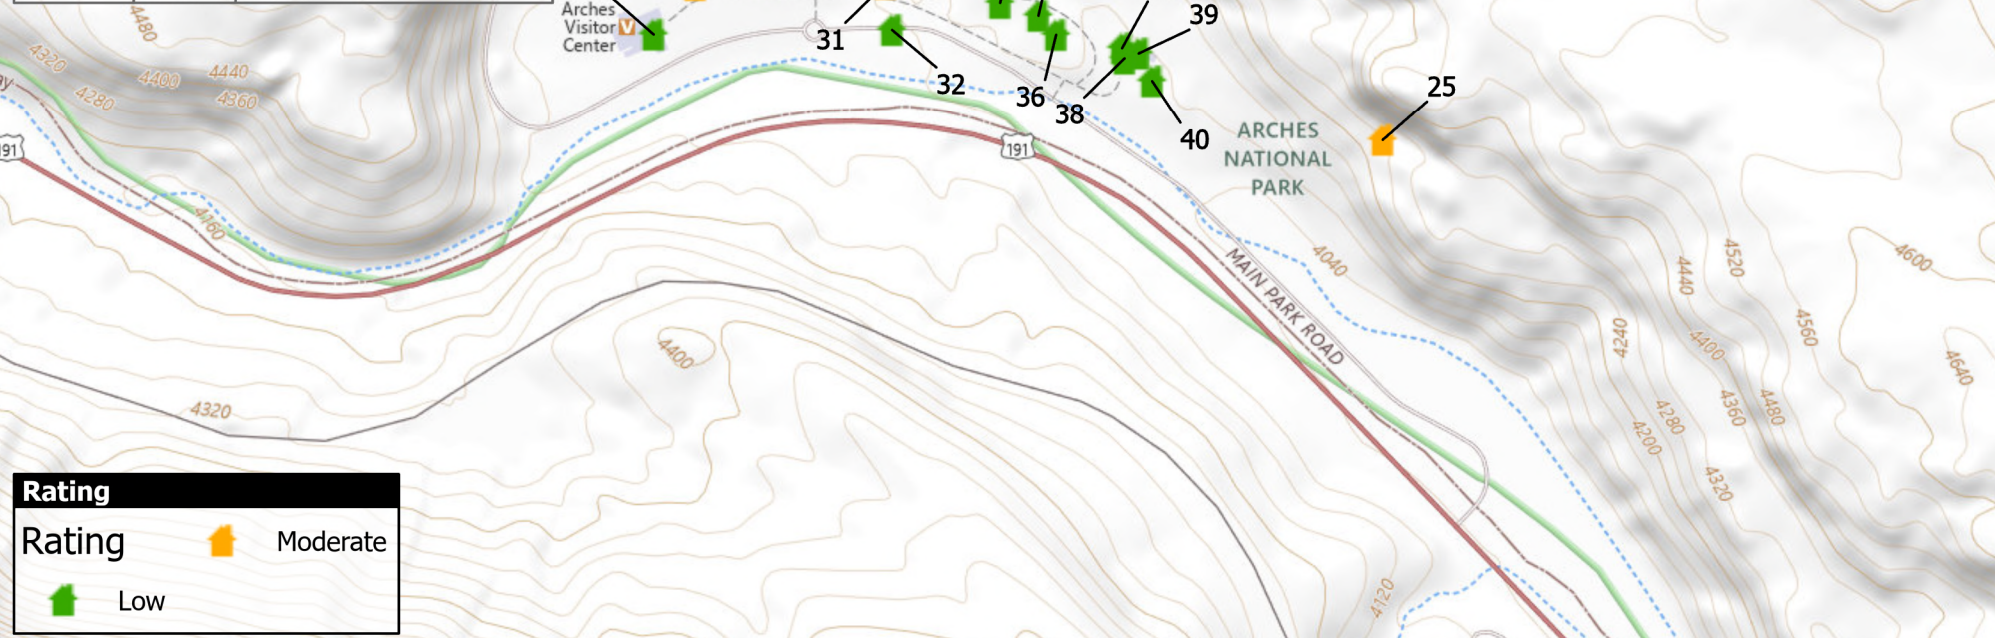

Rating

Rating

Low

Moderate



Author: sszturm
11/5/2024 10:27 AM

0 0.5 Miles

NPS Wildfire Risk Assessments
NPS Fire GIS
November 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: New Visitor Center

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63468, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.98916240' N 109° 37.17850200' W

Rating: Low

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 5 yrs

Map Label: 26

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

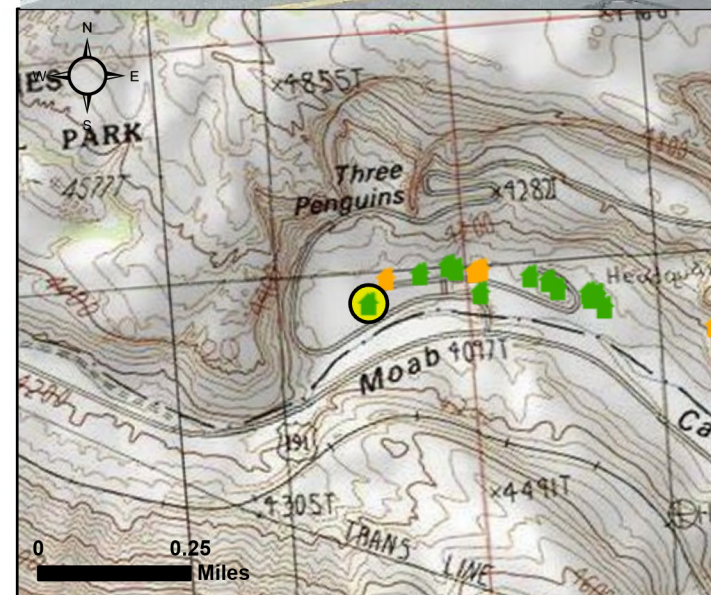



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Rock House

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63470, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.02229182' N 109° 37.14280224' W

Rating: Moderate

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 27

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Combustible or no roof

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

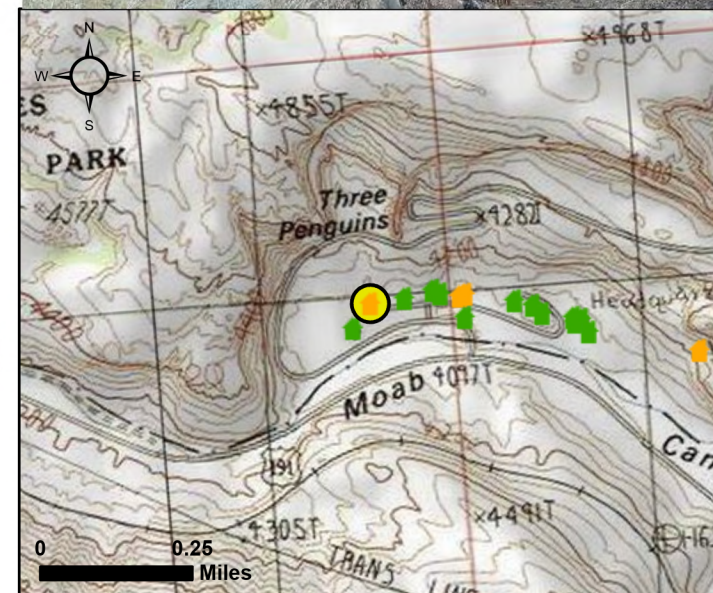



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Well House 2

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63489, **Local ID:**

Structure Type, Use: Utility Site (Water, Gas, Elec), Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.03397046' N 109° 37.02867924' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 29

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

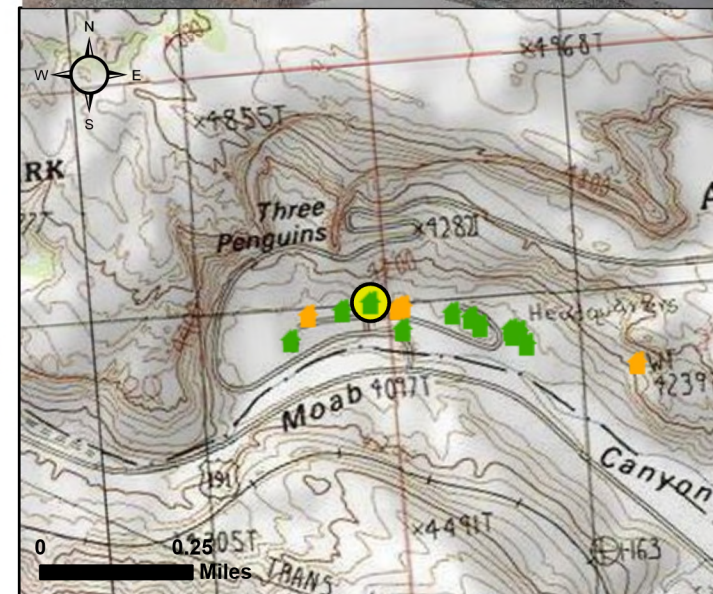



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Four-plex, 7A, 7B, 7C, and 7D

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63481, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.02872820' N 109° 37.01588586' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 30

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Vinyl

Foundation: Closed, 6in to 30in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

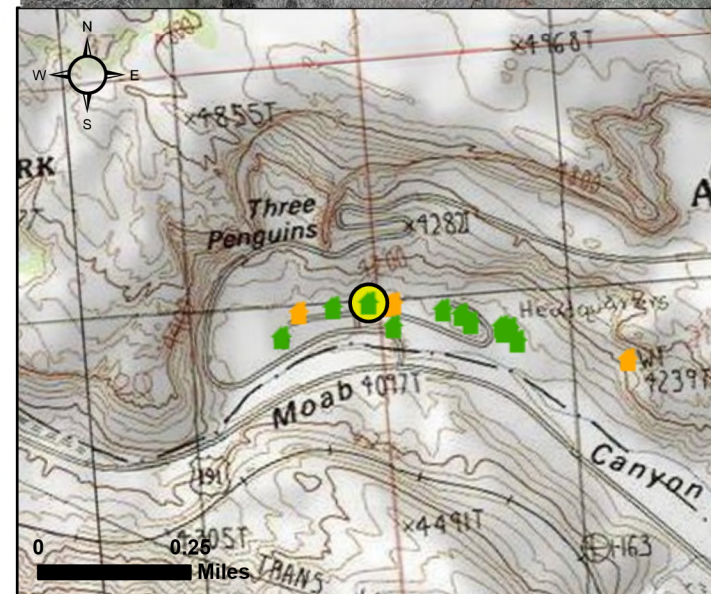



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Quarters 3

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63480, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.02314460' N 109° 36.97999254' W

Rating: Moderate

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 31

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

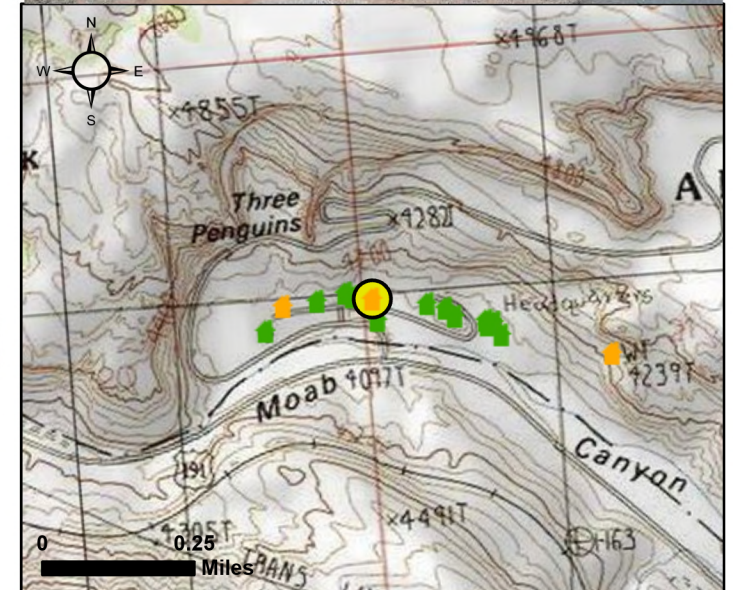



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Quarters 3 Garage

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63486, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.02483828' N 109° 36.97120788' W

Rating: Moderate

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 33

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

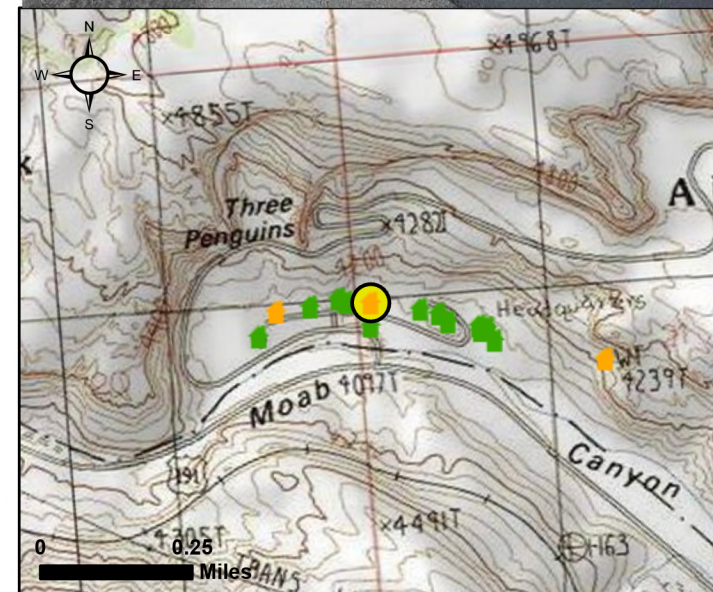



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Quarters 5 AB5Q

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63478, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.01031654' N 109° 36.88202052' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 34

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

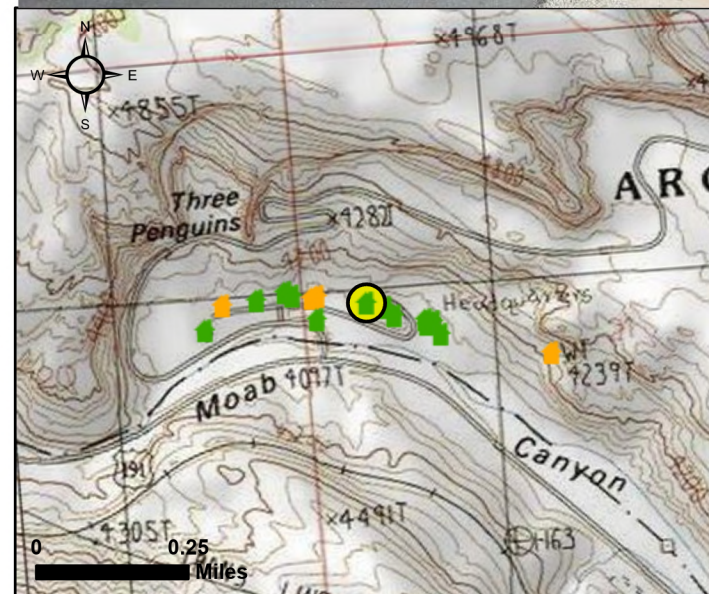



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Quarters 10, AB10Q

Unit - Location: ARCH - Park Headquarters

FMSS ID: 67044, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.00170690' N 109° 36.84929964' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 35

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

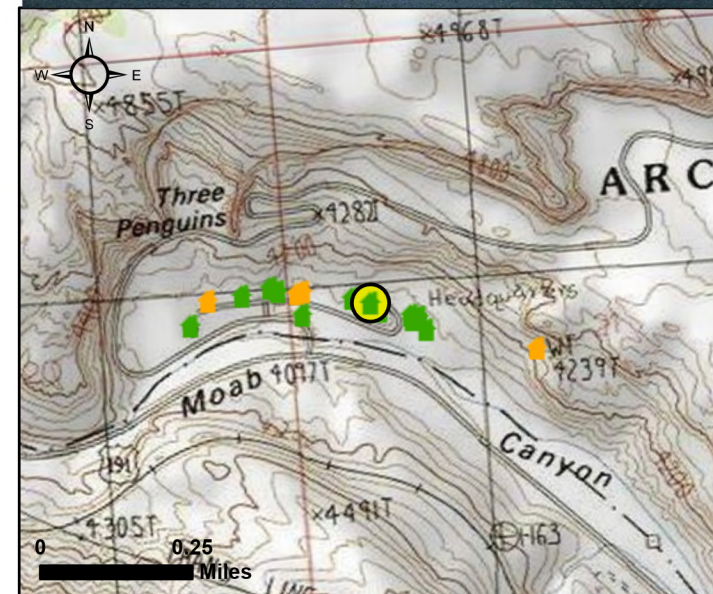



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: House (AB6Q)

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63479, **Local ID:**

Structure Type, Use: Building, Residence

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.98893464' N 109° 36.83415714' W

Rating: Low

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 36

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

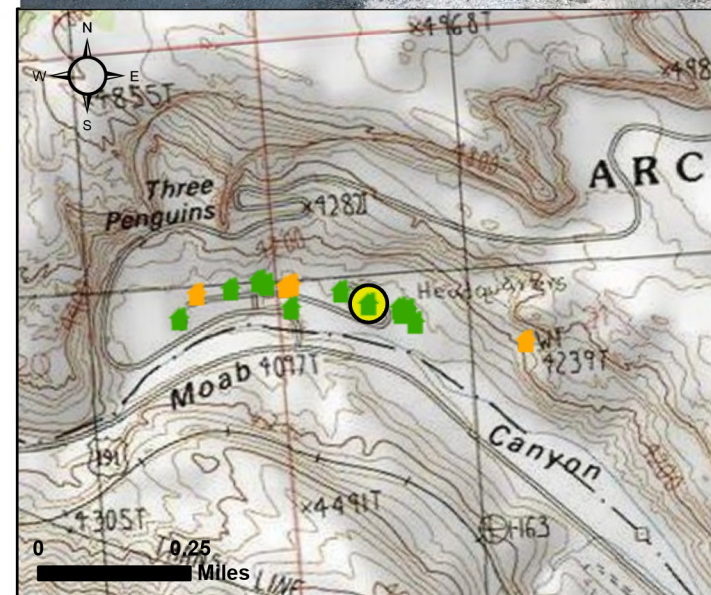



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Maintenance Shop

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63473, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.97651494' N 109° 36.76344918' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 39

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Fire resistant- tar, rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

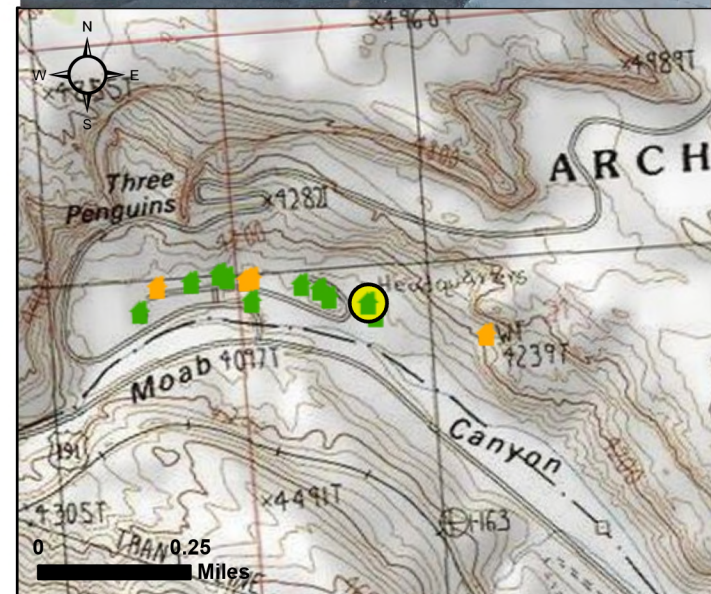



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Maintenance Flammable Storage

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63475, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.97999698' N 109° 36.77770998' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 37

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Greater than 100ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

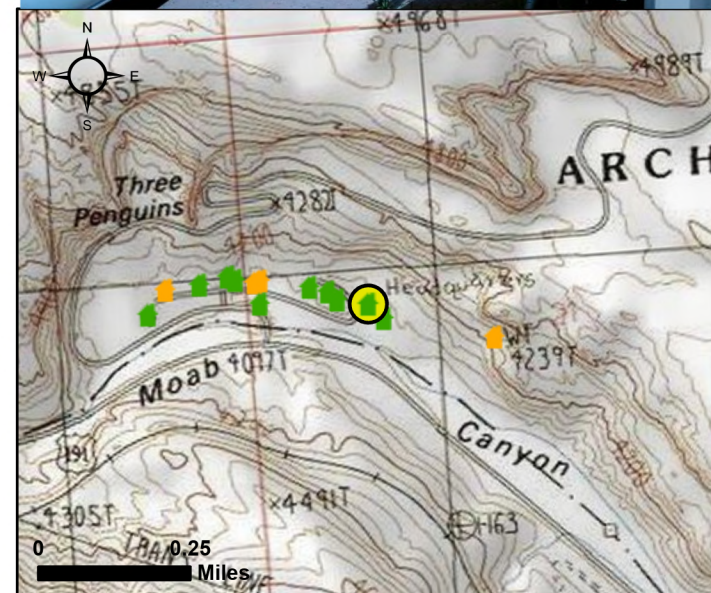



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: SAR Cache (AB50)

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63474, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.95790690' N 109° 36.75198030' W

Rating: Low

ProtectionLevel: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 40

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 100 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

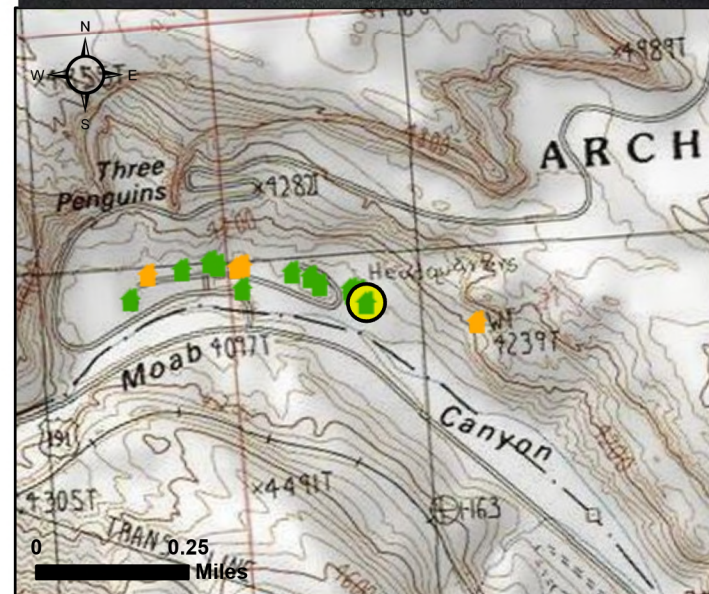



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: SAR Cache (AB50)

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63474, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.95790690' N 109° 36.75198030' W

Rating:

Protection Level: ,

Resources of Concern:

Occupied:

In Community: , Park Headquarters

Revisit Interval: yrs

Map Label:

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Greater than 100ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments:

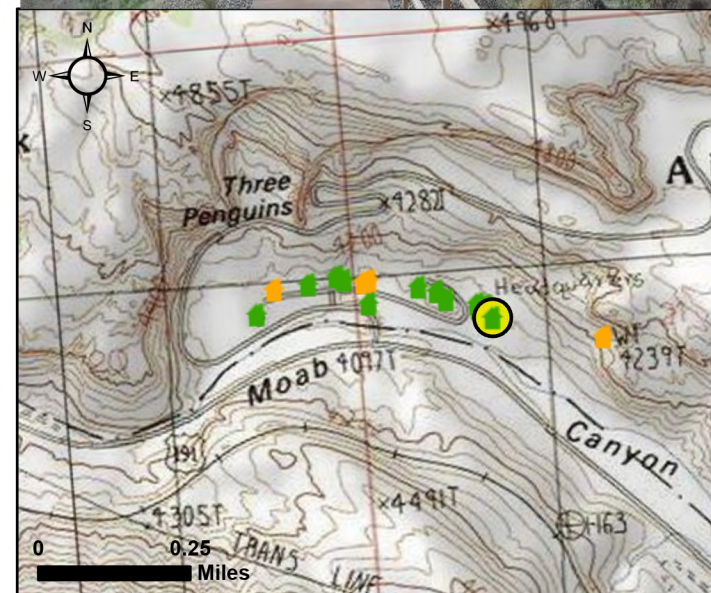



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: 50,000 Water Tank

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63476, **Local ID:**

Structure Type, Use: Utility Site (Water, Gas, Elec), Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.91828590' N 109° 36.55464048' W

Rating: Moderate

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 25

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Less than 30 ft treated

Topography: Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Limited or dependent on electricity

Propane: None

Overhead Hazards: No overhead hazards

Comments:

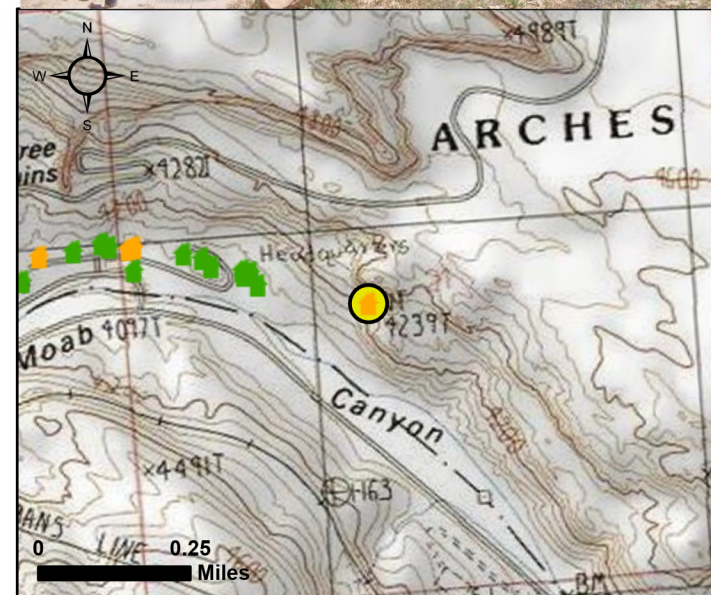



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Old Library (AB11)

Unit - Location: ARCH - Park Headquarters

FMSS ID: 63469, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 37.02577638' N 109° 37.08129558' W

Rating: Low

Protection Level: Undesignated,

Resources of Concern: Unknown

Occupied: Yes

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 28

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1.5 lanes (Greater than 18')

Access Condition: Surfaced-paved, grade Less than 5%

Bridge Condition: Less than 300 ft with no turnaround

Access and Turnarounds: Less than 300 ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, 6in to 30in masonry exposed


Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments: Flammable materials behind house

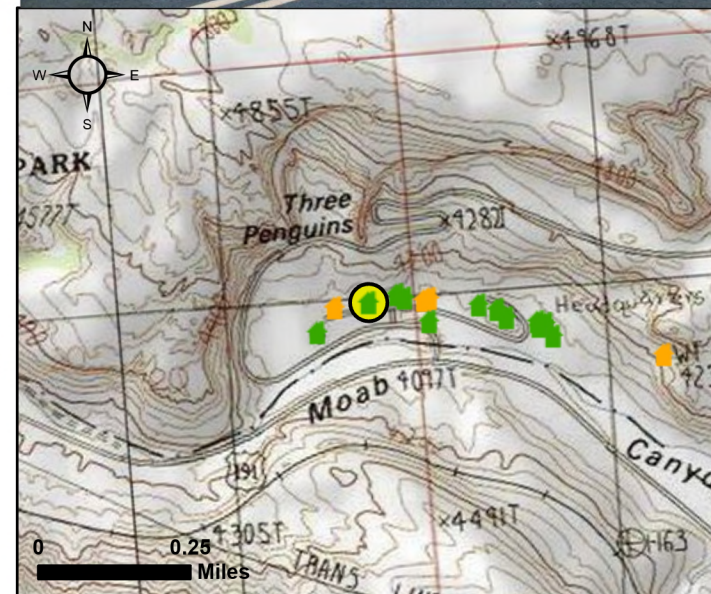



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Recycle Shed

Unit - Location: ARCH - Park Headquarters

FMSS ID: not found , **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Shawn Castillo, March 10, 2021

Coordinates (DDM): 38° 36.97315824' N 109° 36.77558832' W

Rating: Low

ProtectionLevel: ,

Resources of Concern: Unknown

Occupied: No

In Community: Yes, Park Headquarters

Revisit Interval: 10 yrs

Map Label: 38

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Surfaced-paved, grade Greater than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: Greater than 100ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

