


Golden Spike National Historical Park

GOSP - Golden Spike National Historic Site



Map Label	FMSS ID	Common Name
1	32379	Visitors Center Building
2	236390	garage
3	32365	Required Occupancy House
4	32363	Maitenance Building
5	100493	Maitenance Storage Shed
6	32364	Engine House

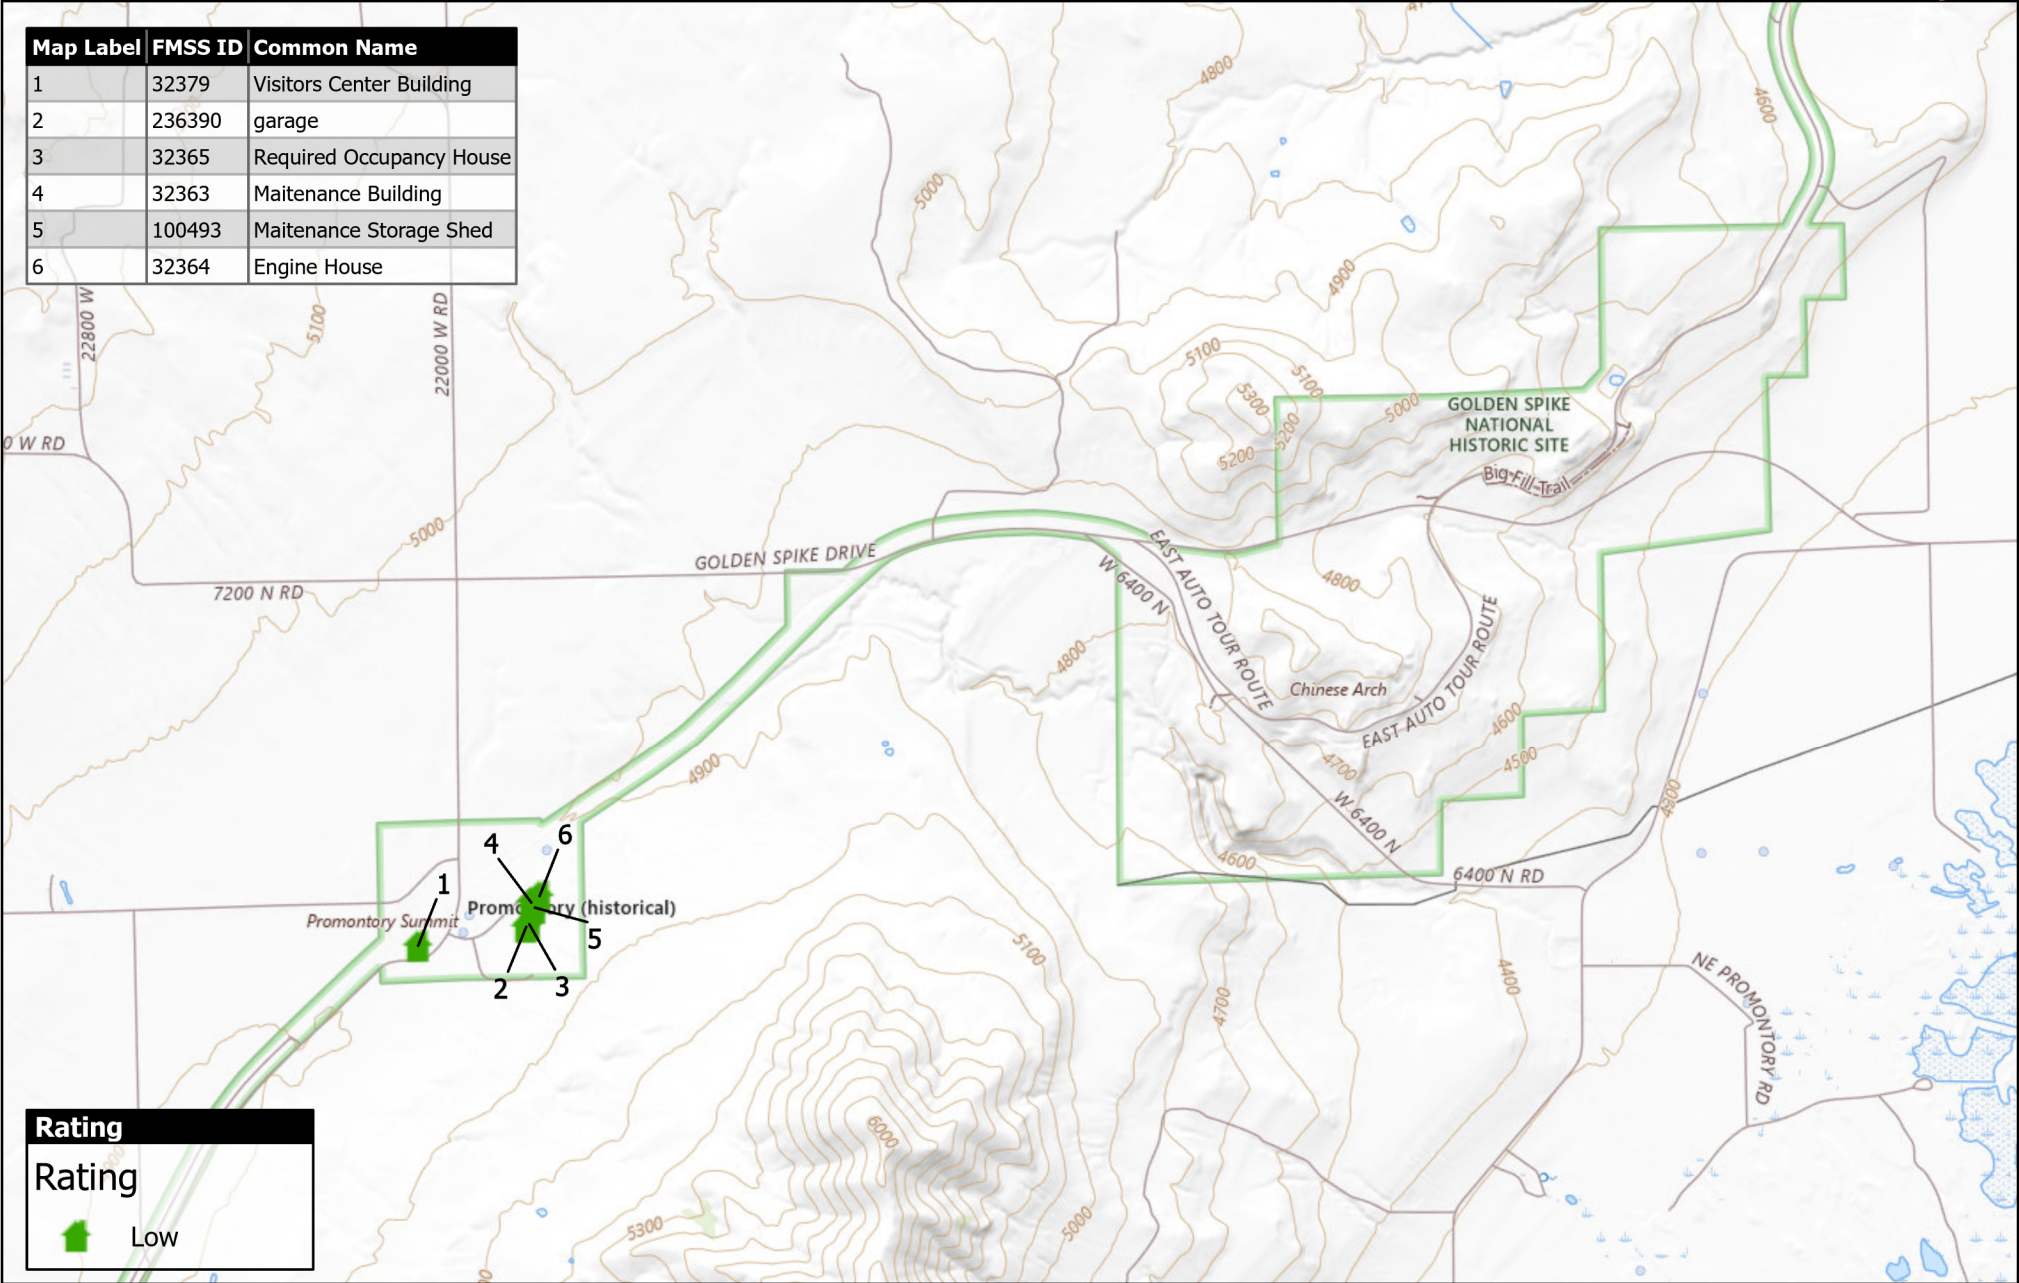



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Maintenance Building

Unit - Location: GOSP - Golden Spike

FMSS ID: 32363, **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 29, 2021

Coordinates (DDM): 41° 37.15002210' N 112° 32.65037928' W

Rating: Low

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 10 yrs

Map Label: 4

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Light or no wildland fuels

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A



Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Adjacent to facility and no fuels clearance

Overhead Hazards: No overhead hazards

Comments: Wooden beams adjacent to bldg. Hazmat inside and adjacent to bldg, diesel/gas feuling station 100 ft away.

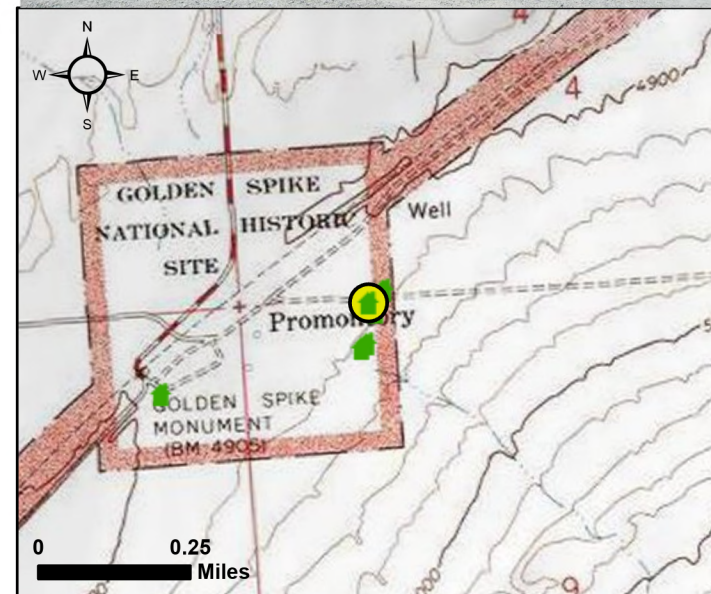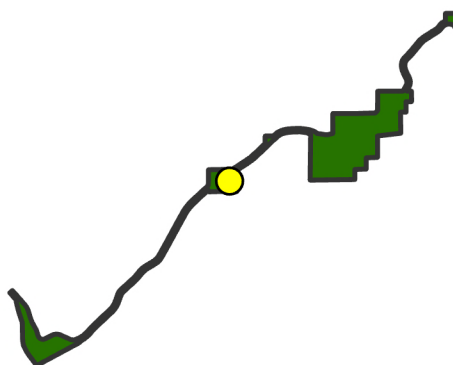



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Engine House

Unit - Location: GOSP - Golden Spike

FMSS ID: 32364, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 29, 2021

Coordinates (DDM): 41° 37.16714880' N 112° 32.62100790' W

Rating: Low

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 10 yrs

Map Label: 6

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed



Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments: pile of coal 50 ft from structure, pile of wood 100 ft from structure, propane tank 50 ft away next to coal pile. Bldg is full of chemicals, burnable fuels, hazmat.

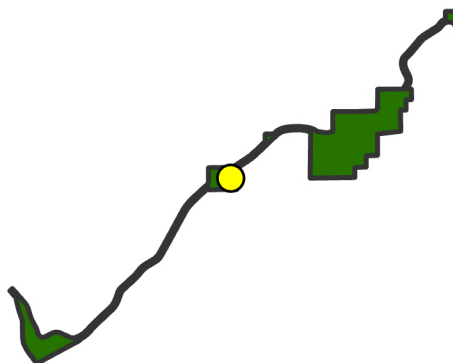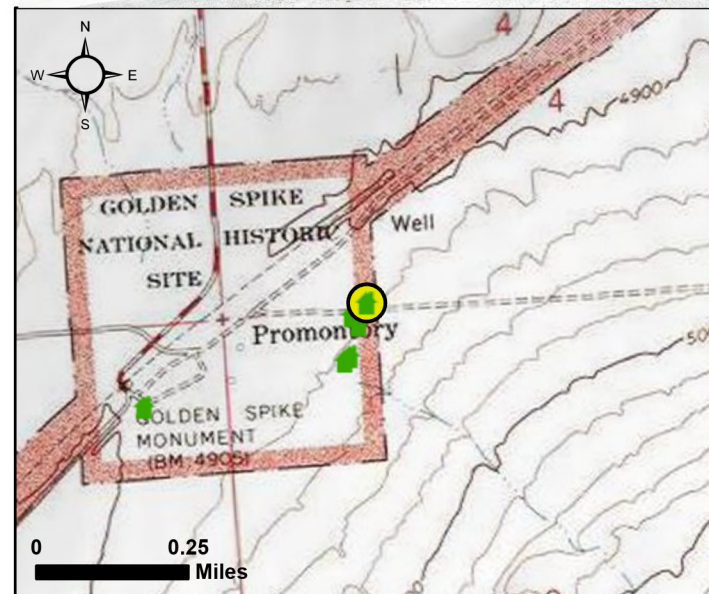





NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Required Occupancy House
Unit - Location: GOSP - Golden Spike
FMSS ID: 32365, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Castillo, March 29, 2021
Coordinates (DDM): 41° 37.09221744' N 112° 32.65749792' W

Rating: Low
ProtectionLevel: Not Designated,
Resources of Concern: Unknown
Occupied: Yes
In Community: No,
Revisit Interval: 10 yrs
Map Label: 3

Primary Access: Road
Ingress Egress: 2 or more roads in/out
Access Width: 2 lanes (Greater than 24')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, 6in to 30in masonry exposed
Firewood: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards
Comments: Detached garage FMSS ID 236390

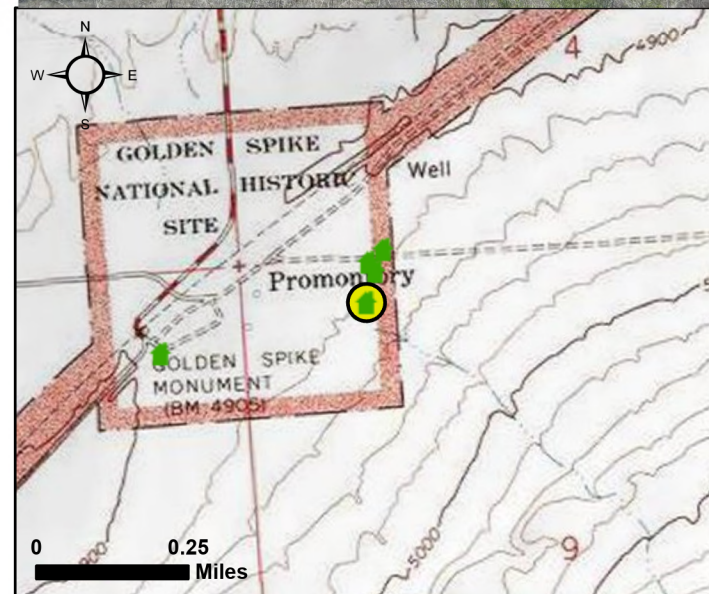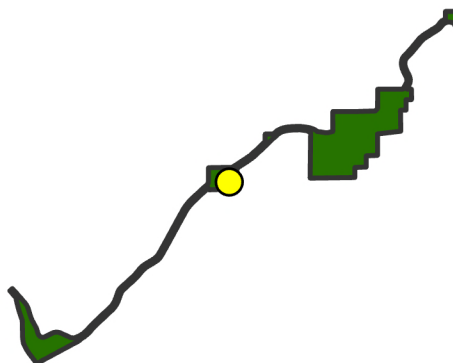



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Visitors Center Building

Unit - Location: GOSP - Golden Spike

FMSS ID: 32379, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 29, 2021

Coordinates (DDM): 41° 37.03501788' N 112° 33.05405478' W

Rating: Low

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: Yes

In Community: No,

Revisit Interval: 10 yrs

Map Label: 1

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: Marked and clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed



Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: Present and fuels clearance

Overhead Hazards: No overhead hazards

Comments: this assessment incl Ranger Storage Unit (FMSS 32383), Living History Storage Unit (FMSS 32386), WNPA Storage Shed (FMSS 32388), Admin Storage Unit (FMSS 46473)

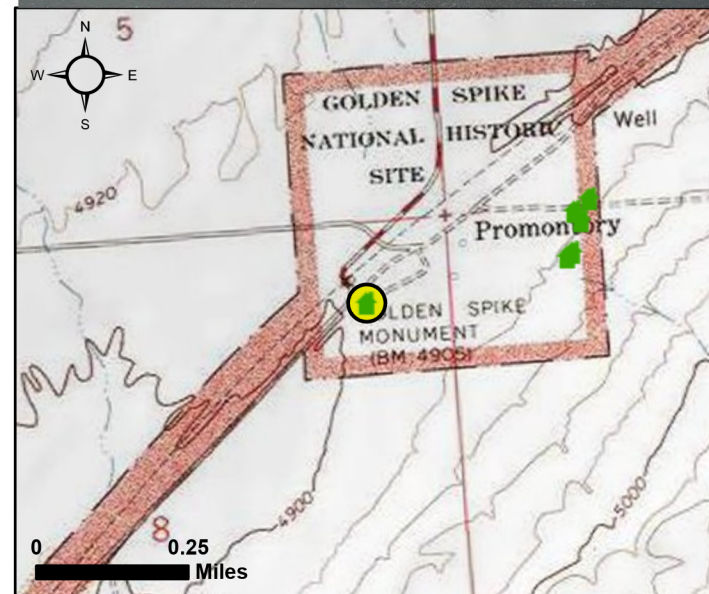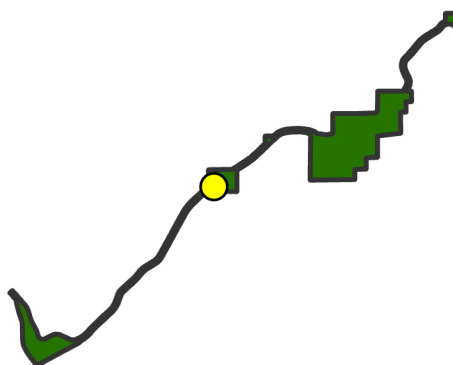



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Maintenance Storage Shed

Unit - Location: GOSP - Golden Spike

FMSS ID: 100493, **Local ID:**

Structure Type, Use: Building, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, March 29, 2021

Coordinates (DDM): 41° 37.13666526' N 112° 32.63807364' W

Rating: Low

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 10 yrs

Map Label: 5

Primary Access: Road

Ingress Egress: 2 or more roads in/out

Access Width: 2 lanes (Greater than 24')

Access Condition: Surfaced-paved, gradeLess than 5%

Bridge Condition: Less than 300 ft with turnaround

Access and Turnarounds: Less than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Grass and shrub, hardwood litter

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed



Firewood: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Propane: None

Overhead Hazards: No overhead hazards

Comments: 10 feet from a diesel/gas fueling station.

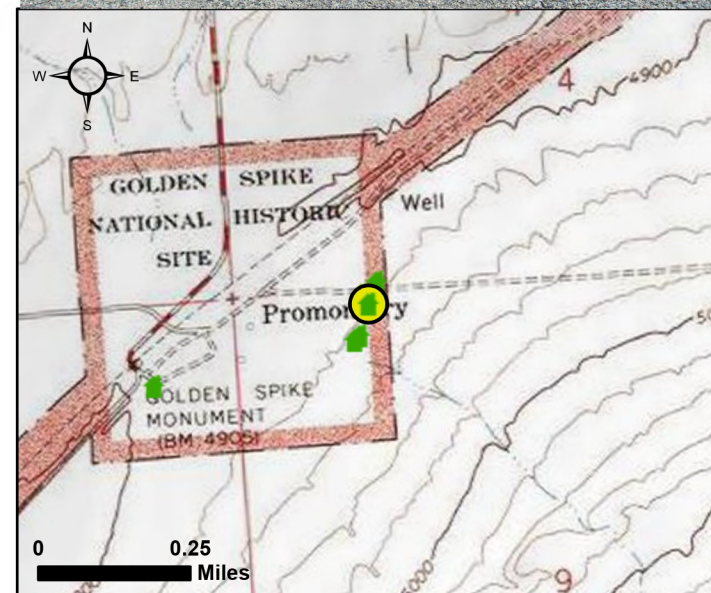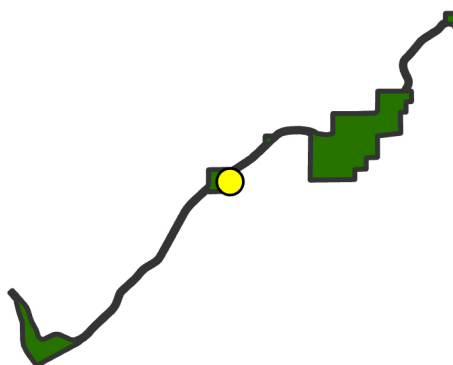



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: garage
Unit - Location: GOSP - Golden Spike
FMSS ID: 236390, **Local ID:**
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Castillo, March 29, 2021
Coordinates (DDM): 41° 37.08582462' N 112° 32.66846196' W

Rating: Low
ProtectionLevel: Not Designated,
Resources of Concern: Unknown
Occupied: Yes
In Community: No,
Revisit Interval: 10 yrs
Map Label: 2

Primary Access: Road
Ingress Egress: 2 or more roads in/out
Access Width: 2 lanes (Greater than 24')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, 6in to 30in masonry exposed
Firewood: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards
Comments: Detached garage FMSS ID 236390

NO PHOTO AVAILABLE

