


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



GRTE- Grand Teton National Park - Overview

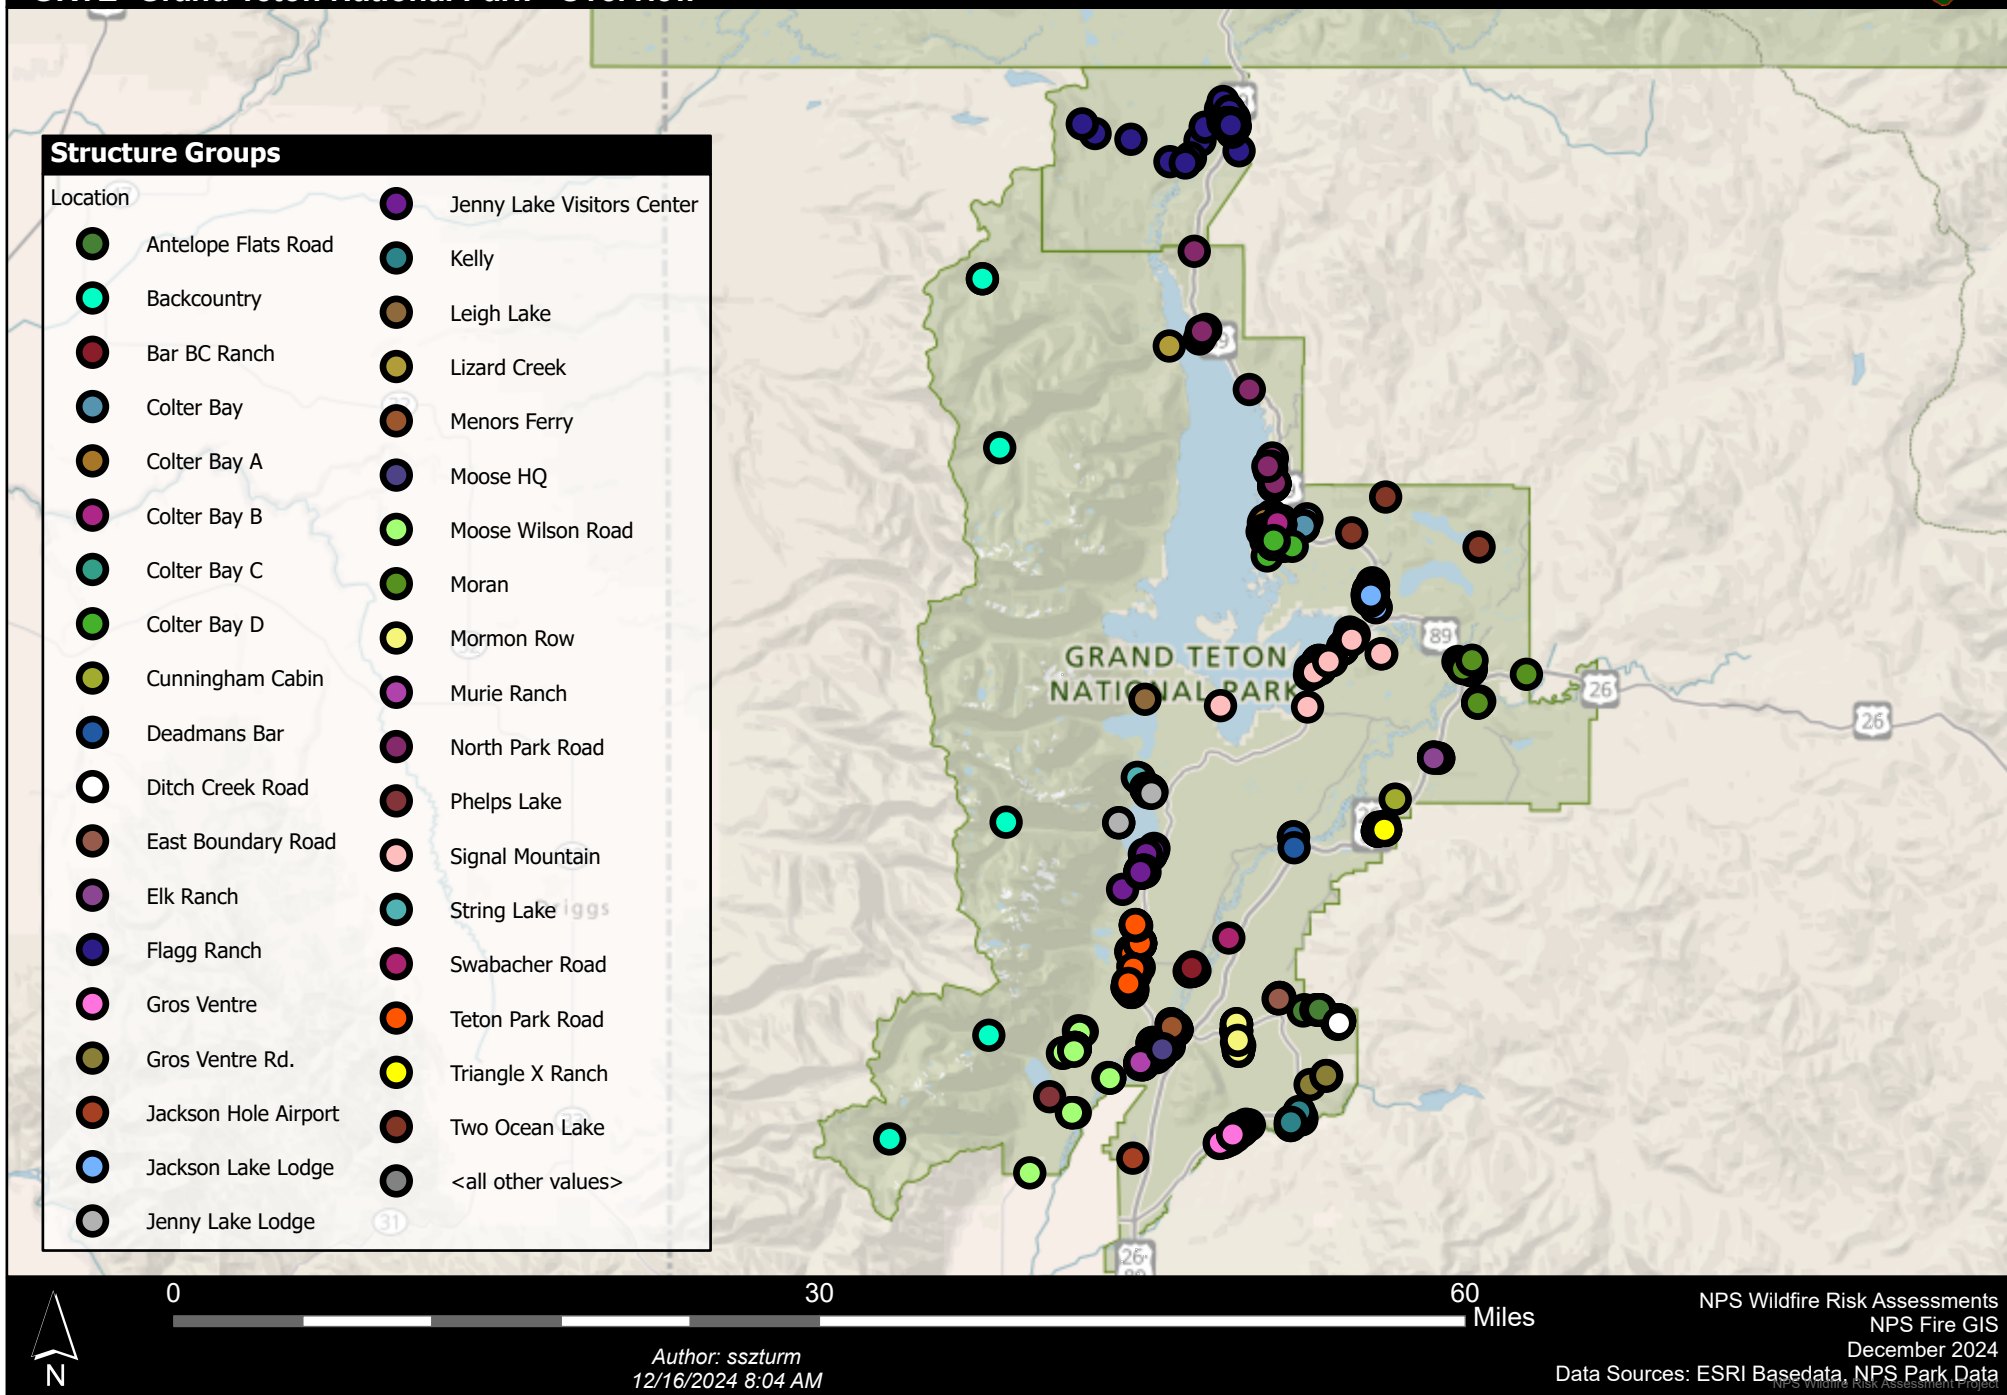


NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior



GRTE- Grand Teton National Park - North - Overview

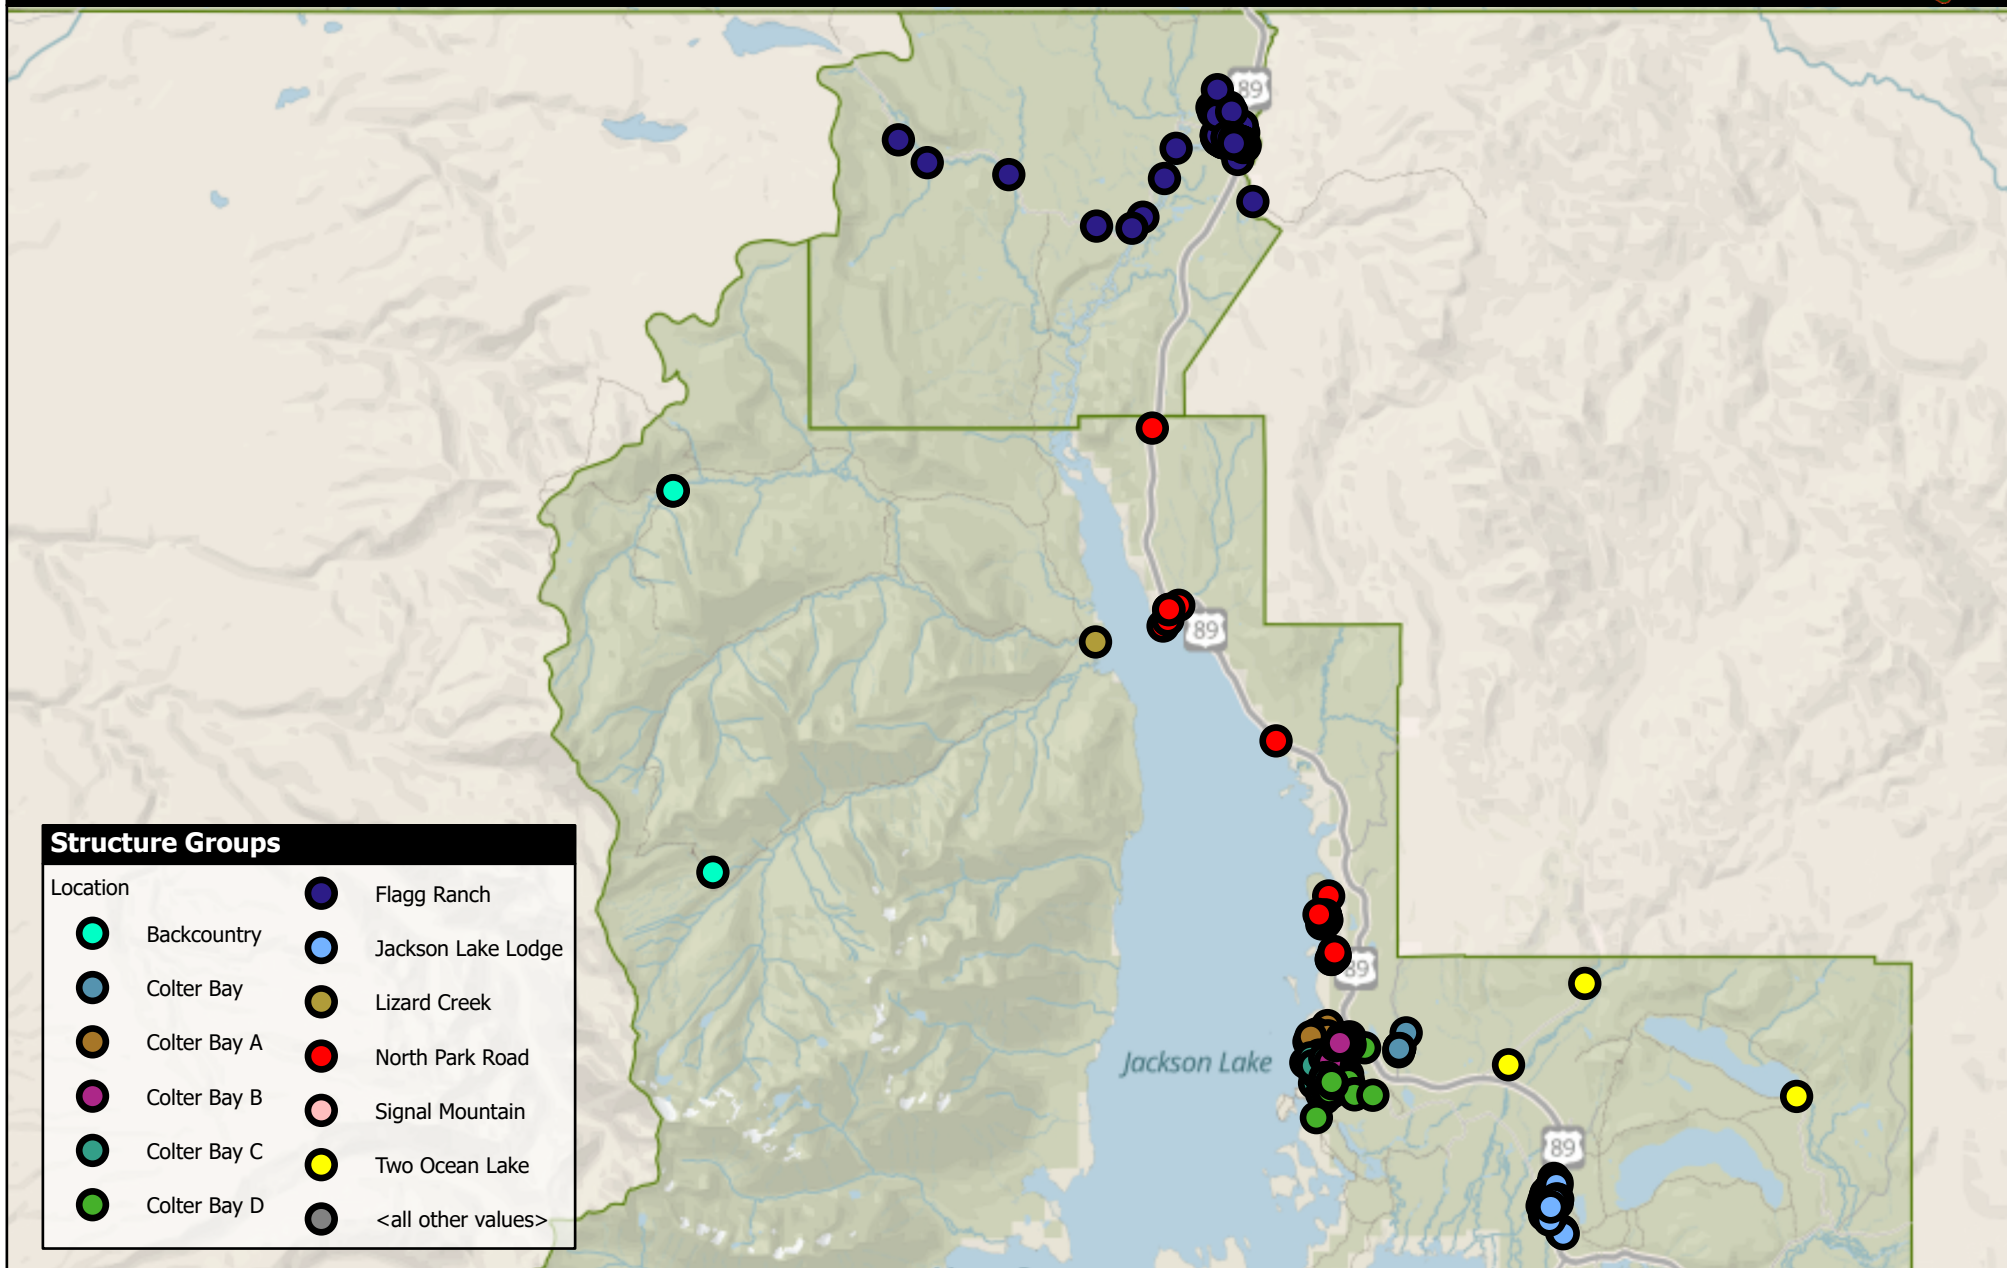

Structure Groups

Location	
Backcountry	Flagg Ranch
Colter Bay	Jackson Lake Lodge
Colter Bay A	Lizard Creek
Colter Bay B	North Park Road
Colter Bay C	Signal Mountain
Colter Bay D	Two Ocean Lake
	<all other values>



0

13

26

Miles

Author: sszturm
12/16/2024 10:01 AM


NPS Wildfire Risk Assessments
NPS Fire GIS
December 2024
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessments Assessment Locations

National Park Service
U.S. Department of the Interior




GRTE- Two Ocean Lake - Overview

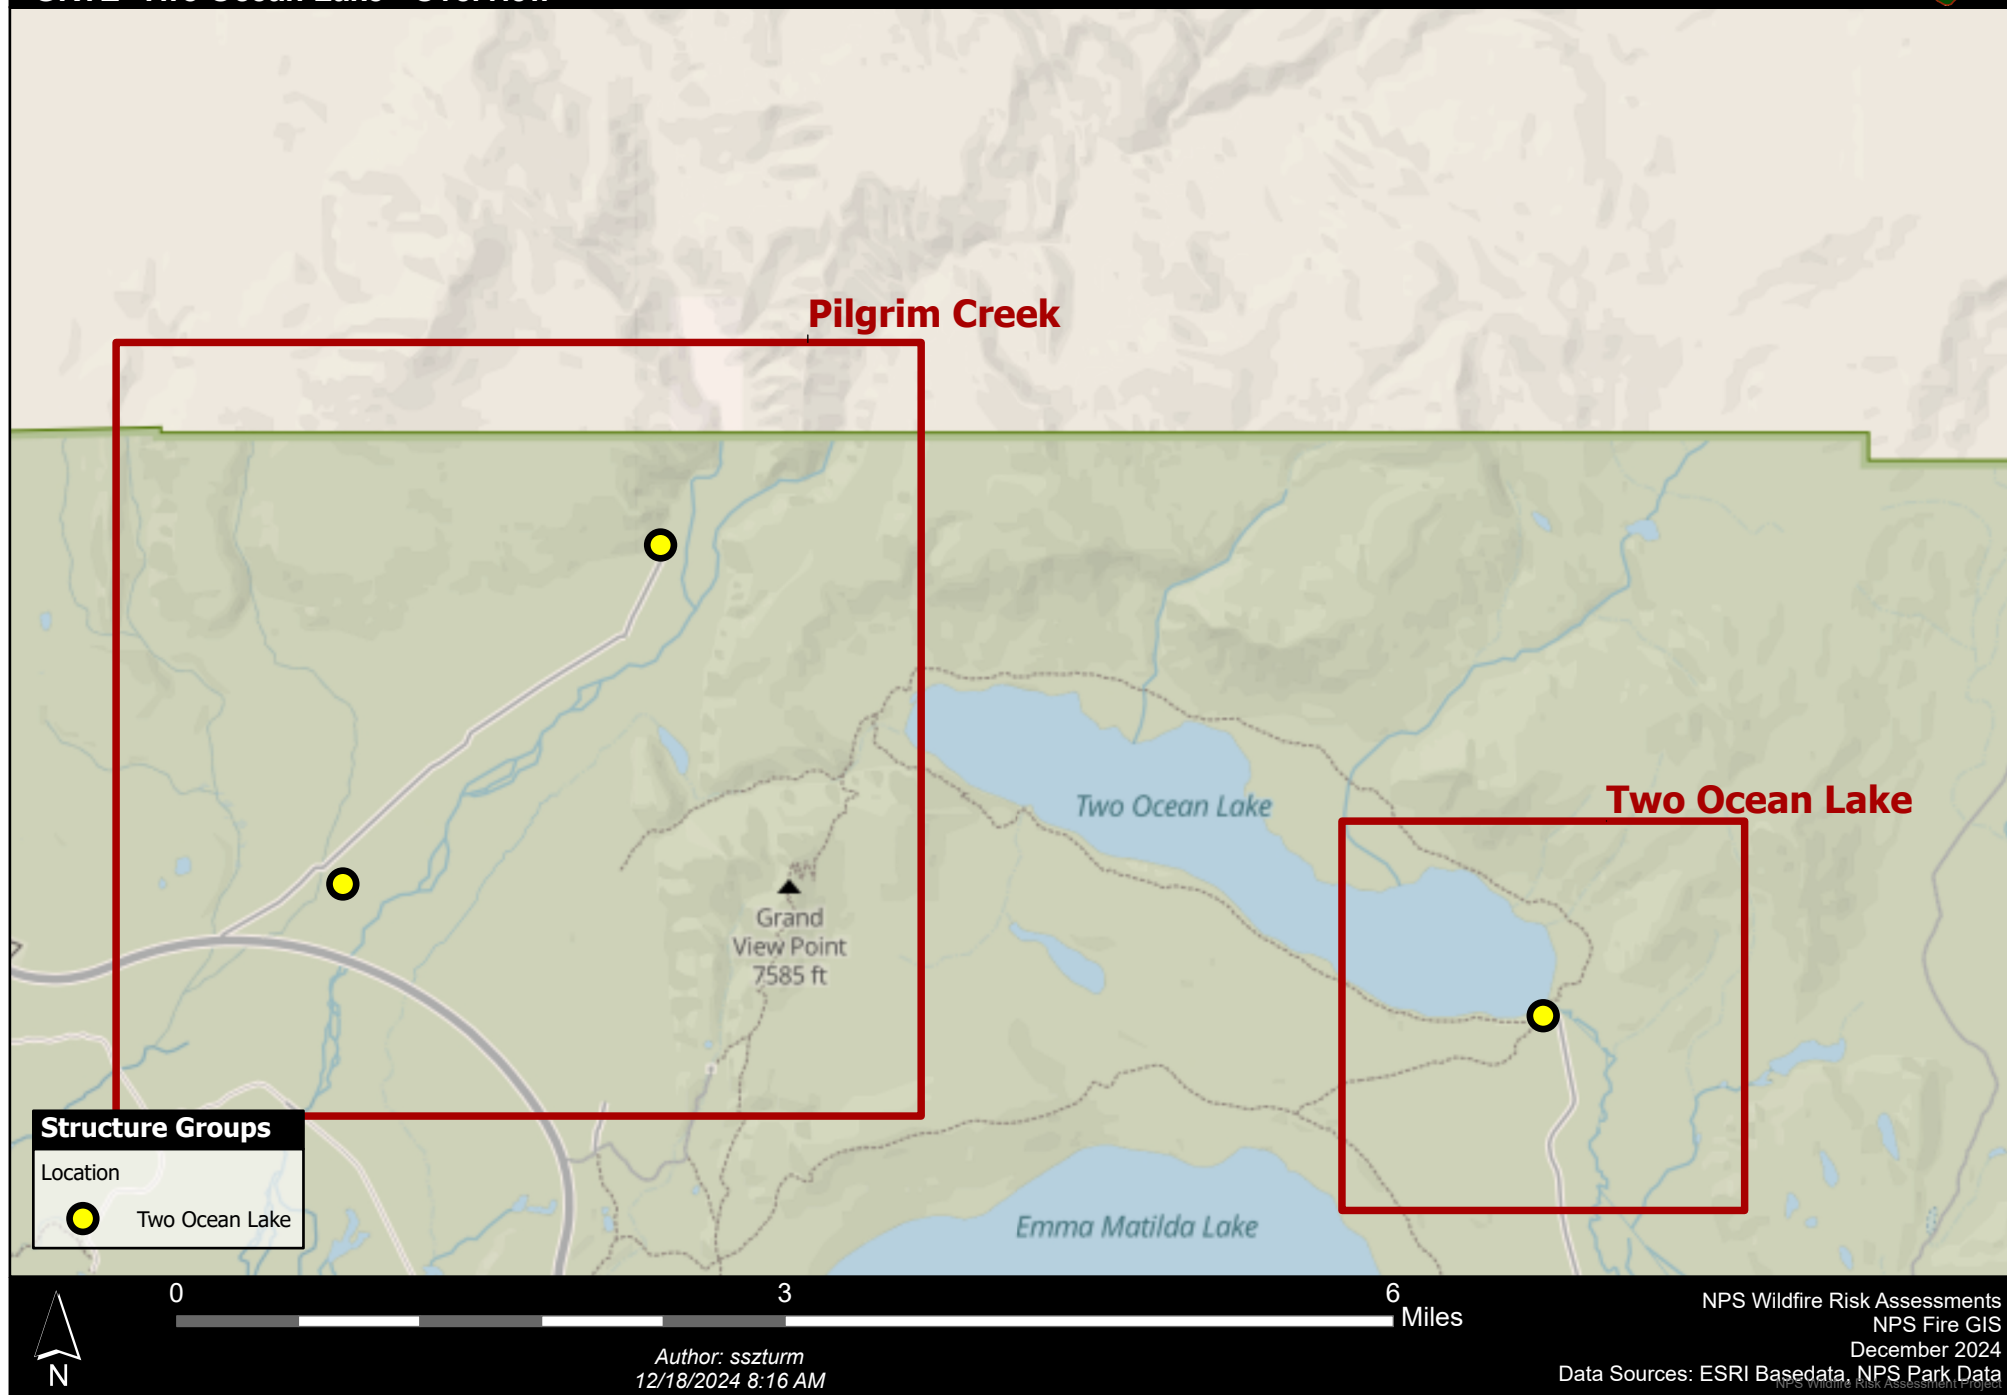

Pilgrim Creek
GRTE - Grand Teton National Park

National Park Service
U.S. Department of the Interior

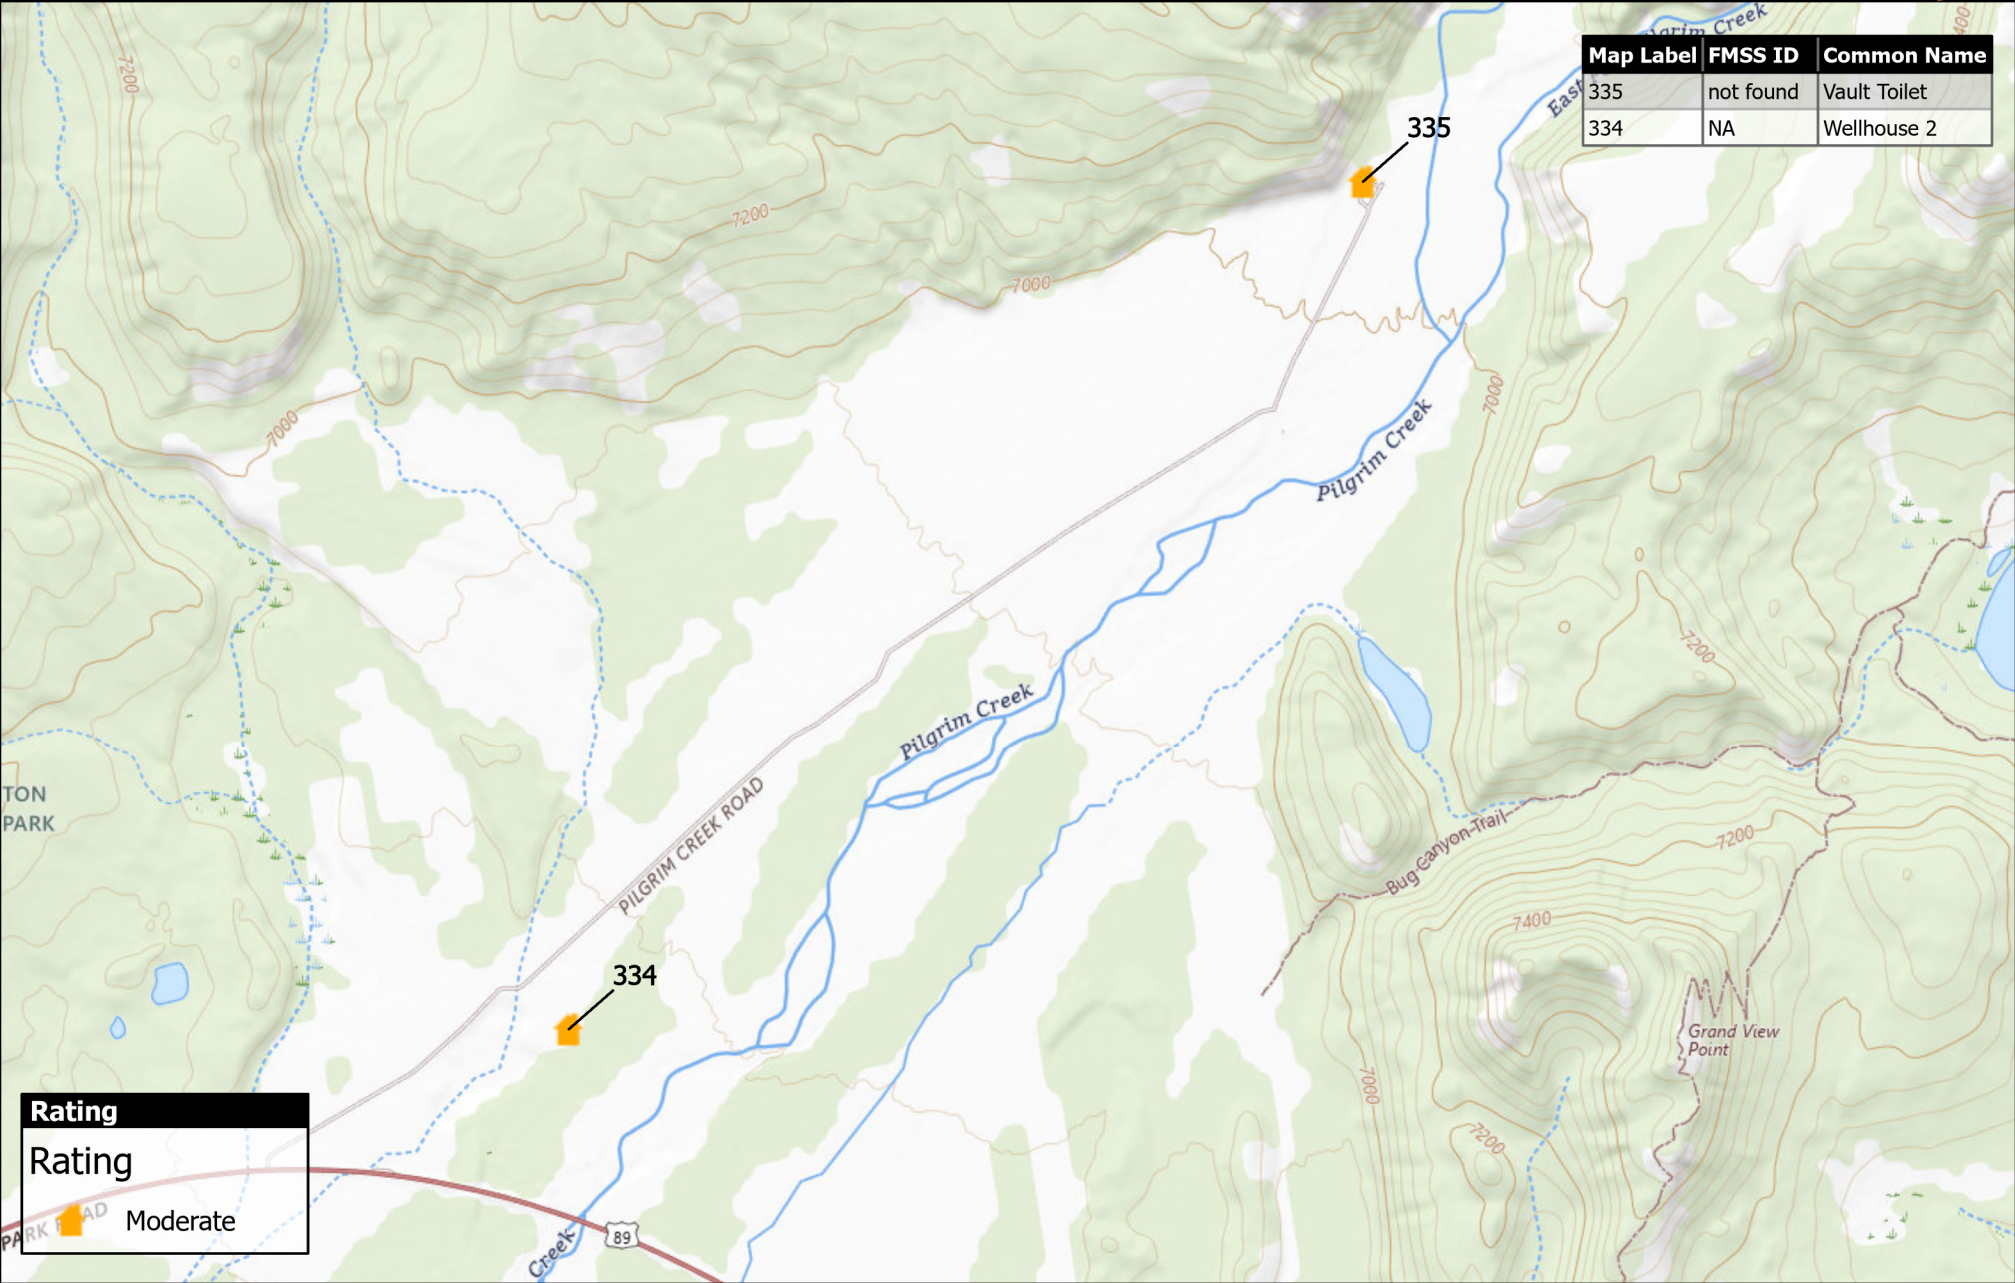

Rating

Rating

Moderate



Author: sszturm
2/18/2025 10:32 AM



NPS Wildfire Risk Assessments
NPS Fire GIS
February 2025
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project


Two Ocean Lake

GRTE - Grand Teton National Park

National Park Service
U.S. Department of the Interior



Map Label	FMSS ID	Common Name
336	9743	B - B2023 Romtec @ TWO OCEAN Lake

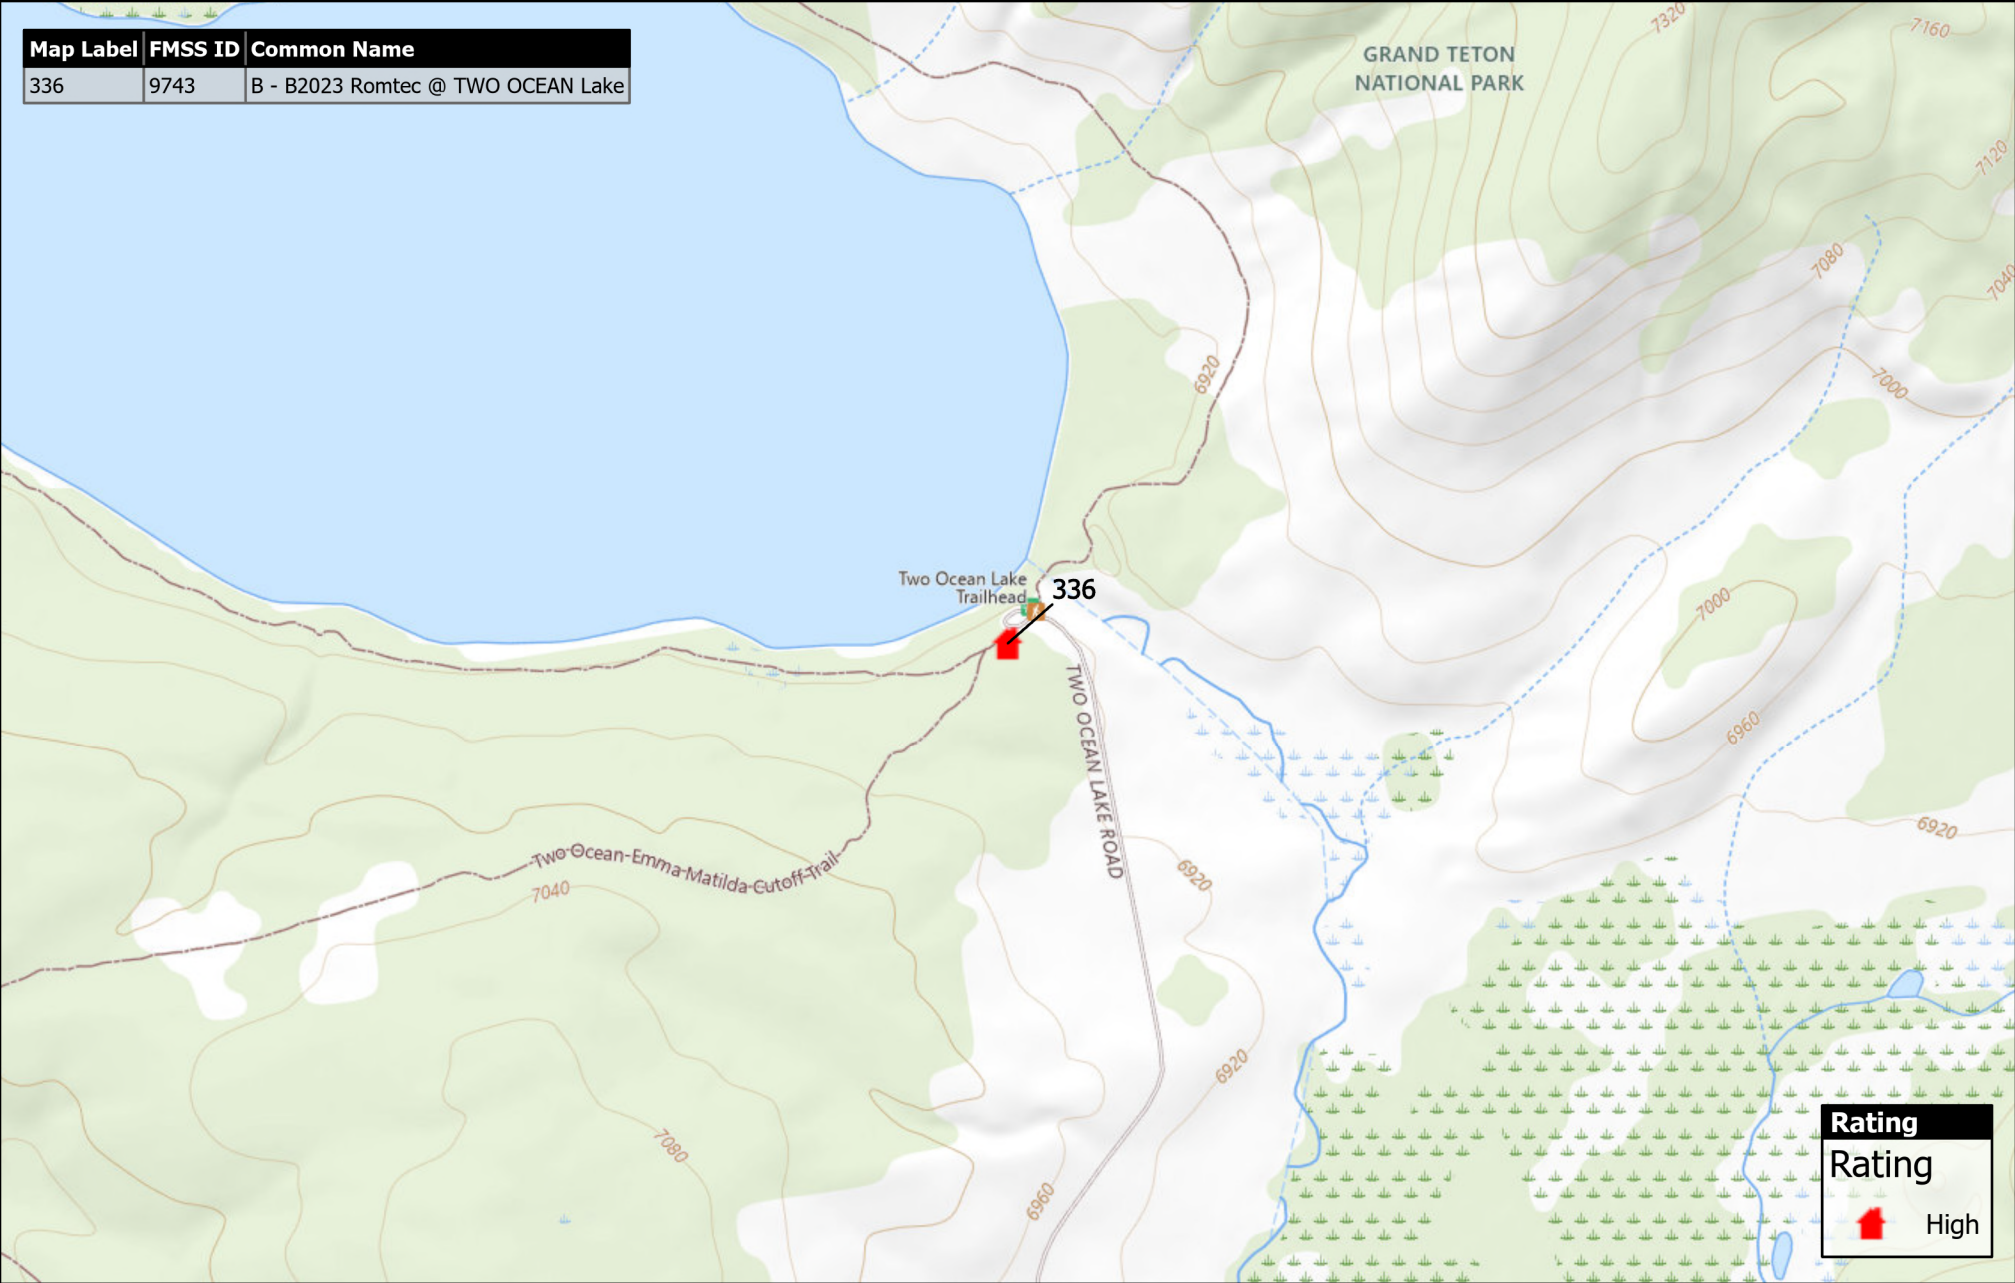

Rating

Rating

 High



Author: sszturm
2/18/2025 10:40 AM

0 0.5 Miles

NPS Wildfire Risk Assessments
NPS Fire GIS
February 2025
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Vault Toilet

Unit - Location: GRTE - Two Ocean Lake

FMSS ID: not found, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Castillo, June 22, 2021

Coordinates (DDM): 43° 55.50342522' N 110° 33.88544424' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 335

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: Less than 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, Greater than 30in masonry exposed or N/A


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

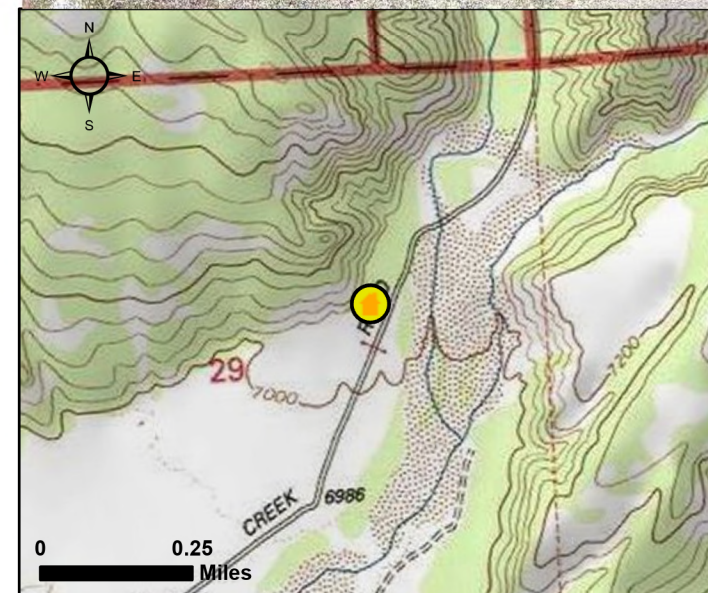



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: B - B2023 Romtec @ TWO OCEAN Lake

Unit - Location: GRTE - Two Ocean Lake

FMSS ID: 9743, **Local ID:**

Structure Type, Use: Toilet, Public

Owner: National Park Service

Field Crew, Visit Date: Vaughn, July 13, 2018

Coordinates (DDM): 43° 54.05259210' N 110° 30.10940982' W

Rating: High

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: yrs

Map Label: 336

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeGreater than 5%

Bridge Condition: Greater than 300 ft with turnaround

Access and Turnarounds: Greater than 300 ft with turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Heavy

Defensible Space: No defensible space

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed


Firewood: None

Water Supply: Reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

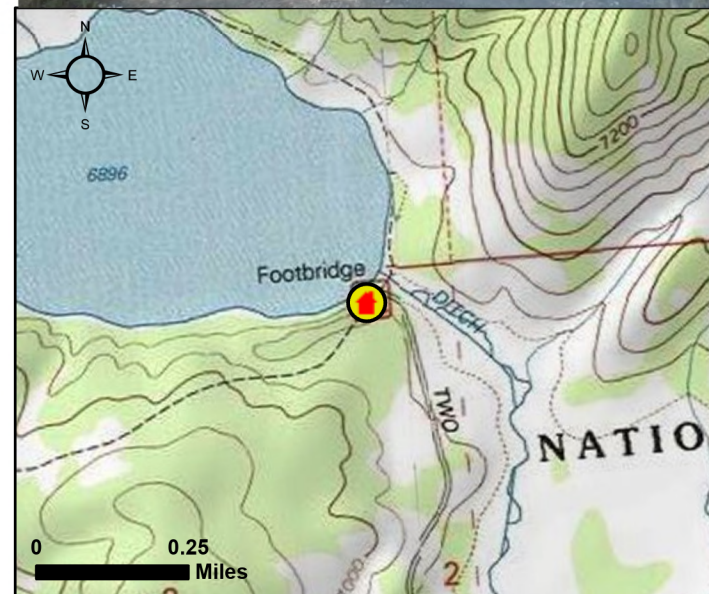



NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com/>

Facility Name: Wellhouse 2

Unit - Location: GRTE - Two Ocean Lake

FMSS ID: , **Local ID:**

Structure Type, Use: Building, Administrative

Owner: National Park Service

Field Crew, Visit Date: Castillo, June 22, 2021

Coordinates (DDM): 43° 54.45869166' N 110° 35.24474436' W

Rating: Moderate

ProtectionLevel: Not Designated,

Resources of Concern: Unknown

Occupied: No

In Community: No,

Revisit Interval: 5 yrs

Map Label: 334

Primary Access: Road

Ingress Egress: 1 road in/out

Access Width: 1 lane (Less than 18')

Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%

Bridge Condition: Greater than 300ft with no turnaround

Access and Turnarounds: Greater than 300ft with no turnaround

Facility Number or Sign: None or not clearly visible

Fuel Type: Shrub or timber

Fuel Load: Moderate

Defensible Space: 30 ft treated

Topography: Slope Less than 5%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, Less than 6in masonry exposed

Firewood: None

Water Supply: No reliable water source nearby

Propane: None

Overhead Hazards: No overhead hazards

Comments:

