



WATER-RIGHT DOCKET

Buffalo National River

Docket No: 13

TYLER BEND WELL #2

Supporting Hydro Data

11-30-1978: letter to state geologist on requesting locations and information on test holes; november 30, 1978

RECEIVED
NATIONAL PARK SERVICE
WASHINGTON OFFICE
DEC 4 7 20 AM '78

L54(SWR)OM

NOV 30 1978

Mr. Orville Wise
State Geologist
Arkansas Geological Commission
3815 W. Roosevelt Road
Little Rock, Arkansas 72204

Dear Mr. Wise:

In response to your telephone request the following is written confirmation of the locations of the five test holes drilled at Tyler Bend on the Buffalo River. Tyler Bend area is located upstream where U.S. Highway 65 crosses the Buffalo River near Silver Hill.

All wells were drilled by Harold King Drilling Company of Everton, Arkansas during the period of June 12 to July 1, 1978. The accompanying table summarizes the physical description of each well and the accompanying plat shows their locations. Cutting samples from each well were mailed to you for analysis sometime ago.

In the near future our intentions are to drill up to 12 additional wells and test pump all wells drilled in the last two years. Chemical analysis of each well water will also be made. All of the above data will be furnished to your office as they become available.

Sincerely yours,

/s/ John E. Coos

Regional Director,
Southwest Region

Enclosures


cc:
Chief, Division of Air and Water, WASO, 550 (Atten: Vic Berte')
Supt., Buffalo NR
Moore, OM, SWR (each with copies of enclosures)

Well #	Elev. (ft.)	Depth (ft.)	Diameter (inches)	Casing Depth (ft.)	Grout Depth (ft.)	SWL (BGL) ¹⁾ (ft.)	Drilling Estimate 2) flow
1	950	1275	6	68	68	132.82	10
2	950	670	6	66	66	259.46	45
3	975	580	6	61	61	203.28	50
4	625	235	6	130	130	60.41	150
5	625	430	6	93	93	26.07	60

1) SWL (BGL) means Static Water Level (Below ground level)


2) Method - Watch and 5 gal. bucket

Sec. 35 Township No. 16N of Range No. 17W

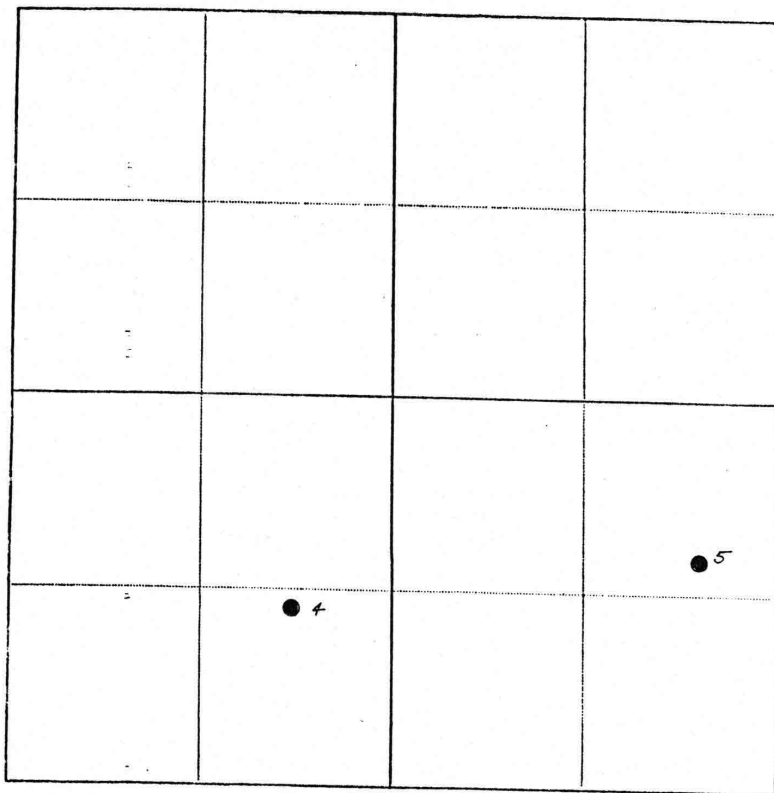


BUFFALO NATIONAL RIVER - SEARCY COUNTY
AREA - TYLER BEND

Sec. 2 Township No. 15 N of Range No. 17 W

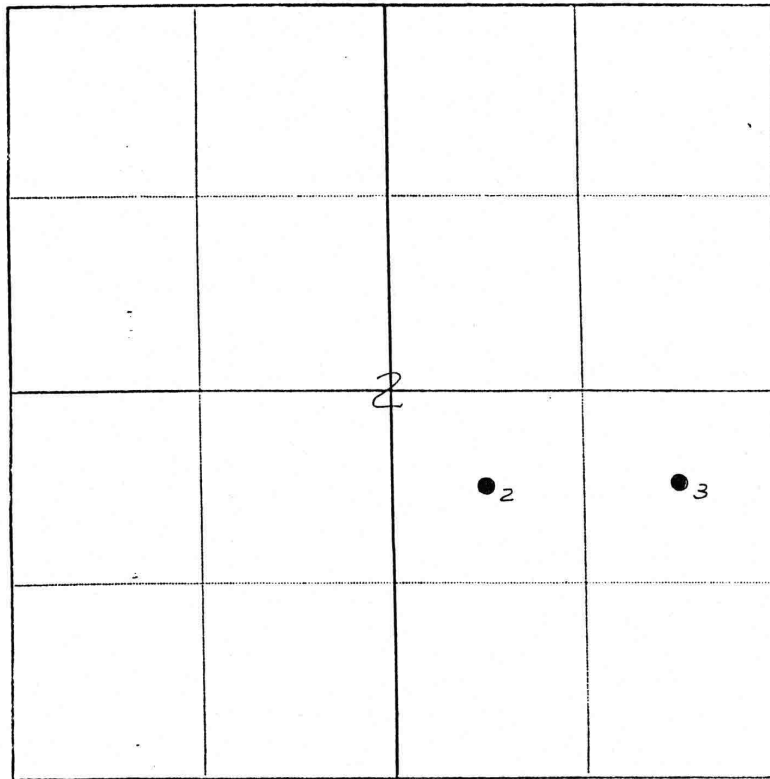

BUFFALO NATIONAL RIVER - SEARCY COUNTY
AREA - TYLER BEND

Sec. 1 Township No. 15N of Range No. 17W

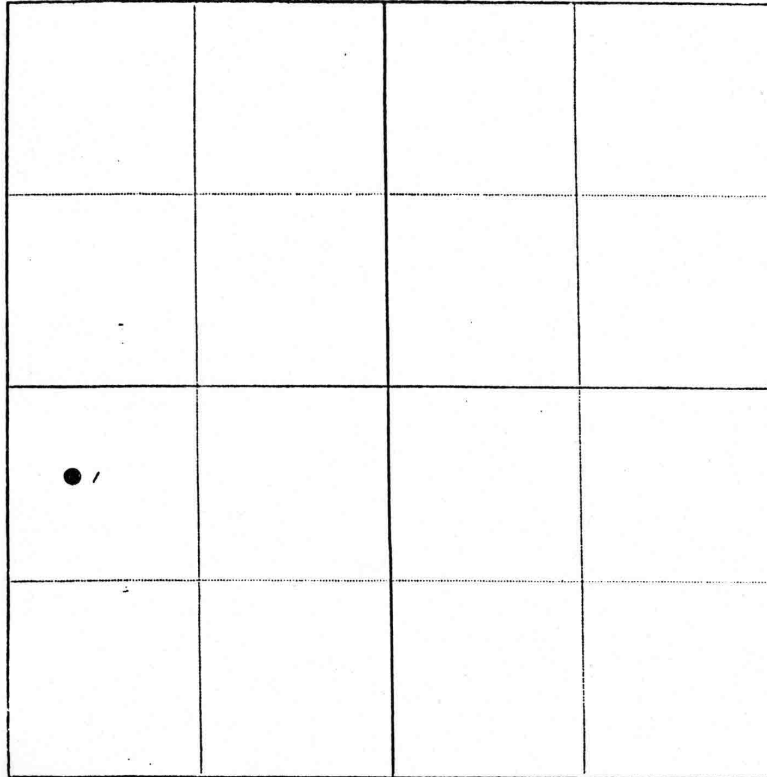

BUFFALO NATIONAL RIVER - SEARCY COUNTY
AREA - TYLER BEND

Well #2

Drilled by: Harold King Well Drilling Company, Everton, Arkansas
 Date drilled: 6/12/78
 Project Supervisor: Garland Moore, Southwest Region, Water Resources
 Location: Tyler Bend, Buffalo National River - **Well No. 2**

Driller's Log

<u>Depth</u>	<u>Description</u>
0' to 40'	Clay and chunk rock
40'	Rock, 35 lost return in chunk rock
47'	Soft rock mud and chunk rock
57'	Soft rock gray lime
109'	White and gray lime
185'	Soft brown rock and gray lime mix
190'	Gray lime
286'	Hard gray lime
343'	Dark gray lime
365'	Pink lime
375'	Green lime
390'	Dark gray lime
410'	Alternate layers lime
470'	Gray lime
530'	Gray sandstone
561'	Gray lime
585'	Gray sand
629'	Pink quartz, Water? 2
642'	White quartz, Water? 10
1'	Brittle quartz and brown rock
644'	Gray hard sandie lime
660'	Hard White and gray sand
642'	1' Pink and white quartz
30 g.p.m. at 642'	
670' D 65½" C.	
Cased 24' into solid	
Est. 300' to 350' W.	
Clear water - clean well	

Docket Information

Number of Documents in Docket 6
 Documents Dated from 6/12/1978 to 11/30/1978
 Docket Compiled: 2/10/2011