

National Park Service Cultural Landscapes Inventory 2022



Wright Brothers National Memorial Landscape

Wright Brothers National Memorial

[Internal Review/Park Review/SHPO Review]

Table of Contents

Chapter 1: General.....	7
Region	7
Park Alpha Code	7
Park Org Code.....	7
Resource Type	7
Resource Classification	7
Inventory Status.....	7
Resource ID.....	7
Resource Name.....	7
Parent Landscape	7
Parent Resource ID	7
State	7
Park Name.....	8
Cultural Landscapes in the Cultural Resources Inventory System:	8
Landscape Description	10
Landscape Hierarchy Description	12
Recent Condition	12
Subsite/Child components.....	12
Landscape Type	12
Cover Page Graphic.....	12
Site Plan(s)	13
Hierarchy Description Graphic	14
Other Names	14
Chapter 2: Concurrence Status	16
Park Superintendent Concurrence Date	16
Park Superintendent Concurrence	16

Completion Status Explanatory Narrative	16
Concurrence Graphics	16
Revision	24
Chapter 3: Geographic Information	25
Area (Acres)	25
Land Tract Number(s)	25
Boundary Description	25
Latitude/Longitude	25
Regional Landscape Context	26
Physiographic	26
Cultural	26
Political	26
Location Map Graphic Information	27
Counties and States	27
Chapter 4 : Management Information	28
Management Category	28
Management Category Date	28
Management Category Explanatory Narrative	28
Management Agreements	29
Legal Interests	29
Located in a managed wilderness?	29
Adjacent Lands Information	29
Do Adjacent Lands Contribute?	29
Narrative	29
Adjacent Lands Graphic	29
Chapter 5: National Register Information	30
National Register of Historic Places	30

Documentation Status.....	30
Documentation Narrative Description	30
Eligibility	30
Concurrence Eligibility Date	30
Concurrence Eligibility Narrative.....	30
Significance Level	30
Contributing/Individual	30
National Register Classification	30
Statement of Significance.....	30
National Register Significance Criteria	32
National Register Criteria Considerations	32
National Register Periods of Significance (with Historic Context Themes).....	32
National Register Areas of Significance	33
NRIS Information	33
State Register Documentation	33
National Historic Landmarks	34
Statement of Significance for National Historic Landmark	34
World Heritage Site	36
Is Resource within a designated National Natural Landscape?	36
Chapter 6: Chronology & Physical History	37
Chronology	37
Physical History	40
Sequence Number and Physical History Time Period.....	40
Physical History Narrative.....	40
Sequence Number and Physical History Time Period.....	47
Physical History Narrative.....	47
Sequence Number and Physical History Time Period.....	48

Physical History Narrative	48
Sequence Number and Physical History Time Period	59
Physical History Narrative	59
Chapter 7: Uses	85
Functions and Uses	85
Public Access	85
Public Access	85
Public Access Narrative	85
Associated Ethnographic Groups	85
Ethnographic Study Status:	85
Ethnographic Narrative:	85
Chapter 8: Analysis & Evaluation	86
Analysis and Evaluation Summary	86
Landscape Characteristics and Features	89
Buildings and Structures	89
Circulation	98
Natural Systems and Features	105
Small-Scale Features	106
Spatial Organization	114
Topography	118
Vegetation	120
Views and Vistas	125
Chapter 9: Condition Assessment	129
Assessment Interval:	129
Condition	129
Condition:	129
Condition Date:	129

Narrative:	129
Condition:	129
Condition Date:	129
Narrative:	129
Condition:	129
Condition Date:	129
Narrative:	129
Condition:	129
Condition Date:	130
Narrative:	130
Condition:	130
Condition Date:	130
Narrative:	130
Impacts	131
Chapter 10: Treatment	133
Stabilization Measures	133
Approved Treatments	133
Chapter 11: Bibliography and Supplemental Information	135
Bibliography	135
Supplemental Information.....	137
Appendix	138
Landscape Features.....	138

Chapter 1: General

Region

Southeast

Park Alpha Code

WRBR

Park Org Code

5187

Resource Type

Cultural Landscape

Resource Classification

Cultural Landscape

Inventory Status

Complete

Resource ID

550169

Resource Name

Wright Brothers National Memorial Landscape

Parent Landscape

N/A

Parent Resource ID

N/A

State

NC

Park Name

Wright Brothers National Memorial

Cultural Landscapes in the Cultural Resources Inventory System:

CRIS is the National Park Service's database of cultural resources on its lands, consisting of archaeological sites, historic structures, ethnographic resources and cultural landscapes. The set of CRIS records for cultural landscapes is referred to as CRIS-CL. CRIS-CL records conform to a standardized data structure known as the Cultural Landscapes Inventory (CLI).

The legislative, regulatory and policy directions for conducting and maintaining the CRIS are: Section 110 of the National Historic Preservation Act, NPS Management Policies (2006), Director's Order 28 (Cultural Resources) and Director's Order 28a (Archeology).

The Cultural Landscapes Inventory (CLI)

The CLI is the data structure within CRIS used to document and evaluate all potentially significant landscapes in which NPS has, or plans to acquire any enforceable legal interest.

Each CRIS-CL record is certified complete when the landscape is determined to meet one of the following:

Landscape individually meets the National Register of Historic Places criteria for evaluation; or,
Landscape is a contributing element of a property that is eligible for the National Register; or,
Landscape does not meet the National Register criteria, but is managed as cultural resources because law, policy or decisions reached through the park planning process.

Cultural landscapes vary from historic sites, historic designed landscapes, historic vernacular landscapes to historic ethnographic landscapes, but may also fit within more than one type. Those eligible for the National Register have significance in the nation's history on a national, state or local level, as well as integrity or authenticity.

The legislative, regulatory and policy directions for conducting and maintaining the CLI within CRIS are: *National Historic Preservation Act of 1966 (16 USC 470h-2(a)(1)). Each Federal agency shall establish...a preservation program for the identification, evaluation, and nomination to the National Register of Historic Places...of properties...*

Executive Order 13287: Preserve America, 2003. Sec. 3(a)...Each agency with real property management responsibilities shall prepare an assessment of the current status of its inventory of historic properties required by section 110(a)(2) of the NHPA...No later than September 30, 2004, each covered agency shall complete a report of the assessment and make it available to the Chairman of the Advisory Council on Historic Preservation and the Secretary of the Interior...

Executive Order 13287: Preserve America, 2003. Sec. 3(c) each agency with real property management responsibilities shall, by September 30, 2005, and every third year thereafter, prepare a report on its progress in identifying...historic properties in its ownership and make the report available to the Council and the Secretary...

The Secretary of the Interior's Standards and Guidelines for Federal Agency Historic Preservation Programs Pursuant to the National Historic Preservation Act, 1998. Standard 2: An agency provides for the timely identification and evaluation of historic properties under agency jurisdiction or control and/or subject to effect by agency actions (Sec. 110 (a)(2)(A) Management Policies 2006. 5.1.3.1 Inventories: The Park Service will (1) maintain and expand the following inventories...about cultural resources in units of the national park system...Cultural Landscape Inventory of historic designed landscapes, historic vernacular landscapes,...and historic sites...

Cultural Resource Management Guideline, 1997, Release No. 5, page 22 issued pursuant to Director's Order #28. As cultural resources are identified and evaluated, they should also be listed in the appropriate Service-wide inventories of cultural resources.

Landscape Description

Wright Brothers National Memorial is a 421-acre interpretive and commemorative site located in Kill Devil Hills, Dare County, North Carolina, about four miles south of the community of Kitty Hawk and about seven miles north of the coastal village of Nags Head, in a highly developed corridor along the Outer Banks. Administered by the National Park Service as part of the Outer Banks Group, the park incorporates the site of the first successful human attempt at heavier-than-air, controlled, powered flight. The designed landscape serves both to interpret this seminal event in aviation history and to memorialize the efforts of Orville and Wilbur Wright.

The analysis of the landscape development at Wright Brothers National Memorial suggests that the appropriate period of significance is 1900-1960. As the location of the Wright brothers' early experiments, culminating in the December 17, 1903, successful heavier-than-air powered flight, Wright Brothers National Memorial achieves its primary significance for its association with that historic event (1900-1903). However, radical changes that occurred to the site, beginning with the stabilization of Kill Devil Hill with grass and shrubs, as part of the Park Development era (1928-1942) altered the historic setting. Subsequent changes in the way the visitor is oriented to the site (1947-1960) altered the commemorative landscape. The 1947 Master Plan and later refinements that included a 1952-1954 visitor center overlay reflect the culmination of design and development at Wright Brothers National Memorial, ending in 1960 with the construction of the Wright Brothers National Memorial Visitor Center.

The historic condition of the site was that of open, shifting sandsflats devoid of vegetation punctuated by three large sand dunes and steady winds of 15-16 miles per hour. A major characteristic of the Wright-era landscape was its dynamic nature in response to natural forces and features. The Wrights chose the Outer Banks as the site of their experiments because the landscape met certain criteria: broad, open expanses of soft sand, prevailing winds, and sparse vegetation. The landscape was characterized by continual and dynamic change due to the low profile, narrowness, sand deposition, and adjacent high wave energy. The high winds, storm overwash, and salt spray precluded the establishment of dense vegetation.

Beginning in 1928, the topography and vegetation of the site were dramatically changed by the stabilization of Kill Devil Hill and West Hill, which were planted with grasses and shrubs to stop their southwestwardly migration. Construction of artificial barrier dunes along the Outer Banks between 1936-1940 reduced salt spray, sand movement, and storm overwash, dramatically altering the distribution and composition of the vegetation at Wright Brothers National Memorial.

These changes have resulted in the loss of the original setting of the Wright brothers' first flight of December 17, 1903. No Wright-era structures or vegetation remain on site. The World Heritage Committee denied the park's nomination in 1980 as a World Heritage site for this reason. The setting of Wright Brothers National Memorial has achieved significance as an example of a designed commemorative landscape that has evolved over time. Early efforts to memorialize the site focused on the Wright Brothers Monument, the First Flight Marker, and the spatial relationship between the two. With the decision to build a museum/visitor center and landing strip in the early 1950s, emphasis shifted from the monument and marker to a larger interpretive program that included the reconstruction of the Wright brothers' camp buildings. Markers placed at the landing sites of the first powered flights (the first flight path) have gained importance as a later addition to the commemorative landscape. The landscape retains overall integrity of location, design, workmanship, feeling, and association.

The Wright Brothers landscape includes several historic landscape features: the Wright Monument and associated Powerhouse (1932), the First Flight Marker (1928), the circular monument road and curvilinear pedestrian paths (1936), the original entrance gates (1933), the open, grassed mall that delineates the first flight area (1936), and the Wright Brothers National Memorial Visitor Center (1960). Although the setting of the Wright-era landscape has largely been lost, the open character remains intact. The landscape retains integrity of key features of its commemoration including spatial organization, structures, vegetation, and views and vistas.

Landscape Hierarchy Description

The Wright Brothers Cultural Landscape encompasses the entire 421-acre site of the Wright Brothers National Memorial, corresponding to its listing in the National Register of Historic Places. There are no component landscapes.

Recent Condition

Good

Subsite/Child components

N/A

Landscape Type

Historic Designed Landscape

Cover Page Graphic

See Cover Page.

Site Plan(s)

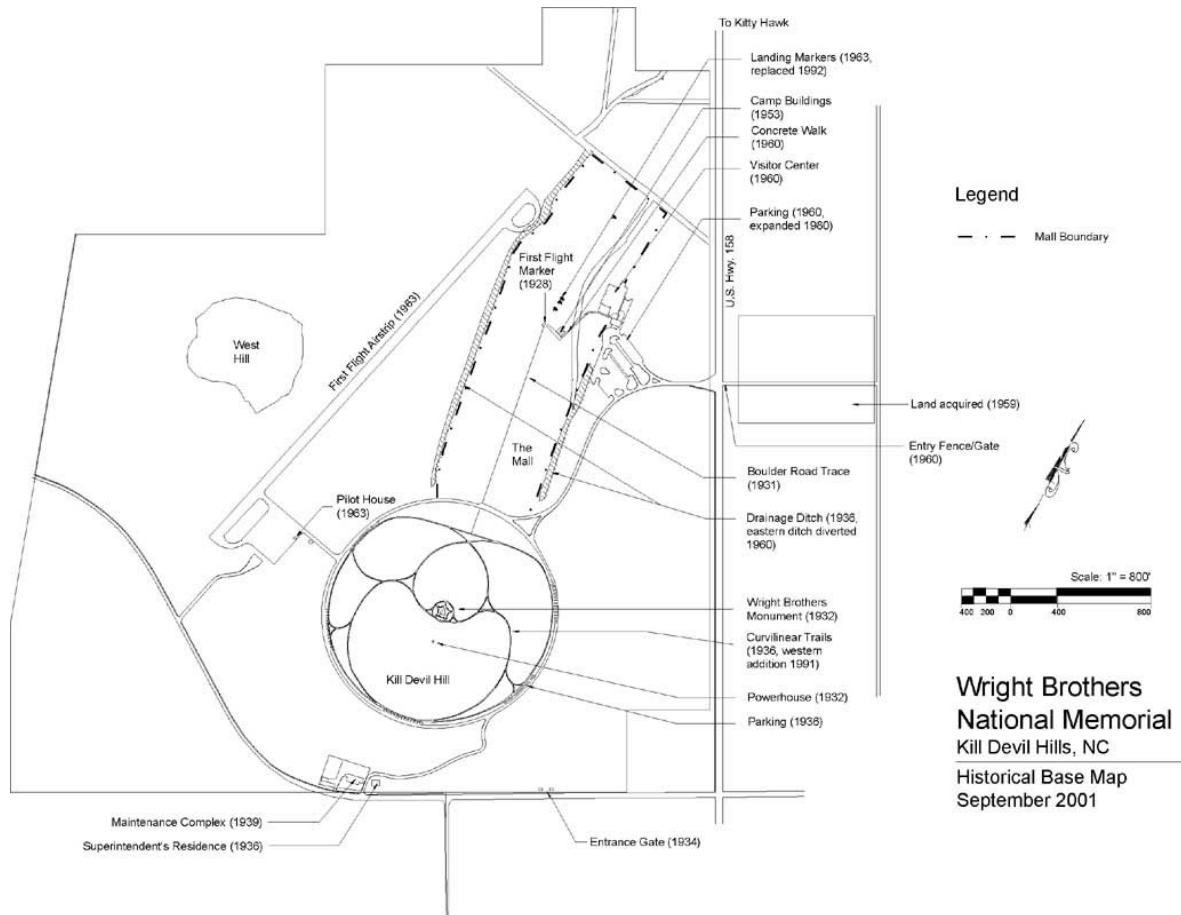


Fig 1. Site Plan 1 – Historical Base Map

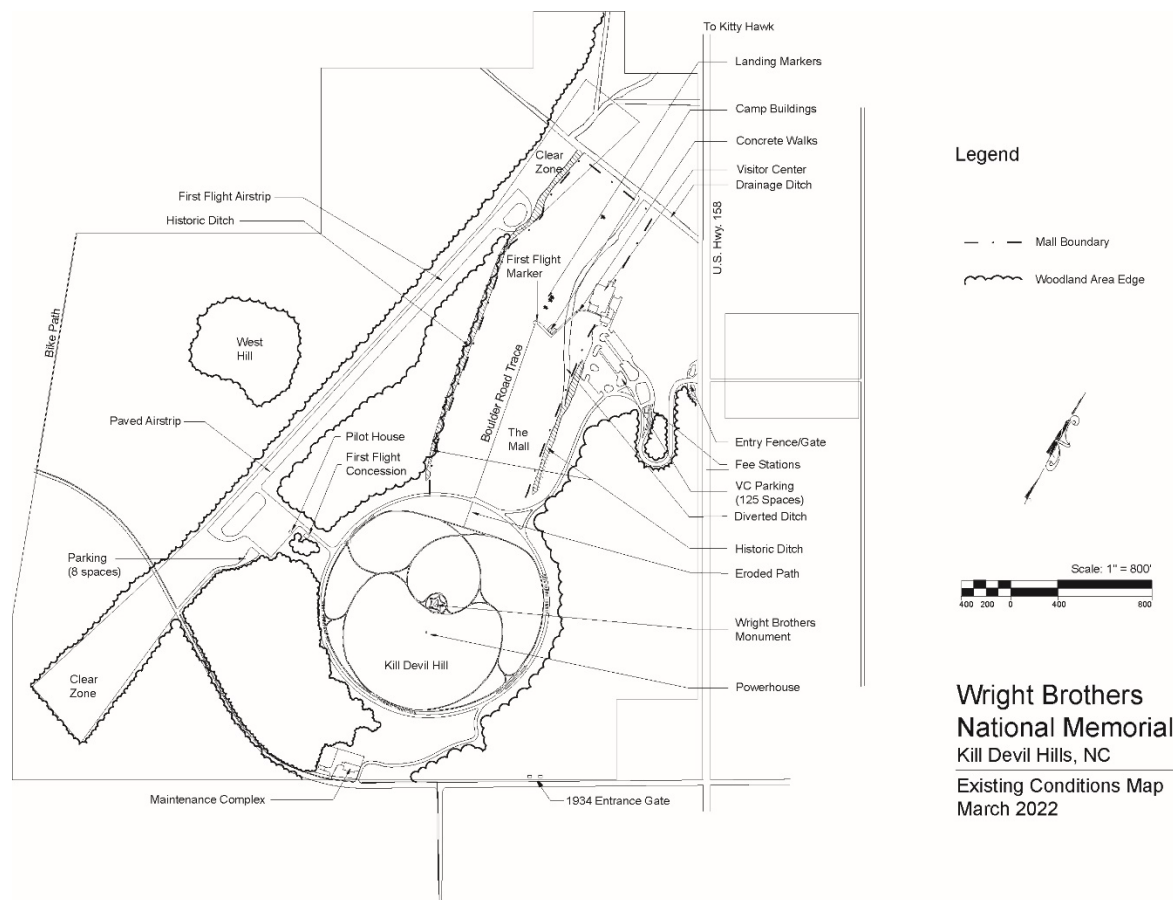


Fig 2. Site Plan 2 – Updated Existing Conditions Map

Hierarchy Description Graphic

N/A

Other Names

Seq. No.	Name	Type
01	Kill Devil Hill Monument	Historic
02	Kill Devil Hill Monument National Memorial	Historic
03	Kill Devil Hill National Memorial	Historic

04	Wright Brothers National Memorial	Historic and Current
----	-----------------------------------	----------------------

Chapter 2: Concurrence Status

Park Superintendent Concurrence Date

08/18/2010

Park Superintendent Concurrence

Yes

Completion Status Explanatory Narrative

Concurrence info will be added after CLI is complete and with signatures. Documentation for the CLI Levels I and II was extracted from a CLR for Wright Brothers National Memorial written by Susan Hitchcock and completed in 2001. Several site visits were conducted during the course of the CLR research, including a systematic review of the historic park maps and archival photographs. The author also photographed the key landscape features, surveyed the vegetation, and recorded existing conditions for the site. The Level II date reflects the date that the information was entered into CLAIMS, not the date that field research was completed.

The Wright Monument and associated powerhouse, the curvilinear trail system, the First Flight Marker, the grassed mall, the old entrance gates, the reconstructed camp buildings, and the Wright Brothers National Memorial Visitor Center are evaluated in greater detail as Level III landscape features. The park contact is Jami Lanier.

Concurrence Graphics



United States Department of the Interior

NATIONAL PARK SERVICE
Southeast Regional Office
Atlanta Federal Center
1924 Building
100 Alabama St., S.W.
Atlanta, Georgia 30303



H22(SERO-CRD)

12 July 2004

Memorandum

To: Superintendent, Wright Brothers National Memorial (WRBR)
From: Chief, Cultural Resource Division, Southeast Region *R. B. Hasty*
Subject: Cultural Landscape Inventory
Wright Brothers National Memorial Landscape
Reply Due: 16 August 2004

We are pleased to transmit to WRBR the Cultural Landscape Inventory (CLI) for the Wright Brothers National Memorial Landscape. The CLI is an evaluated list of landscape properties in the National Park System that are eligible for listing on the National Register of Historic Places (NR) or contribute to an existing historic property. In order for the CLI to be certified and counted under goals 1a7 and 1b2B in PMDS, the North Carolina State Historic Preservation Office (NC-SHPO) needs to concur on the eligibility of the property for listing in the National Register of Historic Places, and the Park Superintendent needs to concur on the condition assessment and management category provided within the inventory. Through prior communication with NC-SHPO on the Cultural Landscape Report, there is consensus on the significance of cultural landscape features at the property. For Park Superintendent approval, a signature page has been sent along with this CLI. It needs to be signed by the Superintendent and returned to the Regional Office for the final certification. If the condition assessment and management category are agreed upon, please sign the attached approval form and return to our office to the attention of David Hasty.

Enclosures



Letter to the Superintendent

CULTURAL LANDSCAPE INVENTORY
CONDITION ASSESSMENT CONCURRENCE SHEET

Park Information

Park: Wright Brothers National Memorial
Name: Wright Brothers National Memorial Landscape
Location: North Carolina
County: Dare
CLI#: 550169

Cultural Landscape Condition Information

Landscape Condition:

Good X

Fair

Poor

Management Category:

Must be preserved X

Should be preserved

May be preserved

May be released, altered or destroyed

Park Superintendent Concurrence

Concur Do Not Concur

Lawrence A. Belli 8/3/04
Superintendent Date

Superintendent Signature of Concurrence; 2004

AUG. 18. 2010 3:53PM NATIONAL PARK SERVICE

NO. 033 P. 1

CULTURAL LANDSCAPE INVENTORY
CONDITION ASSESSMENT CONCURRENCE SHEET

8 July 2010

Park Information

Park: Wright Brothers National Memorial
Name: Wright Brothers National Memorial Landscape
Location: North Carolina
County: Dare
CLI#: 550169

Cultural Landscape Condition Information

Landscape Condition:

Good X

Fair

Poor

Management Category:

Must be preserved X

Should be preserved

May be preserved

May be released, altered or destroyed

Park Superintendent Concurrence

Concur ✓ Do Not Concur

Michael B. Murray 8-18-10
Superintendent Date

Superintendent Signature of Concurrence; 2010

NRT PARK SERVICE

FAX 252-410-2030

PM 4:04

4/11

1:04

Page 3

Lawrence Belli

April 8, 2002

- Pages 70-74: The analysis section includes a description of changes to the visitor center (page 70), but the evaluation that follows does not mention those changes in terms of the seven aspects of integrity. For consistency and thoroughness, these changes should be addressed with regard to design and materials.
- Pages 79-80: The bulleted items on treatment of the visitor center should specify that any vegetation planted should not block the distant view of the visitor center, which is an important landmark in the community and commemorative landscape.
- Find Notes: It would be easier to read the several sets of end notes if the identification numbers were properly formatted (smaller and in superscript).
- Bibliography, unpublished reports. We enclose a copy of our "Evaluation of the Visitor Center (Mitchell/Giurgola, 1959-1960), Wright Brothers National Memorial, Kill Devil Hill, Kitty Hawk, North Carolina," North Carolina State Historic Preservation Office, January 14, 1997, and request that it be cited among the "Unpublished Reports" in the bibliography.

The above comments are made pursuant to Section 106 of the National Historic Preservation Act and the Advisory Council on Historic Preservation's Regulations for Compliance with Section 106 codified at 36 CFR Part 800.

Thank you for your cooperation and consideration. If you have questions concerning the above comment, contact Renee Gledhill-Harley, environmental review coordinator, at 919/733-4763. In all future communication concerning this project, please cite the above referenced tracking number.

Sincerely,

David Brook by J. Hotteluck

David Brook

DB:kgc

enclosures

cc: Doug Stover, NPS, Manteo

2nd page of Letter from Superintendent

NHT PARK SERVICE FAX: 252-413-2333

North Carolina Department of Cultural Resources
State Historic Preservation Office
David L. S. Brooks, Administrator

Division of Historical Resources
David J. Olson, Director

Michael P. Easley, Governor
Lisbeth C. Evans, Secretary
Jeffrey J. Crow, Deputy Secretary
Office of Archives and History

April 8, 2002

Lawrence A. Belli
Outer Banks Group
National Park Service
1401 National Park Drive
Manteo, NC 27954

Re: Wright Brothers National Memorial Cultural Landscape Report,
Dare County, ER 02-8976

Dear Superintendent Belli:

Last fall we received a draft version of the above-cited report, but were asked to withhold comment until a later date. This January staff at the Wright Brothers National Memorial asked us to review the final report. A comparison of the final report with the draft report indicates that the only substantive differences are additional documentary photographs and plans and a brief section at the end on preparing a record of treatment.

Overall, the cultural landscape report does an excellent job of acknowledging, describing and analyzing the multi-layered history of the site and its landscape, especially the history of commemoration over the years. Throughout the report, there is an appropriate emphasis on interpreting the changes to the site, particularly the commemorative design elements.

The following corrections and additions are recommended:

- Page 31: At the top of the page, the granite company is incorrectly cited. The company is the North Carolina Granite Corporation, formed in 1904 in Mount Airy. John D. Sargent, a stonecutter from Vermont, became superintendent in 1910 and in 1918 became the company's president. Under Sargent, the company became a national leader in its field, providing the stone for numerous important national projects such as the Ft. Knox Bullion Depository and the Arlington Bridge in Washington, D.C.
- Pages 33-35: It would be helpful if architects J. M. Thrower and Thomas C. Vint were more fully identified. Where were they based? What were their credentials?
- Page 38: Efforts to obtain the 1903 Wright brothers plane are mentioned. A bit more information would be helpful. Where was the plane ca. 1950? Were those overseeing development of the Wright Brothers National Memorial in competition with groups in Dayton?

	Location	Mailing Address	Telephone/Fax
Administration	507 N. Blount St. Raleigh, NC	4617 Mail Service Center, Raleigh 27699-4617	(919) 733-4763 • 733-8653
Restoration	515 N. Blount St. Raleigh, NC	4613 Mail Service Center, Raleigh 27699-4613	(919) 733-6547 • 715-4801
Survey & Planning	515 N. Blount St. Raleigh, NC	4618 Mail Service Center, Raleigh 27699-4618	(919) 733-4763 • 715-4801

Letter from the Superintendent

OFFICIAL CORRESPONDENCE VIA ELECTRONIC MAIL
NO HARD COPY TO FOLLOW

United States Department of the Interior

NATIONAL PARK SERVICE
Southeast Regional Office
Atlanta Federal Center
1924 Building
100 Alabama St., S.W.
Atlanta, Georgia 30303

IN REPLY REFER TO: 1.A.2 (SERO-CRD)

08 August 2016

Memorandum

To: Superintendent, Fort Raleigh National Historic Site and Wright Brothers National Memorial

From: Chief, Cultural Resources Division, Southeast Region 

Subject: Cultural Landscapes Inventory – Condition Assessment Renewal

The Cultural Landscapes Inventory (CLI) is an evaluated list of landscape properties in the National Park System eligible for listing in the National Register of Historic Places (NR) or that contribute to a previously listed NR historic property. The CLIs were completed in FY 2010. The CLI for Fort Raleigh National Historic Site Landscape was produced by Wiss, Janney, Elstner Associates, Inc. through an IDIQ contract with SERO. The CLI for Wright Brothers National Memorial Landscape was produced by SERO employee Susan Hitchcock. At that time, the CLI was approved with signature by the North Carolina state historic preservation office, and by the park Superintendent of Fort Raleigh National Historic Site and Wright Brothers National Memorial. Digital copies of the inventories are located on the Cultural Resources Division IRMA at:

Fort Raleigh National Historic Site Landscape:

<https://irma.nps.gov/DataStore/Reference/Profile/2229831>

Wright Brothers National Memorial Landscape:

<https://irma.nps.gov/DataStore/Reference/Profile/2198173>

In order for the CLIs to remain certified, WASO requires the condition assessment to be less than six years old. Through consultation with Jamie Lanier, we believe the properties should remain in their currently listed conditions. We ask that you review the updated condition assessment and condition impacts in the attached forms. If the condition is agreed upon, please sign the attached condition concurrence and return it to our office to the attention of Laura Bradford by fax (404.562.3202), email (laura_bradford@partner.nps.gov) or mail. If you have any questions, please contact David Hasty, CLI Coordinator (david_hasty@nps.gov or 404.507.5780).

Attachments

CLI Reassessment Memo to Superintendent

**CULTURAL LANDSCAPE INVENTORY
CONDITION ASSESSMENT CONCURRENCE SHEET – August 03, 2016**

Park Information

Park: Fort Raleigh National Historic Site and Wright Brothers National Memorial

State: North Carolina

County or Counties: Dare

Cultural Landscape Information

Inventory Name	CLI ID #	New Condition	Old Condition & Date
Fort Raleigh National Historic Site	550168	Fair	(Fair – 07/15/2010)
Wright Brothers National Memorial	550169	Good	(Good – 08/18/2010)

Park Superintendent Concurrence

Concur ☒ Do Not Concur ☐



Superintendent

9/15/16

Date

CLI Reassessment Superintendent Signature

**CULTURAL LANDSCAPE INVENTORY
CONDITION RE-ASSESSMENT CONCURRENCE SHEET – August 2022**

Park Information

Park: Outer Banks Group: Cape Hatteras National Seashore, Wright Brothers National Memorial, and Fort Raleigh National Historic Site
State: North Carolina **County:** Dare

Cultural Landscape Information

<u>Inventory Name</u>	<u>CRIS CLI ID #</u>	<u>Previous Condition</u>	<u>New Condition</u>
Cape Hatteras Light Station	550150	Fair	Fair
Wright Brothers NM	550169	Good	Good
Fort Raleigh NHS	550168	Fair	Fair

Management Category: Must Be Preserved and Maintained

Park Superintendent Concurrence

Cape Hatteras National Seashore/Outer Banks Group concurs with the CLI updates for Cape Hatteras Light Station, Wright Brothers National Memorial, and Fort Raleigh National Historic Site.

Concur



Not Concur



Superintendent Signature
and Date


9/14/2022

Good: Indicates the inventory unit shows no clear evidence of major negative disturbance and deterioration by natural and/or human forces. The inventory unit's cultural and natural values are as well preserved as can be expected under the given environmental conditions. No immediate corrective action is re-quired to maintain its current condition.

Fair: Indicates the inventory unit shows clear evidence of minor disturbances and deterioration by natural and/or human forces, and some degree of corrective action is needed within 3-5 years to prevent further harm to its cultural and/or natural values. If left to continue without the appropriate corrective action, the cumulative effect of the deterioration of many of the landscape characteristics will cause the inventory unit to degrade to a poor condition.

Poor: Indicates the inventory unit shows clear evidence of major disturbance and rapid deterioration by natural and/or human forces. Immediate corrective action is required to protect and preserve the remaining historical and natural values.

CLI Superintendent Reassessment Signature 2022

Revision

CLI condition updated in FY 22.

Chapter 3: Geographic Information

Area (Acres)

421

Land Tract Number(s)

01-101 through 01-123

Boundary Description

The 421-acre park is located in Kill Devil Hills, Dare County, North Carolina, about four miles south of the older community of Kitty Hawk and about seven miles north of the historic coastal village of Nags Head, in a highly developed corridor along the Outer Banks. Expanded from its earlier 314-acre size on June 23, 1959, Highway 158 forms the eastern boundary of the park, and Colington Road forms the south boundary. To the west and southwest, a wooded area of pine/hardwood forest buffers the park. More built-up areas surround the park on the southeast, east, and north, although areas of woody vegetation on the southeast and east screen the site from increasing development.

Latitude/Longitude

[enter text here (eg 'See spreadsheet in Appendix.')]]

Seq. No.	Geo-metry	Latitude	Longitude	Geo-Datum	Elevation (Meters)	Position Source	Position Accuracy	Date	Narrative
		36.0236 526051 334	- 75.6654 768737 832						
		36.0064 677369 571	- 75.6753 190295 104						
		36.0108 455629 44	- 75.6581 563764 245						

		36.0190 562169 992	- 75.6812 527586 423						
--	--	--------------------------	-------------------------------	--	--	--	--	--	--

Regional Landscape Context

Physiographic

Wright Brothers National Memorial is located on an Atlantic barrier island on the Outer Banks of North Carolina. The shore zone or interface between the land and sea portions of the coastal plain consists of a series of barrier islands two to twenty miles offshore. Most are low islands one to three miles wide and ten to twenty miles long. The highest topographic features are sand dunes, usually 10 to 20 feet above sea level, but sometimes reaching heights of more than 100 feet. The barrier islands of the Outer Banks are an assemblage of sedimentary layers, each made up of particles of different sizes that indicate their source and the processes responsible for their movement.

Cultural

Native peoples inhabited the North Carolina barrier islands hundreds of years before they were discovered by European explorers in the 16th century. In 1584, Sir Walter Raleigh sent two vessels across the Atlantic to search for suitable sites for New World settlements. Within a year, a settlement was established on the northern end of Roanoke Island. By 1590, however, there was no trace of the colonists, and the mystery remains unsolved to this day.

The area was not permanently settled until the mid-17th century when English colonists settled near present-day Colington. From the beginning, proximity to the ocean and the mainland has been important to those living on the Outer Banks. The natural processes that formed these islands have caused major redistributions of the populations for the past 400 years.

Political

The park is located within the 3rd Congressional District of North Carolina.

Location Map Graphic Information

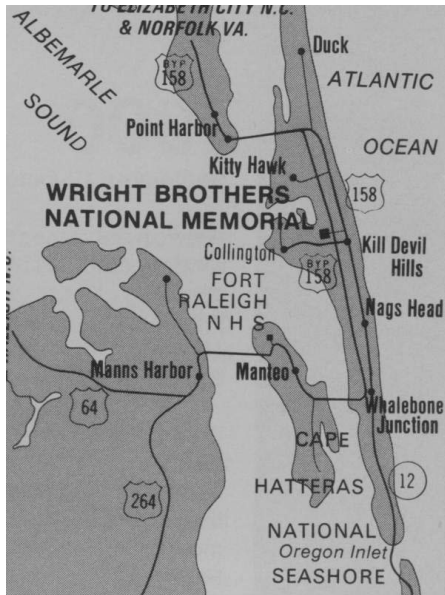


Fig 3. Location map for Wright Brothers National Memorial

Counties and States

Dare County, North Carolina

Chapter 4 : Management Information

Management Category

Must be Preserved and Maintained

Management Category Date

8/18/2010

Management Category Explanatory Narrative

The park incorporates the site of the first successful human attempt at heavier-than-air powered flight—an accomplishment attained by Orville and Wilbur Wright on 17 December 1903. The Wright brothers came to the Outer Banks of North Carolina in 1900 to conduct glider experiments. The area met their needs of a wide, open space devoid of vegetation with steady winds of fifteen-sixteen miles per hour. They chose the area south of Kitty Hawk because of the presence of three large sand dunes, known locally as Kill Devil Hills. The Wrights spent the next three years, intermittently at Kill Devil Hills, conducting experiments and test flights before achieving success with four powered flights, the longest of which was 852 feet in 59 seconds. Historians now view the Wright brothers' efforts as a seminal event in aeronautic development, paving the way for future advances in aviation. The park was established in 1927 to commemorate this event. Beginning in 1928, the site was planted with grasses in order to stabilize the sand dunes and to create a memorial landscape that included the Wright Brothers Monument on top of Kill Devil Hill, the First Flight Marker, and a grassed mall.

In January 2001, the Wright Brothers National Memorial Visitor Center was designated a National Historic Landmark, in recognition of its being a nationally significant example of a Mission 66 visitor center and as one of the most important examples nationally of the Philadelphia School of modern architecture. It had previously been included as a contributing feature of the existing National Register historic district as an outstanding example of modernist architecture in North Carolina.

Management Agreements

Management Agreement	Other Management Agreement	Management Agreement Expiration Date	Management Agreement Explanatory Narrative
Concession Contract/Permit		12/31/2011	The First Flight Airstrip services the site's concession and general aviation.

Legal Interests

Legal Interest Type	Fee Simple Reservation Expiration Date	Other Organization/Agency	Legal Interest Narrative
Fee Simple			

Located in a managed wilderness?

Unknown

Adjacent Lands Information

Do Adjacent Lands Contribute?

No

Narrative

Lands outside the park boundary do not contribute to the significance of the Wright Brothers National Memorial Landscape.

Adjacent Lands Graphic

N/A

Chapter 5: National Register Information

National Register of Historic Places

Documentation Status

Entered – Inadequately Documented

Documentation Narrative Description

Wright Brothers National Memorial was first listed in the National Register on 15 October 1966, upon passage of the National Historic Preservation Act. Documentation for the district was accepted by the Keeper of the National Register on 25 August 1978. An amendment to the nomination, accepted 13 September 1996, provides documentation about the Wright Brothers National Memorial Visitor Center.

Eligibility

Eligible – SHPO Consensus Determination

Concurrence Eligibility Date

04/08/2004

Concurrence Eligibility Narrative

NC-SHPO concurred on the significance of the cultural landscape through information provided in the CLR, which is the source for this CLI.

Significance Level

National

Contributing/Individual

Contributing

National Register Classification

District

Statement of Significance

Wright Brothers National Memorial encompasses the site of the first heavier-than-air powered flight, achieved by Orville Wright on 17 December 1903, and subsequent test flights of the same day piloted by both Orville and Wilbur Wright. The Wright brothers' earlier experiments with gliders also occurred here.

Wright Brothers National Memorial is significant under National Register Criterion A and B as the location of the Wrights' successful flight experiments. The resources are also significant under Criterion A for their association with the efforts to recognize, commemorate, and preserve the site. They are significant under National Register Criterion C for the commemorative architecture and landscape architecture of the site. The period of significance is 1900-1960.

The Wrights chose the Outer Banks for their experiments because the landscape met certain criteria: broad, open expanses of soft sand, prevailing winds, and sparse vegetation. A major characteristic of the Wright-era landscape was its dynamic nature in response to natural forces and features. The high winds, storm overwash, and salt spray precluded the establishment of dense vegetation.

The Kill Devil Hills area was the focus of their experiments because of the presence of three large sand dunes. The Wrights spent the next three years intermittently on site conducting experiments and test flights before achieving success with four powered flights on 17 December 1903, the longest of which was 852 feet in fifty-nine seconds. Historians now view the Wright brothers' efforts as a seminal event in aeronautic development that paved the way for future advances in aviation.

Congress created Kill Devil Hill Monument in 1927 to commemorate the Wright brothers' historic first flight. Beginning in 1928, the site was stabilized to support a memorial landscape, including the Wright Monument, a nationally significant example of commemorative architecture, the First Flight Marker, the curvilinear trails and circular monument road, the monument's associated powerhouse, and the grassed mall that set off the area from the surrounding landscape that was growing up in woody vegetation. These resources represent the realization of the intended commemorative purpose of the park through a formal designed landscape under War Department and NPS management.

With the decision to include a larger interpretive program in the 1947 Master Plan, emphasis

shifted from the monument and marker to plans for a museum/visitor center, reconstruction of the Wright brothers' camp buildings, and markers placed at the landing sites of the first powered flights. The developments associated with this shift to a comprehensive interpretation approach altered much of the Park Development-era landscape. However, the landscape as proposed in 1947 with refinements in 1952-54 remains essentially intact and is in the range of being 50 years old.

The Wright Brothers National Memorial Visitor Center was the centerpiece of the shift from commemoration to comprehensive interpretation in the landscape. Throughout the Mission 66 period, the Park Service's overriding goal for its visitor centers was to improve interpretation and stimulate public interest in the park (Allaback 2000, 26). Recently designated a NHL, this early Mission 66 visitor center controlled the approach and entry from the parking lot into the building, with clear views out to the mall blocked by the cypress fence. Visitors were directed to the visitor center first, where they learned the Wright brothers' story, and then were released out to the camp buildings, the first flight line, and the monument beyond.

National Register Significance Criteria

- A - Associated with events significant to broad patterns of our history
- B - Associated with lives of persons significant in our past
- C - Embodies distinctive construction, work of master, or high artistic values

National Register Criteria Considerations

- E -- A reconstructed building, object, or structure
- F -- A commemorative property
- G -- A property less than 50 years of age

National Register Periods of Significance (with Historic Context Themes)

Seq. No.	Start Year/Era and End Year/Era	Historic Context Theme	Subtheme	Facet
----------	---------------------------------	------------------------	----------	-------

01	1900 CE – 1924 CE	Expanding Science and Technology	Technology (Engineering and Invention)	Transportation
02	1925 CE – 1960 CE	Expressing Cultural Values	Architecture	Moderne Art Deco (1920-1945)
03	1925 CE – 1960 CE	Expressing Cultural Values	Landscape Architecture	The 1930s: Era of Public Works

National Register Areas of Significance

Seq. No.	Category	Subcategory (only for Archeology and Ethnic Heritage)	Narrative
01	Architecture		
02	Conservation		
03	Invention		
04	Landscape Architecture		

NRIS Information

Seq. No. (R)	NRIS Name (R)	NRIS ID (R)	NRIS URL (R)	Other Name	Primary Certification Date (R)
	Wright Brothers National Memorial	66000071	Asset Detail (nps.gov)		10/15/1966

State Register Documentation

Seq. No. (R)	Identification Number	Name	Listed Date	Narrative
N/A	N/A	N/A	N/A	N/A

National Historic Landmarks

Status	Theme	Contributing	NHL ID	NHL URL	Date
Yes	III. Expressing Cultural Values; 5. Architecture, Landscape Architecture, and Urban Design	Individual (Wright Brothers National Memorial Visitor Center)	66000071	Asset Detail (nps.gov)	01/03/2001

Statement of Significance for National Historic Landmark

The following is pulled directly from the National Historic Landmark nomination for the Wright Brothers National Memorial Visitor Center:

The Wright Brothers National Memorial Visitor Center is of extraordinary national importance under NHL Criteria 1 and 4. The property falls under the NHL Theme III (Expressing Cultural Values), Subtheme 5 (Architecture, Landscape Architecture, and Urban Design). The property is less than 50 years old, but qualifies under Criteria Exception 8 because of its extraordinary national importance.

Under NHL Criterion 1, the property is associated with events that have made significant contributions to the broad national patterns of American history. Specifically the property is associated with the Park Service's "Mission 66" program, which transformed the American national park system to meet postwar conditions. The park "visitor center" was the central planning and design element of the Mission 66 program. The visitor center was the most significant architectural expression of national park development in the postwar period and subsequently became the centerpiece of park planning of all types both nationally and abroad. The Wright Brothers National Memorial Visitor Center was one of the four most significant and successful examples of the new building type. Because of its significance within the Mission 66 program, and therefore within the history of American parks, the property possesses extraordinary national importance under NHL Criterion 1.

The Wright Brothers building was a high profile project for Mission 66, in part because of the

recent 50th anniversary of the first flight in 1953, But the outstanding critical acclaim that greeted the building probably took many by surprise. At the time, Ehrman Mitchell and Romaldo Giurgola had only been in business two years, and had never had a commission that attracted national attention. The Wright Brothers National Memorial Visitor Center did attract national attention, in contemporary design magazines, among other architects, and within the Park Service. The building became a national showcase for the Mission 66 program and an important factor in legitimizing the use of modern architecture in the national parks. It also launched the firm of Mitchell/Giurgola, which went on to become one of the most important American architectural firms of the 1960s and 1970s. Since then, numerous publications and surveys on American architecture have remarked on the significance of the Wright Brothers building as a seminal commission for the Mitchell/Giurgola firm. Scholars have noted, as well, the high quality of the building's design and construction. The Wright Brothers building was the first major success for Mitchell/Giurgola, and influenced their later work, and as a result the course of American architecture.

Under NHL Criteria 4, the property embodies distinguishing characteristics of an architectural type specimen exceptionally valuable for the study of a period and style. Specifically the property one of the four most significant examples of Park Service Modern architectural style. This style relates to contemporary American modernism, and Mitchell/Giurgola were among the most important American modern architects of the era. The Wright Brothers National Memorial Visitor Center was this firm's most important early commission.

The property is also a significant example of the Philadelphia School of modern architecture. In the late 1950s and early 1960s, a small group of architects in Philadelphia, inspired in part by the teaching and work of Louis I. Kahn, began to move away from the strict formalism and objectivism of the International Style, as it was being advocated by Walter Gropius and Mies Van der Rone, The Wright Brothers National Memorial Visitor Center is one of the most important examples nationally of the emerging style of this school.

The Wright Brothers National Memorial Visitor Center was also an early, precedent-setting

example of modern style embraced by the Park Service as part of Mission 66. The critical and popular success of the building legitimized modern architectural style for use in national parks. Advanced building technology, efficient materials, and labor saving construction were also showcased by this benchmark project. The Wright Brothers National Memorial Visitor Center was a powerful and influential early example of how modern construction techniques and architectural style could be appropriate and successful for national park development. The Wright Brothers National Memorial Visitor Center is one of the four most significant examples of the particular strain of American modern architecture that can be described as Park Service Modern. Because of its significance as an example of American modern architecture of the period, the property possesses extraordinary national importance under NHL Criterion 4.

World Heritage Site

Status	Category	WHS ID	WHS ID URL	Date
No				

Is Resource within a designated National Natural Landscape?

No

Chapter 6: Chronology & Physical History

Chronology

Seq. No.	Major Event	Major Event Narrative	Start Year of Event	Start Era	End Year of Event	End Era
01	Engineered	Between 1900-1903, the Wright brothers conducted experiments at Kill Devil Hills, culminating in the first heavier-than-air powered flight of December 17, 1903. The brothers continued their work at the site in 1908 and 1911.	1900	CE	1911	CE
02	Memorialized	On December 17, 1928, members of the International Civil Aeronautics Conference dedicated a granite marker placed at the approximate location of the 1903 liftoff and the cornerstone of the monument to be placed on Kill Devil Hill.	1928	CE	1928	CE
03	Stabilized	Beginning in 1928, Kill Devil Hill was stabilized by the planting of grasses and shrubs.	1928	CE	1931	CE
04	Built	In 1931, construction began on the Rogers and Poore Art Deco-inspired granite monument. The monument and its associated powerhouse were completed in 1932.	1931	CE	1932	CE
05	Built	The War Department constructed an entrance road that arced around the east side of Kill Devil Hill and turned due north, on axis with the First Flight Marker. The War Department constructed an entrance feature that was completed in 1933.	1931	CE	1933	CE
06	Land Transfer	In August 1933, Kill Devil Hills Monument National Memorial was transferred from the War Department to the National Park Service.	1933	CE	1933	CE

07	Altered	Between 1934-1936, NPS removed the War Department entrance road and built a new circular road. NPS also removed the existing path ascending Kill Devil Hill and built a symmetrical, curvilinear path system.	1934	CE	1936	CE
08	Built	A caretaker's residence and comfort station were built between 1935-1936.	1935	CE	1936	CE
09	Planted	In 1936, the Greenbriar Farms of Norfolk, Virginia completed an ornamental planting project at the site.	1936	CE	1936	CE
10	Reconstructed	In 1953, the Wright brothers' camp buildings were reconstructed.	1953	CE	1953	CE
11	Altered	In 1954, the park repointed the exterior walls and enclosed the terrace of the superintendent's quarters on the north side.	1954	CE	1954	CE
12	Altered	Beginning in 1957, the circulation system was significantly altered. A new entrance road and a bypass road to Colington were completed in 1958. The old entrance road and Boulder Road were removed between 1958-1959.	1957	CE	1959	CE
13	Purchased/Sold	In 1959, Congress authorized the formal acquisition of the additional 111 acres to the north and east.	1959	CE	1959	CE
14	Built	In February 1959, the contract for the construction of the Wright Brothers National Memorial Visitor Center was awarded to Hunt Construction Company of Norfolk, Virginia.	1959	CE	1960	CE
15	Built	An airstrip was constructed east of West Hill in 1963.	1963	CE	1963	CE
16	Reconstructed	In November 1963, the park took down the reconstructed camp buildings (quarters and hangar) and reconstructed them in 1964-65.	1964	CE	1965	CE

17	Altered	In 1974, the terrace of the superintendent's residence was enclosed with screening and wood lattice, and the original steel sash windows were replaced with double-hung metal windows.	1974	CE	1974	CE
18	Altered	In 1976, the original steel frame windows of the visitor center were replaced with aluminum frames and the steel casement-type windows in the assembly room were replaced with fixed-sash aluminum windows.	1976	CE	1976	CE
19	Demolished	The abandoned entrance station was removed in 1979 after the park received Section 106 clearance.	1979	CE	1979	CE
20	Expanded	In 1980, Denver Service Center oversaw a contract to approximately double the visitor center parking lot.	1980	CE	1980	CE
21	Land Transfer	In 1984, the United States conveyed to the state of North Carolina a right-of-way along a portion of Ocean Bay Boulevard and a portion of Colington Road.	1984	CE	1984	CE
22	Preserved	The Williamsport Training Center completed preservation work on the Wright Brothers Monument in 1987.	1987	CE	1987	CE
23	Altered	In 1992, the park replaced the small concrete pedestals previously used to mark the 1903 landing sites with granite markers.	1992	CE	1992	CE
24	Reconstructed	In 1993, the park's preservation team rebuilt the quarters and hangar building.	1993	CE	1993	CE
25	Rehabilitated	In 1997, the Wright Brothers Monument was rehabilitated.	1997	CE	1997	CE
26	Removed	In 1998, the park removed the cypress fence and associated vegetation that provided a screen from the parking lot to the first flight area.	1998	CE	1998	CE
27	Stabilized	In 2000, the powerhouse was stabilized.	2000	CE	2000	CE

28	Altered	Between 2002 and 2005, Boulder Road Trace/First Flight Path was paved between Wright Memorial Drive and the First Flight Marker.	2002	CE	2005	CE
29	Altered	The entrance drive was rerouted to incorporate a loop and a new visitor center/fee station south of the main parking area.	2005	CE	2006	CE
30	Demolished	Superintendent's Quarters demolished	2012	CE	2012	CE
31	Rehabilitated	Visitor Center rehabilitation including removal of unsympathetic alterations	2016	CE	2019	CE
32	Restored	Project to restore the historic landscape of Kill Devil Hill started	2019	CE	2019	CE
33	Rehabilitated	Work is currently in progress in the visitor center and parking.	2021	CE	2022	CE

Physical History

Sequence Number and Physical History Time Period

01 – 1900-1911

Physical History Narrative

The Wright Brothers National Memorial is recognized as the site of the first successful human attempt at heavier-than-air, controlled, powered flight carried out by Orville and Wilbur Wright on December 17, 1903. The first flight marked the end of many years of experimentation by the brothers from Dayton, Ohio. The three years immediately preceding were spent intermittently on site conducting experiments and test flights. The brothers' fascination with heavier-than-air flight has been traced back to 1892 when they began reading and analyzing previous writings and experiments on flight. Employed in their own bicycle manufacturing and repair business, the Wrights were able to devote the majority of September to January to their experiments. In 1899, the brothers conducted their first glider experiments using a double-foiled kite, and the following year they continued testing construction materials and techniques. Their goal was to create a glider capable of carrying the weight of a man.

It was during this first period of experimentation in Dayton that the brothers began to search for a more practical site to test their glider. They consulted the U.S. Weather Bureau and other individuals conducting flight experiments to identify locations that would meet certain criteria of topography, vegetation, and wind (a wide, open space; steady winds of fifteen-sixteen miles per hour; isolation; elevation change; and soft sand for landing). They chose the North Carolina Outer Banks because the landscape was characterized by broad, open expanses of shifting sand and steady northeasterly prevailing winds. The area was void of vegetation because of the high winds, salt spray, and periodic storm overwash. Following correspondence with residents of Kitty Hawk, North Carolina, Orville and Wilbur Wright were persuaded that this was the best location for their flight experiments, due to the presence of several large sand dunes, known in the area as Kill Devil Hills. Insert footnote: Over the years, there have been many theories as to the origin of this place name. Regardless, the name appears on maps as early as 1809. A lifesaving station established here in 1870 bore the name, and when the town incorporated in 1954, it adopted the name as well.

The First Season

The brothers' first season of experiments at Kitty Hawk began when they arrived in September 1900. The last leg of the trip was by boat, as there were no bridges connecting the Outer Banks with the North Carolina mainland. At the time Kitty Hawk was an isolated fishing village of several hundred inhabitants. A letter from Wilbur in 1900 described the area:

In October my brother and myself spent a vacation of several weeks at Kitty hawk, North Carolina, experimenting with a soaring machine. We located on the bar which separates Albemarle sound from the ocean. South of Kitty hawk the bar is absolutely bare of vegetation and flat as a floor, from sound to ocean, for a distance of nearly five miles, except a sand hill [Kill Devil Hill] one hundred and five feet high which rises almost in its center. The main slope of the hill is to the northeast, which is facing the prevailing winds. The slope is one to six. To the north, northeast, and east, and southeast there is nothing but flat plain and ocean for a thousand miles nearly. It is the ideal place for gliding experiments except for its inaccessibility (Westcott 1983, 30).

The brothers originally stayed in the home of the local Postmaster, William J. Tate, and his family in the village of Kitty Hawk. Soon thereafter they established a camp immediately outside the village, approximately four miles north of the current National Memorial. Orville and Wilbur began to experiment with their first glider in October 1900, focusing on flying the glider as a kite using guide ropes controlled from the ground. On October 19, they moved their experiments about four miles south to the Kill Devil Hills area to begin their first manned glides from the slopes of three large sand dunes (referred to by the Wrights as Big Hill [Kill Devil Hill], West Hill, and Little Hill). Wilbur later described the Kill Devil Hills practice ground as a “group of detached hills or mounds formed by sand heaped up by the winds ... constantly changing in height and slope, according to the direction and force of the winds” (Westcott 1983, 76).

Before the end of their first season, the brothers had completed about a dozen manned glides from the Kill Devil Hills. They returned to Dayton in late October and resumed their work in the bicycle shop and began the design and construction of a second glider that they completed early the following year.

1901, The Second Season

Orville and Wilbur transported their second glider to the Outer Banks for testing in July 1901. At this time they established a more permanent camp, constructing a combined wood frame workshop and storage facility about four miles south of their old camp and just northeast of the main Kill Devil Hill (Stick 1958, 204). The season's experiments consisted primarily of manned glides that were launched from the slopes of the main Kill Devil Hill. With the benefit of an increased wing span and surface area, the brothers broke the previous season's records of manned glider distance and time aloft. The brothers completed their experiments in August and returned to Dayton for further work. After a series of wing configuration tests, they had enough data to create a new design, which they incorporated into the 1902 glider and subsequent powered aircraft.

1902, The Third Season

The Wright brothers began a third season at the Kill Devil Hills site in August 1902. They returned to the camp established the previous year to find it in disrepair as a result of winter storms and shifting sand. With the help of local labor, the brothers made basic repairs to their camp and added ten feet to the storage and workshop building to be used as living quarters (Combs 1979, 158). The brothers remained in camp until October while they tested their new glider, surpassing the previous year's records of distance and time aloft, completing over 700 glides from the slopes of the three large sand dunes that dominated the topography of the site. By the end of the 1902 season, the Wrights had made great progress on the way to successful flight. They returned to Dayton to develop an engine for their aircraft.

1903, The Fourth Season

The Wrights spent the winter of 1902 and spring of 1903 in Dayton developing an engine for their glider with the goal of attaining powered flight. They returned to the Outer Banks for their fourth season at the Kill Devil Hills site in late September. Upon their arrival they began repairs on the storage facility/workshop, which had been blown off its foundation by storms. They found the 1902 glider intact, despite damage to the storage facility, and practiced with it until the 1903 aircraft was ready. They also constructed a second building, or hangar, for their powered aircraft. The new building, constructed just west of the old camp building, was a wood frame structure that was braced on two sides against the wind and measured approximately 44-by-16 feet (Stick 1958, 208). The powered glider, which they called the Flyer, arrived one month after Orville and Wilbur, and another month passed before the powered aircraft was assembled. To aid in the launching of the Flyer, the brothers constructed a sixty-foot "monorail" that consisted of four, 15-foot two-by-fours covered with a metal strip. The Wrights immediately experienced engine difficulties, which in turn resulted in damage to one of the propeller shafts, which they sent to Dayton for repairs. In the interim, the brothers improved the construction of the monorail, which had to be relaid for each flight along the northeast side of Big Hill. The repaired shafts arrived at the camp on November 20, but extremely cold weather delayed test flights throughout the month. After finding a crack in one of the propeller shafts, they decided only solid steel shafts could withstand the vibrations of the engine. Orville traveled back to Dayton to get the necessary parts (Howard 1988, 122).

On December 12, 1903, the brothers installed new propeller shafts on the Flyer. The following Monday, they decided to test the machine despite low wind velocities, but were only able to stay aloft for three and one-half seconds before the Flyer clipped the sand with its left wing. After repairs were completed, the next attempt was made on December 17, 1903. They erected the monorail on the flat ground just west of their camp buildings. Orville Wright piloted the first flight, which covered a distance of 120 feet and lasted only twelve seconds. Following repairs to a damaged rudder, the brothers repeated the experiment. At 11:20 Wilbur made a second flight, totaling 175 feet. A half-hour later Orville made the third flight, covering a little more than 200 feet and lasting about fifteen seconds. At noon Wilbur piloted the fourth and longest flight of the day, covering 852 feet in fifty-nine seconds. A gust of wind toppled the Flyer after the fourth flight, cracking the engine and making any further attempts impossible and ending the season's experiments.

The Aftermath

After successfully completing the first powered flights of 1903, Orville and Wilbur returned to Dayton to work on a sturdier flyer that would hold a more powerful engine. The brothers used a field located about eight miles from Dayton as a practice area for the two new planes that they designed and constructed in 1904 and 1905. Although they acknowledged that the practice area was not as favorable as the Kill Devil Hills site, they continued to set new records of time and distance aloft.

Between 1905 and 1908, the brothers devoted their time to making improvements to the flyer and in negotiating with potential clients. In 1908, the brothers secured two contracts with the U.S. Army Signal Corps and a French client. Because the contracts were dependent on successful demonstrations of the flyer, the brothers decided to return to Kill Devil Hills where they could count on better winds, more open space, and privacy to regain their skills and further test the aircraft.

The Fifth Season

The fifth season began in April 1908 when Wilbur arrived to prepare the camp; Orville arrived a month later. In their absence storms had again destroyed the camp buildings used in previous seasons. They constructed a new building to serve as both living quarters and hangar for the 1908 experiments. By the end of May, the brothers were confident they could meet the required demonstrations the contracts called for. Wilbur left the Outer Banks on May 17 to go directly to Europe where he began assembling the glider for the demonstration in LeMans, France. Orville left camp a few days later for Dayton to begin building a new flyer for the U.S. Signal Corps tests at Fort Myer, Virginia (HRS 1997, 38). In 1911, Orville returned for a short period for further glider experiments. Wilbur died in 1912 of typhoid fever.

Physical History Graphics



Fig 4. View of camp, 1900

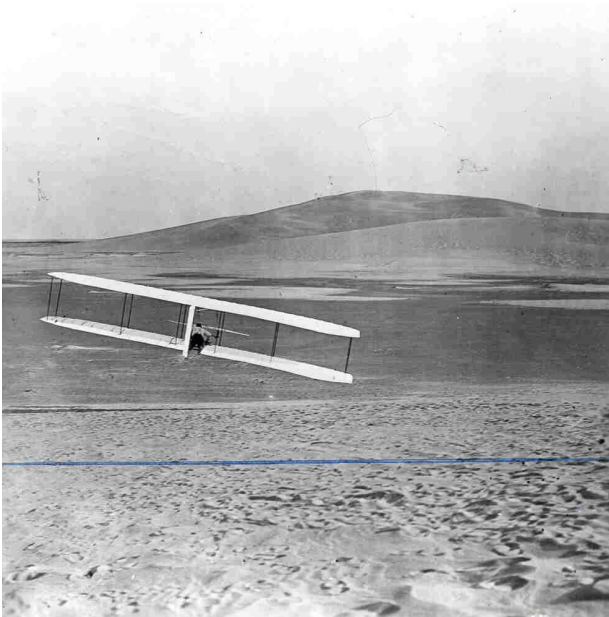


Fig 5. Glider flights from West Hill, 1902

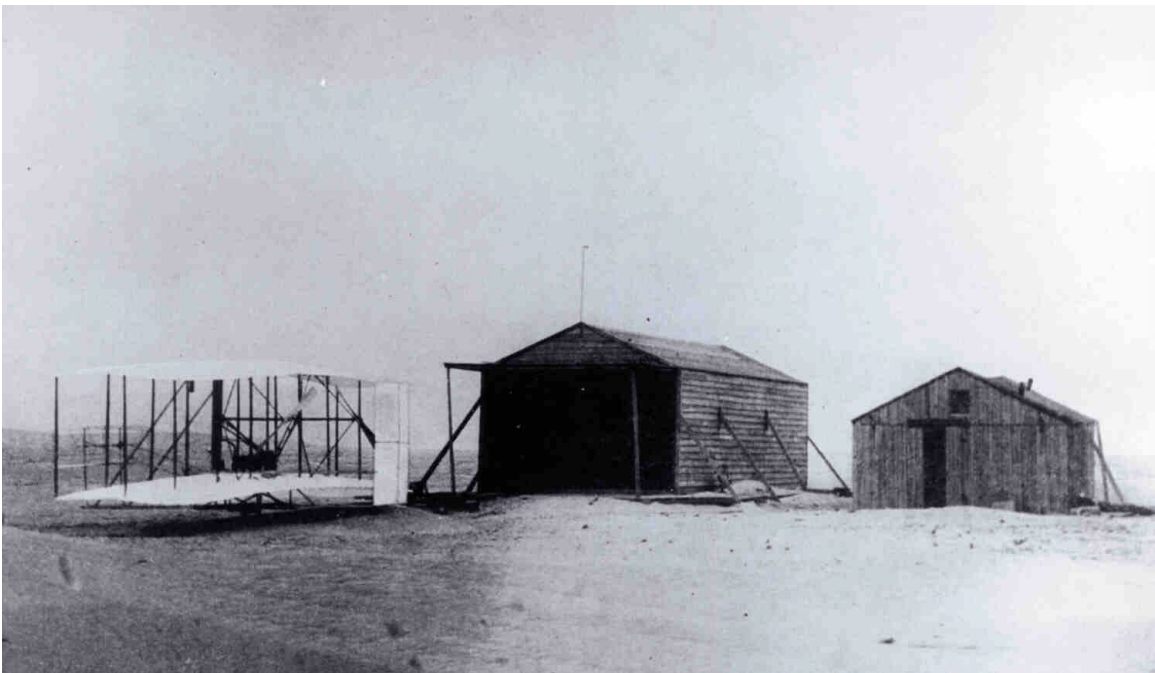


Fig 6. Camp buildings and Flyer, 1903

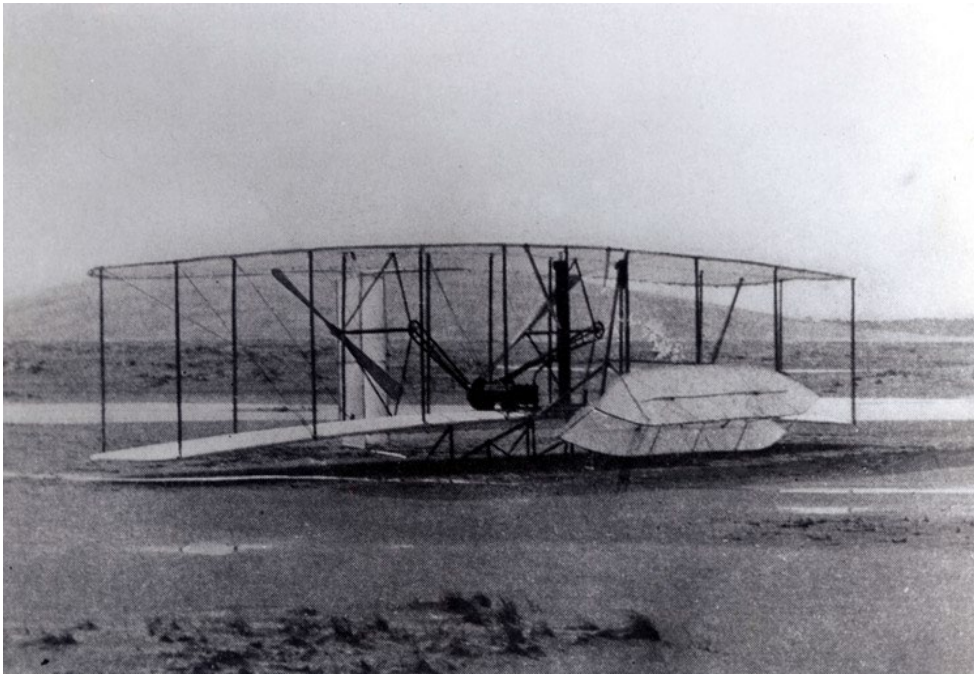


Fig 7. 4th landing site, December 17, 1903

Sequence Number and Physical History Time Period

02 – Early Recognition of the Wright Brothers, 1913-1927

Physical History Narrative

The LeMans and Fort Myer tests received wide acknowledgement as resounding successes. By 1909, the Wrights led the world in the piloting and production of airplanes, but their standing was not universally accepted at the time. For many years they faced a number of contenders for priority in aeronautics, especially the American aviator Glenn Curtiss, whose independent development of ailerons, or flaps, eventually superseded the Wrights' wing-warping mechanism.

The onset of WWI highlighted the Wrights' contributions to the development of flight. By the war's end, the British Royal Flying Corps, originally made up of 150 aircraft and 1,800 men and officers, expanded to 300,000 men and 22,000 aircraft. The U.S. air division, which started with Wright-supplied Signal Corps aircraft in 1917, grew to a force of 13,000 planes, with orders pending for 52,000 more (HRS 1997, 40).

The mid-to-late 1920s introduced a period of renewed interest in the capabilities of aircraft and the general potential for air flight, culminating in Charles A. Lindbergh's nonstop flight from New York to Paris in May 1927. The increased flight activity of the late 1920s encouraged a public recognition of the Wrights' place in the history of aviation. At the local level, North Carolinians, led by W.O. Saunders, sought to memorialize the site of the Wrights' experiments and to underscore the importance of the Outer Banks to their success. Saunders, the editor of the nearby *Elizabeth City Independent*, organized the Kill Devil Hill Memorial Association to ensure a proper commemoration of the Wrights' first flight effort (Hewes 1967, 15). A longstanding champion of Outer Banks causes, Saunders progressively pushed for economic development, with a memorial to the Wright brothers seen as only a part of that development. Other important players included Frank Stick, a real estate developer from New Jersey interested in promoting the Outer Banks, and North Carolina administrators and politicians such as Frank Page of the North Carolina Highway Commission and R. Bruce Etheridge, Director of the North Carolina Department of Conservation and Development (HRS 1997, 42).

National figures joined local efforts to promote the idea of a Wright brothers memorial. U.S. Representative Lindsay Warren of North Carolina first introduced a bill for a Wright memorial to Congress on December 17, 1926, the twenty-third anniversary of the first flight of 1903 (Congressional Record Dec. 17, 1926). Senator Hiram Bingham of Connecticut, a former WWI aviator, as well as the renowned discoverer of Machu Pichu, the "Lost City of the Incas" in Peru, introduced a similar bill in the U.S. Senate the same day. Warren enlisted the support of Orville Wright and the National Aeronautics Association. Frank Stick and other New Jersey investors donated the land at Kill Devil Hills where the Wrights conducted their experiments. The act passed both houses of Congress and was signed by President Coolidge on March 2, 1927, establishing the Kill Devil Hill Monument National Memorial.

Sequence Number and Physical History Time Period

03 – War Department Administration, 1928-1933

Physical History Narrative

The specifics of the Wright Brothers Memorial Act called for a monument to be erected in commemoration of the first successful human attempt at power-driven airplane flight. A

commission made up of the Secretaries of War, Navy, and Commerce would select an appropriate location within the memorial for a monument. The Commission of Fine Arts—a commission established by Congress and composed of various experts who were to decide on matters concerning aesthetics and the fine arts—and the Joint Committee on the Library would be responsible for approval of the design and other plans for the memorial (Hewes 1967, 11).

The Kill Devil Hills Memorial Association lobbied for construction of a bridge to the Outer Banks (completed in 1930) and a new road (Highway 158) connecting Kitty Hawk and Nags Head. The memorial offered an incentive for tourists to visit the area, and therefore provided a justification for new roads and bridges. The state of North Carolina took over the land for the proposed road in October 1927 (Hewes 1967, 18).

The Office of the Quartermaster General prepared a report in October 1928 suggesting that the top of the largest hill (Kill Devil Hill) would be a suitable location for the monument. Previously, it had been thought that such an attempt would be impractical because of the shifting sands on the dune, but a committee appointed to investigate the site discovered that the hill consisted of moist and heavily compacted sand, which could be planted and secured (Hewes 1967, 24). By this time nothing remained of the camp buildings constructed by the Wrights, and the prevailing winds had caused the southwestward migration of Kill Devil Hill by what has been estimated as 300-600 feet. In 1928, the Coast Guard and local citizens began the first stabilization efforts of Kill Devil Hill, planting shrubs and sand grass around its base and over its conical sides (New York Times, December 18, 1928).

No War Department Master Plan has been located for the development that occurred at Wright Brothers National Memorial. Consequently, the work carried out by the War Department will be laid out chronologically.

First Commemoration

An important first step in the realization of the Wright Brothers National Memorial occurred on December 17, 1928, when 200 delegates from the International Civil Aeronautics Conference and

more than 3,000 visitors dedicated a granite marker placed at the approximate location of the 1903 liftoff and laid the cornerstone of the monument to be placed on Kill Devil Hill. W.O. Saunders, Senator Hiram Bingham, and Secretary of War Dwight Davis addressed the crowd, including Orville Wright and Amelia Earhart. The National Aeronautics Association (NAA) provided the marker, carved to resemble a boulder.

Identifying the exact location of the takeoff was problematic because the topography of the site had shifted in the years following the Wrights' experiments. On November 4, 1928, under the direction of the NAA, Captain William Tate organized a meeting of three of the four surviving witnesses to the first flight to determine the point of takeoff. Using Orville Wright's accounts of the flight, Will Dough, Adam Etheridge, and Johnny Moore identified the approximate location of the takeoff. Tate described their methods at the marker's dedication ceremony:

Dough, Etheridge, Moore, and I assembled here and I explained to them the importance of arriving at a definite conclusion with respect to the spot where the Wright brothers' airplane, in making its first successful flight, first began to move along the ground. We located the four corners of the building in which the machine was housed. . . . We took into consideration what Mr. Orville Wright said about it in his article How We Made Our First Flight. We had a compass with us and we were sure of our compass course. After considering all these things and talking it over these three men proceeded by themselves to come out here on this point and select the spot on which this magnificent boulder stands and said that this was the spot where the Wright airplane started its first successful flight. . . . After agreeing upon this exact spot we signed a paper to that effect. . . . (U.S. House, 70th Congress, 2d Session, House Document 520, 1929:23)

A copper pipe was driven into the ground to mark the spot, and a concrete foundation was poured over it. The granite marker, measuring approximately 6-by-4 feet, was set on the foundation, and a small mound of sand was spread over the foundation and covered with grass so that the boulder would give the appearance of having been set in the sand (East 1961, 36).

Selection of Monument Design

The cornerstone laid at the top of Kill Devil Hill on 17 December 1928 initiated the spatial relationship between the granite marker and the monument. The construction of the monument was set out in the 1927 Congressional Act, but its actual design was undecided. The Memorial Commission favored a utilitarian design, and the Commission of Fine Arts (a commission established by Congress and composed of various experts who were to decide on matters concerning aesthetics and the fine arts) favored a purely commemorative structure. Much of this controversy took place before the 1928 anniversary celebration. By June 1928, the Office of the Quartermaster General, responsible for supervision of construction, realized the futility of a quick decision and announced a design competition. By 31 January 1929, thirty-six entries had been received by a jury established by the Memorial Commission through the Quartermaster General. The selection of the winning design was made in accordance with principles established by the American Institute of Architects. The jury chose the submission by the New York architectural firm of Rodgers and Poor, and the Commission of Fine Arts concurred. The objections of several parties delayed official notification until 14 February 1930.

The winning Art Deco-inspired design was a masonry shaft and base of approximately sixty feet set on a star-shaped foundation. The foundation formed a terrace around the monument base and shaft at a height of five to ten feet above grade. The triangular shaft was embellished with relief carvings symbolizing stylized sculpted wings on the east and west sides. The design implied ancient Egyptian motifs, an important source for Art Deco designs. The main entry to the monument was from the terrace at the center of the base on the south side (HRS 1997, 47). Alfred Poor later remarked that the design and orientation of the monument was influenced by thoughts of placing an airstrip south of the monument. There were no provisions for pedestrian or auto circulation.

Stabilization of Kill Devil Hill

Before construction of the monument began, Kill Devil Hill required further stabilization. In 1929, the War Department appointed William H. Kindervater of the Quartermaster Corps as caretaker and inspector of construction. Kindervater found that the most serviceable grasses and shrubs

were bermuda grass (*Cynodon dactylon*), secured from around dwellings locally and transplanted on the hill; bitter panic grass (*Panicum amarulum*) gathered at nearby Virginia Beach; and a range of local shrubs including yaupon (*Ilex vomitoria*), myrtle (*Myrica cerifera*), pine (*Pinus* sp.), live oak (*Quercus virginiana*), and sumac (*Rhus* sp.). Other grasses planted were crotalaria (*Crotalaria* sp.) and rye (*Lolium multiflorum*). The planting method is described below:

Shallow furrows plowed about thirty inches apart. Fertilizer applied, wire grass roots placed in furrow, and different grass seeds sowed with the wire grass roots. All planting then covered with a thin layer of sand and the entire area covered with two to three inches of wood's mold. Wood mold helped to fertilize sand and prevented the movement of sand while the seeds were germinating (Landscaping Report, December 27, 1930).

Over the years Bermuda grass was referred to as wire grass (*Aristida stricta*) in the park reports.

Stabilization was completed in 1931. This planting method effectively halted the southwestward migration of Kill Devil Hill, which weathered several storms in 1929 and 1930 without damage. West Hill was not stabilized at this time (Little Hill, the third sand dune, was never acquired).

It was also necessary to protect the site from "the molestation of tourists and souvenir collectors, and the ravages of wild hogs." A wire fence enclosed the area around Kill Devil Hill to prevent animal grazing on the newly planted grass (Hewes 1967, 30).

Circulation System

The War Department constructed an access road into the park from Highway 158 (the new road from Kitty Hawk to Nags Head). Title to the strip of land connecting the park and the highway was obtained from Dare County on 3 February 1931 (Hewes 1967, 38). Bidding on the construction of an internal road network was opened in February 1931. The 1931 Plan of Proposed Roads called for a sand-asphalt entrance road that curved around the east side of Kill Devil Hill, turning due north on axis with the First Flight Marker and the Wright Brothers Monument. Roundabouts were located at either end of an axial roadway (Boulder Road)

connecting the First Flight Marker and the base of Kill Devil Hill. The plan specified that the centerline of the roadway (16' wide with a 4' shoulder on each side) was to be symmetrical about the granite marker, which was encircled by a concrete block walk. With roadwork completed by May 1931, the location of the entrance road provided a sight line to the First Flight Marker.

Another component of the circulation system was a concrete block footpath, on axis with Boulder Road, starting at the base of Kill Devil Hill and ascending the hill to the monument. Photographs dated December 1933 show that a concrete block plaza was also constructed on the monument's south side.

Monument Construction

The Wills and Mafera Corporation of New York won the bid for general contractor. Construction specifications called for a granite tower, 61 feet high, with a light beacon and a base measuring 36-by- 43 feet. Details specified stainless steel for metal fittings, except for roofing, flashing, and thresholds, which were to be copper and bronze. The Sargent Granite Company of Mount Airy, North Carolina, received the contract to supply the granite.

The stone was transported to the park by railroad via Norfolk and Elizabeth City and then by barge and truck. The bridge at Kitty Hawk opened that spring, allowing smaller pieces to be delivered directly by truck. Moving larger pieces required on-site rails to be constructed (HRS 1997, 52). Work on the star-shaped granite base began in December 1931. Granite blocks were lifted into place by a crane mounted on the hillside. Construction crews completed the monument and its associated powerhouse (designed by the War Department) in November 1932.

Entrance Feature

The War Department constructed an entrance feature that was sited to provide a visual link to the First Flight Marker, as well as provide a view to the Wright Brothers Monument. Roughly following the form of truncated obelisks, the entrance posts used ancient Egyptian motifs like the monument. Extending about nine feet above grade with approximately thirty-inch-square, slightly projecting bases, the four obelisks tapered to less than twenty-four inches at the top,

terminated with a recessed, pyramidal cap. The two outer-most posts were fitted with bronze fence panels, and similarly designed moveable bronze gates, mounted on the two inner-most posts, guarded the entrance. The park built a small, concrete contact station just to the west of the entrance, which served as a caretaker's office. It appears that the Quartermaster General Corps was responsible for the design and oversight of construction, completed before the transfer to NPS in 1933.



Fig 8. Kill Devil Hill, 1928



Fig 9. First Flight Marker, 1934



Fig 10. Monument elevation, 1929



Fig 11. Stabilization of Kill Devil Hill, 1930



Fig 12. Boulder Road construction, 1931



Fig 13. Monument plaza, 1933



Fig 14. Footpath ascending Kill Devil Hill, 1934

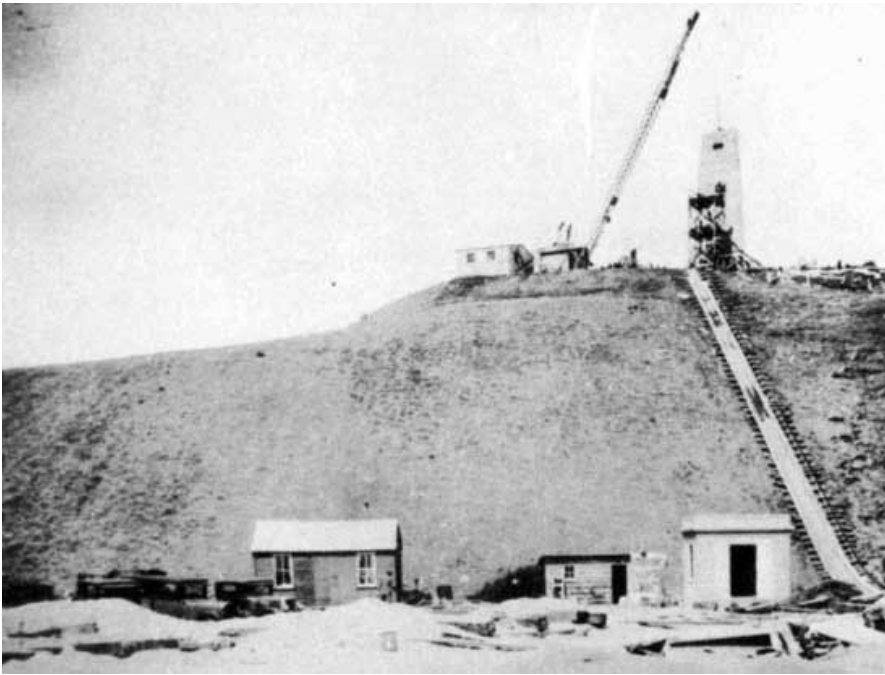


Fig 15. Monument and power house construction, 1932



Fig 16. Entrance station, undated

Sequence Number and Physical History Time Period

04 – National Park Service Administration, 1933-Present

Physical History Narrative

The Wright Brothers In August 1933, two Executive Orders transferred administrative authority of forty-eight areas under the War Department to the National Park Service (NPS). Kill Devil Hills Monument National Memorial was one of the forty-eight. Horace Dough, local boatbuilder and fishing guide, was appointed caretaker just a few days before the transfer.

One of the issues immediately faced by NPS was whether to construct an airstrip, which had been one of the original goals of the Kill Devil Hill Memorial Association. Soon after the transfer, the Association renewed lobbying for an airstrip. NPS was hesitant because of the expense required to buy needed additional lands, the cost of construction, and a concern that operation of an airport was not in keeping with the mission of the NPS (Hewes 1967, 50-51).

Park Development Era (1933-1942)

1938 Master Plan

As a result of President Franklin D. Roosevelt's New Deal programs, the park received \$90,500 through the Public Works Administration for "improvements." The final budget listed road and trail improvements (\$38,000), a superintendent's residence and office (\$13,500), a comfort station and shelter for visitors (\$10,000), additional fencing (\$5,000), electrical service (\$4,000), plants for the road, trails, and monument (\$10,000), and plants for 290 acres of the park (\$10,000). The 1934 Preliminary General Plan, which was further articulated in the 1938 Master Plan, outlined these developments in a very formal, Beaux Arts-style layout.

In July 1934, the park erected a fence constructed of concrete posts and eight strands of barbed wire around the entire 314-acre site. Previously, only a portion of the site was fenced to exclude free range grazing. Also in 1934, the park stabilized West Hill with Bermuda grass, which was described as "growing fine and . . . [had] completely covered the hill except three small areas" (Super. Report July 1934).

Circulation System Alterations

Between 1935-1936, NPS removed the War Department road that arced around the east side of Kill Devil Hill and built a new monument road that encircled the base of the monument. The specified road mix was sand-asphalt. An exit spur led to the village of Colington. The public utilized part of the monument road to reach Colington until a bypass road was built by the state of North Carolina in the 1950s.

In 1934, the preexisting footpath ascending the north slope of Kill Devil Hill was removed and portions used to lay out the walks at the superintendent's residence (Super. Report March 1936). Also at this time, the concrete plaza leading up to the monument on the south side was replaced with asphalt. Between 1934-1936, four symmetrical, curvilinear paths (sand-bituminous foundation and sandrock asphalt surface) were constructed ascending Kill Devil Hill. The shoulders were graded, planted with Bermuda grass, and covered with rushes. (June 1935-January 1936 Super. Reports; 361/1008 dated 11/34).

Structures

New additions to the site during the early NPS period included a superintendent's residence, with an associated access road, and a comfort station for visitors. The residence and comfort station were sited to "provide minimum disruption of the natural and historic environment while still providing the best possible protection for the monument" (Hewes 1967, 59). As a result, the new buildings were located on the south side of Kill Devil Hill, out of view of the First Flight Marker but on axis with the center line of the monument. Architect J.M. Thrower prepared the designs for both, sending his first versions of the plans to Superintendent Horace Dough late in 1934. Construction of the comfort station and the residence began in October 1935 and ended in 1936 (HRS 1997, 58). Concrete pathways linked the comfort station to the circulation system on Kill Devil Hill.

Further implementation of the 1938 Master Plan occurred in 1939. NPS added a maintenance shop and storage building adjacent to the superintendent's residence. Another storage building

and workshop were added in 1941 (Horace Dough to the Director NPS 2/8/28; Superintendent's Monthly Report 8/41).

Articulation of the Mall and Ornamental Plantings

A 1935 letter from T.C. Vint states that another \$7500 was needed to make "such further improvement as a tree and bush-lined mall between the First Flight Marker and the Monument" (Hewes 1967, 60). A 1936 proposal for projects for the years 1938-1943 (the Six-Year Plan) called for paths along the mall and plantings. The 1938 Master Development Plan articulated this concept, showing a long rectangular open space that linked the two focal points of the site—the monument and the granite marker.

In 1936, the Greenbriar Farms of Norfolk, Virginia, "completed the ornamental plantings projects . . . lining the circular drive with trees, planting flat, sandy areas with grass, and installing numerous shrubs" (Hewes 1967, 59). The January 1936 Superintendent's Report states that 330 live oak trees were planted around the circular drive. The Circular Drive Planting Plan specified that the trees be aligned with the center line of the monument. The Monument Planting Plan also called for a 3-ft.-high yaupon hedge to be planted at the base of the monument. The Caretaker's Residence Planting Plan and the Comfort Station Planting Plan called for a palette of predominately native plants, arranged in a naturalistic planting style. In January 1938, Greenbrier Farms had to replace the 330 oak trees planted in 1936 (Jan 1938 Super. Report).

1950s aerial photographs show the mall defined by thin bands of vegetation along its longest sides, apparently planted as part of the 1936 ornamental planting project. The mall is set apart from surrounding areas of the park by differences in vegetation management. Outside the mall the vegetation was released to natural succession, resulting in scattered shrub growth (triggered by fertilizing, seeding, changes in drainage patterns, and the construction of an artificial foredune along the length of the Outer Banks). The aerial photographs suggest the park arrested successional vegetation within the mall by regular mowing of grass and removal of trees and shrubs (see vegetation management below). Drainage ditches dug by the NPS in the 1930s prevented standing ponds of rainwater from destroying the grass.

An Airport

Support for an airport continued a scheme that was included in the 1938 Master Plan. The area south of the monument seemed most probable, due to the high costs of land to the north and the lack of space to the west. The park determined that a minimum of 523 acres would be needed in order for the airstrip to be useful as more than just an exhibit. Alfred Poor, the architect for the monument, offered to design the airstrip, stating that the original plans for the memorial included an airfield south of Kill Devil Hill, which influenced the design and orientation of the monument. In July 1939, the park produced schematic layouts both north and south of the monument. The scheme south of the monument was selected, but Roy Knabenshue, charged with working out acquisition costs and other problems, concluded that building costs at the south end would be too high due to the necessary removal of a large sand dune (Hewes 1967, 64).

World War II (1942-1945)

World War II brought development at the Wright Brothers National Memorial to a complete halt. A lack of funding forced NPS to reduce staff. Money was unavailable for basic needs, such as fertilizer.

Appropriation cuts brought by WWII (from a 1940 level of \$21 million to \$5 million in 1943) dealt a final blow to any further additions to the mall, such as formalized plantings around the granite marker. Plans for an airport were also shelved. NPS continued to plan for the future, completing a new master plan in 1942. With the end of WWII in 1945, basic maintenance funds were returned to the park, but the 1942 Master Plan was never implemented. An unplanned maintenance cost occurred in 1944, when the copper-sheathed roof of the superintendent's quarters was replaced with an asphalt roof following a damaging storm (Hewes 1967, 74).

The focus of park maintenance during this time was vegetation management. In 1943, park staff had to remove bushes and small trees from the forty-acre mall area extending from Kill Devil Hill. The June 1944 Superintendent's Report stated that "it has been determined by the Service Landscape Architect and everyone else concerned that the growth of trees and shrubs on Kill

Devil Hill and around the base of the hill within the circular drive should be kept at the lowest possible elevation.” The reasons given were to preserve the open character of the site, and to prevent overgrown trees and shrubs from competing with the Wright Brothers Monument (June 1944 Super. Report; May 1945; June 1945). In November 1949, the yaupon shrubs planted around the base of the monument were “dug up with as much turf as possible and were reset in trenches” (November 1949 Monthly Report). Remnants of the hedge can be seen in photographs taken in the 1960s.

1947 Master Plan and Mission 66 (1947-1966)

Superintendent Horace Dough wrote the Director in 1946 asking for exhibits and other improvements “in order that the visiting public might be better informed” (Hewes 1967, 76). In 1947, the park drew up another master plan that emphasized interpretation and advocated thinning out brush and other vegetation in order to return to a more accurate historic scene (Turner 1993, 97). The 1947 General Development Plan prompted the acquisition of an 800-by-2,000-foot strip of land between the monument and Highway 158 to the east, so that a new East-West entrance road could be built. The state of North Carolina promised to build a bypass road to Colington, so that internal park roads would no longer be utilized by the public. The North-South entrance road would be obliterated. Alterations to the orientation of the site initiated the groundwork required before a larger interpretive program could be implemented. Funds could not be found for the required land purchase at this time, postponing related developments until the 1950s.

Refinements to the 1947 Master Plan in the 1950s included a museum/visitor center that ultimately changed the park’s orientation and focus. A proposal for an “ultra-modern aviation museum” had been made in 1942 during an effort to obtain the original 1903 Wright Brothers plane, but funding was not forthcoming (Hewes 1967, 73). Such an ambitious construction project began to seem possible in 1951, when the Kill Devil Hills Memorial Association reorganized as national “Society” hoping to raise awareness about the 50th anniversary of the first flight to be celebrated in 1953. The Kill Devil Hills Memorial Society hoped to raise funds for land acquisition, a museum, reconstruction of the camp buildings, and eventually an airstrip. In

February 1952, the park prepared preliminary plans for a museum facility to be located near the eastern park boundary. The Wright Brothers Memorial Museum included a “court of honor,” “Wright Brothers exhibit area,” “library and reception center,” and funnel-shaped “first flight memorial hall” with outdoor terraces facing the view of the First Flight Marker to the north and the Wright Brothers Monument to the west (Allaback 2000, 68-69).

These plans marked a shift from commemoration to comprehensive interpretation in the landscape. The monument was no longer the focal point of the site, as the new entrance road directed visitors to the museum and then out to the camp buildings, markers, and monument. All subsequent revisions to the 1947 Master Plan were based on this concept. The plans proposed that the park boundaries be extended to accommodate the museum and also to include the site of the 4th landing on 17 December 1903. The proposed east entrance was laid out in a curvilinear manner in its approach to the circular monument drive. This particular scheme sited the museum/visitor center southeast of its present location.

As early as the spring of 1952, it became obvious that enough money could not be raised to cover all the projects proposed, and plans for the \$1.2 million museum were postponed. Instead of a museum, the Society decided to prioritize the reconstruction of the two camp buildings and the monorail from which the 1903 flyer had taken off; to erect cast aluminum information markers at the four landing points of the December 17 flights; and to construct walkways connecting these interpretive elements (Hewes 1967, 83). In November 1953, the archaeologist from the Regional Office arrived to locate the site of the Wright brothers’ camp buildings. The camp buildings and monorail were completed by the 50th anniversary celebration in December (Super. Report November and December 1953). The installation of these features initiated a change in the way visitors experienced the site, culminating in the construction of the Wright Brothers National Memorial Visitor Center.

Wright Brothers National Memorial Visitor Center

In November 1953, the Avalon and Old Dominion Foundations of New York gave \$82,000 for land acquisition at Wright Brothers. With the money finally in hand for the needed land

purchase, building the museum and new entrance road became the next priority. The 1954 General Development Plan, which included an airstrip east of West Hill, further articulated the implementation of a larger interpretive program for Wright Brothers. The plan proposed changes to the commemorative landscape not seen in earlier plans. Boulder Road would be taken out and the new east entrance located farther north. The plan sited a museum and associated parking area north of the Wright Brothers Monument, slightly east of the location ultimately chosen for the visitor center. This 1954 revision to the 1947 Master Plan outlined all the subsequent changes that occurred to the site.

In 1957, the NPS offered to sponsor a scaled-down version of the facility. In an October meeting, Director Conrad Wirth outlined Mission 66, a ten-year program to transform the American national park system to meet the conditions and demands of the postwar era. The program included a new building type that centralized basic visitor services. The “visitor center” became the most significant architectural expression of national park development in this period and subsequently became the centerpiece of park planning all over the country. The use of the word “center” indicated the planners desire to centralize park interpretive and museum displays with new types of interpretive presentations, park administrative offices, restrooms, and various other services (Allaback 2000, 24). For its Mission 66 visitor center at Wright Brothers, the Park Service sought a smaller, less expensive, more compact structure with distinct components; restrooms (preferably entered from the outside), a lobby, exhibit space, offices, and a room for airplane displays and ranger programs (Allaback 2000, 70). Wirth approved the 1957 General Development Plan, a variation on the 1954 plan that sited the visitor center on the eastern edge of the mall. NPS chose the architectural firm of Mitchell, Cunningham, Giurgola, Associates of Philadelphia to design the building.

A collaborative effort took shape between the NPS and Mitchell/Giurgola for the design of the visitor center and surrounding site. The location of the entrance road to the monument, the parking lot design, visitor center footprint, and paths to the quarters and hangar were approved by John Cabot, Regional Director Elbert Cox, Thomas Vint, and Conrad Wirth between April and June 1958 (Allaback 2000, 74). The 1958 Visitor Center Development Plan placed the building and

parking area along the eastern edge of the mall. It appears that NPS determined this location. The Mission 66 Prospectus for the park stated that the visitor center was to be “near the camp buildings” and a pedestrian path would connect the new building and the first flight line (“Mission 66 Prospectus for Wright Brothers,” 5). According to architect Mitchell, the siting of the building was entirely a NPS decision. It was “exactly what they dictated. The location was specified as being close to the first flight line” (Allaback 2000, 75). Park Service historians and planners felt that some encroachment on the historical and natural environment could be justified in light of the more effective public education that resulted. (Allaback 2000, 27).

Throughout the design process, Mitchell and Giurgola were considering the location of the building in relation to the Wright Brothers Monument and the first flight line. Preliminary site sketches include arrows indicating vistas from the building to these points of interest. He also stated that “the low profile of the building is in keeping with the expanse of land and the gentle undulation of the dunes, and the distribution of the spaces is in relation with the view of the existing monument and of the Wright Brothers’ shelters and take-off area. . . . the design reflected the particular period of American architecture of the early 60s in which the rigidity of modernism evolved into more articulated solutions integrating internal and external spaces” (Romaldo Giurgola to Carol Shull, March 4, 1997).

While the architects worked with possible design schemes, the park turned its attention to construction of the entrance road and parking facilities. In June 1958, they awarded a contract for the construction of the east entrance road and parking lot to Dickerson, Inc., of Monroe, North Carolina. In August, a group from the Eastern Office of Design and Construction (EODC) visited “to discuss plans for the Visitor Center and Parking Area” (Allaback 2000, 76). The half-mile road and parking area was completed by December, and the following February the contract for the construction of the visitor center was awarded to Hunt Construction Company of Norfolk, Virginia. In June 1959, Congress authorized the formal acquisition of the additional property to the north and east needed for the visitor center and parking lot, including the fourth landing site of 17 December 1903. A second sixteen-acre tract was added between Lowell and Woodmere

Avenues to provide a buffer from encroaching development. A total of 111 acres were added to the park for a total of 421 acres.

Beginning in 1957, the circulation system, and ultimately the way visitors experienced the park, was significantly altered. The state of North Carolina was proceeding with the relocation of the main highway paralleling the eastern boundary of the park. The new highway would be located directly on the proposed eastern boundary and the new entrance into the park would be adjacent to this highway. Another change was the construction of a bypass road to Colington, completed in July 1958. Public traffic no longer had access to internal park roads, although the right-of-way for the bypass road was located in the southwestern corner of the park. The old entrance road and the internal Colington Road extension were obliterated in May 1959. Apparently Boulder Road was taken out sometime prior to 1959 (Hewes 1967, 91; May 1959 Superintendent's Report). Insert footnote here: The 1959 Obliteration and Access to Residence Map (361/ 3007) shows Boulder Road gone and the other two roads still to be obliterated.

Mitchell/Giurgola's final plan for the visitor center was a single-story concrete and glass building, slightly elevated on a 128-foot square concrete platform. Two parallel, rectangular blocks with flat roofs occupied the east half of the platform. The easternmost block consisted of restrooms and offices, and the other served as entry lobby and display area. The display area joined directly to a large domed "assembly room," square in plan that occupied the northwest quarter of the platform. The southwest quarter of the platform was an open "ceremonial terrace," and the southeast corner was open as well, functioning as a smaller "entry terrace." By alternating interior spaces with open exterior terraces, the architects avoided the potential monotony of such geometry. The roof structure design formed "a strong focal point on the exterior of the structure, which stands above the low-lying landscape, in concert with the higher rising dunes and pylon" (Allaback 2000, 80).

The attention lavished on aesthetics and symbolic purpose did not detract from the visitor center's practical function. The visitor center served as a control point for what planners called "visitor flow," as well as a more efficient means of serving far larger numbers of visitors and cars

in a more concentrated area (Allaback 2000, 24). Visitors arrived on the new entry road “located so as to give access, in proper sequence, to the historic sites and buildings.” (Mission 66 Prospectus 1957, 8) The parking lot oriented visitors at a 45-degree angle to the entry terrace at the southeast corner of the building. Both the entry road and the siting of the parking lot directed the visitor away from the Wright Brothers Monument, which had previously been the focus of the site. The Park Service sited the building to become the new center for visitor arrival and orientation, with both monuments and the first flight line easily viewed from the visitor center itself. During an August 1958 meeting of the “Wright Memorial Committee,” members agreed that “special consideration be given to directing people to the first flight line area rather than to the memorial feature.” (Ronald Lee to David Stick, August 14, 1958).

Cypress fences were part of the original plan, flanking the building on the south and east sides. The fence extended approximately ninety-five feet from the south side of the building along the west side of the parking lot. By blocking the view from the parking lot to the first flight line, the fence and associated vegetation funneled the visitor to an open entry court and controlled the visitor’s initial view of the camp buildings, First Flight Marker, and Wright Brothers Monument. The intent was to guide the visitor into the building, through the museum exhibits, and into the assembly room housing the replica airplane, where a wall of glass allowed the visitor to look out onto the first flight line. This scheme also blocked views back to the parking lot from the ceremonial terrace. The fence on the south side was damaged by Hurricane Donna in September 1960 but was immediately rebuilt. The fence extending approximately forty-six feet from the east side of the building screened staff parking from view of arriving visitors. An entry feature with a fence and gate were designed as part of the site plan.

The approach from the parking lot was a crucial part of the design concept of controlling pedestrian flow up to the building, so that clear views out onto the mall were blocked. Walkways oriented visitors to the raised entry terrace. Steps extended the full length of a terrace, and visitors crossed an open area to reach the double glass doors leading into the lobby. In addition to the entry terrace, the raised platform included a concrete walkway connecting the two terraces

along the south side of the building and wrapping the east and north sides of the ceremonial terrace. A wooden bench was an original feature along the south side of the platform between the entry and ceremonial terraces; four cast-concrete planters were designed for the east and north sides of the ceremonial terrace. A formed-concrete water fountain was designed for the east side of the entry terrace near the rest rooms. A walkway also extended past the rest rooms north of the entry terrace. A flagpole was located at the south end of the walkway that brought visitors to the entry terrace from the parking lot.

The main entry brought visitors into the lobby area, where they had an immediate view directly across to the ceremonial terrace, with the first flight line in the distance. Visitors then proceeded into the interpretive display area, and finally to the large domed assembly room, which also featured views out to the first flight line and the Wright Brothers Monument beyond through large window walls on three sides of the room. The steel window frames and mullions were painted bright red-orange, drawing attention to the glass areas of the walls (Allaback 2000, 81). Double doors at either end of the south facade led out to the ceremonial terrace, designed to be the focal point for the park's more formal events. A walkway on the south side of the ceremonial terrace led visitors out to the camp buildings and the first flight line beyond. According to the Completion Report for the Visitor Center, portions of the encircling exposed-aggregate concrete block walk around the First Flight Marker were taken up and used to complete the walk from the marker to the camp buildings (Completion Report Visitor Center and Utilities dated 2/16/61).

The original planting plans for the visitor center specified bearberry (*Arctostaphylos uva-ursi*), a native groundcover that could not be supplied by the contractor. The completion report states that "considerable experimentation and effort" was used with native groundcovers in trying to replace the bearberry. The subcontractor was able to secure a prostrate, spreading form of yaupon, which was proposed to be used with a non-native creeping liriop (Liriop *spicata*). The "as built" planting plan indicates that creeping liriop was the only groundcover used. The open areas were stabilized with Bermuda grass and rye grass.

The visitor center (9900 square feet) was dedicated in December 1960. At this time the Wright Brothers Monument was closed to visitors, as the visitor center and camp buildings became the center of comprehensive interpretation. Staffing was not adequate to man the monument, and there was also a concern about visitor safety (Memo from Acting Regional Director to Superintendent December 1960).

Definite plans for a three-thousand-foot airstrip, to be located east of West Hill, were announced at the December 1962 anniversary ceremonies. The airfield was sited so that landing planes would have the correct wind conditions the majority of the time. The dedication of the airstrip occurred at the 60th anniversary celebration in 1963.

Vegetation Management

Vegetation management during this time (other than routine mowing) entailed planting various grass seeds on the road shoulders and removal of brush and trees. In June 1950, an area of ½ acre was planted in oats as an experiment and was to be expanded to include all the areas along the roadways that were not adequately grassed (this experiment was not mentioned again in the Monthly Reports). In October 1950, rye grass was sown on the bare portions of the road shoulders to prevent erosion by strong winter winds (Super. Report October 1950).

Superintendent Dough reported in May 1951 that the top soil and Bermuda grass roots have started “growing a good cover” on the road shoulders around the hill. He noted that in February 1951, the park removed brush and trees from the 50 acres between Kill Devil Hill and the First Flight Marker, flanking both sides of Boulder Road (Super. Report Feb. 1951). A similar notation was made for July 1960.

Miscellaneous Projects

In 1948, the park graded and reshaped the shoulders on the inside of the circular monument road to correct drainage problems. In 1954, the park repointed the exterior walls and enclosed the terrace of the superintendent’s quarters on the north side. In 1957, the circular monument road and curvilinear walks were resurfaced with sand-asphalt and the shoulders regraded and

covered with topsoil and Bermuda grass. In 1959, maintenance crews repainted the comfort station and garage and replaced the wooden walkways alongside the hangar.

In November 1963, the park took down the camp buildings and rebuilt them in 1964-65.

In June 1963, the park erected triangular pedestal markers at the landing points of the December 17, 1903 flights (Super. Report June 1963). The pedestals were painted orange-red to match the color of the original steel window frames and mullions, creating a striking link between the building and the landscape.

Another important change to the commemorative landscape occurred in 1966. With Boulder Road taken out and interpretation shifted to the visitor center, the park rotated the First Flight Marker so that it faced the camp buildings, and the small mound supporting the marker was leveled in an effort to return the topography to a more accurate Wright-era appearance. A new concrete walkway (brush-finish surface) connected the marker and the camp buildings with the visitor center.

1965 Master Plan

The 1965 Master Plan called for “recreating the historic scene” by removal of all trees and shrubs from Kill Devil Hill and West Hill and from the area between Kill Devil Hill and the first flight line. It called for selective cutting to maintain a view of West Hill from the first flight line and visitor center, but screening of the airstrip turn-around as viewed from the visitor center. The plan recommended removing the comfort station, powerhouse, and old entrance station. The comfort station was removed sometime before 1969. In 1977, the park submitted Section 106 compliance documentation for removal of the old entrance station and powerhouse. The park received clearance to remove the old entrance station with the suggestion from the North Carolina State Historic Preservation Office that the entrance posts be retained. Park maintenance carried out the demolition of the entrance station in December 1979. The park also received clearance to remove the powerhouse but chose to keep it.

In October 1966, Wright Brothers National Memorial was entered in the National Register of Historic Places, subsequent to passage of the National Historic Preservation Act, and documented as a historic district in August 1978. A Historic Resources Study, completed in 1997, added the Wright Brothers Monument, the First Flight Marker, the monument powerhouse, the curving trails and circular road, the spatial relationship between the monument and the marker, Kill Devil Hill, West Hill, and the Wright Brothers National Memorial Visitor Center as contributing resources.

Vegetation Management

A 1980 Grounds Management Plan restated that a low profile vegetative cover evocative of the openness of the 1900-1903 period should be maintained. It called for the removal of 170 acres of trees and shrubs in and near Kill Devil Hill, West Hill, and the first flight line. These areas would be maintained as grass; all trees and shrubs were to be removed from West Hill. In 1987, the Superintendent reported that “a major landscaping project on the main hill at Wright Brothers was accomplished with the participation of personnel from all divisions.” No further description of the work was included (Annual Report 1987).

Miscellaneous Projects

In 1974, the terrace of the superintendent’s quarters was enclosed with screening and wood lattice, and the original steel sash windows were replaced with double-hung metal windows. In 1976, the park also replaced the original steel frame windows and doors of the visitor center with an aluminum window-and-door system (HRS 1997, 67-68).

In 1980, Denver Service Center oversaw a contract to approximately double the visitor center parking area. Handicapped access ramps alongside the restrooms were added at this time. (Super. Annual Reports; 361/41007-B dated 1978).

In 1980, the First Flight Airstrip and parking area, as well as the walks from the airstrip to the Wright Brothers Monument, were repaved. Also during the 1980s, the park partially enclosed the employee parking lot on the northeast side of the building with a wood fence similar in

appearance to the fencing along the visitor parking lot. In 1984, metal stair railings on both the entry and ceremonial terraces were installed, and a new entrance sign was designed and constructed, and the hangar was rebuilt for a third time to more exact specifications after being destroyed by a storm. (Super. Annual Reports).

In 1985, a road and walkway rehabilitation project was contracted out through the Federal Highway Administration. It included leveling and overlaying the entrance road, maintenance road, and airstrip access roads; reconditioning and overlaying the circular monument road and parking areas; reconstructing the entrance road intersection and the airstrip parking area and turnaround. The Williamsport Preservation Training Center completed preservation work on the Wright Brothers Monument in 1987. The first phase included replacement of ferrous metal with stainless steel and cleaning/painting of the stairwell. (Super. Annual Report 1987). Also in 1987, the entrance gates to the park were replaced, and a fee collection kiosk was placed near the park's exit (modified in 1989).

In 1991, a new asphalt walkway was constructed on the west side of Kill Devil Hill where visitors had carved out a path between one of the parking pulloffs and the original curvilinear path. The installation of new fencing, handicapped access ramps, and gates at the airstrip also occurred in 1991(Super Annual Reports).

In 1992, the park replaced the small concrete pedestals previously used to mark the 1903 landing sites with granite markers. In 1993, the Cape Hatteras National Seashore preservation team rebuilt the camp buildings (for a fourth time). The installation of a new fiberglass flagpole also occurred in 1993. In 1997, the Wright Brothers Monument was rehabilitated. The replacement of the windows on the north side of the assembly room in the visitor center with solid walls also occurred at this time when a new HVAC system was installed. In 1998, the cypress fence that separated the parking lot from the mall was removed, along with the vegetation in front of it. The installation of the handicapped ramp at the ceremonial terrace also occurred in 1998. The stabilization of the monument powerhouse occurred in 2000.

Land Transfer

In 1984, the United States conveyed to the state of North Carolina a right-of-way along a portion of Ocean Bay Boulevard and a portion of Colington Road, which the state was already maintaining under terms of a special use permit. The basis for the transfer was a reduction in administrative workload. Rights of ingress and egress were retained (Amundson 1987, 24).

1997 General Management Plan

In 1997, a General Management Plan (GMP) was approved for Wright Brothers National Memorial. It proposed the following:

- Removal of the 1960 Wright Brothers National Memorial Visitor Center
- Construction of a new visitor center, entrance road, and parking for 225 vehicles
- 16, 250 ft. of stabilized trails
- Addition of a fee collection plaza
- Removal of camp buildings; footprints of the buildings interpreted instead
- Removal of a portion of the road system linking the existing entrance with the circular drive
- Restriction of access to full circular drive
- Thinning of the vegetation adjacent to the First Flight Airstrip to provide a view of aircraft taking off and landing
- Selective planting of vegetation at the park's entrance to screen Hwy 158
- Removal of Superintendent's residence
- Relocation of maintenance facilities
- Removal and relocation of First Flight Airstrip concession structure
- Culverts to replace sections of the drainage ditch on the east side of the monument
- Stabilize and repoint monument

The NPS prepared an Environmental Assessment (EA) on the GMP for Wright Brothers National Memorial, which resulted in a Finding of No Significant Impact (FONSI) pursuant to the Council of Environmental Quality's regulations for implementing the National Environmental Policy Act. The GMP/EA addressed the issues of visitor use and circulation, interpretation, protection of cultural and natural resources, facility development, the use and disposition of extant structures,

and how to prepare for the centennial of powered flight. Compliance was completed in 2017 to update the 1997 General Management Plan by identifying “appropriate site locations for new park offices, partner office space and warehouse, education center, new walkways and trails within mostly developed areas of the Memorial that would be designed in way that would be sensitive to the cultural landscape viewshed of the Memorial” (PEPC 76008).

The North Carolina Department of Cultural Resources commented that the Wright Brothers Memorial Visitor Center appeared to be eligible for listing in the National Register of Historic Places, as an outstanding example of modernist architecture designed in the mid-20th century in North Carolina. Concurrent with the general management planning process, NPS prepared additional documentation for the park’s National Register district that defined contributing and non-contributing resources. Research on the maintenance history and architectural significance of the visitor center resulted in a non-contributing recommendation for the resource. A copy of the documentation was sent to the North Carolina Department of Cultural Resources for comment in July 1996. NPS received no response from the Department of Cultural Resources. On 13 September 1996, the Keeper approved the additional documentation and NPS notified the state of North Carolina. Soon thereafter, the North Carolina Department of Cultural Affairs, the American Institute of Architects, the Society of Architectural Historians, and other professional observers vigorously challenged the decision by the Keeper regarding the visitor center.

In 1997, as a result of the concerns raised by the professional community, NPS amended the National Register documentation to include the visitor center as a contributing feature of the existing 421-acre historic district (Wright Brothers National Memorial listed 1966; documentation for historic district submitted 1978). In January 2001, the visitor center was designated as a National Historic Landmark as a nationally significant example of a Mission 66 visitor center and as one of the most important examples nationally of the Philadelphia School of modernist architecture. National Historic Landmark status adds an additional level of compliance review to any action affecting the building, since the Secretary of the Interior would have to comment, in addition to the SHPO. An Historic Structures Report (HSR) is being prepared concurrent with the Cultural Landscape Report. Details concerning the visitor center will be addressed in the HSR.

First Flight Centennial Plan

In the late 1990s and early 2000s the National Park Service undertook various planning projects to prepare the park for the 100th anniversary of flight in 2003. Designation of the Wright Brothers National Memorial Visitor Center as a NHL will necessitate a new GMP. The park wrote an Action Plan for the First Flight Centennial Anniversary. The celebration was expected to draw a minimum of 30,000 visitors per day over a two-day period and included multiple local, state, and federal agencies, extensive civilian and military aircraft participation, and possibly a presidential visit.

Between 2002 and 2005, Boulder Road Trace/First Flight Path was paved between Wright Memorial Drive and the First Flight Marker. The entrance drive was rerouted c.2005-2006 to incorporate a loop and a new visitor center/fee station south of the main parking area. In 2012, the Superintendent's Quarters were demolished. A 2016 through 2019 rehabilitation of the Visitor Center worked to remove unsympathetic modern alterations. Work is currently in progress in the visitor center and parking.



Fig 17. Construction of curvilinear paths, 1935



Fig 18. Aerial view of visitor center, 1963

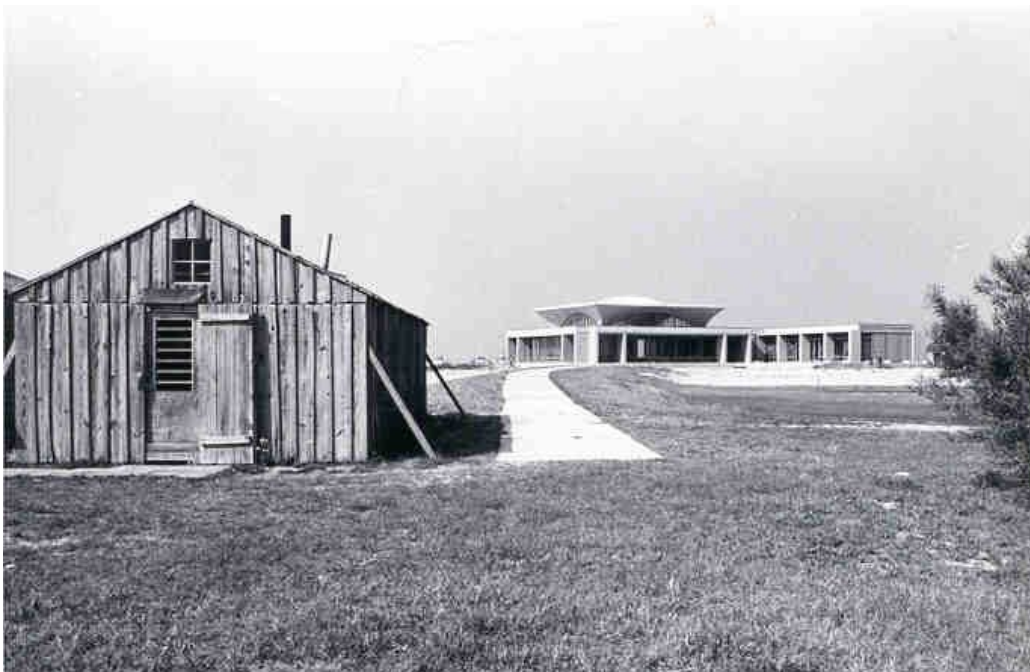


Fig 19. Walkway connecting camp buildings with visitor center, 1960



Fig 20. Approach to visitor center showing cypress fence, 1960



Fig 21. Aerial view of the airstrip, 1969

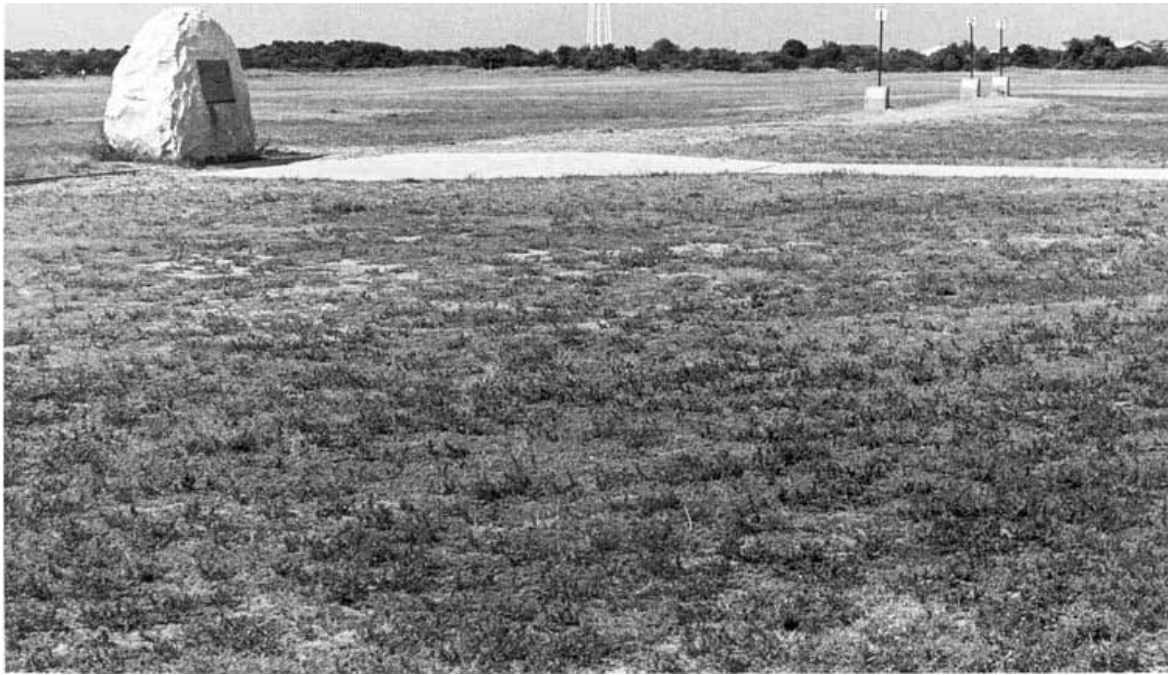


Fig 22. View of reoriented First Flight Marker and pedestal markers, post-1966



Fig 23. Abandoned entrance station, 1977



Fig 24. Monument tour road showing tree planting, 1936

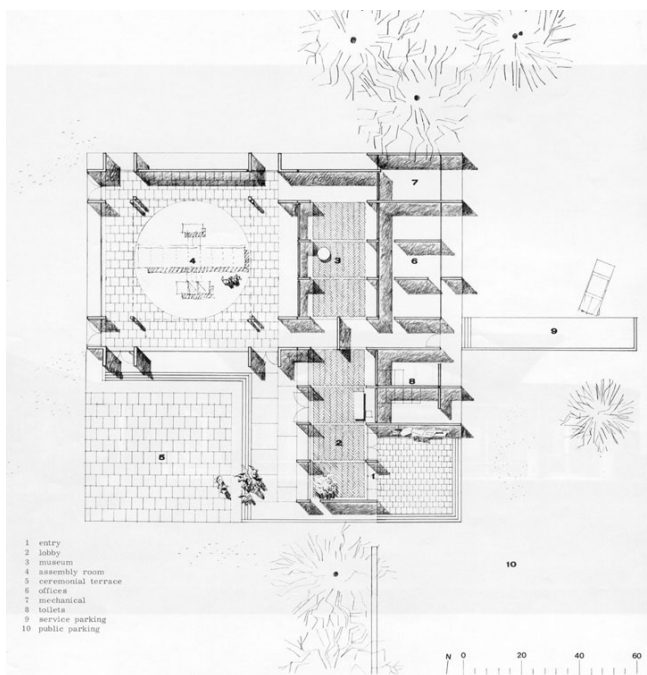


Fig 25. Axiometric view of visitor center, 1959



Fig 26. Aerial view of the site, 1950s



Fig 27. Vegetation on Kill Devil Hill, 1941



Fig 28. View of Wright Brothers Monument, 1963



Fig 29. Archaeological testing, 1953

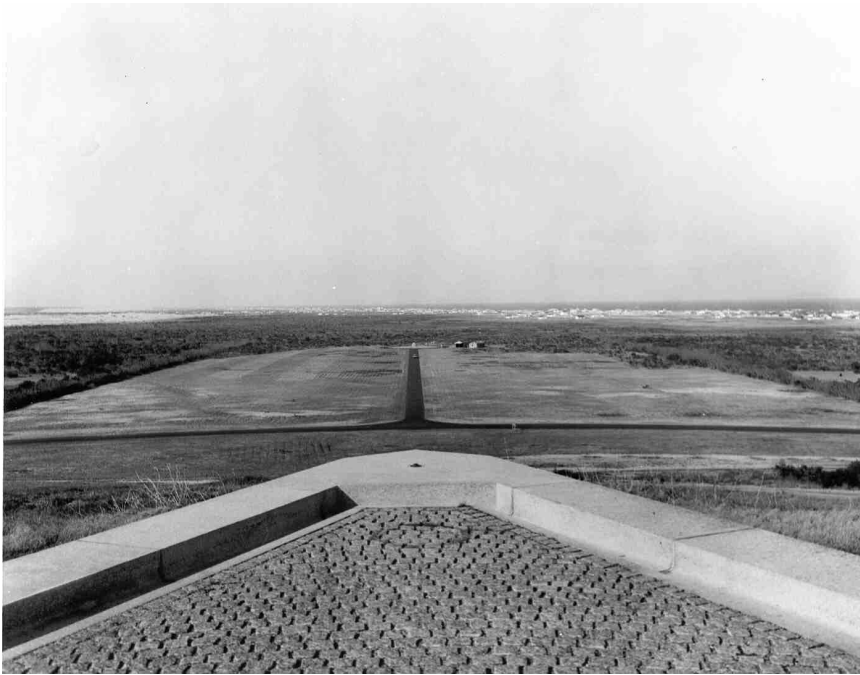


Fig 30. View of the mall with camp buildings in place, 1956

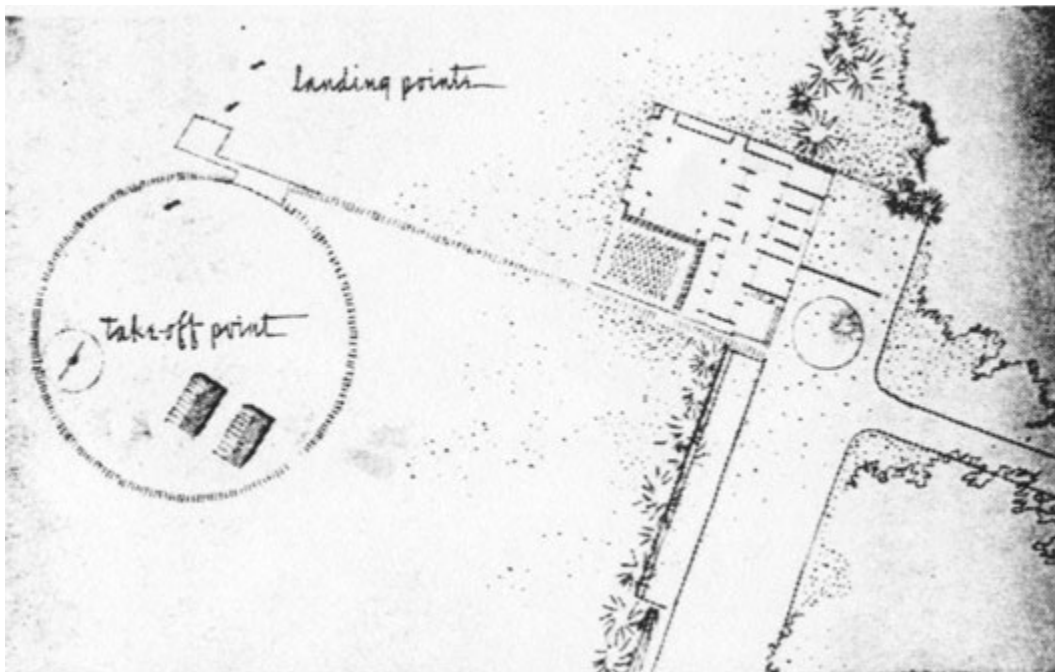


Fig 31. Mitchell/Giurgola site plan sketch

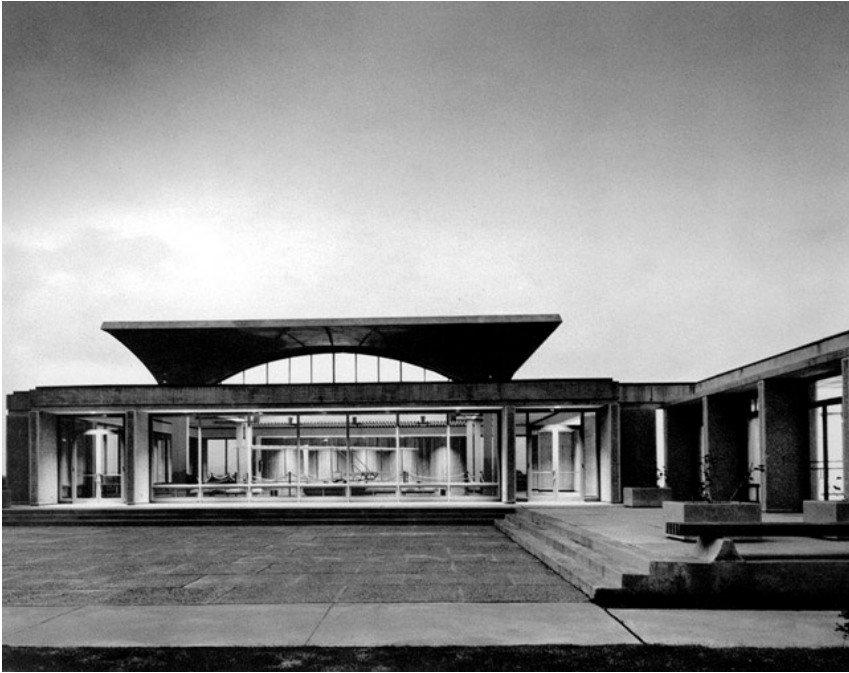


Fig 32. Mitchell/Giurgola visitor center

Chapter 7: Uses

Functions and Uses

Seq. No. (R)	Major Category (R)	Category (R)	Use/ Function (R, if exists)	Historic (Yes/No)	Current (Yes/No)	Primary (Yes/No)
	Landscape	Leisure-Passive (Park)	Leisure-Passive (Park)	Yes	Yes	No
	Recreation/Culture	Monument (Marker, Plaque)	Monument (Marker, Plaque)	Yes	Yes	No
	Transportation	Air-Related	Airplane	Yes	Yes	Yes
	Transportation	Pedestrian-Related	Interpretive Trail	Yes	Yes	No
	Transportation	Road-Related	Automobile	Yes	Yes	No

Public Access

Public Access

Unrestricted

Public Access Narrative

[enter text here]

Associated Ethnographic Groups

Seq. No. (R)	Ethnographic Group [Select from drop down pick list.]	Current (Yes/No)	Historic (Yes/No)
	No Survey Conducted		

Ethnographic Study Status:

No Survey Conducted

Ethnographic Narrative:

N/A

Chapter 8: Analysis & Evaluation

Analysis and Evaluation Summary

LANDSCAPE CHARACTERISTICS

The evolution of the historic landscape of Wright Brothers National Memorial is a complex one, beginning with stabilization efforts in 1928 that altered the historic setting. The initial direction of the commemorative landscape (1927-1942), although never fully realized, was to create a direct relationship between the Wright Brothers Monument and the First Flight Marker, reinforced with a grassed mall that set off the area from the surrounding landscape that was growing up in woody vegetation. With the decision to include a larger interpretive program in the 1947 Master Plan, emphasis shifted from the monument and marker to plans for a museum/visitor center, reconstruction of the Wright brothers' camp buildings, and markers placed at the landing sites of the first powered flights. The 1947 Master Plan and later refinements that included a 1952-1954 visitor center overlay reflect the culmination of design and development at Wright Brothers National Memorial, ending in 1960 with the construction of the Wright Brothers National Memorial Visitor Center. Landscape characteristics and features will be evaluated based upon work completed from the 1947 Master Plan.

INTEGRITY

Location-

The historic location of the Wright Brothers Monument and associated powerhouse, First Flight Marker, curvilinear paths and circular road, visitor center, and the spatial relationship between the monument and marker retain overall integrity of location. The rotation of the First Flight Marker in 1966 reduced the resource's integrity of location, but because it was originally placed at a location determined by the best estimates of surviving witnesses, it has never marked more than an approximate location. The boundary of the park was expanded in 1959 to include the location of the 4th landing site of 17 December 1903.

Design-

The Wright Brothers Monument and associated powerhouse, First Flight Marker, curvilinear paths and circular monument road, and the spatial relationship between the monument and marker retain high design integrity. Changes to the visitor center landscape (removal of the fence and associated vegetation and changes to the bench) reduced its design integrity but did not compromise the building's overall form. The original entrance gateway, superintendent's quarters, and maintenance area have all undergone substantial alterations and lack sufficient integrity.

Setting-

A major characteristic of the Wright-era landscape was its dynamic nature in response to natural forces and features. The Wrights chose the Outer Banks for their experiments because the landscape met certain criteria: broad, open expanses of soft sand, prevailing winds, and sparse vegetation. The Kill Devil Hills area was the focus of their experiments because of the presence of three large sand dunes. The natural forces and features that made the site ideal contributed to creating a landscape characterized by continual and dynamic change due to the low profile, narrowness, sand deposition, and adjacent high wave energy. The high winds, storm overwash, and salt spray precluded the establishment of dense vegetation.

Beginning in 1928, the topography and vegetation of the site were dramatically changed by the stabilization of Kill Devil Hill and West Hill, which were planted with grasses and shrubs to stop their southwestwardly migration. Construction of artificial barrier dunes along the Outer Banks between 1936-1940 reduced salt spray, sand movement, and storm overwash, altering the distribution and composition of the vegetation at Wright Brothers National Memorial.

These changes have compromised the original setting of the Wright brothers' first flight of 17 December 1903. The World Heritage Committee denied the park's nomination in 1980 as a World Heritage site for this reason.

The setting of Wright Brothers National Memorial has achieved significance as an example of a designed commemorative landscape that has evolved over time. Early efforts to memorialize the

site focused on the Wright Brothers Monument, the First Flight Marker, and the spatial relationship between the two. With the decision to build a museum/visitor center and landing strip in the early 1950s, emphasis shifted from the monument and marker to a larger interpretive program that included the reconstruction of the Wright brothers' camp buildings. Markers placed at the landing sites of the first powered flights (the first flight path) have gained importance as a later addition to the commemorative landscape.

Materials-

The original entrance feature gate posts lost materials integrity when the bronze gates were removed in the 1960s. The removal of the generating equipment from the monument powerhouse resulted in a small loss of materials integrity.

Granite, asphalt, and concrete are historically significant materials repeated throughout the memorial. Failure to match the finishes of the terraces and walkways when installing handicapped access ramps and railings has compromised the material integrity of the visitor center platform. The platform bench also lost integrity due to replacement of all materials from the original installation, with the exception of the concrete support piers.

Waxleaf privet (*Ligustrum lucidum*) and eastern red cedar (*Juniperus virginiana*) survive from the 1935 Custodian's Residence Planting Plan. One group of yaupon and one live oak tree survive from the 1959 Visitor Center Planting Plan. Although the yaupon has outgrown its intended use as a low-growing foundation plant, the live oak tree remains in scale with the building and helps define the entry terrace. Planting plans for the memorial have specified predominately native plant materials.

Workmanship-

Most of the features associated with the Wright Brothers National Memorial retain integrity of workmanship. The most prominent example of loss of integrity of workmanship occurred during the many alterations and additions to the maintenance buildings, with no attempt made to retain the original features of the 1930s-era design.

Feeling/Association-

The Wright Brothers Monument lost some integrity of feeling and association following the move of the park entrance and the construction of the visitor center in the late 1950s, which marked a shift in the way visitors experienced the park. Up until this time, the monument had been the focal point of the commemorative landscape. After the visitor center opened in 1960, however, the monument was closed to visitors—it became something to be viewed at a distance. The monument's powerhouse lost a measure of integrity of feeling and association after the discontinuation of the substation function of the building. The association of the powerhouse and the monument remains strong and offers an opportunity to interpret the monument's original beacon feature. The First Flight Marker retains integrity of feeling and association, as the spatial relationship between the marker and the monument remains intact, as well as the spatial relationship of the marker and the first flight line. Development outside the park boundaries has changed the feel of the location somewhat, although vegetation partially screens the site along all sides.

Landscape Characteristics and Features

Buildings and Structures

Buildings are elements constructed primarily for sheltering any form of human activity in a landscape, while structures are elements constructed for functional purposes other than sheltering human activity.

Summary:

The superintendent's quarters have been demolished and the maintenance area has undergone substantial alterations. Prior to its demolition in 2012, the park replaced the original roof of the superintendent's quarters in 1944 (following storm damage), altered the front terrace in 1954 and 1974, and replaced the original windows in 1974, significantly altering the few original Art Moderne design elements. The maintenance area has had numerous additions and alterations, with no attempt made to retain the original features of the 1930s-era design.

The Wright Brothers Monument and associated powerhouse (recently stabilized) retain overall integrity of design, location, materials, workmanship, and feeling/association, representing the core of the earliest commemorative development at the park. The Wright Brothers Monument lost some integrity of feeling/association following the move of the park entrance and the construction of the visitor center in the late 1950s. Up until this time, the monument had been the focal point of the commemorative landscape. After the visitor center opened in 1960, however, the monument was closed to visitors—it became something to be viewed at a distance. The monument's powerhouse lost a measure of integrity of feeling and association after the discontinuation of the substation function of the building. The association of the powerhouse and the monument remains strong and offers an opportunity to interpret the monument's original beacon feature.

The camp buildings and the monorail are reconstructions whose location was never more than a close approximation. However, their placement in 1953 marked the shift from commemoration to comprehensive interpretation in the landscape.

In January 2001, the 1960 Wright Brothers National Memorial Visitor Center's nomination as a National Historic Landmark was approved. In 1998, it was included as a contributing feature of the park's 421-acre National Register historic district. As one of the original examples of a visitor center, a new building type that concentrated visitor services and supplemented old-fashioned museum exhibits with modern methods of interpretation, it is a nationally significant example of Mission 66 architecture. It is also one of the most important examples nationally of the Philadelphia School of modern architecture, reflecting a period when modernist architects were moving away from the limitations of the rectangular glass box. For the Wright Brothers site, Mitchell/Giurgola sought a design that would both respond to its sun-and-wind-swept site and symbolically portray the concept of flight in static form.

Alterations to the building in 1976 compromised aspects of design integrity. As part of a contract for the refenestration of the building, the original glass was replaced with tinted double-pane,

insulated glass, and the steel window frames and doors were replaced with an anodized-aluminum window-and-door system. This system did not replicate the composition, profile, or color of the original, whose hopper-type, ventilating windows and prominent reddish-orange color were among the building's more distinct features. These changes also disrupted the unity of color between the windows and the pedestal markers (replaced in 1992).

The installation of concrete handicapped access ramps and metal hand-railings has compromised the design and materials integrity of the entry and ceremonial terraces. These installations and other repairs elsewhere on the platform use a standard, brush-finished surface without exposed aggregate, making them quite different from the original in both color and texture. As much as these changes alter the aesthetic of the building, they do not compromise its overall form or affect visitor circulation. Additionally, some of the unsympathetic alterations were reversed during a Visitor Center rehabilitation project (PEPC 20186).

Landscape Features:

Feature Name: Wright Brothers Monument

Feature Contribution: Contributing

Latitude: 36.02161611591469

Longitude: -75.6650516010341

CRIS-HS Resource name: Wright Brothers Monument

CRIS-HS Resource ID: 007396

FMSS Record Type: Location

FMSS Record Number: 29903

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Wright Brothers National Memorial Visitor Center

Feature Contribution: Contributing

Latitude: 36.0224308675865

Longitude: -75.66769977715342

CRIS-HS Resource name: Wright Brothers National Memorial Visitor Center

CRIS-HS Resource ID: 091645

FMSS Record Type: Location

FMSS Record Number: 29908

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Monument Powerhouse

Feature Contribution: Contributing

Latitude: 36.0089385797055

Longitude: -75.67493162413302

CRIS-HS Resource name: Wright Brothers Monument Powerhouse

CRIS-HS Resource ID: 090077

FMSS Record Type: Location

FMSS Record Number: 29903

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Airstrip concession building

Feature Contribution: Non-contributing, Incompatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: [enter text here]

FMSS Record Number: [enter text here]

Is FMSS Record Exact Match?: [enter selection here]

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Pilot House

Feature Contribution: Non-contributing, Incompatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 29915

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Maintenance Complex

Feature Contribution: Non-contributing, Incompatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 93054

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Fee Collection Kiosk (2)

Feature Contribution: Non-contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 93056, 93058

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Hangar

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: Wright Brothers Reconstructed Hangar

CRIS-HS Resource ID: 092487

FMSS Record Type: Location

FMSS Record Number: 29900

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Quarters

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: Wright Brothers Reconstructed Quarters

CRIS-HS Resource ID: 092486

FMSS Record Type: Location

FMSS Record Number: 29892

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]



Fig 33. Monument and powerhouse, 1994



Fig 34. Monument, 2015



Fig 35. View of monument and powerhouse with Superintendent's quarters and maintenance complex, 2015



Fig 36. Wright Brothers National Memorial Visitor Center, 2000



Fig 37. Wright Brothers National Memorial Visitor Center, 2015



Fig 38. Handicapped rails and concrete repairs, 2000



Fig 39. Camp buildings, 1999



Fig 40. Superintendent's residence and maintenance area, 1999

Circulation

Circulation refers to the spaces, features, and applied material finishes that constitute systems of movement in a landscape.

Summary:

Between 1934-36, NPS altered the circulation system designed by the War Department. The entrance road that arced around the east side of Kill Devil Hill was removed and a new circular monument road was built. The concrete block pedestrian path that led straight up the hill was

removed and four symmetrical, curvilinear paths were constructed as part of the commemorative landscape.

Between 1947-60, as part of the 1947 Master Plan and subsequent plans for the visitor center, the park removed Boulder Road, closed the original entrance, and built a new entrance road along the eastern boundary. The state of North Carolina constructed a bypass road to Colington. These changes significantly altered the Park Development-era circulation system, which had previously been processional in nature and culminated in the view from the top of the Wright Brothers Monument out to the First Flight Marker. By constructing a new entrance road and abandoning the War Department entrance gateway, the orientation to the site was changed from the monument to the visitor center. Boulder Road was no longer needed for vehicular traffic, as visitors parked at the visitor center and walked out to the first flight area and monument. It is the circulation initiated by the 1947 Master Plan that has retained integrity.

A two-way asphalt entry road brings the visitor into the site from Highway 158 and directs visitors to the visitor center parking area. The entry road connects with the one-way monument tour road that encircles Kill Devil Hill. The circular monument tour road was constructed by NPS in 1935 as part of the commemorative landscape. There are five symmetrically placed parking areas that accommodate over 100 vehicles around the monument road. A series of paved, curvilinear pedestrian paths ascending Kill Devil Hill are laid out in a symmetrical design on either side of a straight line axis from the Wright Brothers Monument to the First Flight Marker. All but two of the trail segments are part of the 1930s commemorative design. The other segments were added over informal paths created by frequent visitor use. A paved service road accesses the park's maintenance complex and superintendent's quarters. The First Flight Airstrip can be reached either by foot or by car. An asphalt walkway connects the airstrip with the circular monument road. Vehicular access to the airstrip parking area is via an asphalt entrance road located just west of Colington Road.

A volunteer path along the trace of the old Boulder Road connects the monument tour road with the First Flight Marker. This path was paved to match the curvilinear paths between 2002 and

2005. An unpaved path stabilized with landscape matting in 1999 connects the First Flight Marker and the four landing sites of December 1903. Concrete walkways connect the First Flight Marker, the reconstructed camp buildings, and the visitor center. The walkways installed in 1966 to connect the marker and camp buildings are quite different in color and texture from the exposed-aggregate concrete walk that extends to the camp buildings from the ceremonial terrace of the visitor center.

The curvilinear paths, circular monument road, and the spatial relationship between the monument and marker retain integrity of design, location, workmanship, and feeling/association. The spatial relationship between the monument and marker lost materials integrity when Boulder Road was removed.

Feature Name: Curvilinear Paths

Feature Contribution: Contributing

Latitude: 36.018227839669755

Longitude: -75.66798614732922

CRIS-HS Resource name: Monument Curving Trails and Circular Road

CRIS-HS Resource ID: 091553

FMSS Record Type: Location

FMSS Record Number: 29906

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: First Flight Path

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 1464615

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Monument Tour Road

Feature Contribution: Contributing

Latitude: 36.018227839669755

Longitude: -75.66798614732922

CRIS-HS Resource name: Monument Curving Trails and Circular Road

CRIS-HS Resource ID: 91553

FMSS Record Type: Location

FMSS Record Number: 104901

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Entry Road (from Hwy 158)

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 29935

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Five Parking Areas

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 104915

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]



Fig 41. Unimproved pedestrian circulation, 1999



Fig 42. Flight path, First Flight Marker, and Monument, 1999



Fig 43. Entry road connecting to monument tour road, 1999



Fig 44. Aerial view of Wright Memorial Drive and curvilinear paths to monument, 2015



Fig 45. Boulder Road Trace from First Flight Marker, 2015



Fig 46. Boulder Road Trace from monument, 2015



Fig 47. Unpaved path covered in landscape matting connecting the First Flight Marker to four landing sites, 2015

Natural Systems and Features

Natural systems and features are the natural aspects that have influenced the development and physical form of the landscape, and can include geology, geomorphology, hydrology, ecology, climate, and native vegetation.

Summary:

Continuous changes in sea level, wave action, storm surge, and sediment supply lead to rapid changes in barrier island landforms. The Outer Banks have changed from a system dominated by natural processes to a stabilized system. During the 1930s, sand fences erected by the CCC and the WPA, under the direction of NPS, formed an unbroken chain of barrier dunes along the Outer Banks. Thirty years of artificial dune stabilization has greatly altered the ecology and geology of the area. Most striking are a marked difference in beach widths and changes to the normal vegetation sequence. The planting of vegetation on Kill Devil Hill and West Hill stopped their southwestward migration. Drainage patterns were also altered to prevent water buildup on the circular monument road and on Boulder Road.

Feature Name: Artificial Barrier Dunes (sand fences)

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: [enter text here]

FMSS Record Number: [enter text here]

Is FMSS Record Exact Match?: [enter text here]

Associated CRIS-AR Resource ID: [enter text here]

Small-Scale Features

Small-scale features are elements that provide detail and diversity for both functional needs and aesthetic concerns in the landscape.

Summary:

The War Department entrance feature gateposts lost a significant amount of design integrity when the park removed the bronze gates from their posts in the 1960s after abandoning the original entrance in 1958. The gateposts are the only surviving elements of the original entrance feature. The park received clearance and demolished the contact station in 1978.

The rotation of the First Flight Marker in 1966 reduced the resource's integrity of location, but because it was originally placed at a location determined by the best estimates of surviving witnesses, it has never marked more than an approximate location. The small mound supporting the marker was leveled to better convey a sense of the flat terrain at the time of the Wright brothers' experiments. The side of the marker holding the bronze plaque was turned towards the visitor center--it originally faced the monument--in order to be more visible to visitors approaching the first flight area from the visitor center. The First Flight Marker retains integrity of feeling and association, as the spatial relationship between the marker and the monument remains intact, as well as the spatial relationship of the marker and the first flight line.

The wooden bench that was an original feature along the south side of the platform between the entry terrace and the ceremonial terrace has been modified through total redesign and replacement of its wooden components, with only the concrete support piers remaining from the original installation. Early photographs show that the original design was constructed but also show that, by the 1970s, red-painted metal covered the horizontal top of the bench. The metal was eventually replaced with wood of a modified design. The bench was restored during a recent project. Another original feature that still survives intact is the poured-concrete water fountain designed for the east side of the entry terrace near the rest rooms. No longer operative and beginning to deteriorate, the fountain features two concave squarish bowls. A new reproduction of the water fountain was installed.

The 1959 entrance fence and gates, designed as part of the collaborative plans for the visitor center, mark the entry into the site from Highway 158. They retain overall integrity of design, although the original gates were replaced in 1987 and 1999.

The granite markers installed in 1992 mark the four landing sites of December 17, 1903.

In 1998, the cypress fence that separated the parking lot from the first flight line was removed, along with the associated vegetation. Its removal disrupted the intended entry experience and also exposed the parking lot and the more-distant highway to view from the mall.

Feature Name: First Flight Marker

Feature Contribution: Contributing

Latitude: 36.01331651912557

Longitude: -75.6577689878286

CRIS-HS Resource name: First Flight Marker

CRIS-HS Resource ID: 090066

FMSS Record Type: Asset

FMSS Record Number: 314756

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: 1933 Entrance Gateway

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: Wright Brothers Monument Entrance Gateway

CRIS-HS Resource ID: 000207

FMSS Record Type: Asset

FMSS Record Number: 314773

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: 1959 Entrance Fence

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 116984

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Water Fountain

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 1332409

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Wooden Bench

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 1276561

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: First Flight Landing Marker #1

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 113424

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: First Flight Landing Marker #2

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 113426

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: First Flight Landing Marker #3

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 113427

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: First Flight Landing Marker #4

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 113428

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]



Fig 48. First Flight Marker, 1999



Fig 49. First Flight Marker, 2015



Fig 50. Closeup of wooden bench, 2000



Fig 51. Granite markers, 1999



Fig 52. Original 1933 entrance gates, 1992



Fig 53. Original 1933 entrance gates, 2015

Spatial Organization

Spatial organization is the three-dimensional organization of physical forms and visual associations in a landscape, including the articulation of ground, vertical, and overhead planes that define and create spaces.

Summary:

The first effort to create a direct relationship between the Wright Brothers Monument and the First Flight Marker began with the placement of the monument cornerstone on Kill Devil Hill in 1928. This spatial relationship was reinforced by a grassed mall that set off the area from the surrounding landscape that was growing up in woody vegetation. Its roughly symmetrical layout—rectilinear, bisected by a central drive—clearly marked it as a designed landscape. Boulder Road reinforced, but did not determine, the spatial relationship between the two memorial markers. Thus, the spatial organization of the site has retained integrity. The rotation of the First Flight Marker in 1966 reflects the shift to a comprehensive interpretation of the site that evolved from the 1947 Master Plan.

This shift in spatial organization was further articulated in the 1954 General Development Plan, which oriented visitors away from the monument. The subsequent visitor center site plan controlled pedestrian flow up to the building from the parking lot, with a cypress fence shielding the visitor as they approached the visitor center from a clear view of the first flight line and monument. Removing the fence and the associated vegetation changed the visitor experience approaching the building. The spatial organization between the visitor center and the first flight line has been hampered by the lack of a coherent design effort reinforcing the commemorative landscape and the visitor center landscape.

Feature Name: Grass Mall – Relationship between Wright Brothers Monument and First Flight Marker

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: [enter text here]

FMSS Record Number: [enter text here]

Is FMSS Record Exact Match?: [enter text here]

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Visitor Center area

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Location

FMSS Record Number: 93053

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]



Fig 54. View of the mall showing drainage swales, 1936



Fig 55. View of the mall, 1999



Fig 56. Aerial view of the mall, 2015



Fig 57. Aerial view of visitor center area, 2015

Topography

Topography is the three dimensional configuration of the landscape surface characterized by features (such as slope and articulation) and orientation (such as elevation and solar aspect).

Summary:

A major characteristic of the Wright-era landscape was its dynamic nature in response to natural forces and features. The Wrights chose the Outer Banks for their experiments because the landscape met certain criteria: broad, open expanses of soft sand, prevailing winds, and sparse vegetation. The Kill Devil Hills area was the focus of their experiments because of the presence of three large sand dunes. The natural forces and features that made the site ideal contributed to creating a landscape characterized by continual and dynamic change due to the low profile, narrowness, sand deposition, and adjacent high wave energy. The high winds, storm overwash, and salt spray precluded the establishment of dense vegetation.

Beginning in 1928, the topography and vegetation of the site were dramatically changed by the stabilization of Kill Devil Hill and West Hill, which were planted with grasses and shrubs to stop their southwestwardly migration. Construction of artificial barrier dunes along the Outer Banks between 1936-1940 reduced salt spray, sand movement, and storm overwash, altering the distribution and composition of the vegetation at Wright Brothers National Memorial.

These changes have compromised the original setting of the Wright brothers' first flight of 17 December 1903. The World Heritage Committee denied the park's nomination in 1980 as a World Heritage site for this reason.

The setting of Wright Brothers National Memorial has achieved significance as an example of a designed commemorative landscape that has evolved over time. Early efforts to memorialize the site focused on the Wright Brothers Monument, the First Flight Marker, and the spatial relationship between the two. With the decision to build a museum/visitor center and landing strip in the early 1950s, emphasis shifted from the monument and marker to a larger interpretive program that included the reconstruction of the Wright brothers' camp buildings. Markers placed at the landing sites of the first powered flights (the first flight path) have gained importance as a later addition to the commemorative landscape.

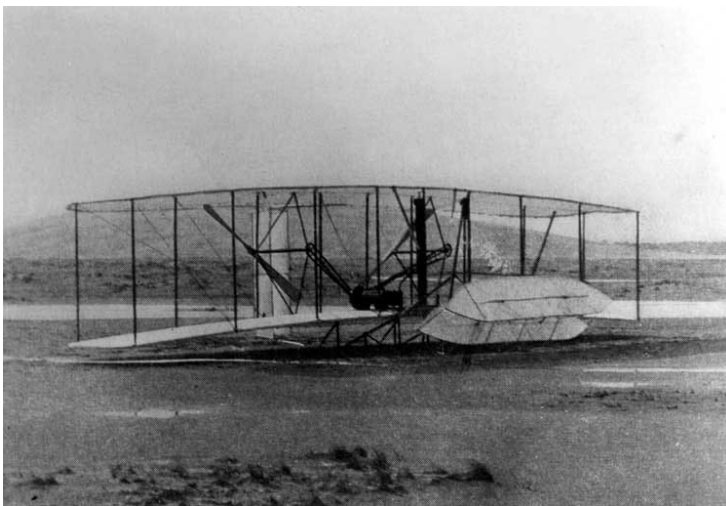


Fig 58. Topography of the site, December 17, 1903

Vegetation

Vegetation includes deciduous and evergreen trees, shrubs, vines, groundcovers, and herbaceous plants and plant communities, whether indigenous or introduced in the landscape.

Summary:

Between 1936 and 1940, the Civilian Conservation Corps constructed an artificial foredune along the Outerbanks, reducing salt-spray exposure, sand movement, and ocean overspray. The artificial dune system drastically altered the distribution and composition of the island vegetation, allowing salt intolerant species previously excluded from the island to thrive. These changes have directed and accelerated successional trends of vegetation, encouraging large increases in prairie and woody vegetation and a corresponding decrease in bare sand and cordgrass communities.

The stabilization of the site with grasses and shrubs began in 1928. The vegetation planted at Wright Brothers National Memorial has adhered to a predominately native palette. By 1936, Greenbriar Farms had completed an ornamental planting project that included lining the circular drive with live oak trees, planting flat, sandy areas with grass, and installing numerous shrubs (native). This project apparently included the mall, which is defined in 1950s aerial photographs by thin bands of vegetation on the east and west growing along drainage swales. Beginning in the 1940s, the park began removing shrubs and small trees from the forty-acre area extending from Kill Devil Hill in order to maintain the historic open pattern of the mall, a character-defining feature. Vegetation outside the mall was released to natural succession.

The planting plan for the visitor center specified native plants. All of the plantings except the live oak and yaupon located in an area in front of the entry plaza have been removed over the years. The most significant loss occurred to the plantings placed in front of the cypress fence to help screen the first flight line from view of the parking lot. Although outside of the 100-foot NHL boundary, these plantings were an original part of the collaborative design and extended the barrier between the parking lot and the mall.

One state-listed plant, wooly beach heather (*Hudsonia tomentosa*) was found at Wright Brothers National Memorial during a field survey of the state and federally-listed threatened, endangered, and other noteworthy plants and animals conducted by terra incognito in 1998 and 1999. A state-listed butterfly, the giant swallowtail (*Papilio cresphontes*), was seen on the property, as well as its food plant, toothache tree (*Zanthoxylum clava-herculis*). Another noteworthy plant found was sandy woods sedge (*Carex arenaria*), which is uncommon in North Carolina.

The open dunes, disturbed grounds, and grasslands are populated with a native cactus that is a nuisance to visitors and probably restricts the numbers of ground-nesting and ground-feeding birds at the park.

Feature Name: Yaupon

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 1464618

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Grassed Mall

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 314697

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Live Oak Tree

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: Asset

FMSS Record Number: 1464617

Is FMSS Record Exact Match?: Yes

Associated CRIS-AR Resource ID: [enter text here]



Fig 59. Encroaching vegetation on Kill Devil Hill, 1941



Fig 60. View of cypress fence and vegetation, 1962



Fig 61. Live oak and yaupon, 1999



Fig 62. Live oak, 2015



Fig 63. Live oak and yaupon, 2015

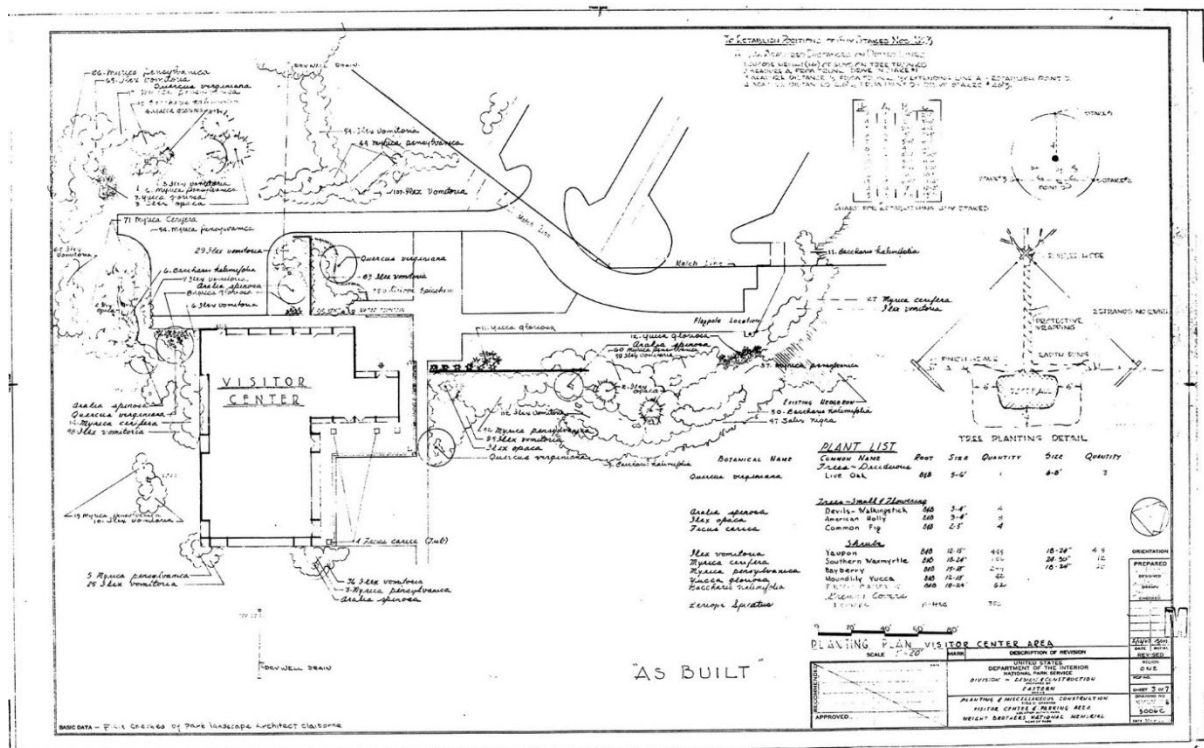


Fig 64. 1960 Planting Plan for Visitor Center Area

Views and Vistas

A view is the expansive and/or panoramic prospect of a broad range of vision that may be naturally occurring or deliberately contrived. A vista is a controlled prospect of a discrete, linear range of vision, which is deliberately contrived.

Summary:

An unobstructed view between Kill Devil Hill and the first flight line has remained a character-defining feature of the site. During the War Department and Park Development eras, sight lines from the Wright Brothers Monument to the First Flight Marker were an important design element. The collaborative plans for the visitor center resulted in its placement on top of the existing vegetation that marked the eastern edge of the mall, but with open vistas to the first flight line. Proposed planting plans were modified so that nothing was planted in the first flight area and no vertical plantings obstructed the view to the Wright Brothers Monument.

Screened views, both from the parking lot out to the mall and from within the mall, were also an important feature of the collaborative design effort of the visitor center. These filtered views were provided by the cypress fence along the south side of the building and the vegetation around it, later removed by the park.

Views to the airstrip from the first flight area are blocked by vegetation that marks the western edge of the mall.

Feature Name: View between Kill Devil Hill and the first flight line

Feature Contribution: Contributing

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: [enter text here]

FMSS Record Number: [enter text here]

Is FMSS Record Exact Match?: [enter text here]

Associated CRIS-AR Resource ID: [enter text here]

Feature Name: Screened views from parking lot to mall and from within the mall

Feature Contribution: Non-contributing, Compatible

Latitude: [enter text here]

Longitude: [enter text here]

CRIS-HS Resource name: [enter text here]

CRIS-HS Resource ID: [enter text here]

FMSS Record Type: [enter text here]

FMSS Record Number: [enter text here]

Is FMSS Record Exact Match?: [enter text here]

Associated CRIS-AR Resource ID: [enter text here]



Fig 65. Open view between Kill Devil Hill and the first flight line, 1999



Fig 66. Open view between Kill Devil Hill and the first flight line, 2015



Fig 67. Visitor center showing view to parking lot blocked by cypress fence, 1960



Fig 68. Vegetation screening airstrip concession area and parking from first flight area, 1999

Chapter 9: Condition Assessment

Assessment Interval:

6

Condition

Condition:

Good

Condition Date:

09/30/2000

Narrative:

N/A

Condition:

Good

Condition Date:

08/03/2004

Narrative:

Condition was initially assessed in 2000. This condition was reconfirmed in 2004 when the park superintendent approved the CLI, condition assessment, and management category.

Condition:

Good

Condition Date:

08/18/2010

Narrative:

N/A

Condition:

Good

Condition Date:

09/15/2016

Narrative:

N/A

Condition:

Good

Condition Date:

09/14/2022

Narrative:

Although the Wright Brothers National Memorial Landscape is susceptible to some negative impacts, the overall condition of the cultural landscape is characterized as “good.” Increasing development on adjacent land threatens the integrity of the historic setting. At the Visitor Center, a yaupon hedge has not been pruned properly and is thus overgrown, and a fountain original to the visitor center area is deteriorating. A reproduction fountain has been installed. Erosion has caused ruts along some of the curvilinear paths leading to the monuments, but has been addressed since the 2016 condition assessment. Another action since the 2016 assessment is the project to restore the historic landscape of Kill Devil Hill, so that a succession of shrubs and small trees does not take over the historic turf-based landscape of the hill (PEPC 88007).

Impacts

Seq. No.	Type	Impact Type – Other	Internal Source?	External Source?	Narrative	Date Identified
xx			Yes/No	Yes/No	1000 Char.	mm/dd/yyyy
	Adjacent Lands		No	Yes	Increasing development in recent years along the Outer Banks has changed the character of the area around the park. Although vegetated areas delineate the site on the west and southwest, the park is now surrounded by more built-up areas on the southeast, east, and north.	07/29/2005
	Pruning Practices		Yes	No	There is a hedge of Ilex vomitoria (yaupon holly) which is part of the original plan for the VC and has gotten overgrown, with the lower section limbed up to form small, multi-trunked trees.	09/14/2022

	Erosion		Yes	No	There are ruts and signs of erosion along some of the curvilinear pathways leading up to the monument. This has largely been improved by washout repairs as recently as 2018.	09/14/2022
	Removal/Replacement		Yes	No	Another original feature that still survives intact is the poured-concrete water fountain designed for the east side of the entry terrace near the rest rooms. No longer operative and beginning to deteriorate, the fountain features two concave squarish bowls. A reproduction of this fountain has recently been installed.	09/14/2022

Chapter 10: Treatment

Stabilization Measures

Stabilization Measure Narrative (R)	Stabilization Cost (R)	Stabilization Cost Date (R)	Estimate Level (R)	Cost Estimator (R)	Cost Narrative
	\$388,000.00	01/01/2004	C – Similar Facilities	Park/FMSS	Landscape stabilization costs are derived from PMIS statements - 38919, 41109, 4051 & 57140 - that are directly related to the stabilization of the cultural landscape.

Approved Treatments

Type	Completed	Approved Treatment Doc.	Doc Date	Narrative	Approved Treatment Cost	Cost Date	Estimate Level	Estimator	Cost Narrative
Rehabilitation	No	Cultural Landscape Report		As defined by the Secretary of the Interior's Standards for the Treatment of Historic Properties with Guidelines for the Treatment of Cultural Landscapes (1996), rehabilitation is the act or process of making possible a compatible use for a property through repair, alterations, and additions while preserving those portions or features which convey its historical, cultural, or architectural values.	\$167,200.00	7/10/2001	Similar Facilities	Regional Office	

Chapter 11: Bibliography and Supplemental Information

Bibliography

Seq No.	Citation Author	Citation Title	Year	Publisher	Citation Location	Citation Type	Citation Number	IRMA Number	Citation URL
		Notes on Historic Sites, Wright Brothers National Memorial			U.S. Department of the Interior, National Park Service			002278	
		Resource Management Plan, Wright Brothers National Memorial			U.S. Department of the Interior, National Park Service			017312	
		The Wright Brothers Camp, Kill Devil Hill, 1903			U.S. Department of the Interior, National Park Service			002276	
		World Heritage List Nomination, Wright Brothers National Memorial						011673	
		Wright Brothers National Memorial, Historic Resource Study			U.S. Department of the Interior, National Park Service			017243	
		"Kitty Hawk Museum" Progressive Architecture				Both Graphic And Narrative			

		"Vegetation Changes Associated with Barrier-dune Construction on the Outer Banks of North Carolina"			CAHA Group Headquarters, SERO	Both Graphic And Narrative			
		Kill Devil Hill: Discovering the Secret of the Wright Brothers			SERO	Both Graphic And Narrative			
		Mission 66 Visitor Centers			SERO	Both Graphic And Narrative			
		The Outer Banks of North Carolina			SERO	Both Graphic And Narrative			
		The Outer Banks of North Carolina, 1584-1958			SERO	Both Graphic And Narrative			
		Wilbur and Orville: A Biography of the Wright Brothers			SERO	Narrative			
		Wind and Sand			SERO	Both Graphic And Narrative			
		Wright Brothers National Memorial: An Administrative History, 1968-1987			CAHA Group Headquarters	Narrative			

		Monthly Superintendent's Reports			CAHA	Both Graphic And Narrative			
		"Man's Impact on the Barrier Islands of North Carolina"			SERO	Both Graphic And Narrative			
		Visitor Center and Utilities Completion Report			CAHA Group Headquarters Museum Building	Both Graphic And Narrative			
		Threatened and Endangered Species of Wright Brothers National Memorial			Park Headquarters	Narrative			

Supplemental Information

Seq. No.	Supplemental Information Title	Supplemental Information Narrative
	NC SHPO to Kirk Cordell	Evaluation of the Wright Brothers National Memorial Visitor Center
	Romaldo Giurgola to Carol Shull	Letter from Romaldo Giurgola describing his design intent for the visitor center

Appendix

Landscape Features

Seq. No.	Feature Name	Feature Contribution	CLI Feature ID	Latitude	Longitude	CRIS-HS Resource Name	CRIS-HS Resource ID	FMSS Record Type	FMSS Record Number	FMSS Exact Match?	CRIS-AR ID
	Natural Systems and Features										
	Artificial Barrier Dunes (sand fences)	NC, Compatible									
	Spatial Organization										
	Grass Mall – Relationship between Wright Brothers Monument and First Flight Marker	Contributing									
	Visitor Center Area	NC, Compatible						Location	93053	Yes	
	Vegetation										
	Yaupon	Contributing						Asset	1464618	Yes	

	Grassed Mall	Contributing						Asset	314697	Yes	
	Live Oak Tree	Contributing						Asset	1464617	Yes	
	Circulation										
	Curvilinear Paths	Contributing		36.0182278 39669755	- 75.66798614 732922	Monument Curving Trails and Circular Road	091553	Location	29906	Yes	
	First Flight Path	Contributing						Asset	1464615	Yes	
	Monument Tour Road	Contributing		36.0182278 39669755	- 75.66798614 732922	Monument Curving Trails and Circular Road	091553	Location	29906	Yes	
	Entry Road (from Hwy 159)	NC, Compatible						Location	29935	Yes	
	Five Parking Areas	NC, Compatible						Location	104915	Yes	
	Buildings and Structures										

	Wright Brothers Monument	Contributing		36.0216161 1591469	- 75.66505160 10341	Wright Brothers Monument	007396	Location	29903	Yes	
	Wright Brothers National Memorial Visitor Center	Contributing		36.0224308 675865	- 75.66769977 715342	Wright Brothers National Memorial Visitor Center	091645	Location	29908	Yes	
	Monument Powerhouse	Contributing		36.0089385 797055	- 75.67493162 413302	Wright Brothers Monument Powerhouse	090077	Location	29903	Yes	
	Airstrip concession building	NC, Incompatible									
	Pilot House	NC, Incompatible						Location	29915	Yes	
	Maintenance Complex	NC, Incompatible						Location	93054	Yes	
	Fee Collection Kiosk (2)	NC, Compatible						Location	93056, 93058	Yes	

	Hangar	NC, Compatibl e				Wright Brothers Reconstructed Hangar	092487	Locatio n	29900	Yes	
	Quarters	NC, Compatibl e				Wright Brothers Reconstructed Quarters	092486	Locatio n	29892	Yes	
	Views and Vistas										
	View between Kill Devil Hill and the first flight line	Contributi ng									
	Screened views from parking lot to mall and from within the mall	NC, Compatibl e									
	Small-Scale Features										
	First Flight Marker	Contributi ng		36.0133165 1912557	- 75.65776898 78286	First Flight Marker	090066	Asset	314756	Yes	
	1933 Entrance Gateway	Contributi ng				Wright Brothers Monument Entrance Gateway	000207	Asset	314773	Yes	
	1959 Entrance Fence	Contributi ng						Asset	116984	Yes	

	Water Fountain	Contributing						Asset	1332409	Yes	
	Wooden Bench	Contributing						Asset	1276561	Yes	
	First Flight Landing Marker #1	NC, Compatible						Location	113424	Yes	
	First Flight Landing Marker #2	NC, Compatible						Location	113426	Yes	
	First Flight Landing Marker #3	NC, Compatible						Location	113427	Yes	
	First Flight Landing Marker #4	NC, Compatible						Location	113428	Yes	