


NPS Wildfire Risk Assessments Assessment Locations

Tonto National Monument

National Park Service
U.S. Department of the Interior

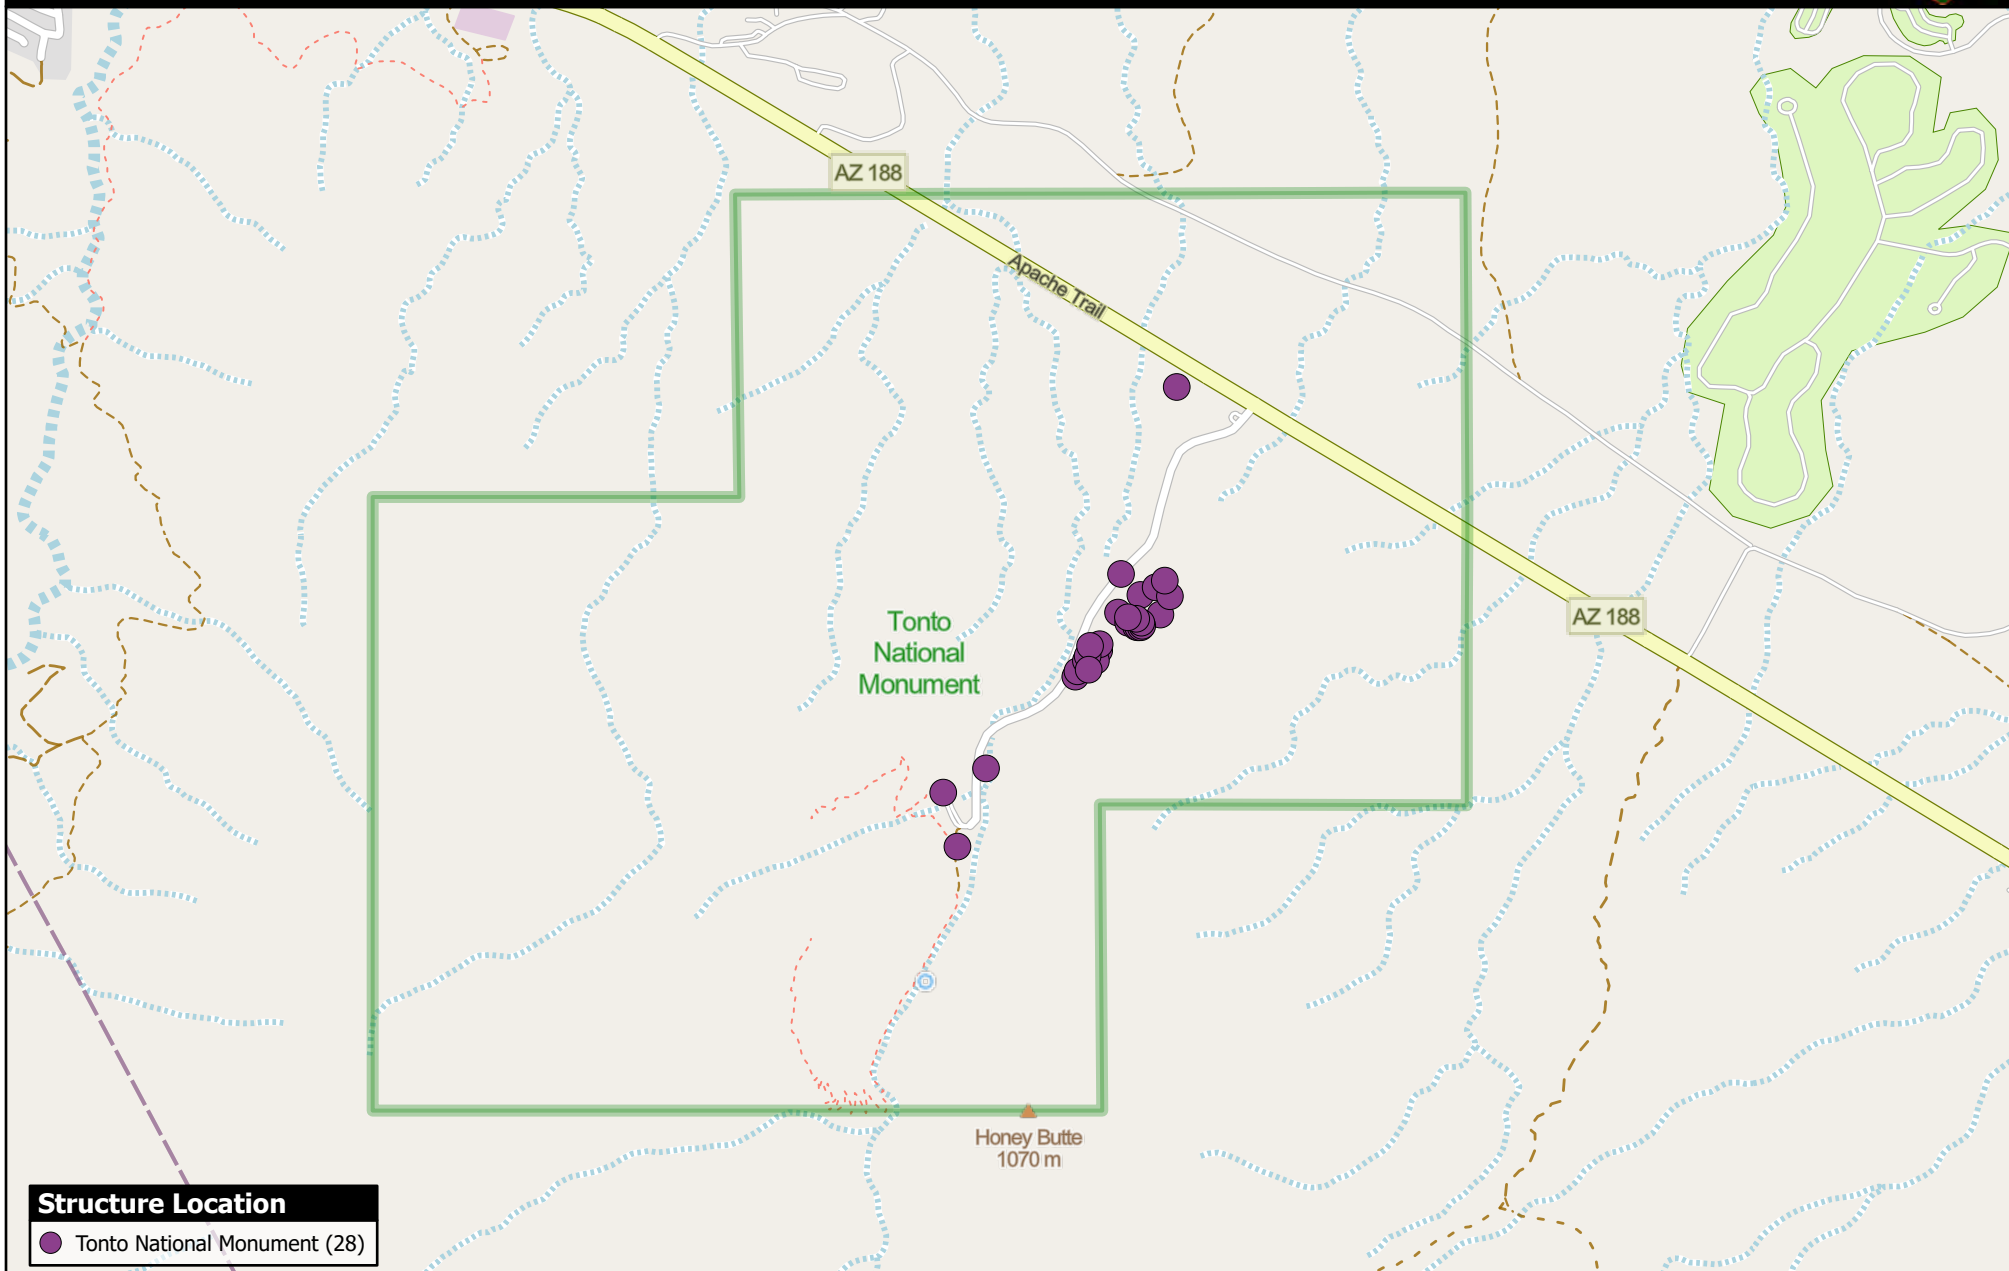

Structure Location

● Tonto National Monument (28)



0

2

Miles

Author: sszturm
1/27/2022 8:43 AM


Intermountain Region Geographic Resources Division
January 2021
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Tonto National Monument

NPS Wildfire Risk Assessments

National Park Service
U.S. Department of the Interior

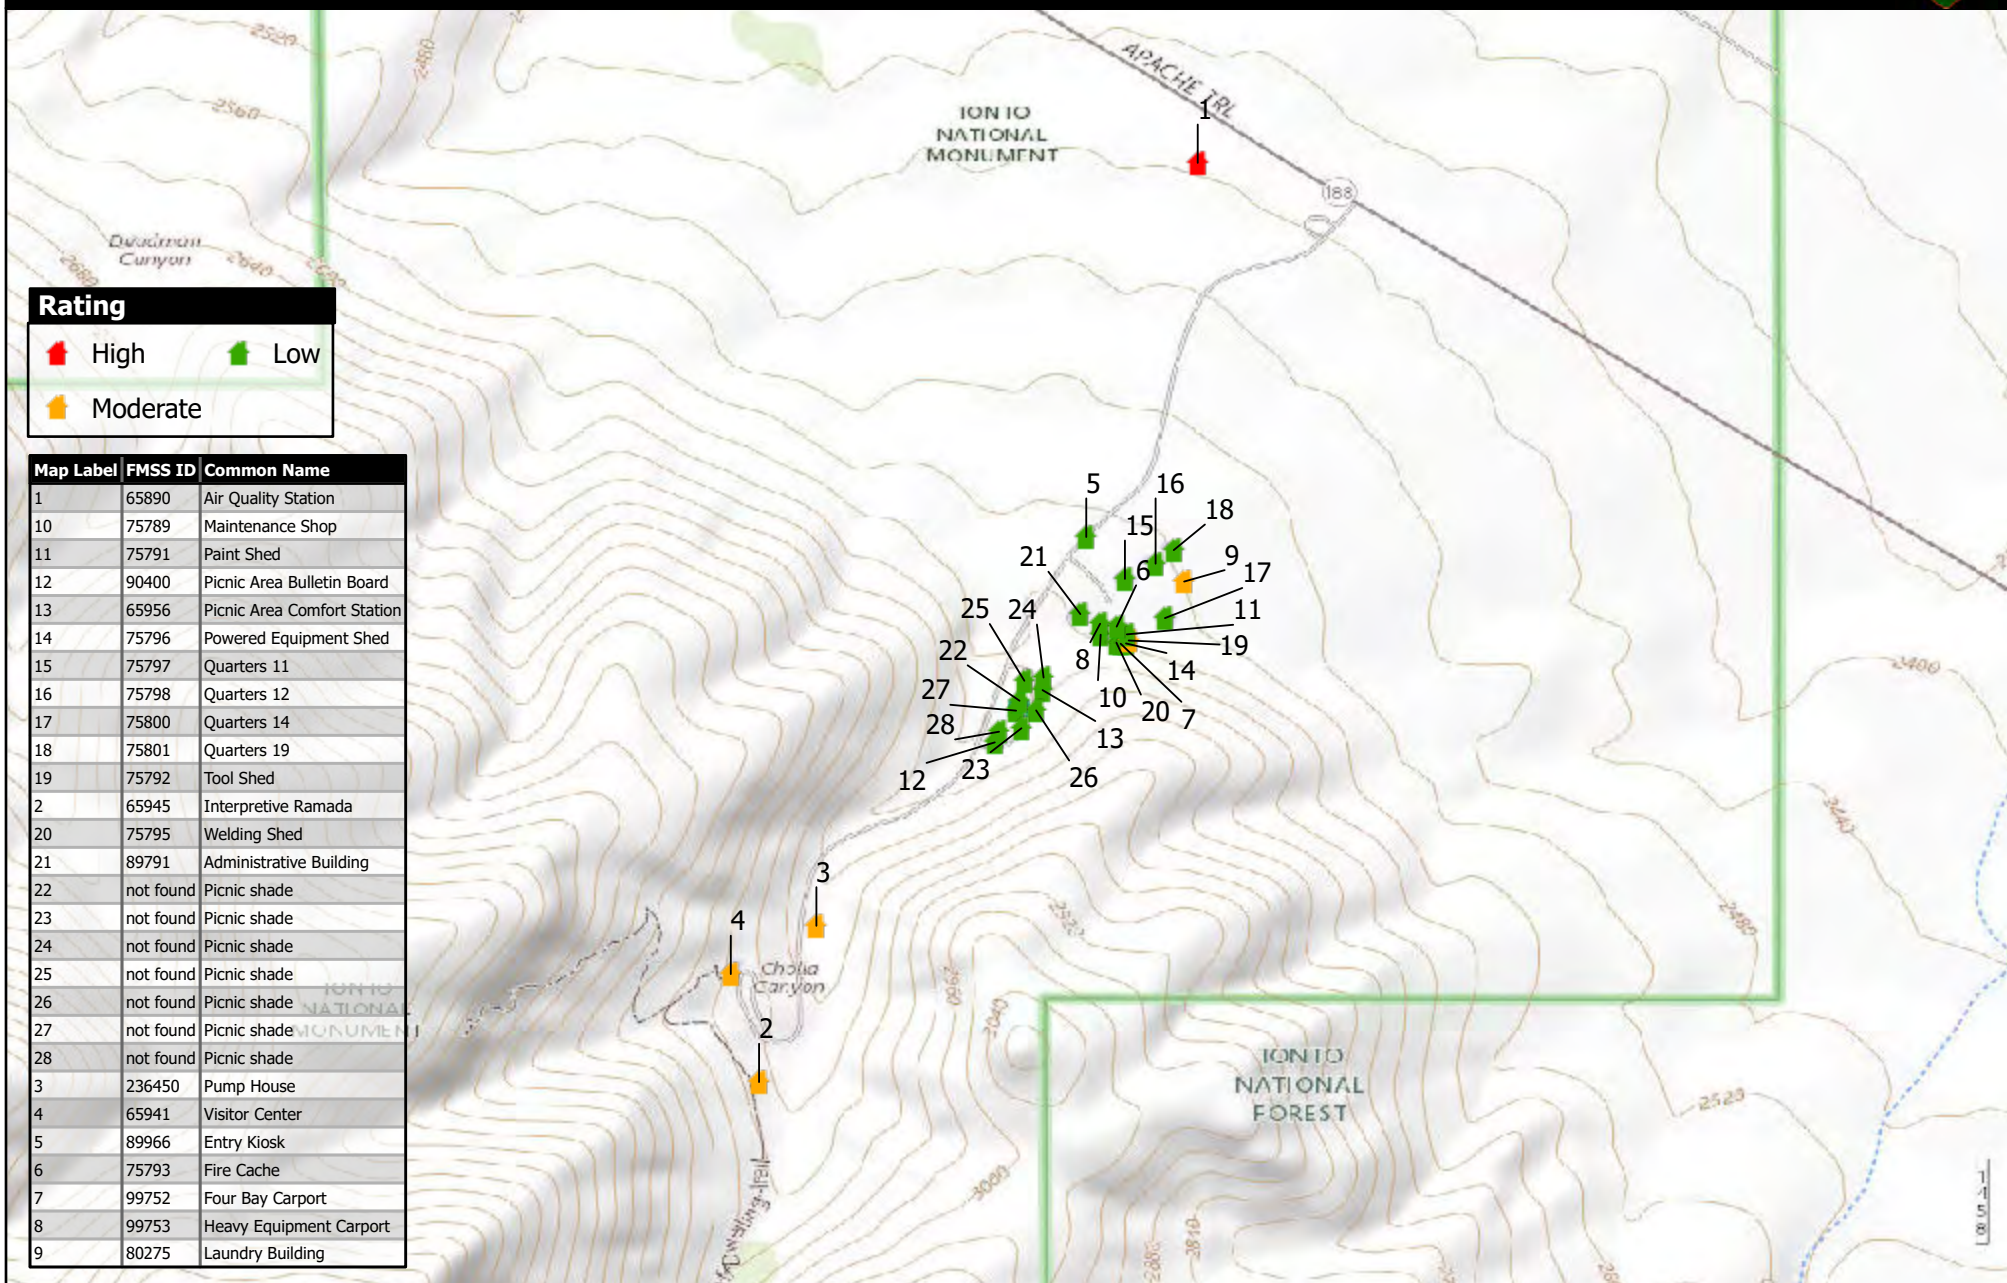

0

1

Miles

Author: sszturm
1/27/2022 8:51 AM

Intermountain Region Geographic Resources Division
January 2021

Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: TONT - Tonto National Monument

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
1	Air Quality Station	NPS	65890	Other	Unknown	No	1/13/21	Unknown	70	High	Unknown	Gate to facility is locked, 2 sets of high voltage power lines adjacent to facility. short walk from hwy 188	UNR
2	Interpretive Ramada	NPS	65945	Building	Public	N	1/13/21	Unknown	58	Moderate	Not Designated		UNR
3	Pump House	NPS	236450	Building	Admin	N	1/13/21	No	47	Moderate	Unknown	Obstacles-this structure is in a steep narrow canyon, nearest potential safety is down canyon at admin building	UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: TONT - Tonto National Monument

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
4	Visitor Center	NPS	65941	Building	Public	Y	1/13/21	Yes	47	Moderate	Unknown	special resources of concern: historic pottery and textiles. Observation deck roof is wood materials.	UNR
5	Entry Kiosk	NPS	89966	Building	Admin	N	1/13/21	Unknown	30	Low	Unknown		UNR
6	Fire Cache	NPS	75793	Building	Admin	Y	1/13/21	Unknown	44	Low	Unknown		UNR
7	Four Bay Carport	NPS	99752	Building	Admin	N	1/13/21	Unknown	44	Low	Unknown		UNR
8	Heavy Equipment Carport	NPS	99753	Building	Admin	N	1/13/21	Unknown	44	Low	Unknown		UNR
9	Laundry Building	NPS	80275	Building	Admin	N	1/13/21	Unknown	53	Moderate	Unknown		UNR
10	Maintenance Shop	NPS	75789	Building	Admin	Y	1/13/21	Unknown	41	Low	Unknown		UNR
11	Paint Shed	NPS	75791	Building	Admin	N	1/13/21	Unknown	44	Low	Not Designated		UNR
12	Picnic Area Bulletin Board	NPS	90400	Sign	Public	N	1/13/21	Unknown	41	Low	Not Designated		UNR
13	Picnic Area Comfort Station	NPS	65956	Building	Public	N	1/13/21	Unknown	41	Low	Not Designated		UNR
14	Powered Equipment Shed	NPS	75796	Building	Admin	N	1/13/21	Unknown	44	Low	Unknown		UNR
15	Quarters 11	NPS	75797	Building	Residence	Y	1/13/21	Unknown	37	Low	Unknown		UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: TONT - Tonto National Monument

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
16	Quarters 12	NPS	75798	Building	Residence	Y	1/13/21	Unknown	30	Low	Unknown		UNR
17	Quarters 14	NPS	75800	Building	Residence	Y	1/13/21	Unknown	30	Low	Unknown		UNR
18	Quarters 19	NPS	75801	Building	Residence	Y	1/13/21	Unknown	30	Low	Unknown		UNR
19	Tool Shed	NPS	75792	Building	Admin	N	1/13/21	Unknown	47	Moderate	Not Designated	Some flammable debris stored behind this building should be removed if fire is imminent	UNR
20	Welding Shed	NPS	75795	Building	Admin	N	1/13/21	Unknown	44	Low	Unknown		UNR
21	Administrative Building	NPS	89791	Building	Admin	Y	1/13/21	Unknown	37	Low	Unknown		UNR
22	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	44	Low	Not Designated		UNR
23	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	44	Low	Not Designated		UNR
24	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	41	Low	Not Designated		UNR
25	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	44	Low	Not Designated		UNR
26	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	44	Low	Not Designated		UNR
27	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	41	Low	Not Designated		UNR
28	Picnic shade	NPS	not found	Shade	Public	N	1/13/21	Unknown	41	Low	Not Designated		UNR



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: TONT - Tonto National Monument

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours
0	Residential & Maintenance Area	Community	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		200.0
		Community	Initial	2	Open crown spacing 10 to 30 feet depending on slope		200.0
		Community	Initial	2	Remove dead or dying component of shrubs and trees		100.0
1	Air Quality Station	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope		12.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		5.0
2	Interpretive Ramada	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		2.0



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

2	Interpretive Ramada	Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		1.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope		8.0
3	Pump House	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings	Maintain current level of protection/clearing.	2.0
		Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed	Maintain current level of protection/clearing.	2.0
		Individual Facility	Initial	1	Roof and gutters should be cleared of vegetative debris	Maintain current level of protection/clearing.	0.5
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		6.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope		12.0
		Individual Facility	Initial	3	Remove standing dead or dying trees or limb 6 to 15 feet above ground	Remove dead and down, limb remove standing dead to meet FireWise specifications.	12.0
4	Visitor Center	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		4.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

4	Visitor Center	Individual Facility	Initial	1	Mow dead/dying grass to less than 4 inches		1.0
		Individual Facility	Initial	2	Flammable ground cover should be removed or isolated		12.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground	Limb trees 6-15 ft above ground vegetation.	6.0
		Individual Facility	Initial	2	Mow dead/dying grass to less than 4 inches	Trim dead/dying grass to less than 4 inches.	2.0
		Individual Facility	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Limb trees 6-15 ft above ground vegetation. Ensure that horizontal spacing is adequate for the slope.	8.0
		Individual Facility	Initial	3	Limb trees 6 to 15 feet above ground	Limb dead/dying branches and trees 6-15 ft above the ground.	12.0
5	Entry Kiosk	Facility In Community (Residential & Maintenance Area)					
6	Fire Cache	Facility In Community (Residential & Maintenance Area)	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Brush needs to be thinned out and trees limbed. Tools needed chainsaws and weed wackers.	0.0
7	Four Bay Carport	Facility In Community (Residential & Maintenance Area)	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Brush needs to be thinned out and trees limbed. Tools needed chainsaws and weed wackers.	0.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

8	Heavy Equipment Carport	Facility In Community (Residential & Maintenance Area)	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Brush needs to be thinned out and trees limbed. Tools needed chainsaws and weed wackers	0.0
9	Laundry Building	Facility In Community (Residential & Maintenance Area)					
10	Maintenance Shop	Facility In Community (Residential & Maintenance Area)					
11	Paint Shed	Facility In Community (Residential & Maintenance Area)					
12	Picnic Area Bulletin Board	Facility In Community (Residential & Maintenance Area)	Initial	2	Mow dead/dying grass to less than 4 inches	Tools: Weed eaters, brush cutters, Chain Saws	6.0
		Facility In Community (Residential & Maintenance Area)	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Tools: Weed eaters, brush cutters, Chain Saws	6.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

13	Picnic Area Comfort Station	Facility In Community (Residential & Maintenance Area)					
14	Powered Equipment Shed	Facility In Community (Residential & Maintenance Area)	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Brush needs to be thinned out and trees limbed. Tools needed chainsaws and weed wackers	0.0
15	Quarters 11	Facility In Community (Residential & Maintenance Area)					
16	Quarters 12	Facility In Community (Residential & Maintenance Area)					
17	Quarters 14	Facility In Community (Residential & Maintenance Area)					
18	Quarters 19	Facility In Community (Residential & Maintenance Area)					



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

19	Tool Shed	Facility In Community (Residential & Maintenance Area)	Initial	2	Mow dead/dying grass to less than 4 inches	Brush needs to be thinned out and trees limbed. Tools needed chainsaws and weed wackers	6.0
		Facility In Community (Residential & Maintenance Area)	Initial	2	Open crown spacing 10 to 30 feet depending on slope	Brush needs to be thinned out and trees limbed. Tools needed chainsaws and weed wackers	0.0
20	Welding Shed	Facility In Community (Residential & Maintenance Area)					
21	Administrative Building	Facility In Community (Residential & Maintenance Area)					
28	Picnic shade	Facility In Community (Residential & Maintenance Area)					
		Facility In Community (Residential & Maintenance Area)					



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

28	Picnic shade	Facility In Community (Residential & Maintenance Area)					
		Facility In Community (Residential & Maintenance Area)					
		Facility In Community (Residential & Maintenance Area)					
		Facility In Community (Residential & Maintenance Area)					
		Facility In Community (Residential & Maintenance Area)					



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: Tonto National Monument - Tonto National Monument

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
Administrative Building	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Air Quality Station	Individual Facility	PrepLeave	Fuels reduction -	16.0	-	
Entry Kiosk	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Fire Cache	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Four Bay Carport	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Heavy Equipment Carport	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Interpretive Ramada	Individual Facility	PrepLeave	Engine on scene -		-	
			Fuels reduction -	6.0	-	
Laundry Building	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Maintenance Shop	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	



NPS Wildland Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
Paint Shed	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Picnic Area Bulletin Board	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic Area Comfort Station	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	
Picnic shade	Facility In Community (Residential & Maintenance Area)	PrepLeave	-		-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
Powered Equipment Shed	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Pump House	Individual Facility	PrepLeave	Fuels reduction -	5.0	-	
			Engine on scene -	12.0	-	
Quarters 11	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Quarters 12	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Quarters 14	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Quarters 19	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Residential & Maintenance Area	Community	NULL	Fuels reduction -	200.0	-	
			Engine on scene -		-	
			Handline and burnout -	250.0	-	
Tool Shed	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	
Visitor Center	Individual Facility	PrepHold	Fuels reduction -	20.0	-	
			Handline and burnout - Tactic has been used in recent wildfire (Woodbury Fire, 2019)	100.0	-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
Visitor Center	Individual Facility	PrepHold	Engine on scene - from 2016 assessment: Sprinkler system in place at time of assessment but it is not a permanent system. Two sprinkler kits, 2 pumpkins and 2 Mark 3 kits suggested.		-	
			Install sprinkler system -	8.0	-	
Welding Shed	Facility In Community (Residential & Maintenance Area)	PrepHold	-		-	



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Air Quality Station

Unit - Location: TONT - Tonto National Monument
FMSS ID: 65890
Structure Type: Other
Structure Use: Unknown
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 1/13/2021

Rating: High
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied?
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 33° 39.2836' **Long(WGS84):** -111° 6.4469'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Non-surfaced- gravel,dirt,grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: Overhead hazards will limit aircraft
Safety Zones: No safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: high voltage
Assessment Comments: Gate to facility is locked, 2 sets of high voltage power lines adjacent to facility. short walk from hwy 188



2021_TONT_65890_Air Quality Station_Front.jpg




Score: 70
Rating: High



Asset Priority Index (API):
N/A



Factors Driving the Ratings

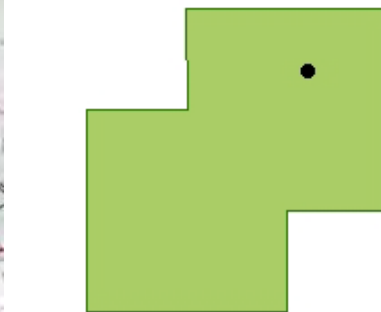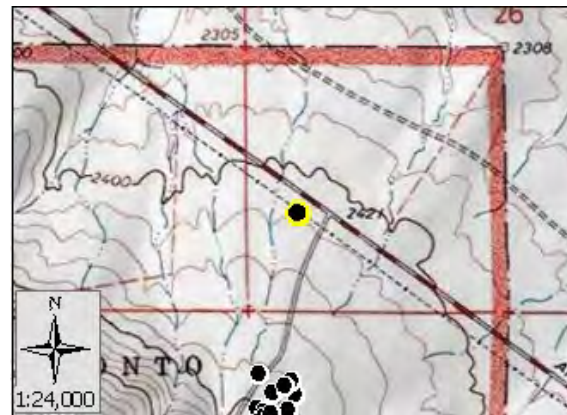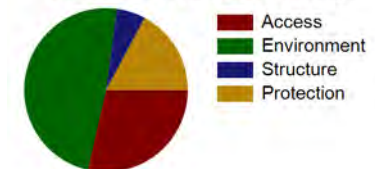

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Interpretive Ramada

Unit - Location: TONT - Tonto National Monument

FMSS ID: 65945

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 38.6281' **Long(WGS84):** -111° 6.75963'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope >40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: No safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_65945_Interpretive Ramada_Front.jpg




Score: 58
Rating: Moderate


Asset Priority Index (API):
0



Factors Driving the Ratings

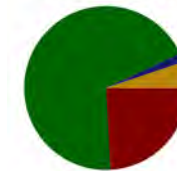

Access
Environment
Structure
Protection

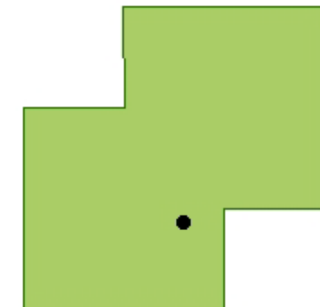

● Facility

■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Pump House

Unit - Location: TONT - Tonto National Monument

FMSS ID: 236450

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? No

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 38.7397' **Long(WGS84):** -111° 6.71884'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 31% to 40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments: Obstacles-this structure is in a steep narrow canyon, nearest potential safety is down canyon at admin building



2021_TONT_236450_Pump House_Front.jpg



Score: 47
Rating: Moderate


Asset Priority Index (API):
27



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection

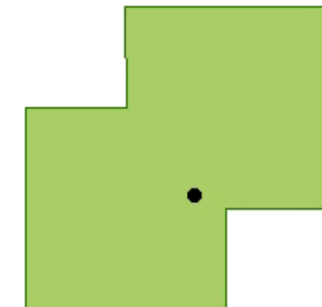

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Visitor Center

Unit - Location: TONT - Tonto National Monument

FMSS ID: 65941

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Yes, contact unit staff before engaging.

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 33° 38.7051' **Long(WGS84):** -111° 6.7799'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope >40%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments: special resources of concern: historic pottery and textiles.

Observation deck roof is wood materials.



2021_TONT_65941_Visitor Center_Front.jpg





Score: 47
Rating: Moderate

Asset Priority Index (API):
100



Factors Driving the Ratings

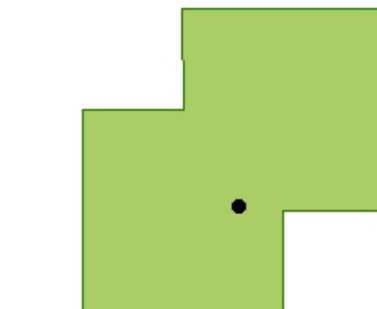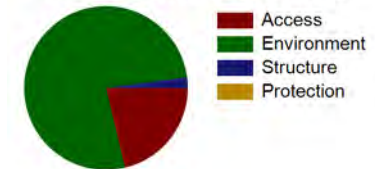

● Facility

■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Entry Kiosk

Unit - Location: TONT - Tonto National Monument

FMSS ID: 89966

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 39.0169' **Long(WGS84):** -111° 6.52633'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_89966_Entry Kiosk_Front.jpg

Score: 30
Rating: Low





Asset Priority Index (API): 15



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection

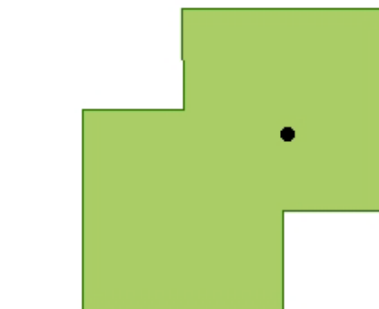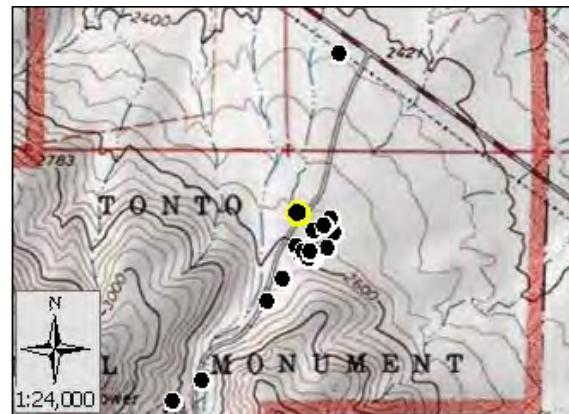

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Fire Cache

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75793

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.953' **Long(WGS84):** -111° 6.50467'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT

Triage Category:

Hazmat: flammable fuel locker near D side

Assessment Comments:



2021_TONT_75793_Fire Cache_Front.jpg


Score: 44
Rating: Low




Asset Priority Index (API):
7



Factors Driving the Ratings

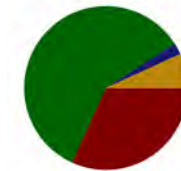

■ Access
■ Environment
■ Structure
■ Protection

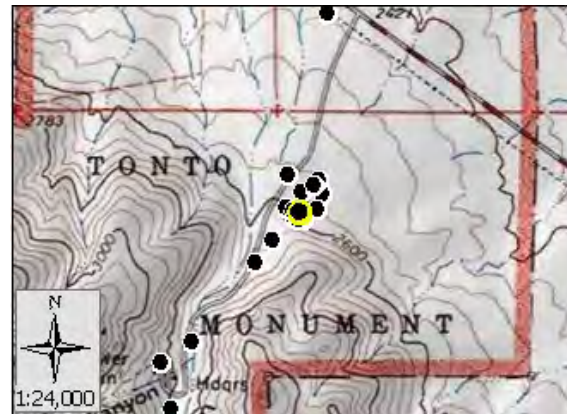

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Four Bay Carport

Unit - Location: TONT - Tonto National Monument
FMSS ID: 99752
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 1/13/2021

Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Residential & Maintenance Area
Lat(WGS84): 33° 38.9408' **Long(WGS84):** -111° 6.50185'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: fuel locker nearby
Assessment Comments:



2021_TONT_99752_Four Bay Carport_Front.jpg


Score: 44
Rating: Low





Asset Priority Index (API): 20



Factors Driving the Ratings

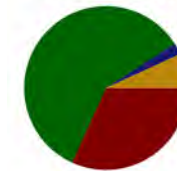

■ Access
■ Environment
■ Structure
■ Protection

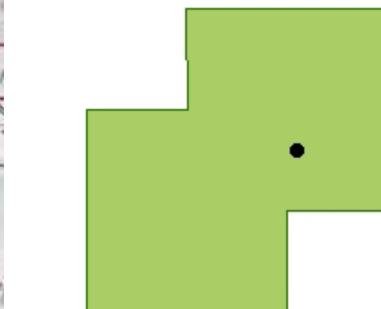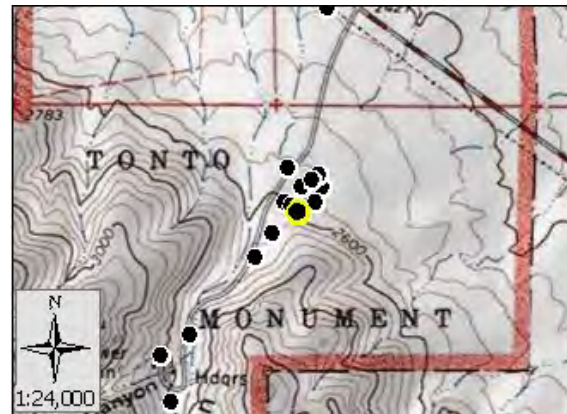

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Heavy Equipment Carport

Unit - Location: TONT - Tonto National Monument
FMSS ID: 99753
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 1/13/2021

Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Residential & Maintenance Area
Lat(WGS84): 33° 38.9551' **Long(WGS84):** -111° 6.5165'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: Overhead hazards will limit aircraft
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_TONT_99753_Heavy Equipment Carport_Front.jpg


Score: 44
Rating: Low





Asset Priority Index (API): 20



Factors Driving the Ratings

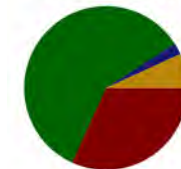

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

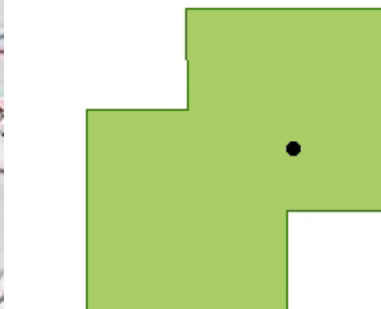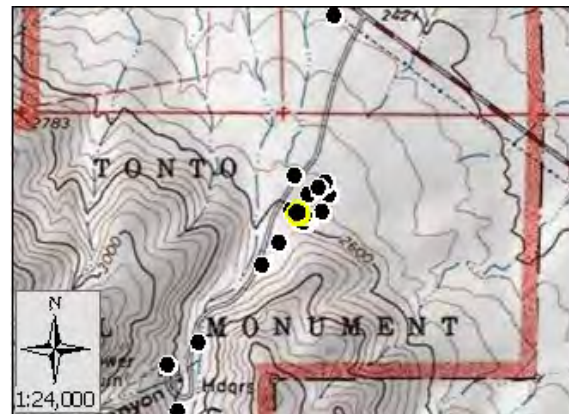

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Laundry Building

Unit - Location: TONT - Tonto National Monument

FMSS ID: 80275

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9852' **Long(WGS84):** -111° 6.45665'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: Present and little to no fuels clearance

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:




2021_TONT_80275_Laundry Building_Front.jpg

Score: 53
Rating: Moderate



Asset Priority Index (API): 13



Factors Driving the Ratings

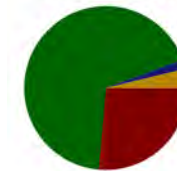

Access
Environment
Structure
Protection

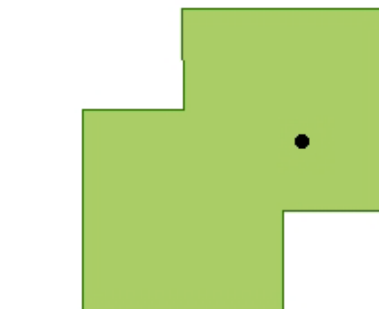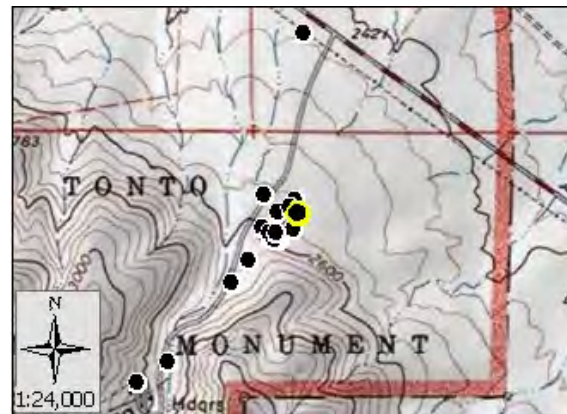

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance Shop

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75789

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9473' **Long(WGS84):** -111° 6.5161'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_75789_Maintenance Shop_Front.jpg

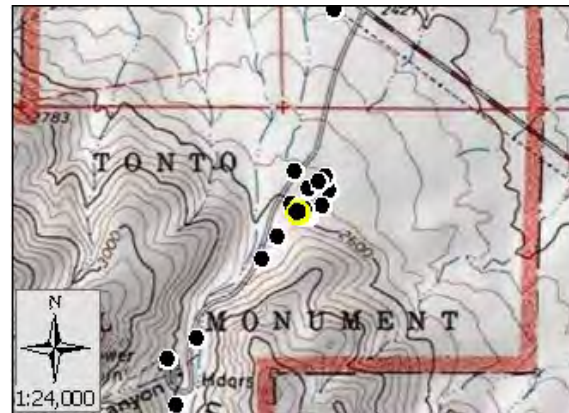

Score: 41
Rating: Low




Asset Priority Index (API): 42



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection

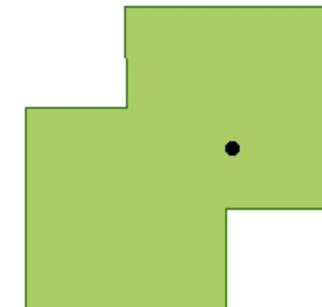

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Paint Shed

Unit - Location: TONT - Tonto National Monument
FMSS ID: 75791
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 1/13/2021

Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Residential & Maintenance Area
Lat(WGS84): 33° 38.9475' **Long(WGS84):** -111° 6.49739'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: fuel locker adjacent
Assessment Comments:



2021_TONT_75791_Paint Shed_Front.jpg


Score: 44
Rating: Low





Asset Priority Index (API): 29



Factors Driving the Ratings

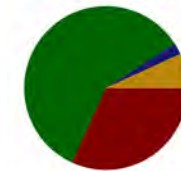

■ Access
■ Environment
■ Structure
■ Protection

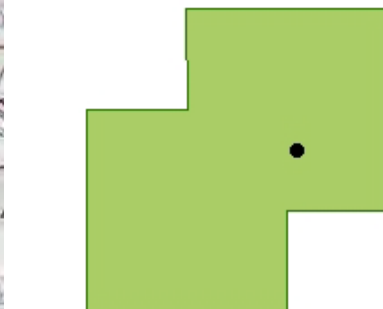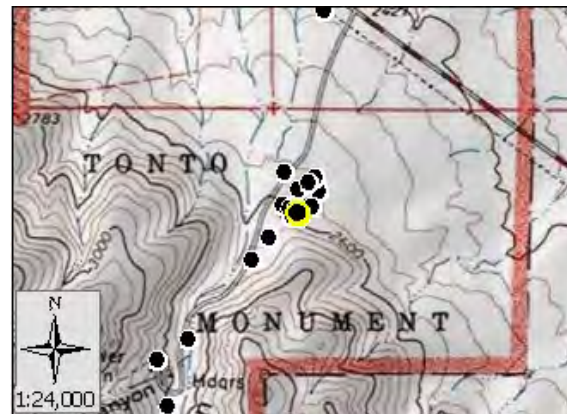

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic Area Bulletin Board

Unit - Location: TONT - Tonto National Monument

FMSS ID: 90400

Structure Type: Sign

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.8705' Long(WGS84): -111° 6.59149'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_90400_Picnic Area Bulletin Board_Front.jpg

Score: 41
Rating: Low



Asset Priority Index
(API):
29



Factors Driving the Ratings



Access
Environment
Structure
Protection

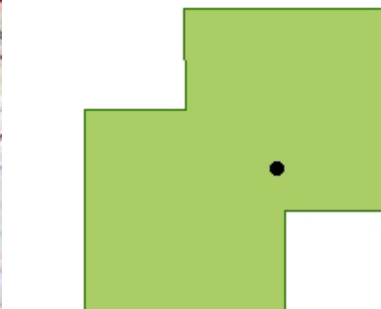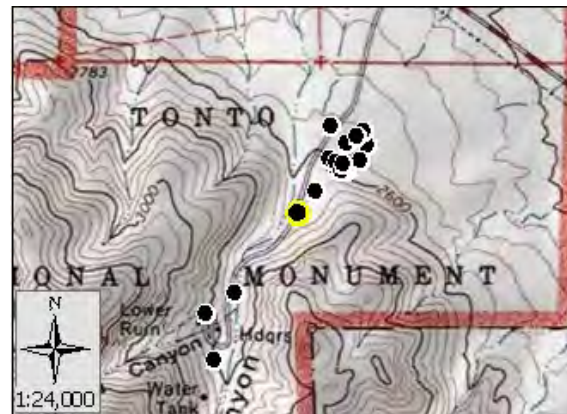

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic Area Comfort Station

Unit - Location: TONT - Tonto National Monument

FMSS ID: 65956

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9078' **Long(WGS84):** -111° 6.55748'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_65956_Picnic Area Comfort Station_Front.jpg

Score: 41
Rating: Low


Asset Priority Index
(API):
29



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection

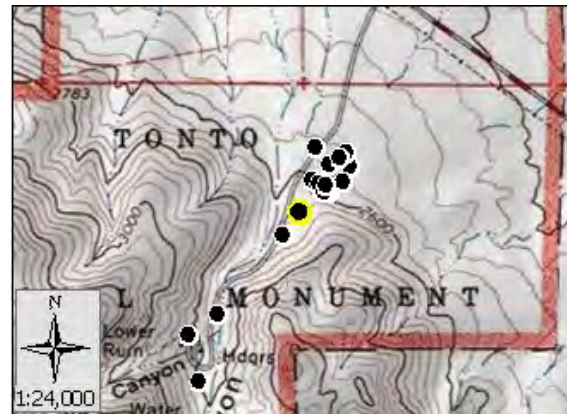

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Powered Equipment Shed

Unit - Location: TONT - Tonto National Monument
FMSS ID: 75796
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 1/13/2021

Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Residential & Maintenance Area
Lat(WGS84): 33° 38.9409' **Long(WGS84):** -111° 6.49811'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: welding shed nearby
Assessment Comments:



2021_TONT_75796_Powered Equipment Shed_Front.jpg


Score: 44
Rating: Low




Asset Priority Index (API):
7



Factors Driving the Ratings

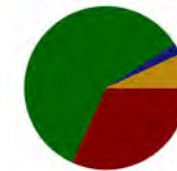

■ Access
■ Environment
■ Structure
■ Protection

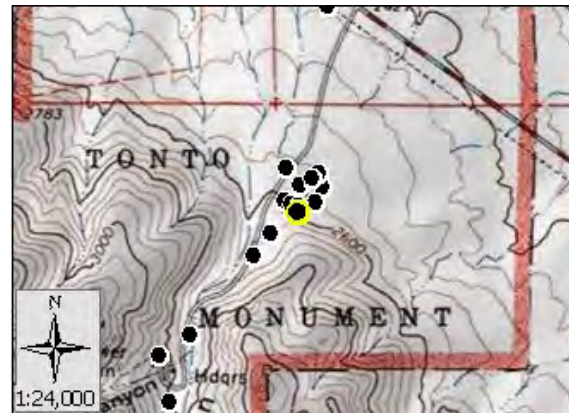



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Quarters 11

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75797

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.987' **Long(WGS84):** -111° 6.49873'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_75797_Quarters 11_Front.jpg

Score: 37
Rating: Low





Asset Priority Index (API): 46



Factors Driving the Ratings



Access
Environment
Structure
Protection

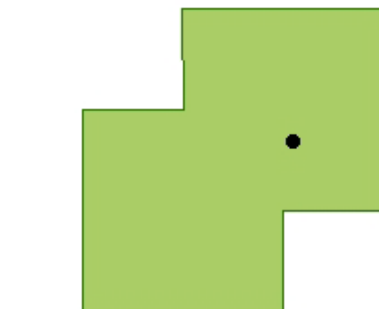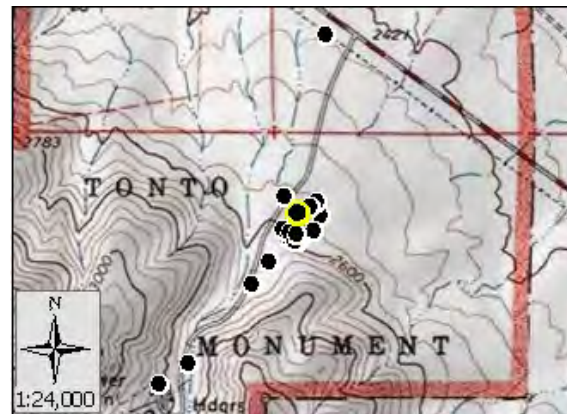

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Quarters 12

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75798

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9979' **Long(WGS84):** -111° 6.47692'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_75798_Quarters 12_Front.jpg




Score: 30
Rating: Low



Asset Priority Index (API): 63



Factors Driving the Ratings

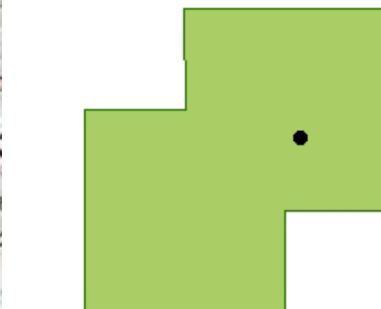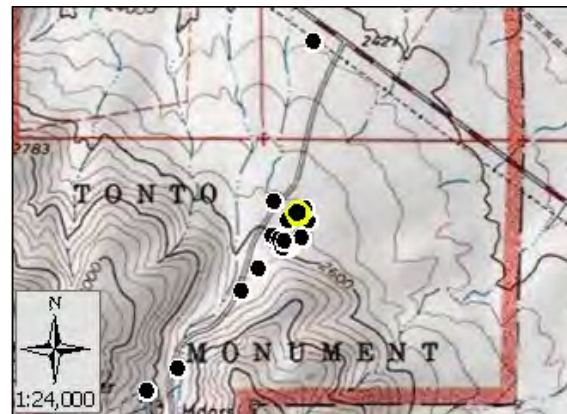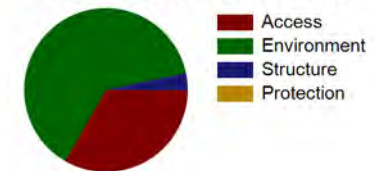

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Quarters 14

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75800

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.959' **Long(WGS84):** -111° 6.47018'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_75800_Quarters 14_Front.jpg

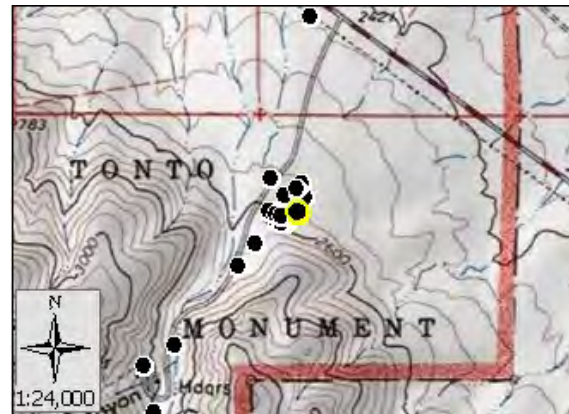

Score: 30
Rating: Low




Asset Priority Index (API): 46



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection

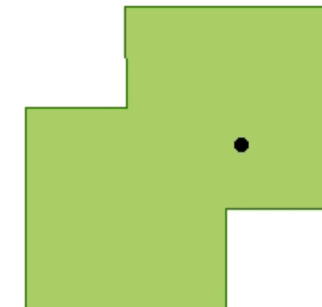

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Quarters 19

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75801

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 39.0074' **Long(WGS84):** -111° 6.46392'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_75801_Quarters 19_Front.jpg

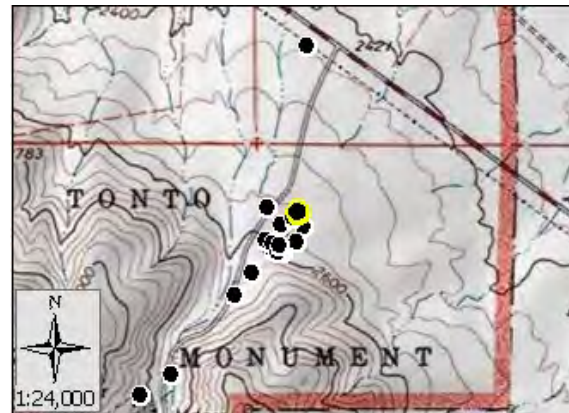



Score: 30
Rating: Low



Asset Priority Index (API): 46



Factors Driving the Ratings

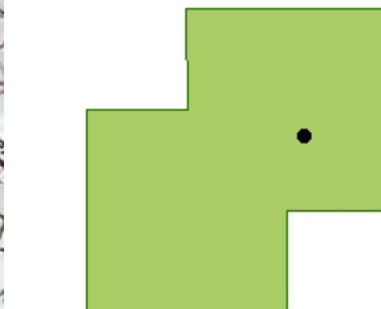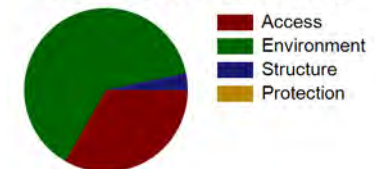

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Tool Shed

Unit - Location: TONT - Tonto National Monument

FMSS ID: 75792

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.943' **Long(WGS84):** -111° 6.49609'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT

Triage Category:

Hazmat: fuel locker across driveway

Assessment Comments: Some flammable debris stored behind this building should be removed if fire is imminent




2021_TONT_75792_Tool Shed_Front.jpg

Score: 47
Rating: Moderate


Asset Priority Index (API):
7



Factors Driving the Ratings

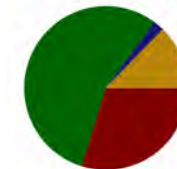

■ Access
■ Environment
■ Structure
■ Protection

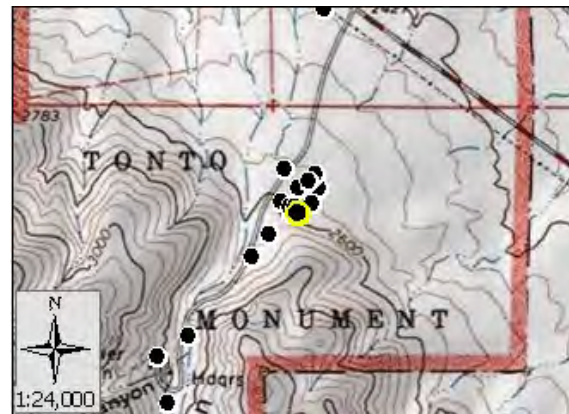



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Welding Shed


Unit - Location: TONT - Tonto National Monument
FMSS ID: 75795
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 1/13/2021

Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Residential & Maintenance Area
Lat(WGS84): 33° 38.9415' **Long(WGS84):** -111° 6.50478'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: contains acetylene gas and oxygen gas
Assessment Comments:



2021_TONT_75795_Welding Shed_Front.jpg

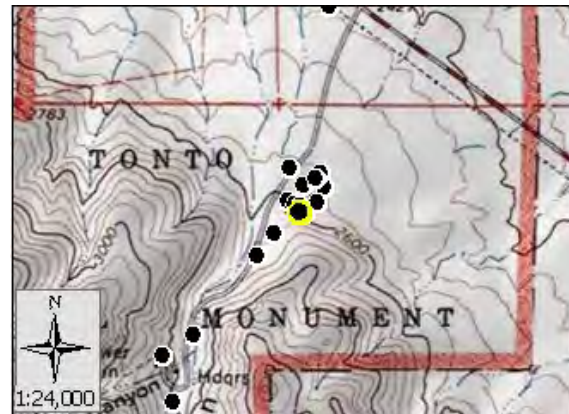


Score: 44
Rating: Low

Asset Priority Index (API): 29



Factors Driving the Ratings

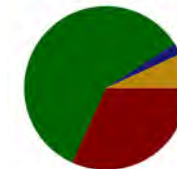

■ Access
 ■ Environment
 ■ Structure
 ■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Administrative Building

Unit - Location: TONT - Tonto National Monument

FMSS ID: 89791

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9618' **Long(WGS84):** -111° 6.53061'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_89791_Administrative Building_Front.jpg

Score: 37
Rating: Low





Asset Priority Index (API): 42



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection

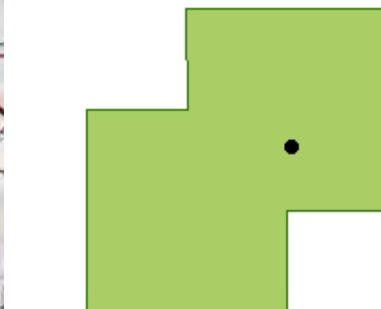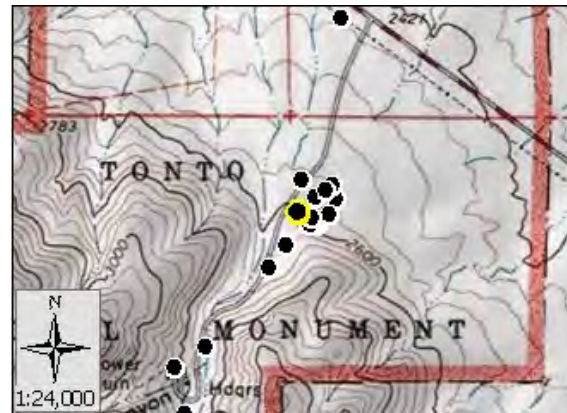

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9' Long(WGS84): -111° 6.57397'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:




2021_TONT_not found _Picnic shade_Front.jpg

Score: 44
Rating: Low

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

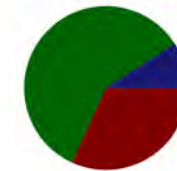

Access
Environment
Structure
Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.8804' **Long(WGS84):** -111° 6.57247'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_not found _Picnic shade_Front.jpg


Score: 44
Rating: Low



Asset Priority Index (API):
N/A



Factors Driving the Ratings

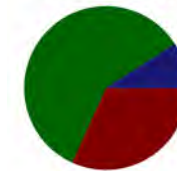

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9167' **Long(WGS84):** -111° 6.5568'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_not found _Picnic shade_Front.jpg

Score: 41
Rating: Low

Asset Priority Index
(API):
N/A



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.9143' **Long(WGS84):** -111° 6.57049'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:




2021_TONT_not found _Picnic shade_Front.jpg

Score: 44
Rating: Low

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

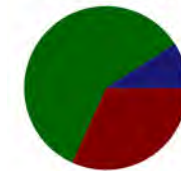

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.8933' **Long(WGS84):** -111° 6.56215'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_not found _Picnic shade_Front.jpg


Score: 44
Rating: Low



Asset Priority Index (API):
N/A



Factors Driving the Ratings

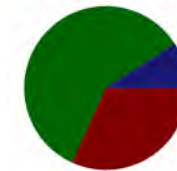

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.8931' **Long(WGS84):** -111° 6.57644'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_not found _Picnic shade_Front.jpg

Score: 41
Rating: Low



Asset Priority Index (API):
N/A



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Picnic shade

Unit - Location: TONT - Tonto National Monument

FMSS ID: not found

Structure Type: Shade

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 1/13/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Residential & Maintenance Area

Lat(WGS84): 33° 38.8781' **Long(WGS84):** -111° 6.58848'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 21% to 30%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:

Assessment Comments:



2021_TONT_not found _Picnic shade_Front.jpg

Score: 41
Rating: Low



Asset Priority Index (API):
N/A



Factors Driving the Ratings



■ Access
■ Environment
■ Structure
■ Protection