


NPS Wildfire Risk Assessments Assessment Locations

Wupatki National Monument

National Park Service
U.S. Department of the Interior

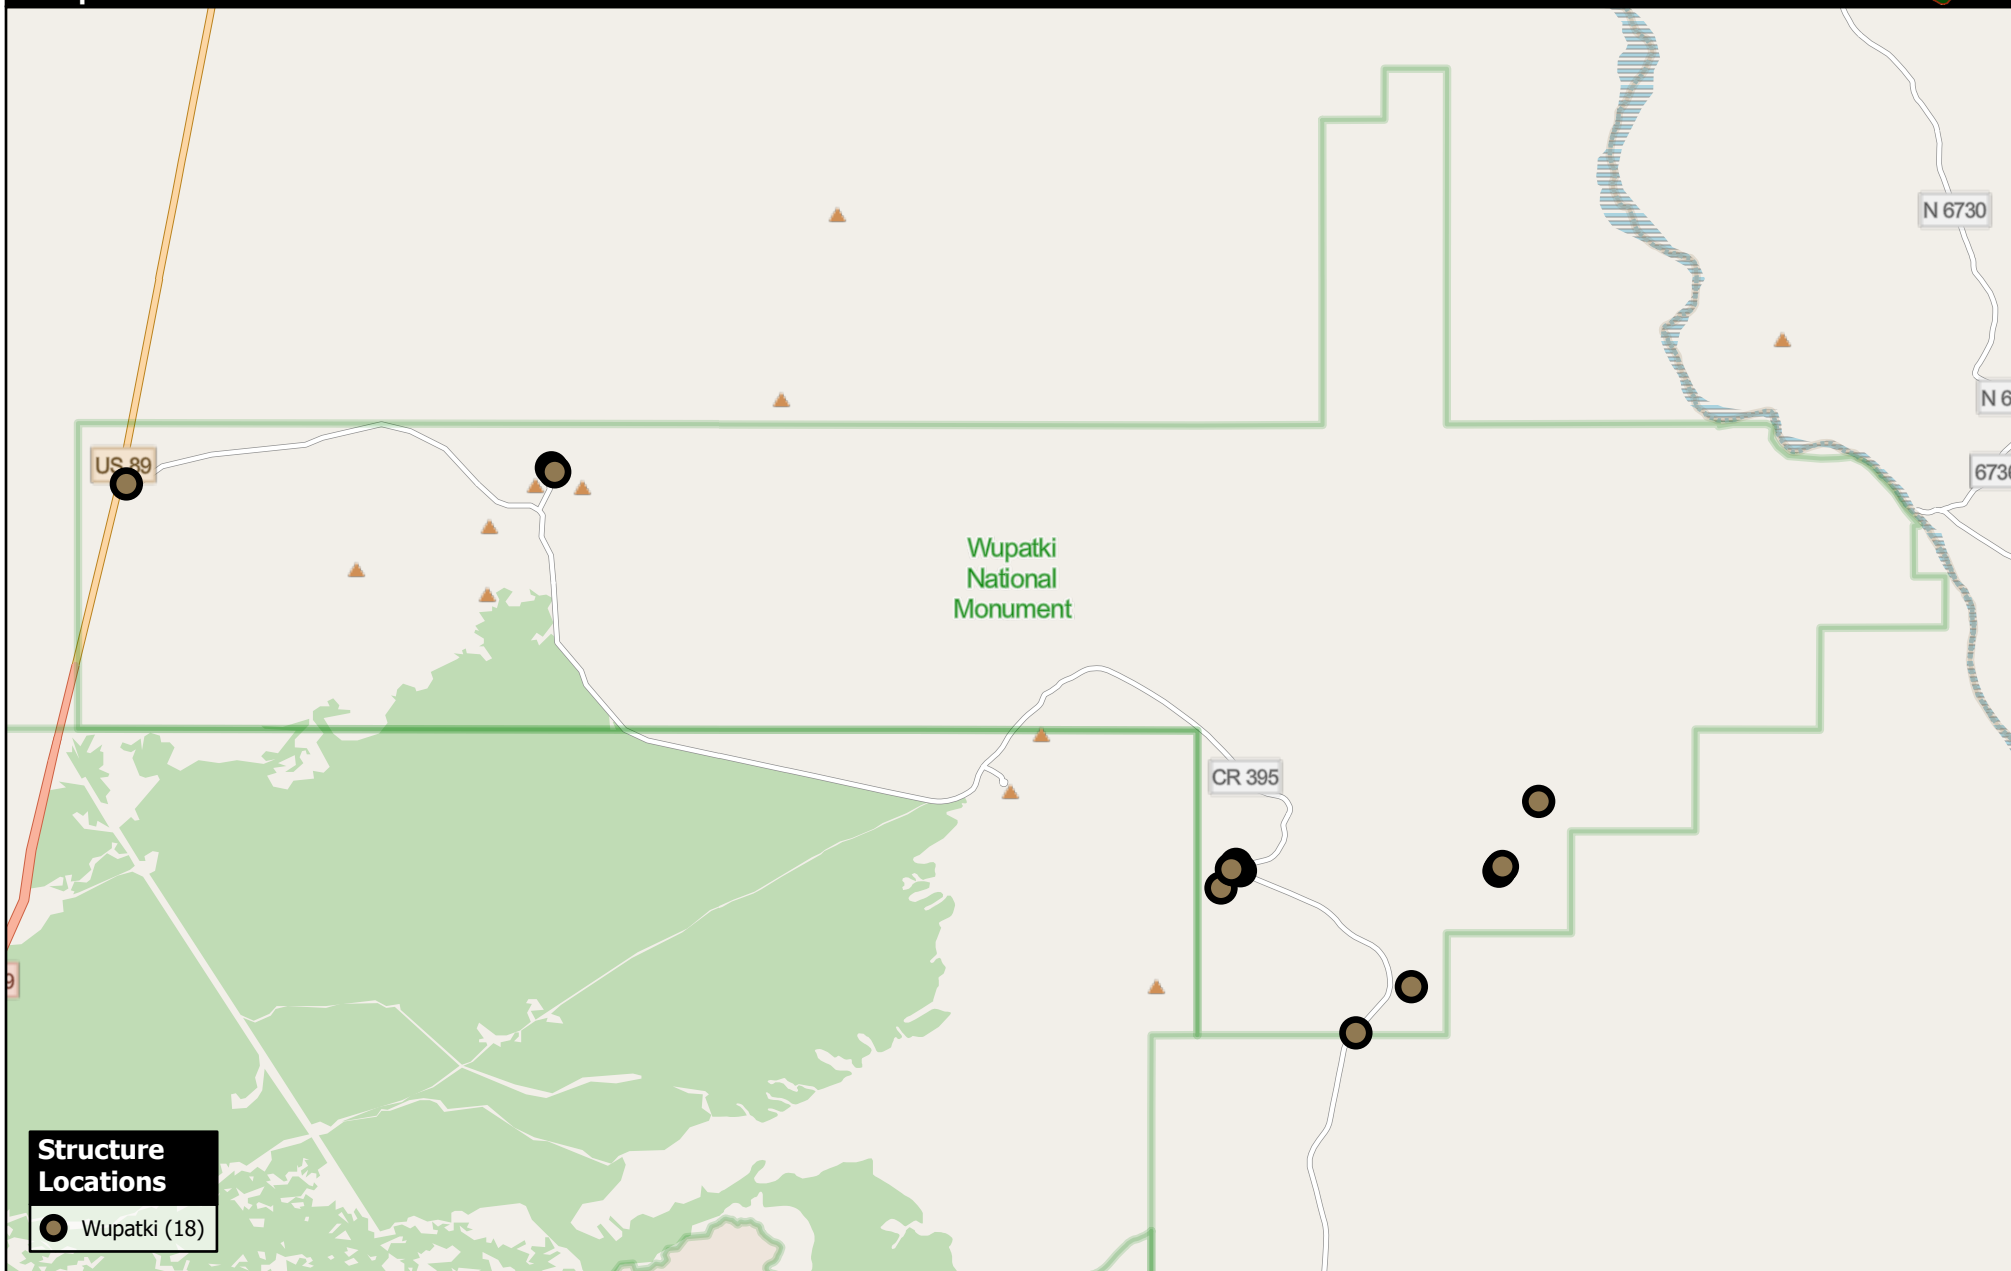

Structure Locations

● Wupatki (18)



0

5

10

Miles

Author: sszturm
1/27/2022 3:05 PM


Intermountain Region Geographic Resources Division
December 2020
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

NPS Wildfire Risk Assessments Assessment Locations

Wupatki National Monument

National Park Service
U.S. Department of the Interior

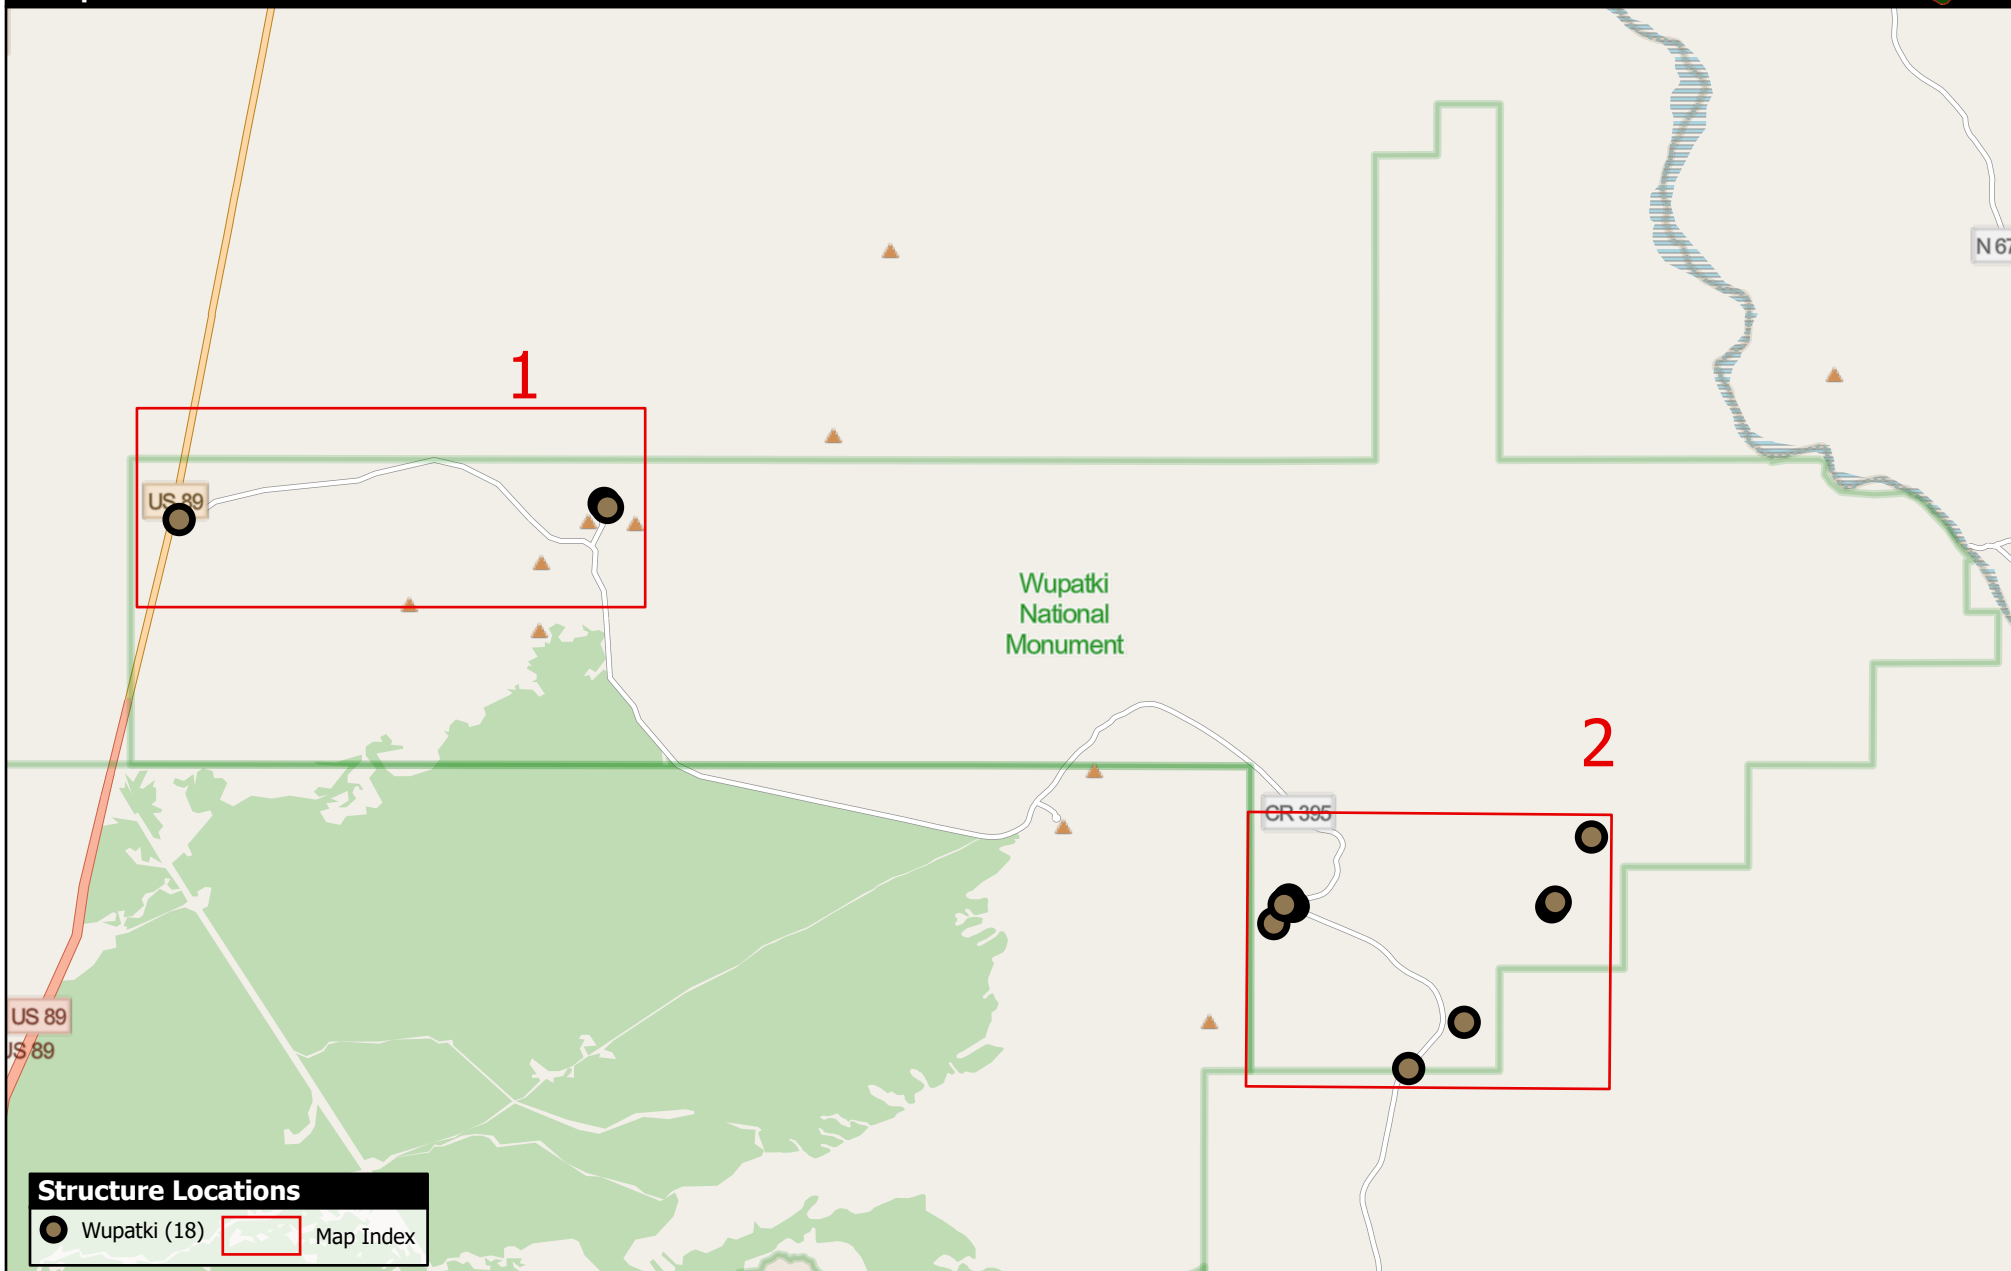

Structure Locations

● Wupatki (18) Map Index



0 5 10 Miles

Author: sszturm
1/27/2022 2:57 PM


Intermountain Region Geographic Resources Division
December 2020
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Wupatki National Monument-1

NPS Wildfire Risk Assessments

National Park Service
U.S. Department of the Interior

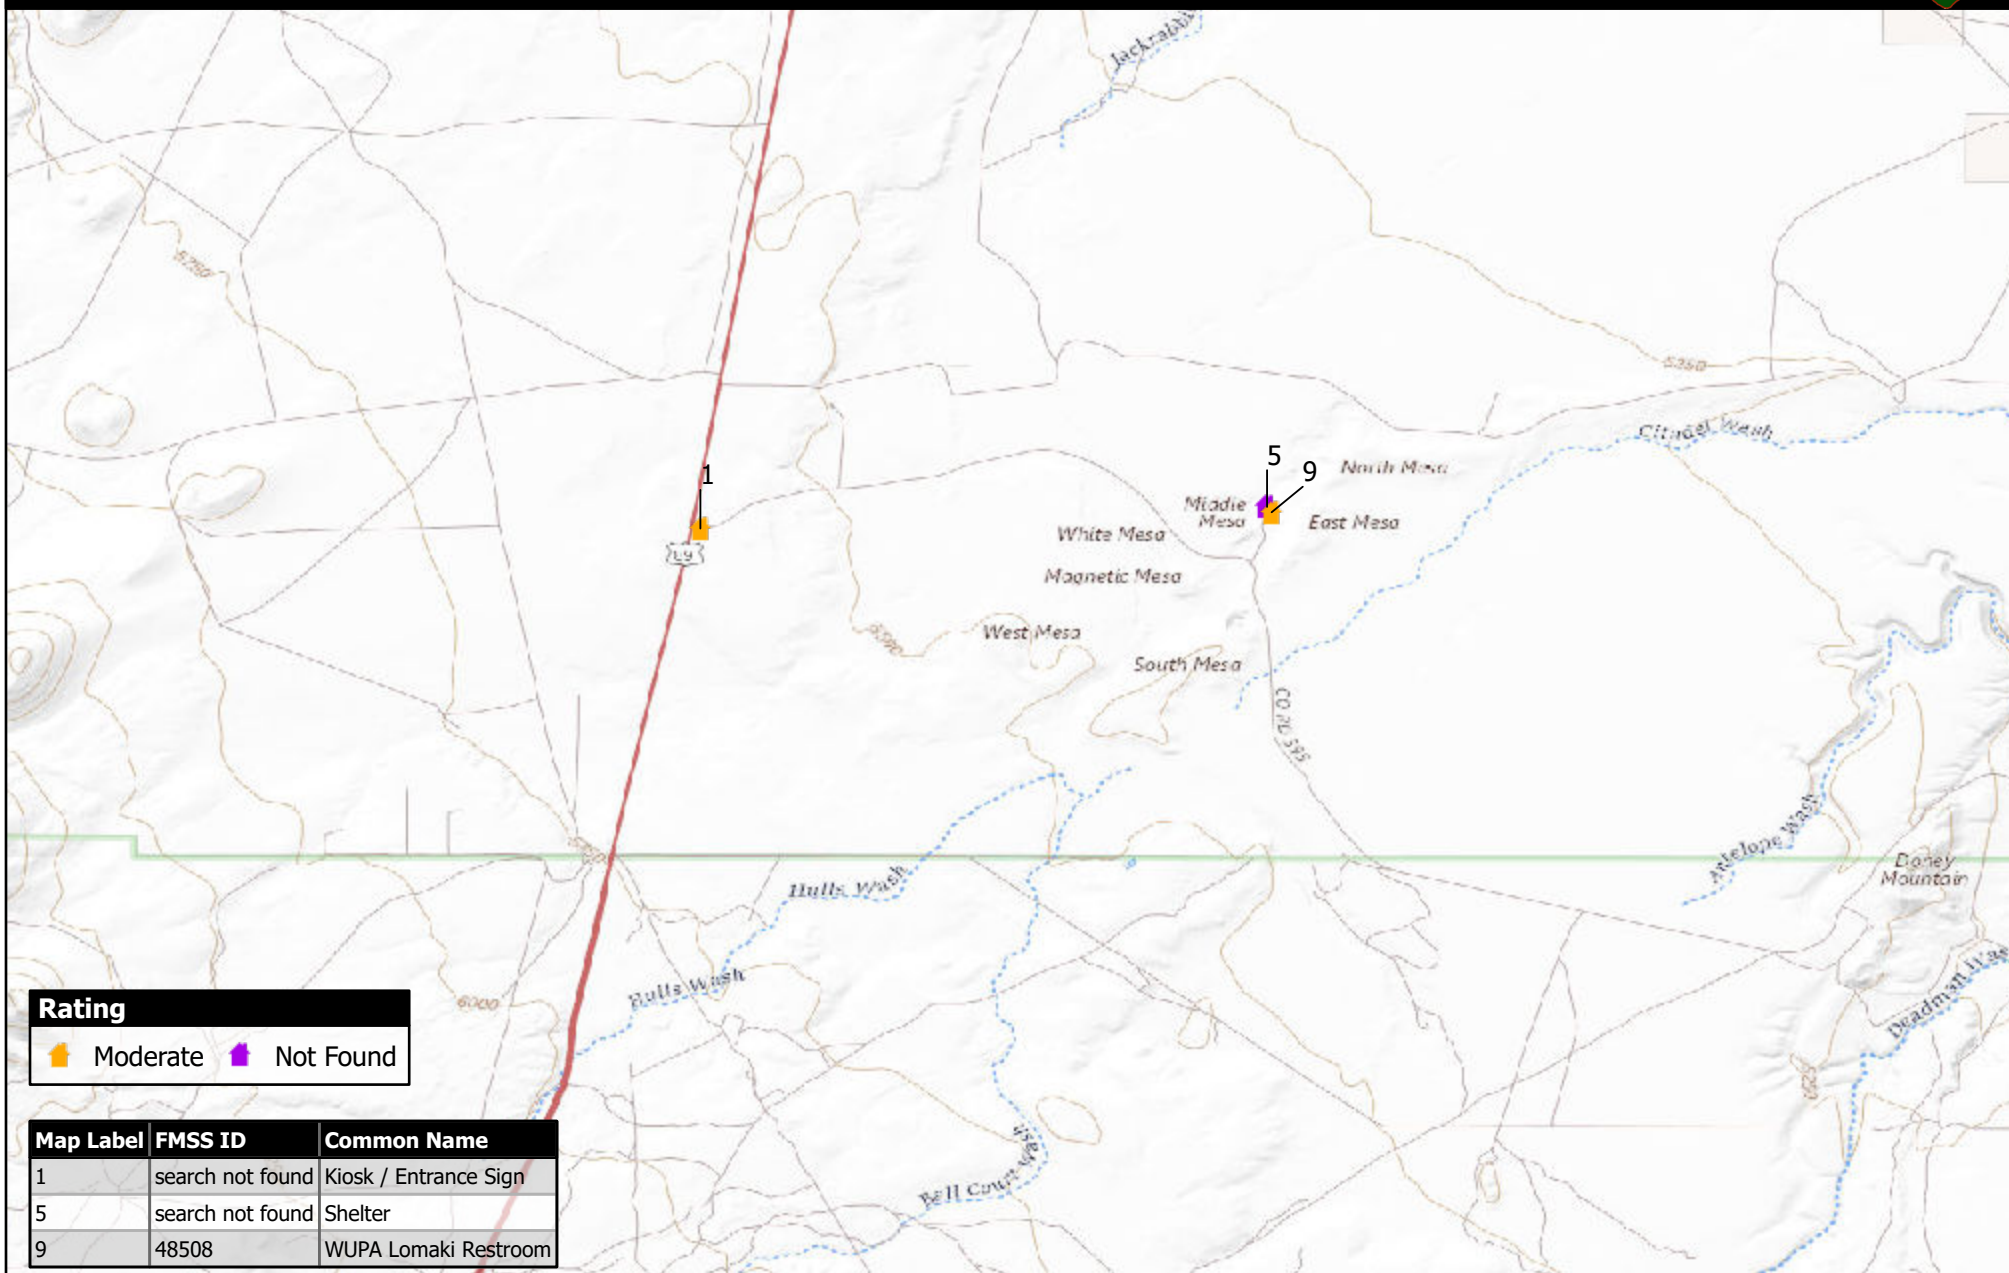

0

5

Miles

Author: sszturm
1/27/2022 3:12 PM

Intermountain Region Geographic Resources Division
December 2020


Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Wupatki National Monument-2

NPS Wildfire Risk Assessments

National Park Service
U.S. Department of the Interior

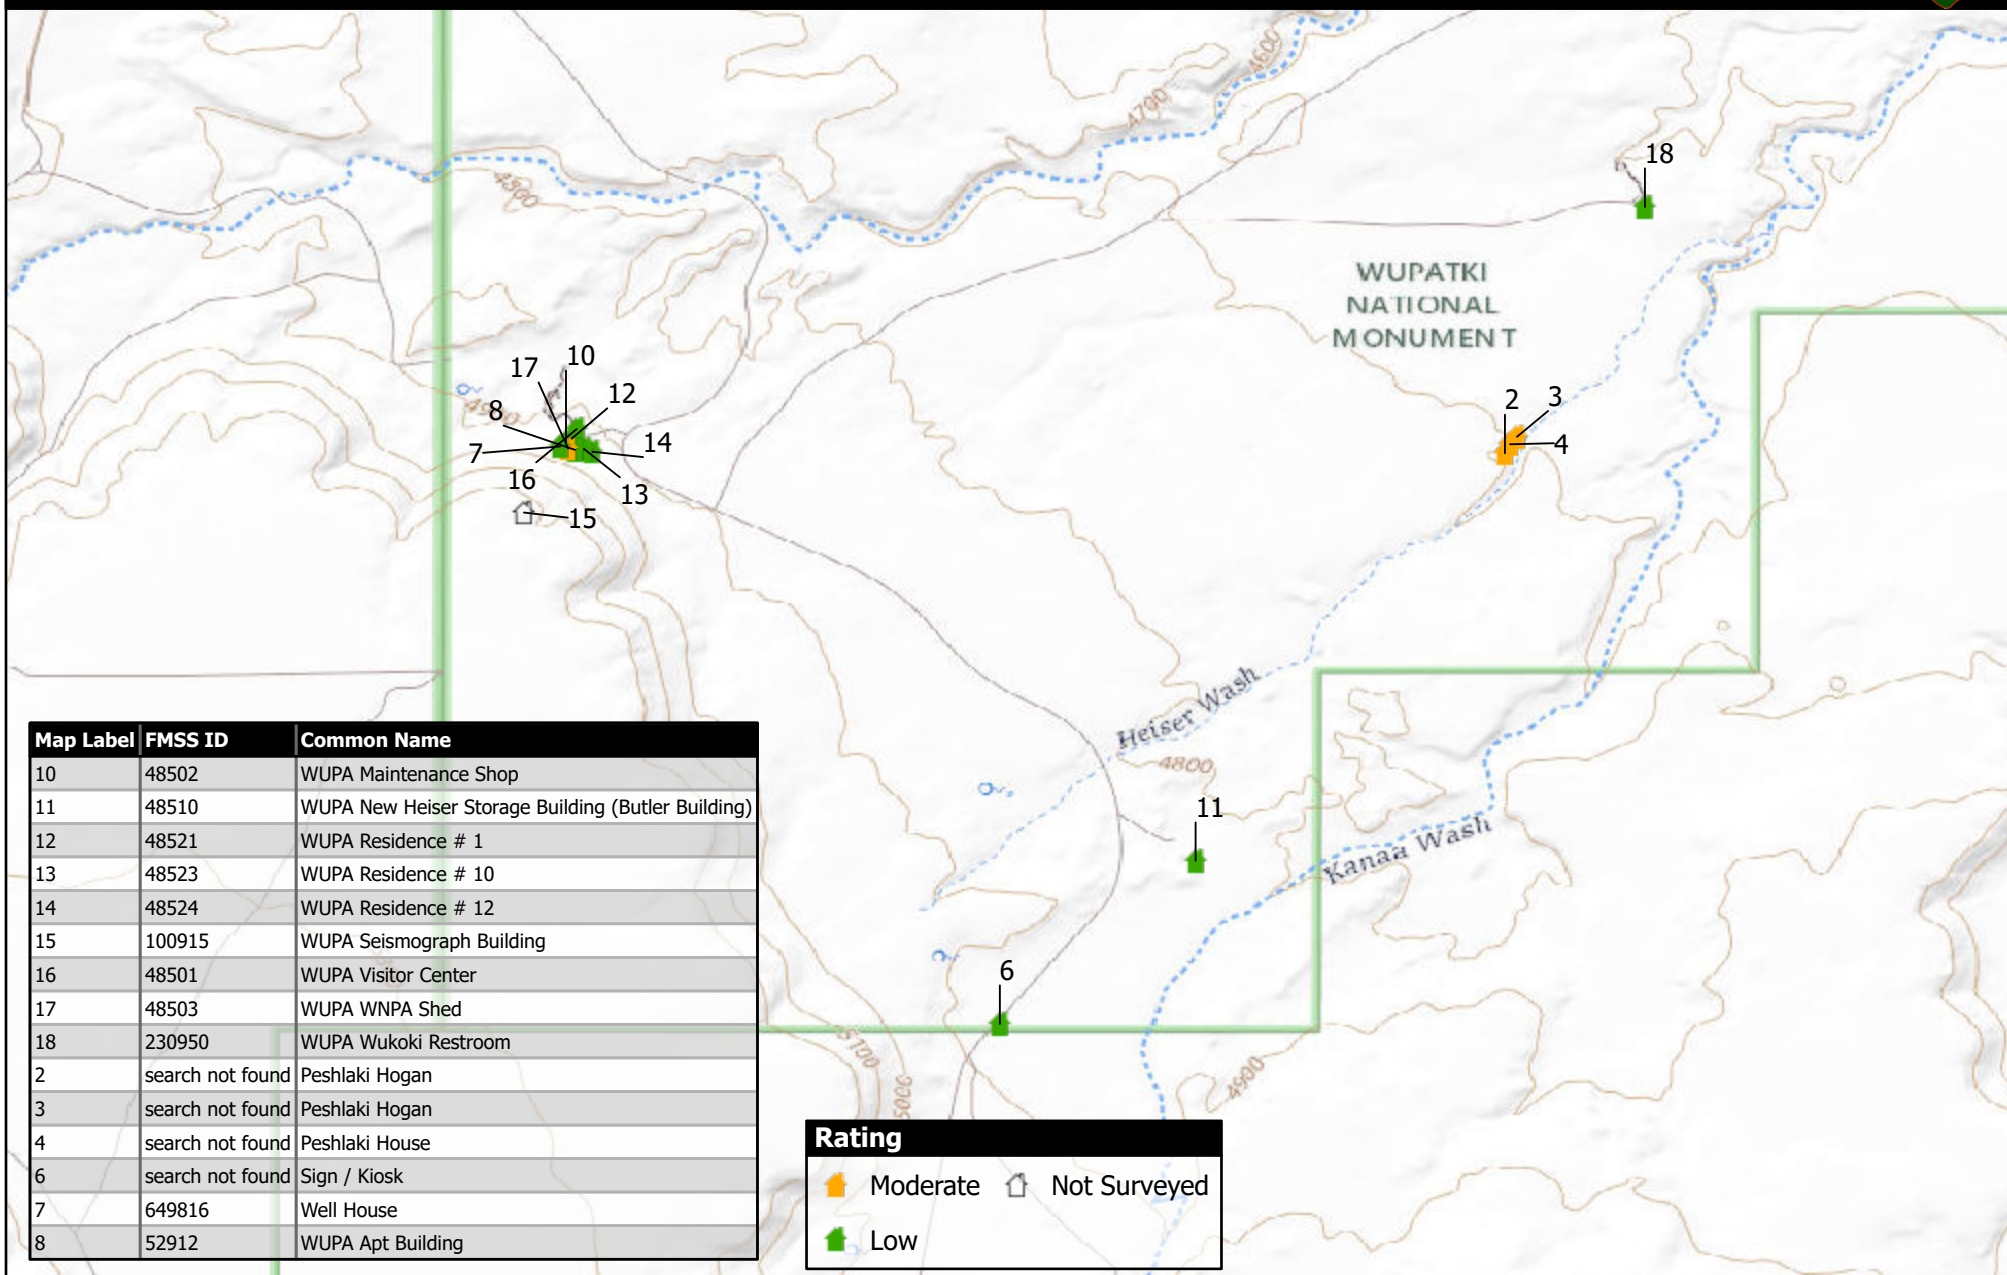

0

2

Miles

Author: sszturm
1/27/2022 3:07 PM

Intermountain Region Geographic Resources Division

December 2020

Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WUPA - Wupatki

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
1	Kiosk / Entrance Sign	NPS	search not found	Sign	Public	N	12/20/20	Unknown	62	Moderate	Not Designated		UNR
2	Peshlaki Hogan	Private	search not found	Building	Private	N	12/21/20	Unknown	62	Moderate	Not Designated		UNR
3	Peshlaki Hogan	Private	search not found	Building	Residence	N	12/21/20	Unknown	48	Moderate	Not Designated		UNR
4	Peshlaki House	Private	search not found	Building	Residence	Y	12/21/20	Unknown	58	Moderate	Not Designated		UNR
5	Shelter	NPS	search not found	None Found	Public	N	12/20/20	Unknown	86	None	Not Designated		UNR
6	Sign / Kiosk	NPS	search not found	Sign	Public	N	12/21/20	Unknown	39	Low	Not Designated		UNR
7	Well House	NPS	649816	Building	Admin	N	12/21/20	Unknown	41	Low	Not Designated		UNR
8	WUPA Apt Building	NPS	52912	Building	Residence	Y	12/21/20	Unknown	26	Low	Not Designated		UNR
9	WUPA Lomaki Restroom	NPS	48508	Toilet	Public	N	12/20/20	Unknown	47	Moderate	Not Designated		UNR
10	WUPA Maintenance Shop	NPS	48502	Building	Admin	Y	12/21/20	Unknown	27	Low	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WUPA - Wupatki

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
11	WUPA New Heiser Storage Building (Butler Building)	NPS	48510	Building	Admin	N	12/21/20	Unknown	30	Low	Not Designated		UNR
12	WUPA Residence # 1	NPS	48521	Building	Residence	Y	12/21/20	Unknown	40	Low	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
13	WUPA Residence # 10	NPS	48523	Building	Residence	Y	12/21/20	Unknown	35	Low	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
14	WUPA Residence # 12	NPS	48524	Building	Residence	Y	12/21/20	Unknown	33	Low	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: WUPA - Wupatki

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
15	WUPA Seismograph Building	NPS	100915	Building	Other	N		Unknown		Not Surveyed	Not Designated		UNR
16	WUPA Visitor Center	NPS	48501	Building	Public	Y	12/20/20	Unknown	36	Low	Not Designated	Spatial data comes from the FRPP section of FMSS. Each point was verified for positional accuracy.	UNR
17	WUPA WNPA Shed	NPS	48503	Building	Admin	N	12/21/20	Unknown	45	Moderate	Not Designated		UNR
18	WUPA Wukoki Restroom	NPS	230950	Toilet	Public	N	12/21/20	Unknown	34	Low	Not Designated		UNR



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: WUPA - Wupatki

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours
1	Kiosk / Entrance Sign	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		0.5
3	Peshlaki Hogan	Individual Facility	Initial	0			
		Individual Facility	Initial	0			
4	Peshlaki House	Individual Facility	Initial	0			
5	Shelter	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		1.0
		Individual Facility	Initial	1	Limb trees 6 to 15 feet above ground		1.0
6	Sign / Kiosk	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		0.5
7	Well House	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

8	WUPA Apt Building	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		1.0
		Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		4.0
9	WUPA Lomaki Restroom	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		1.0
		Individual Facility	Initial	1	Limb trees 6 to 15 feet above ground		1.0
10	WUPA Maintenance Shop	Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		2.0
11	WUPA New Heiser Storage Building (Butler Building)	Individual Facility	Initial	2	Remove dead or dying component of shrubs and trees		6.0
12	WUPA Residence # 1	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		3.0
13	WUPA Residence # 10	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		1.0



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

13	WUPA Residence # 10	Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		1.0
14	WUPA Residence # 12	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		2.0
		Individual Facility	Initial	2	Limb trees 6 to 15 feet above ground		1.0
15	WUPA Seismograph Building	Individual Facility					
16	WUPA Visitor Center	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings		3.0
		Individual Facility	Initial	1	Limb trees 6 to 15 feet above ground		1.0
		Individual Facility	Initial	1	Remove dead or dying component of shrubs and trees		4.0
17	WUPA WNPA Shed	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		1.0
18	WUPA Wukoki Restroom	Individual Facility	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed		1.0



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: Wupatki National Monument - Wupatki

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
Kiosk / Entrance Sign	Individual Facility	Standalone	Other, please describe. - sign made of stone, light fuels surrounding. no tactics necessary		-	
Peshlaki Hogan	Individual Facility	PrepLeave	Fuels reduction - structure is mostly surrounded by natural rock barriers. some brushing in zone 2-3 would provide extra buffer	2.0	-	
			-		-	
Peshlaki Hogan	Individual Facility	Standalone	Fuels reduction - structure is mostly surrounded by natural rock barriers. some brushing in zone 2-3 would provide extra buffer	1.0	-	
Peshlaki House	Individual Facility	PrepLeave	-		-	
			Fuels reduction - structure is mostly surrounded by natural rock barriers. some brushing in zone 2-3 would provide extra buffer	2.0	-	
Shelter	Individual Facility		Engine on scene - 1 x T6		-	
			Handline -	2.0	-	
Sign / Kiosk	Individual Facility	Standalone	Other, please describe. - None necessary. Sign posts are made of rock and the sign is surrounded by patchy fuels separated by sand.		-	
			-		-	
Well House	Individual Facility	PrepLeave	Engine on scene -		-	
			Fuels reduction -	2.0	-	
WUPA Apt Building	Individual Facility	PrepHold	Engine on scene -		-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
WUPA Apt Building	Individual Facility	PrepHold	Fuels reduction -	2.0	-	
			-		-	
WUPA Lomaki Restroom	Individual Facility	Standalone	Other, please describe. - concrete structure with light fuel load. no tactic necessary		-	
			-		-	
			-		-	
WUPA Maintenance Shop	Individual Facility	PrepHold	-		-	
			Engine on scene -		-	
			Fuels reduction -	2.0	-	
WUPA New Heiser Storage Building (Butler Building)	Individual Facility	PrepHold	Fuels reduction -	8.0	-	
			Install sprinkler system -	6.0	-	
WUPA Residence # 1	Individual Facility	PrepHold	Engine on scene -		-	
			Fuels reduction -	4.0	-	
			-		-	
WUPA Residence # 10	Individual Facility	PrepHold	Engine on scene -		-	
			-		-	
			Fuels reduction -	2.0	-	
WUPA Residence # 12	Individual Facility	PrepHold	Fuels reduction -	1.0	-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
WUPA Residence # 12	Individual Facility	PrepHold	Engine on scene -		-	
			-		-	
WUPA Seismograph Building	Individual Facility		-		-	
WUPA Visitor Center	Individual Facility	PrepHold	Fuels reduction -	10.0	-	
			Engine on scene -		-	
WUPA WNPA Shed	Individual Facility	PrepLeave	Engine on scene -		-	
			Fuels reduction -	2.0	-	
WUPA Wukoki Restroom	Individual Facility	Standalone	Other, please describe. - no tactics necessary. light fuel load surrounding concrete building		-	
			-		-	



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Kiosk / Entrance Sign


Unit - Location: WUPA - Wupatki
FMSS ID: search not found
Structure Type: Sign
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/20/2020

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 34.4723' **Long(WGS84):** -111° 31.7957'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Combustible or no roof
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





2020_WUPA_search not found _Kiosk / Entrance Sign_Z.jpg

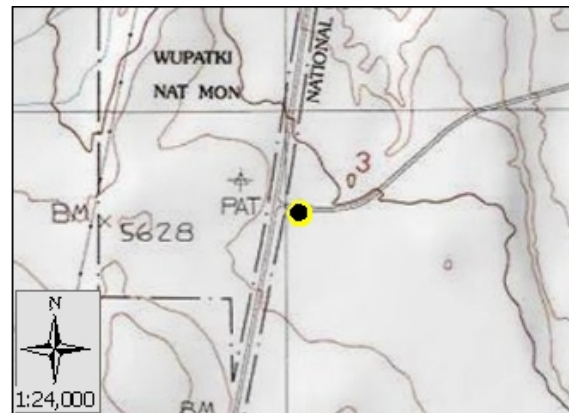


Score: 62
Rating: Moderate

Asset Priority Index (API):
N/A

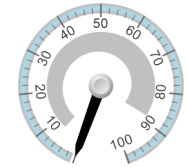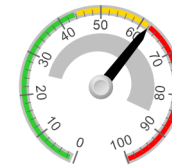

Factors Driving the Ratings

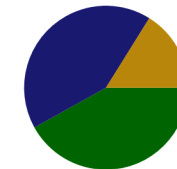

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Peshlaki Hogan

Unit - Location: WUPA - Wupatki
FMSS ID: search not found
Structure Type: Building
Structure Use: Private
Owner: Private
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.1587' **Long(WGS84):** -111° 20.051'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Other than all season
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: >100ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Combustible or no roof
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2020_WUPA_search not found _Peshlaki Hogan_Z.jpg

Score: 62
Rating: Moderate
Asset Priority Index (API):
N/A

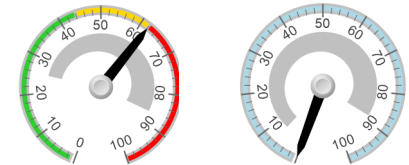

Factors Driving the Ratings

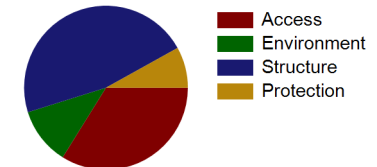

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Peshlaki Hogan

Unit - Location: WUPA - Wupatki
FMSS ID: search not found
Structure Type: Building
Structure Use: Residence
Owner: Private
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.1989' **Long(WGS84):** -111° 20.0214'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Other than all season
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Vinyl
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2020_WUPA_search not found _Peshlaki Hogan_Z.jpg

Score: 48
Rating: Moderate
Asset Priority Index (API):
N/A

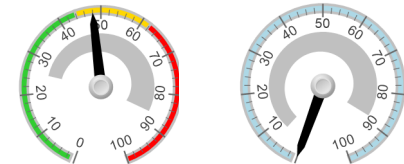

Factors Driving the Ratings

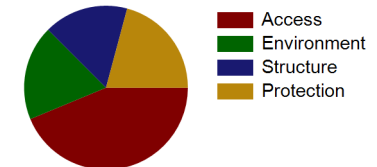

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Peshlaki House

Unit - Location: WUPA - Wupatki
FMSS ID: search not found
Structure Type: Building
Structure Use: Residence
Owner: Private
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.1806' **Long(WGS84):** -111° 20.0382'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Other than all season
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: >100ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Combination of fire resitant and combustible
Siding Material: Vinyl
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





2020_WUPA_search not found _Peshlaki House_Z.jpg



Score: 58
Rating: Moderate
Asset Priority Index (API):
N/A

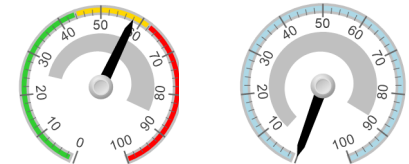

Factors Driving the Ratings

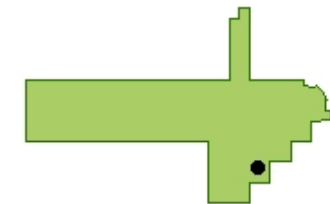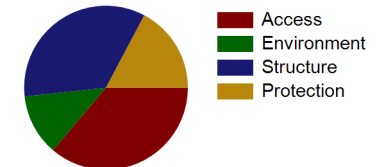

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Shelter

Unit - Location: WUPA - Wupatki
FMSS ID: search not found
Structure Type: None Found
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/20/2020


Rating: None
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 34.6103' **Long(WGS84):** -111° 28.159'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: No defensible space
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



WUPA--Shelter-Front.jpg


Score: 86
Rating: None

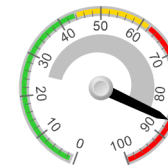


Asset Priority Index (API):
N/A




Factors Driving the Ratings

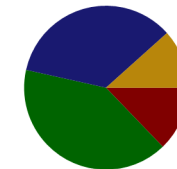

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

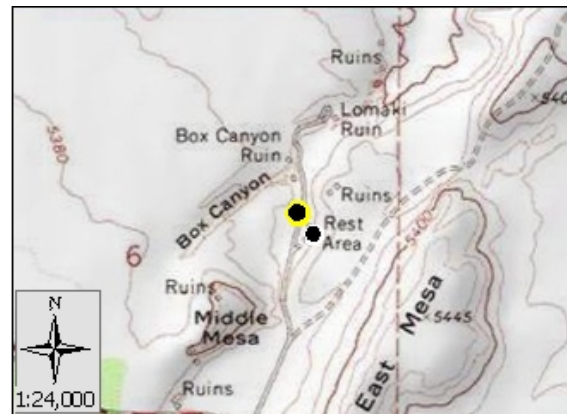

● Facility
 ■ NPS Boundary

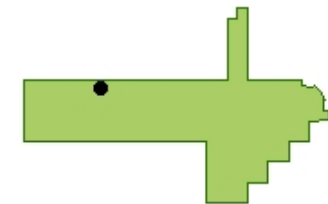



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Sign / Kiosk

Unit - Location: WUPA - Wupatki
FMSS ID: search not found
Structure Type: Sign
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 29.7752' **Long(WGS84):** -111° 21.2754'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_WUPA_search not found _Sign / Kiosk_Z.jpg



Score: 39
Rating: Low

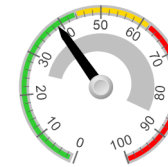

Asset Priority Index (API):
N/A



Factors Driving the Ratings

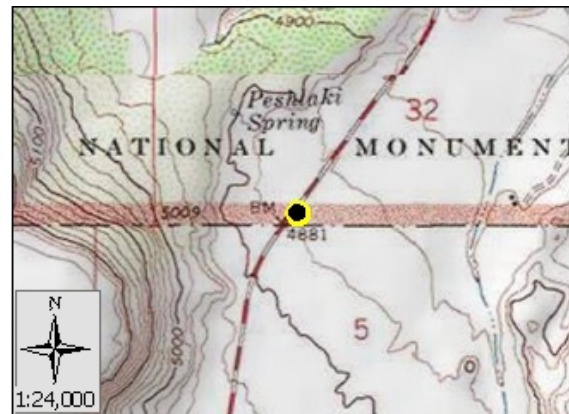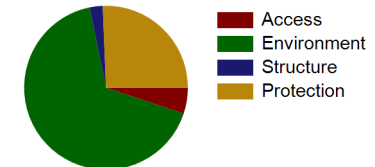

● Facility
 ■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Well House

Unit - Location: WUPA - Wupatki
FMSS ID: 649816
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.1756' **Long(WGS84):** -111° 22.3405'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_WUPA_649816_Well House_Z.jpg


Score: 41
Rating: Low

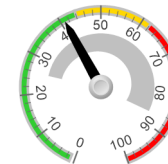


Asset Priority Index (API):
N/A




Factors Driving the Ratings

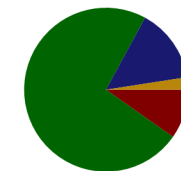

■ Access
■ Environment
■ Structure
■ Protection

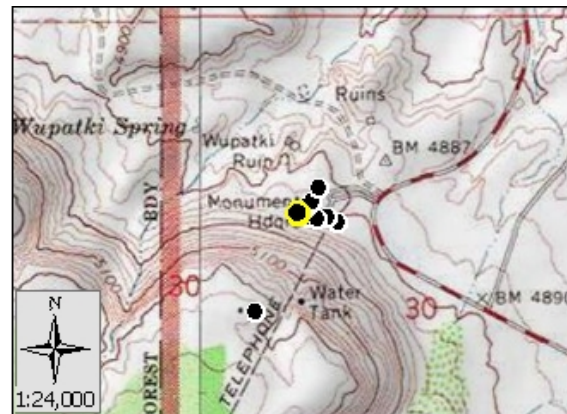

● Facility
■ NPS Boundary

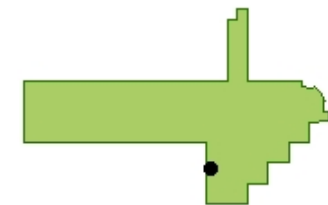



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Apt Building

Unit - Location: WUPA - Wupatki

FMSS ID: 52912

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/21/2020

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 31.1672' **Long(WGS84):** -111° 22.3053'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:




2020_WUPA_52912_WUPA Apt Building_Z.jpg


Score: 26
Rating: Low

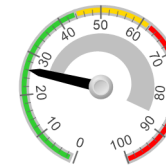


Asset Priority Index (API): 53

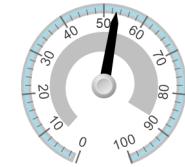

Factors Driving the Ratings

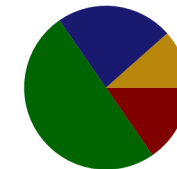

Access
Environment
Structure
Protection

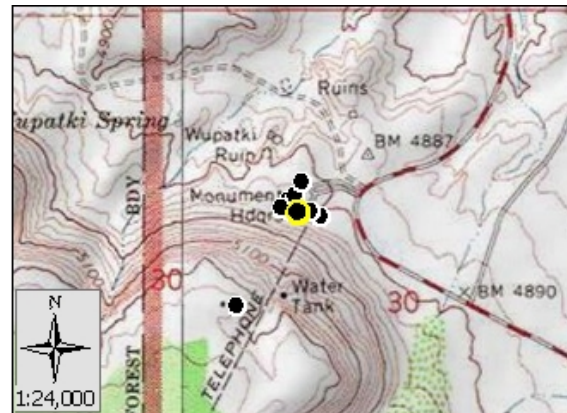



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Lomaki Restroom

Unit - Location: WUPA - Wupatki
FMSS ID: 48508
Structure Type: Toilet
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/20/2020


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local ID]
In a Community? No
Lat(WGS84): 35° 34.5759' **Long(WGS84):** -111° 28.1305'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:






2020_WUPA_48508_WUPA Lomaki Restroom_Z.jpg

Score: 47
Rating: Moderate
Asset Priority Index (API): 39

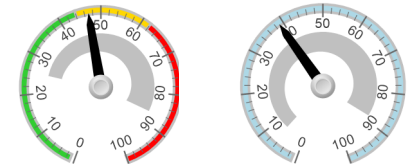

Factors Driving the Ratings

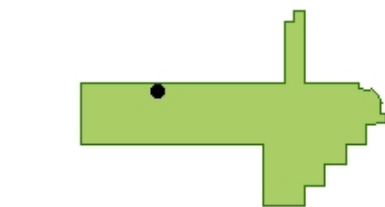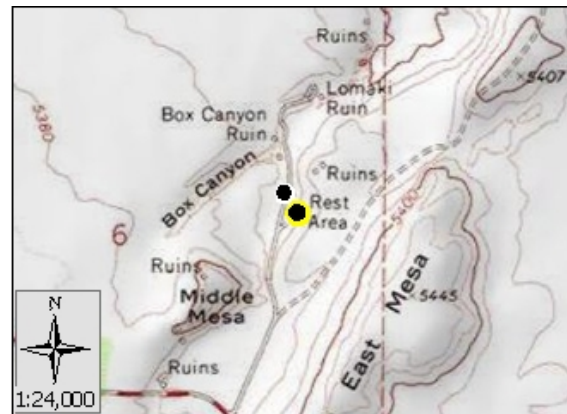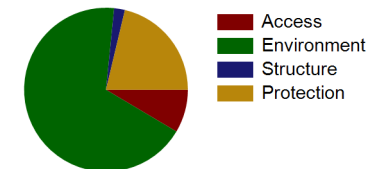

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Maintenance Shop

Unit - Location: WUPA - Wupatki
FMSS ID: 48502
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.1856' **Long(WGS84):** -111° 22.3267'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.




2020_WUPA_48502_WUPA Maintenance Shop_Z.jpg


Score: 27
Rating: Low

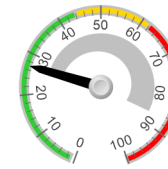



Asset Priority Index (API): 53

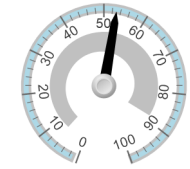

Factors Driving the Ratings

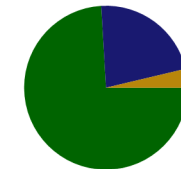

■ Access
■ Environment
■ Structure
■ Protection

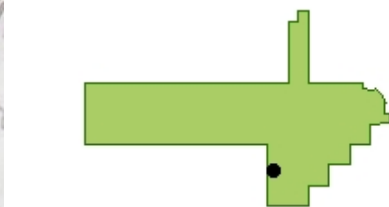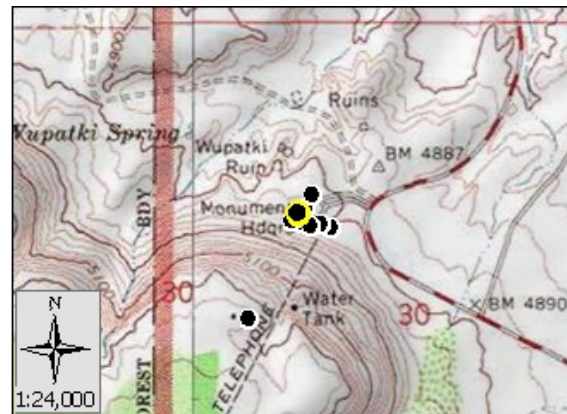

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA New Heiser Storage Building (Butler Building)

Unit - Location: WUPA - Wupatki

FMSS ID: 48510

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/21/2020

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 30.1705' Long(WGS84): -111° 20.8003'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2020_WUPA_48510_WUPA New Heiser Storage Building (Butler Building)_Front.jpg


Score: 30
Rating: Low

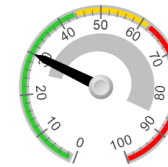


Asset Priority Index
(API):
7



Factors Driving the Ratings

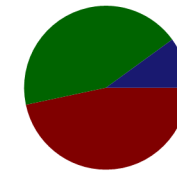

Access
Environment
Structure
Protection

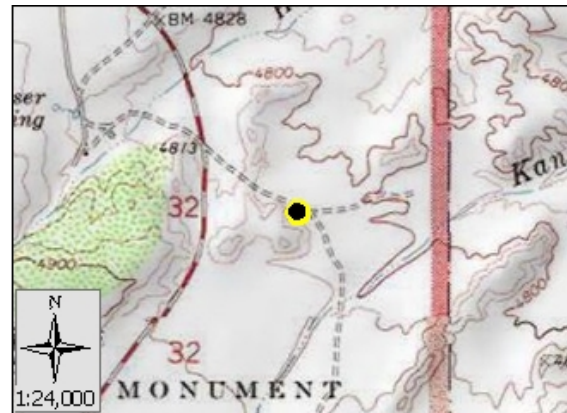

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Residence # 1

Unit - Location: WUPA - Wupatki

FMSS ID: 48521

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/21/2020

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 31.1939' Long(WGS84): -111° 22.3135'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments: Spatial data comes from the FRPP section of FMSS.

Each point was verified for positional accuracy.




2020_WUPA_48521_WUPA Residence # 1_Z.jpg


Score: 40
Rating: Low

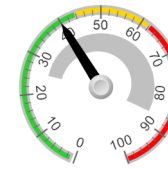



Asset Priority Index
(API):
40

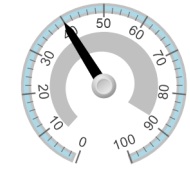

Factors Driving the Ratings

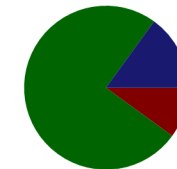

Access
Environment
Structure
Protection

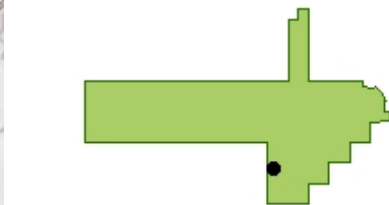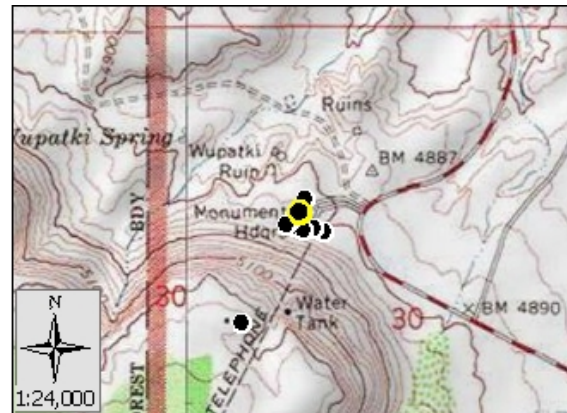

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Residence # 10

Unit - Location: WUPA - Wupatki

FMSS ID: 48523

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/21/2020

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 31.1693' Long(WGS84): -111° 22.2834'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: 5ft to 30ft from facility

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.




2020_WUPA_48523_WUPA Residence # 10_Z.jpg


Score: 35
Rating: Low

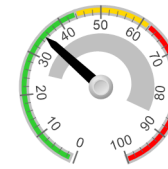


Asset Priority Index
(API):
46

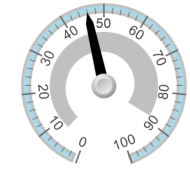

Factors Driving the Ratings

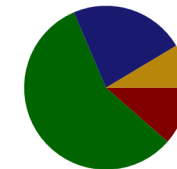

Access
Environment
Structure
Protection

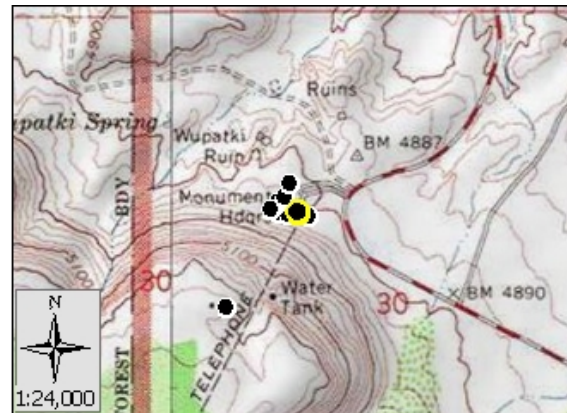



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Residence # 12

Unit - Location: WUPA - Wupatki

FMSS ID: 48524

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/21/2020

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 31.1627' **Long(WGS84):** -111° 22.2632'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Spatial data comes from the FRPP section of FMSS.
Each point was verified for positional accuracy.




2020_WUPA_48524_WUPA Residence # 12_Z.jpg


Score: 33
Rating: Low

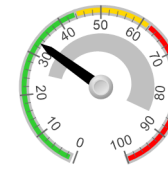


Asset Priority Index (API): 46

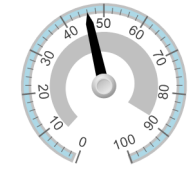

Factors Driving the Ratings

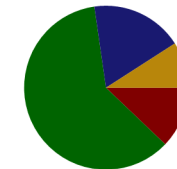

■ Access
■ Environment
■ Structure
■ Protection

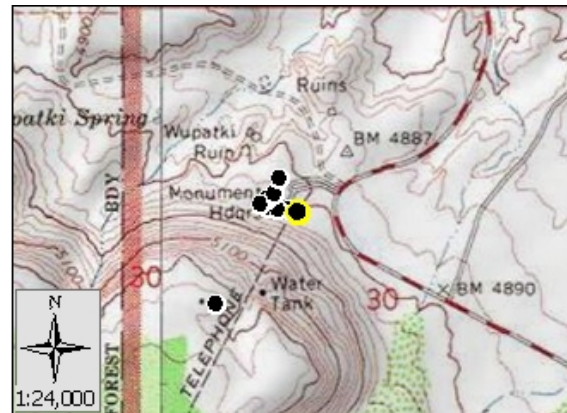

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>


Facility: WUPA Seismograph Building

Unit - Location: WUPA - Wupatki
FMSS ID: 100915
Structure Type: Building
Structure Use: Other
Owner: NPS
Field Crew:
Last Site Visit Date:



Rating: Not Surveyed
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.0152' Long(WGS84): -111° 22.4293'

Primary Access:
Ingress/Egress:
Access Width:
Access Condition:
Bridge Condition:
Access & Turnarounds:
Facility Number/Sign:
Defensible Space:
Fuel Load (w/in 300 ft):
Fuel Type (w/in 300ft):
Topography (w/in 300ft):
Roof Material:
Siding Material:
Foundation:
Fences/Decks:
Firewood:
Propane Tanks:
Water Supply:
Overhead Hazards:
Safety Zones:
Additional Obstacles:
Triage Category:
Hazmat:
Assessment Comments:

Score: Rating: Not Surveyed
Asset Priority Index (API): 19

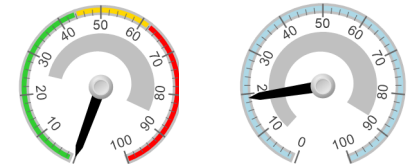

Factors Driving the Ratings

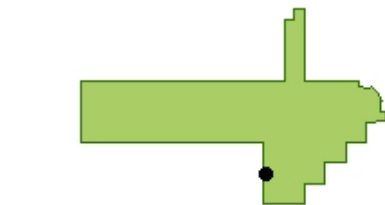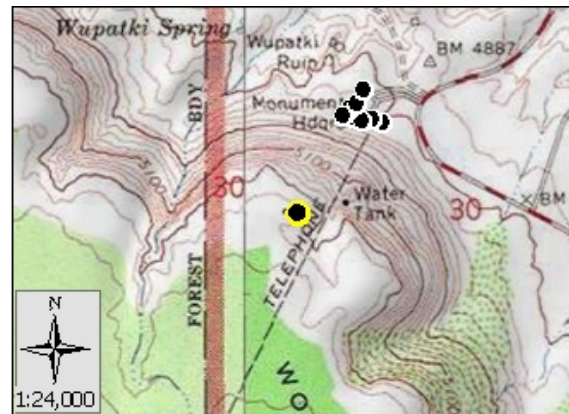

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Visitor Center

Unit - Location: WUPA - Wupatki

FMSS ID: 48501

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/20/2020

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 31.2172' Long(WGS84): -111° 22.301'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments: Spatial data comes from the FRPP section of FMSS.

Each point was verified for positional accuracy.




2020_WUPA_48501_WUPA Visitor Center_Z.jpg


Score: 36
Rating: Low

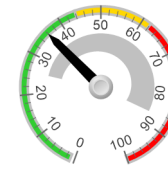


Asset Priority Index
(API):
88

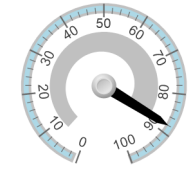

Factors Driving the Ratings

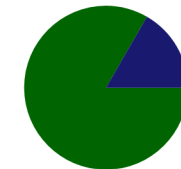

Access
Environment
Structure
Protection

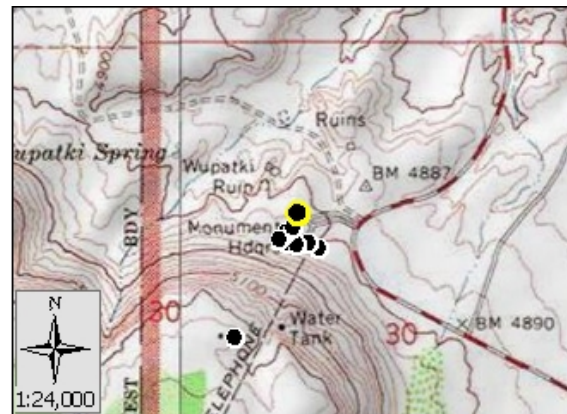

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA WNPA Shed

Unit - Location: WUPA - Wupatki

FMSS ID: 48503

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 12/21/2020

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 35° 31.1704' Long(WGS84): -111° 22.3218'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 2 lanes (>24ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2020_WUPA_48503_WUPA WNPA Shed_Front.jpg

Score: 45
Rating: Moderate


Asset Priority Index
(API):
7

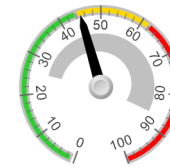

Factors Driving the Ratings

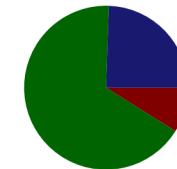

Access
Environment
Structure
Protection

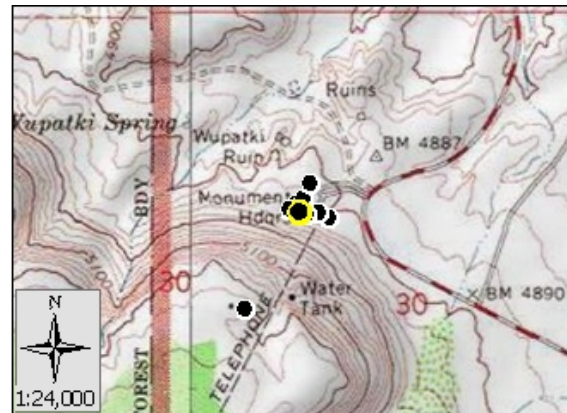



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: WUPA Wukoki Restroom

Unit - Location: WUPA - Wupatki
FMSS ID: 230950
Structure Type: Toilet
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 12/21/2020


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 35° 31.756' **Long(WGS84):** -111° 19.7112'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: No reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2020_WUPA_230950_WUPA Wukoki Restroom_Front.jpg


Score: 34
Rating: Low

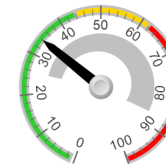


Asset Priority Index (API): 39

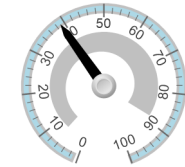

Factors Driving the Ratings

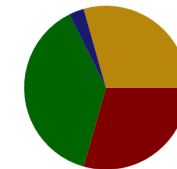

■ Access
 ■ Environment
 ■ Structure
 ■ Protection

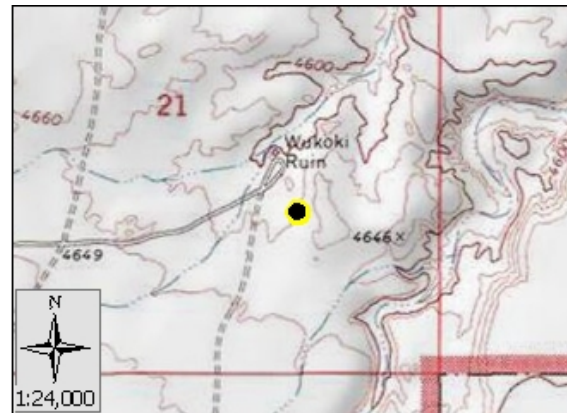

● Facility
 ■ NPS Boundary