
NPS Wildfire Risk Assessments
Assessment Locations

CANY - Canyonlands National Park - Overview

National Park Service
U.S. Department of the Interior

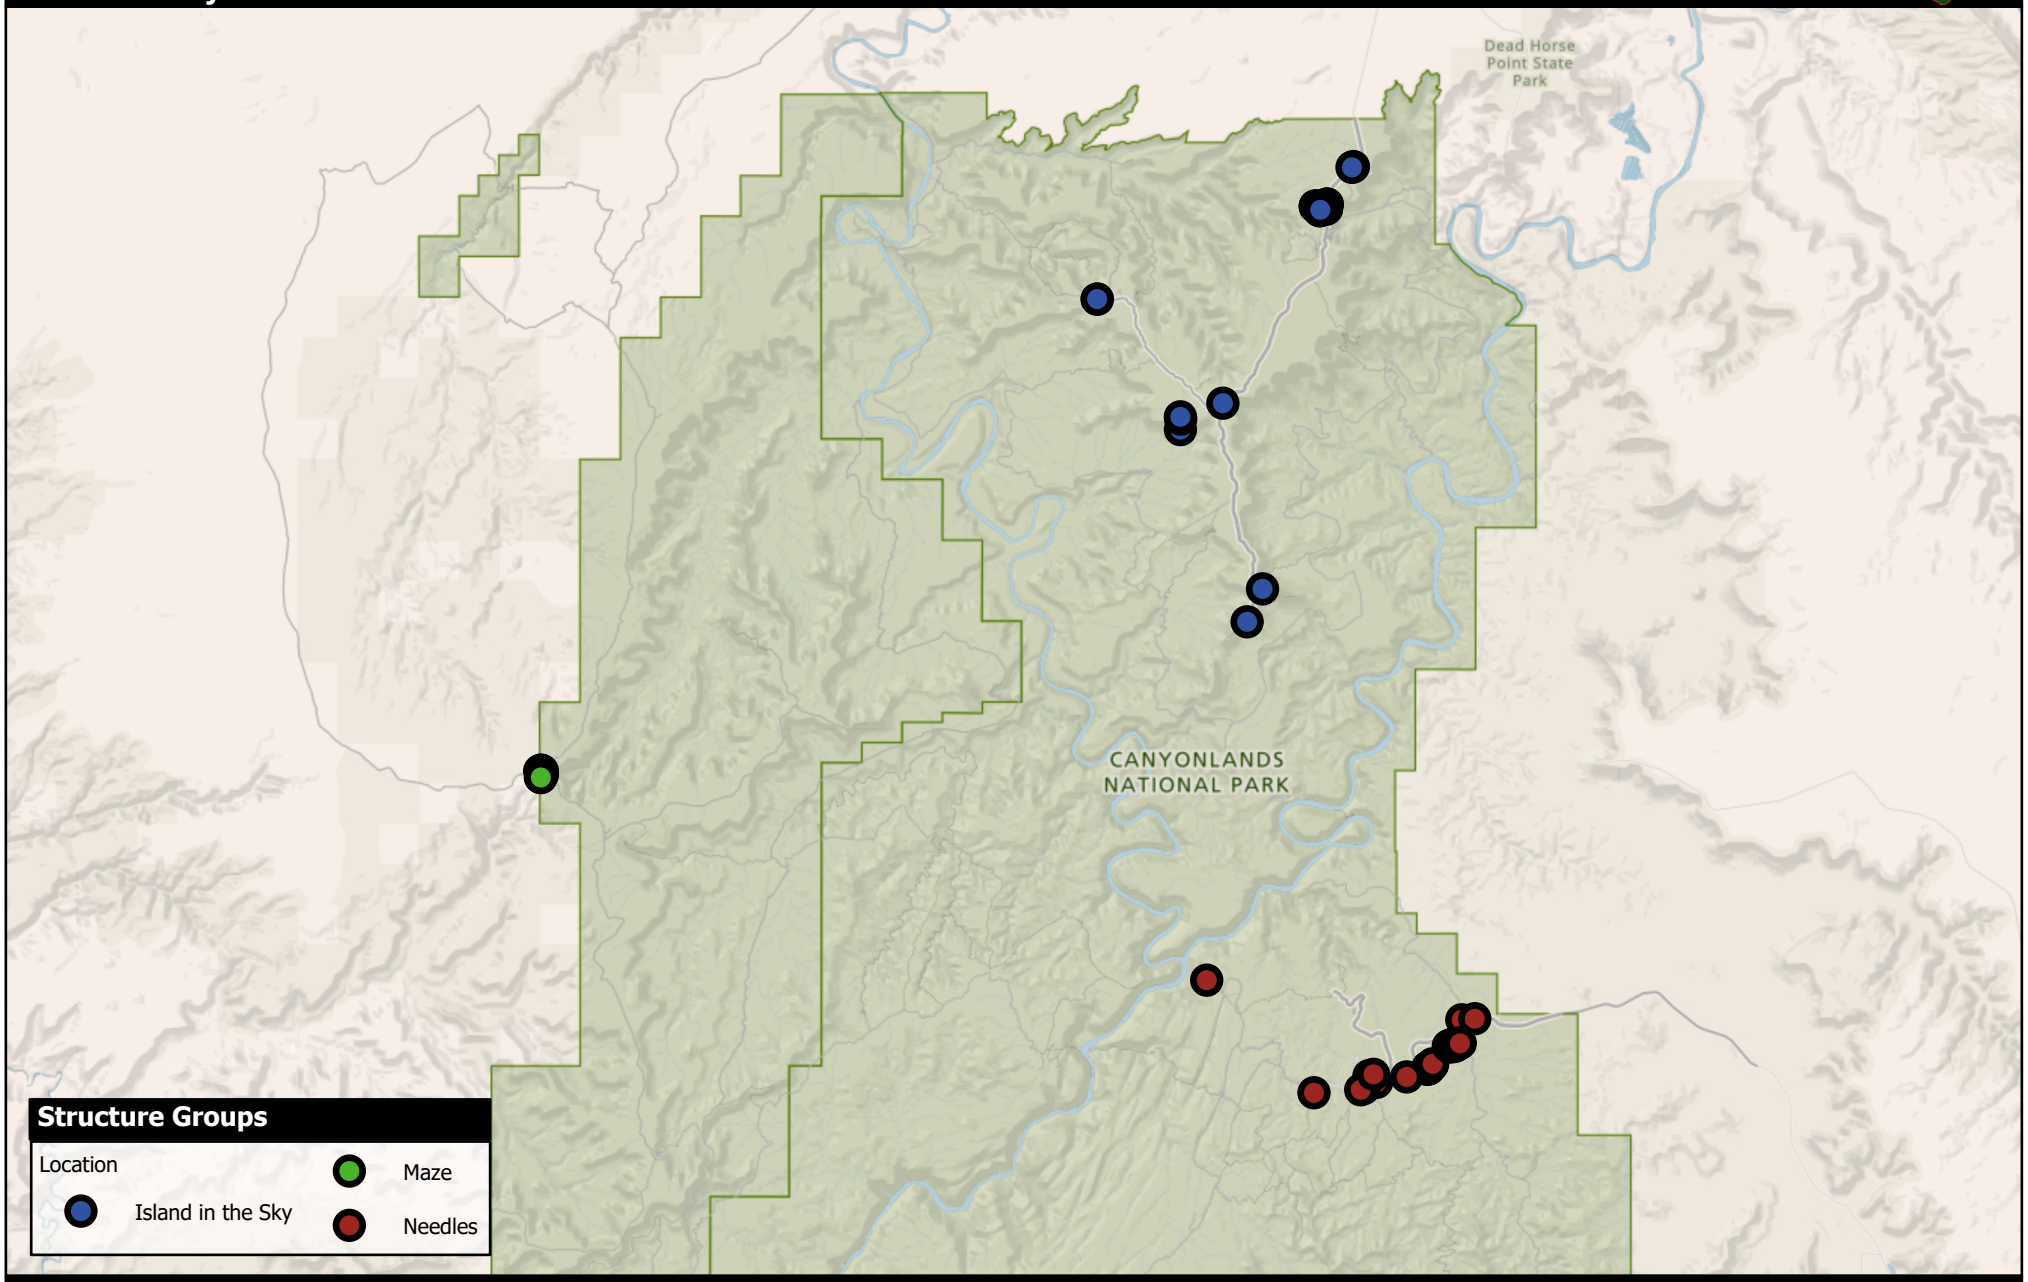

Structure Groups

Location
- Island in the Sky
- Maze
- Needles

N

0 18 36 Miles


Author: sszturm
11/4/2024 8:10 AM

NPS Wildfire Risk Assessments
NPS Fire GIS
November 2024
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessments
Assessment Locations

CANY - Needles - Overview

National Park Service
U.S. Department of the Interior

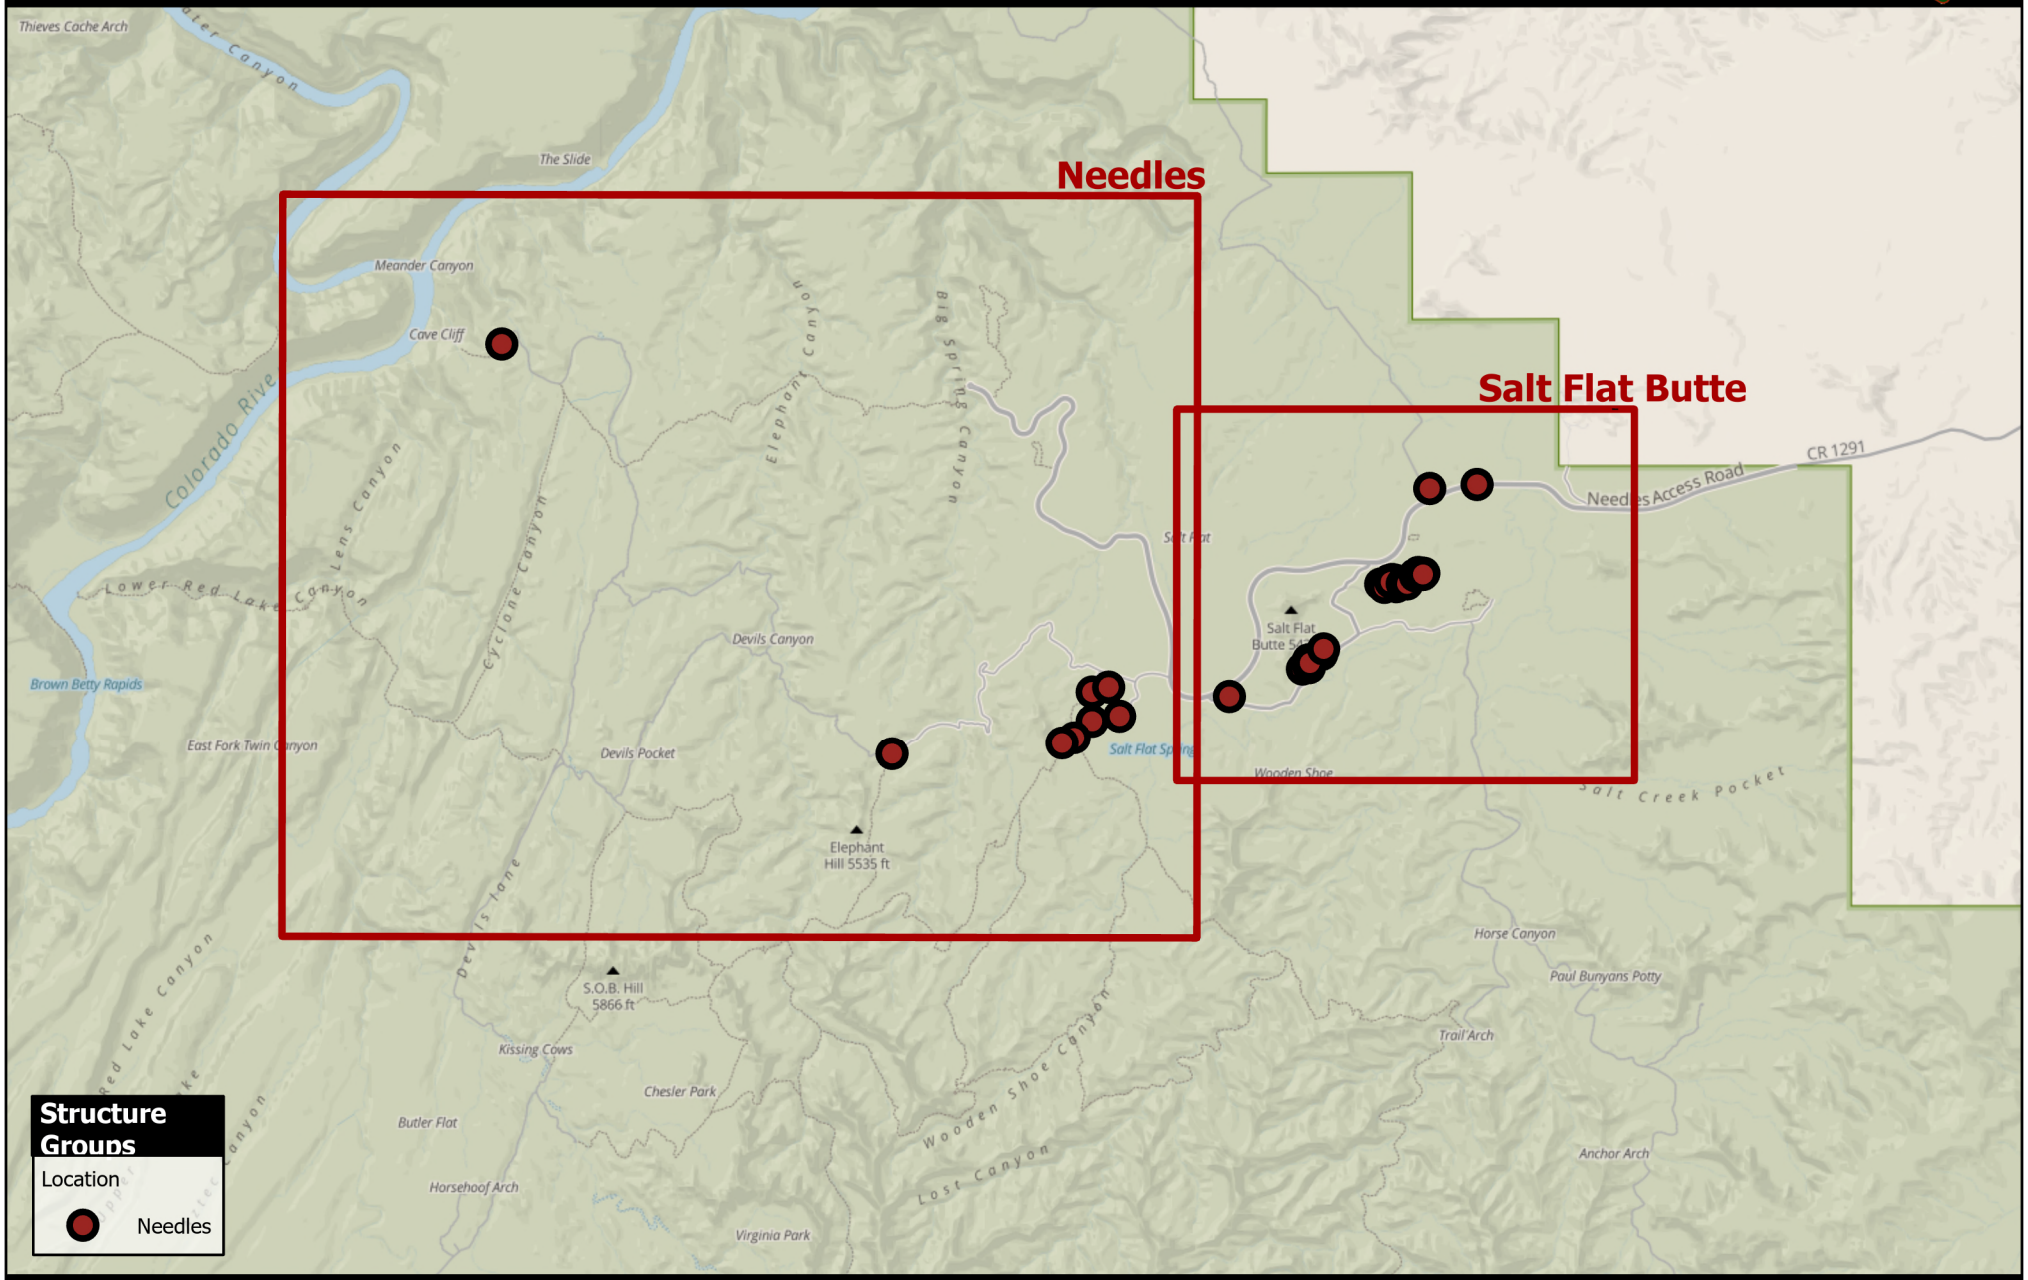

0 5 10 Miles

N

Author: sszturm
11/4/2024 9:38 AM


NPS Wildfire Risk Assessments
NPS Fire GIS
November 2024
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Needles

CANY - Canyonlands National Park

National Park Service
U.S. Department of the Interior

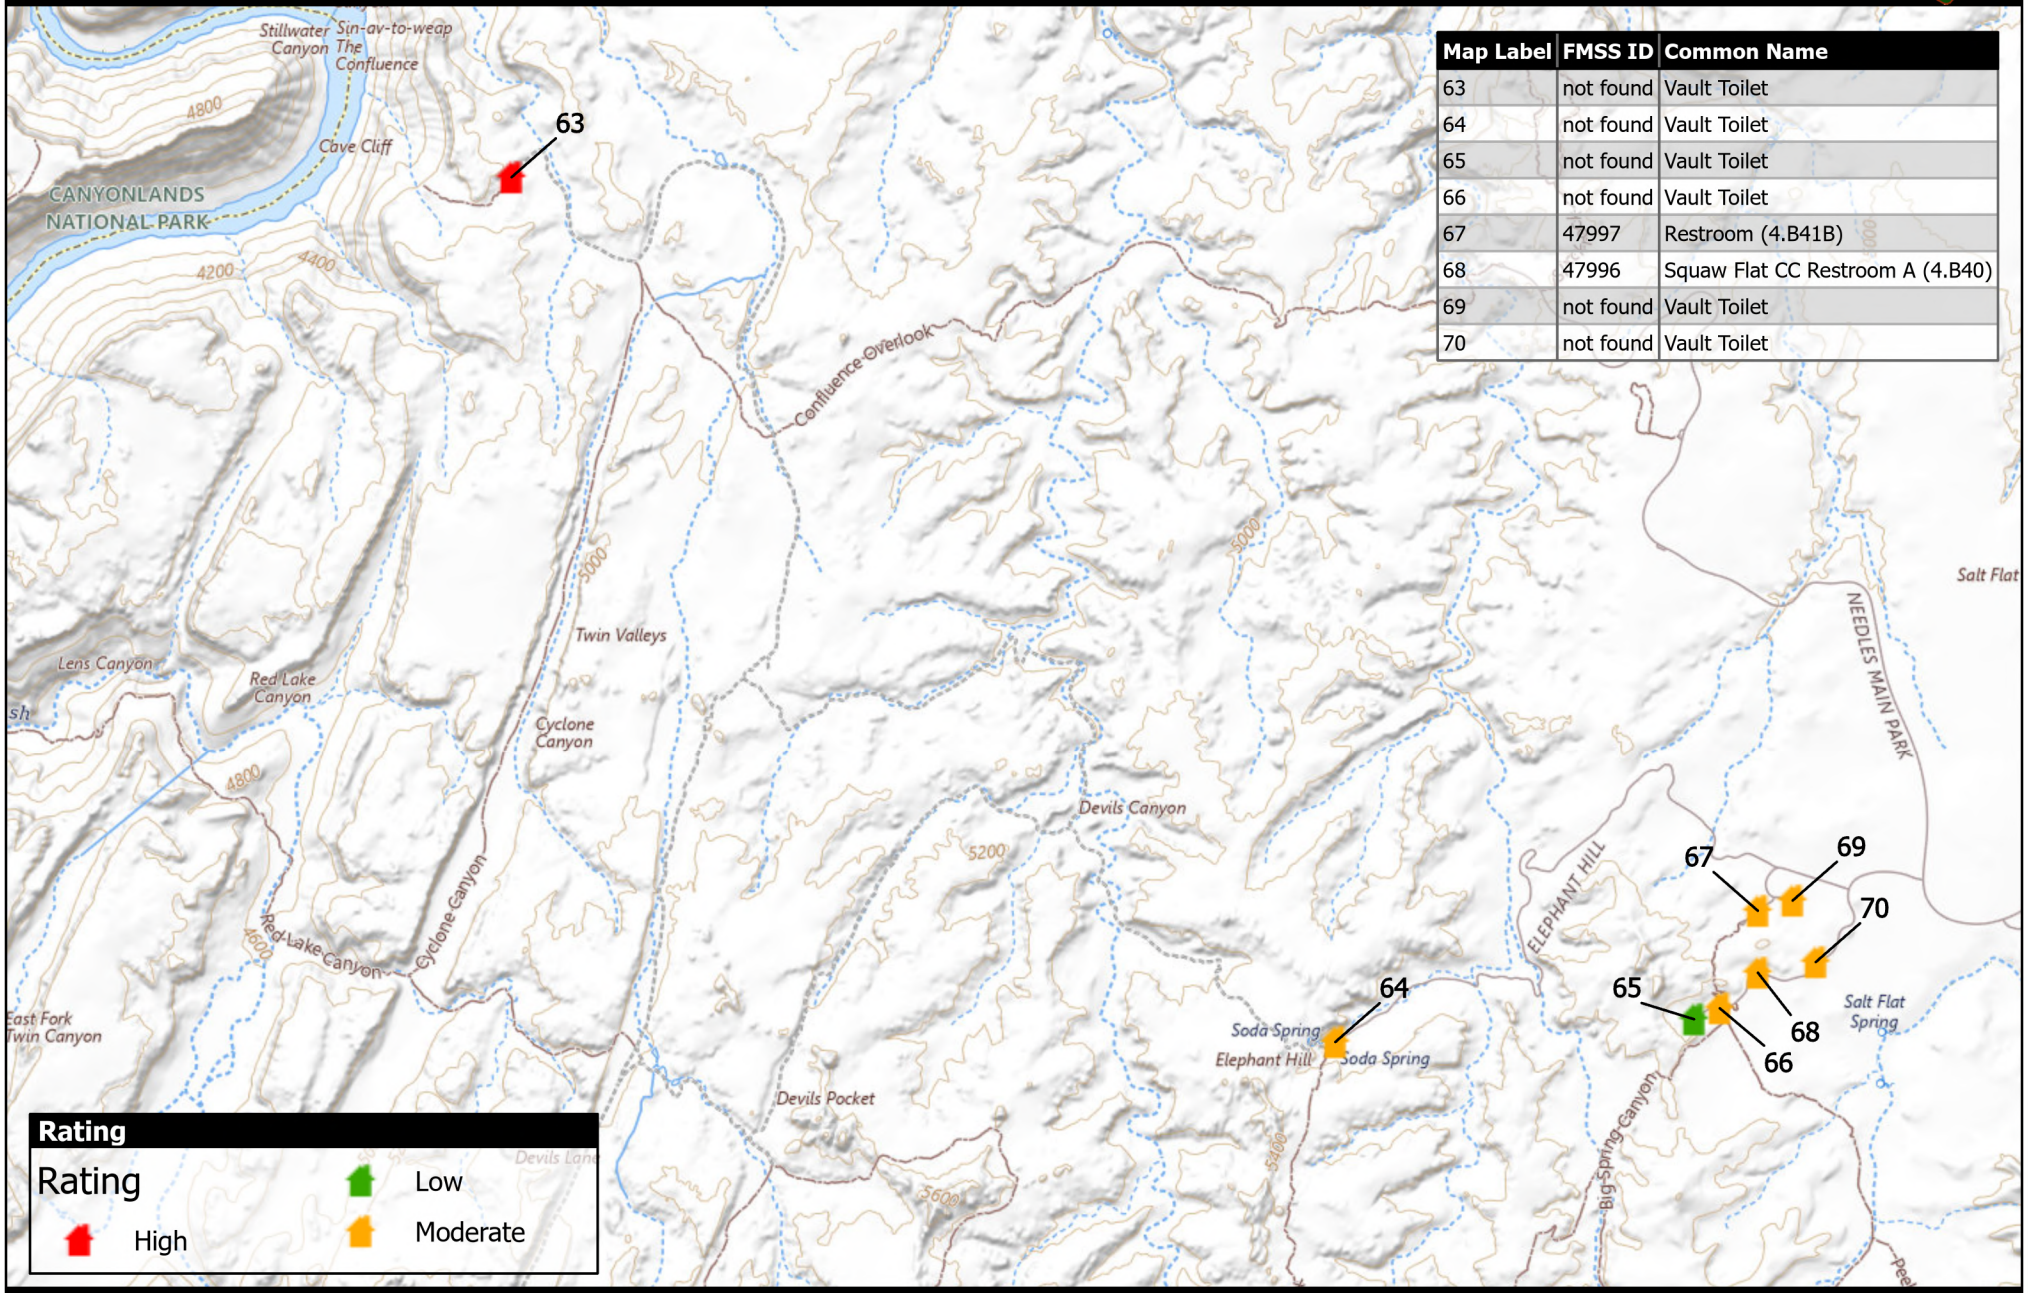

Map Label	FMSS ID	Common Name
63	not found	Vault Toilet
64	not found	Vault Toilet
65	not found	Vault Toilet
66	not found	Vault Toilet
67	47997	Restroom (4.B41B)
68	47996	Squaw Flat CC Restroom A (4.B40)
69	not found	Vault Toilet
70	not found	Vault Toilet

Rating

Rating

- High
- Low
- Moderate

N

Author: sszturm
11/4/2024 9:07 AM


0 4 Miles

NPS Wildfire Risk Assessments
NPS Fire GIS
November 2024
Data Sources: ESRI Basedata, NPS

Salt Flat Butte

GLCA - Glen Canyon National Recreation Area

National Park Service
U.S. Department of the Interior

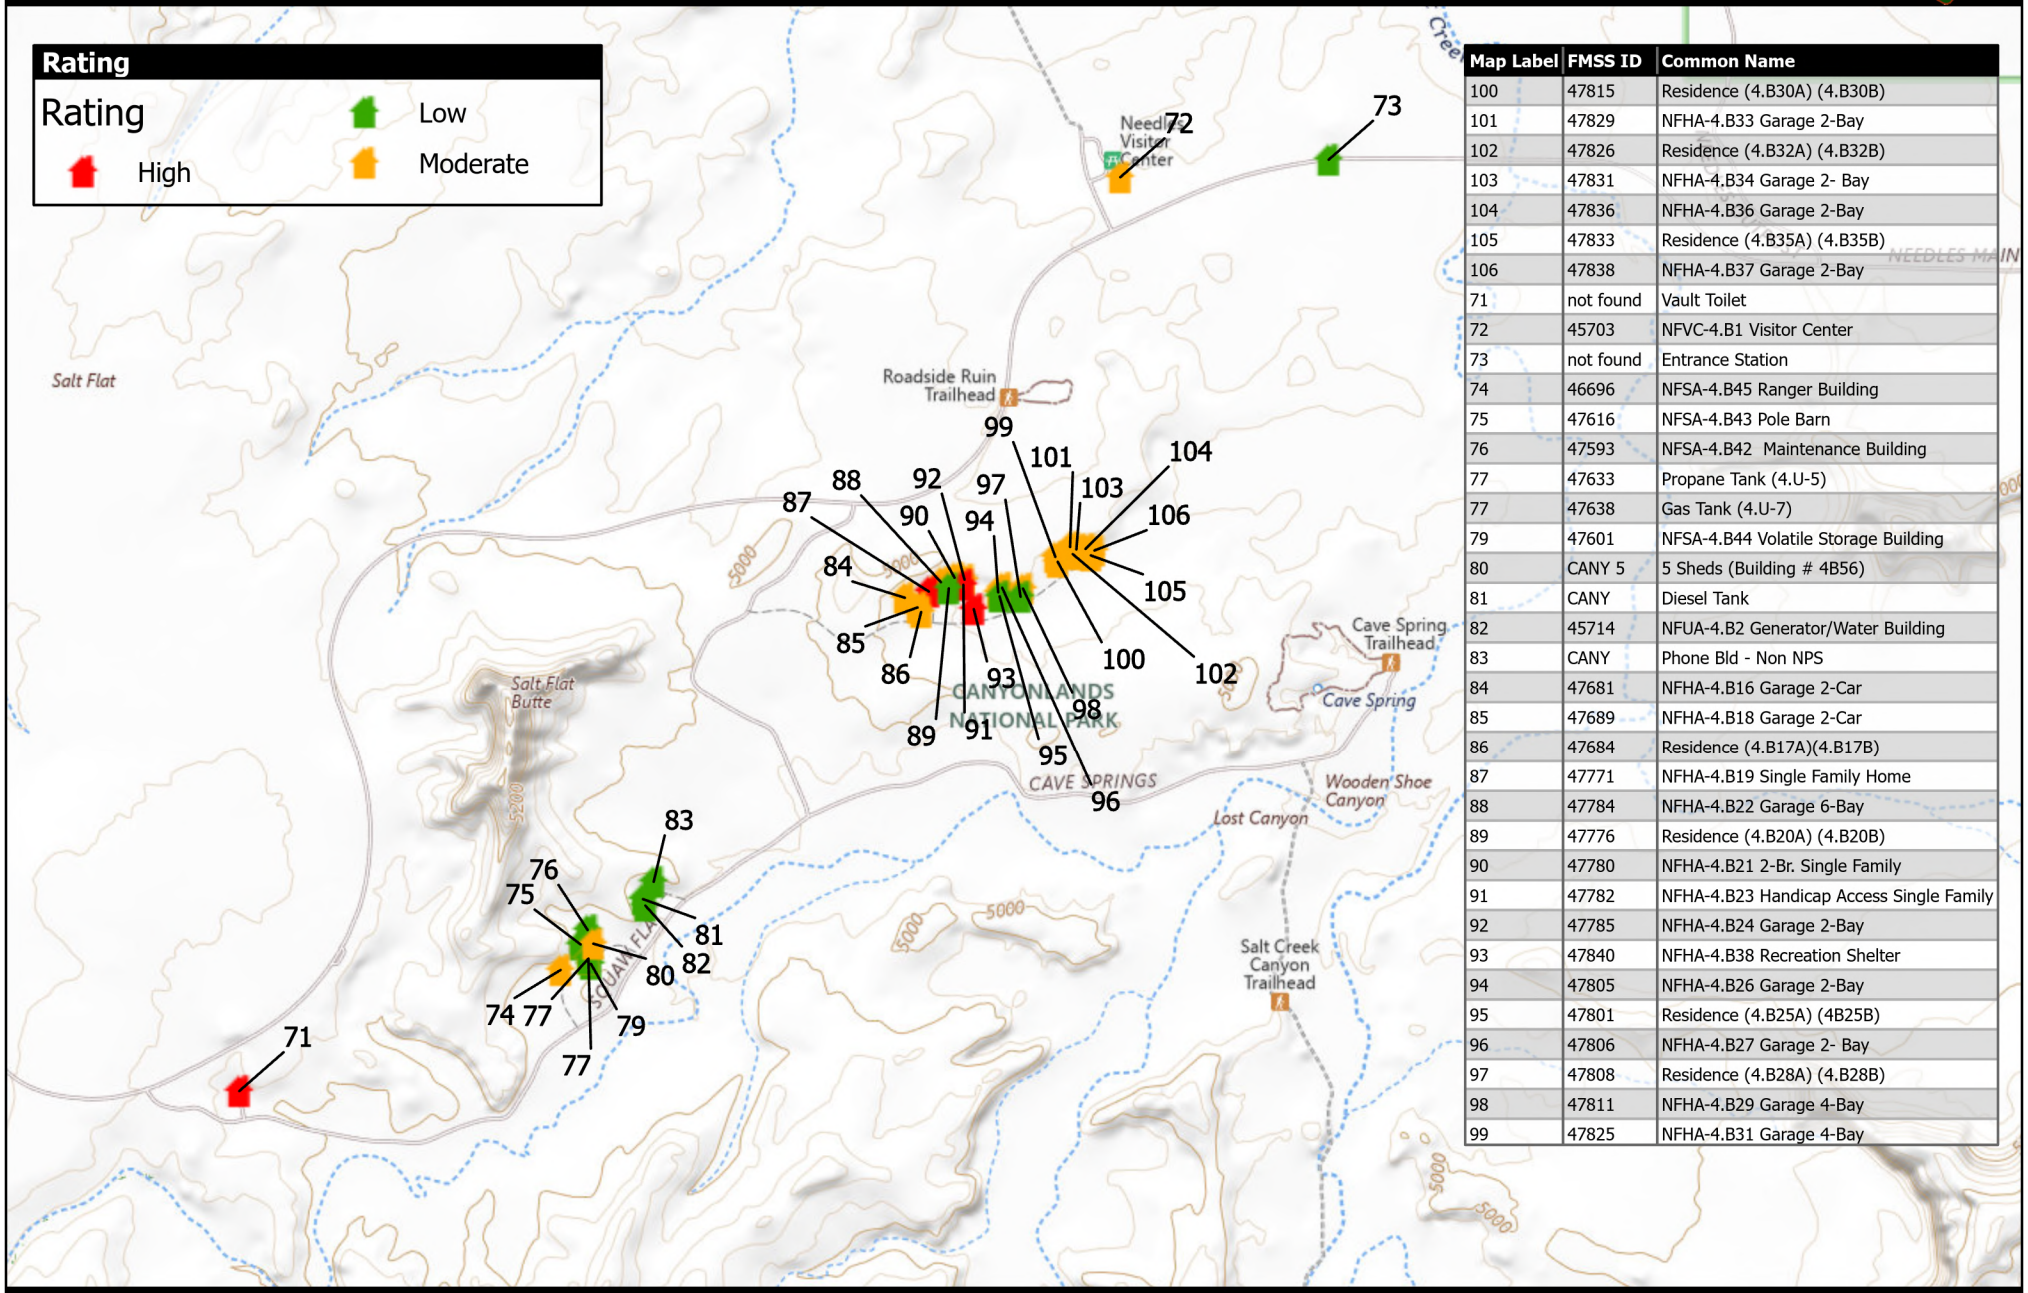

Map Label	FMSS ID	Common Name
100	47815	Residence (4.B30A) (4.B30B)
101	47829	NFHA-4.B33 Garage 2-Bay
102	47826	Residence (4.B32A) (4.B32B)
103	47831	NFHA-4.B34 Garage 2- Bay
104	47836	NFHA-4.B36 Garage 2-Bay
105	47833	Residence (4.B35A) (4.B35B)
106	47838	NFHA-4.B37 Garage 2-Bay
71	not found	Vault Toilet
72	45703	NFVC-4.B1 Visitor Center
73	not found	Entrance Station
74	46696	NFSA-4.B45 Ranger Building
75	47616	NFSA-4.B43 Pole Barn
76	47593	NFSA-4.B42 Maintenance Building
77	47633	Propane Tank (4.U-5)
77	47638	Gas Tank (4.U-7)
79	47601	NFSA-4.B44 Volatile Storage Building
80	CANY 5	5 Sheds (Building # 4B56)
81	CANY	Diesel Tank
82	45714	NFUA-4.B2 Generator/Water Building
83	CANY	Phone Bld - Non NPS
84	47681	NFHA-4.B16 Garage 2-Car
85	47689	NFHA-4.B18 Garage 2-Car
86	47684	Residence (4.B17A)(4.B17B)
87	47771	NFHA-4.B19 Single Family Home
88	47784	NFHA-4.B22 Garage 6-Bay
89	47776	Residence (4.B20A) (4.B20B)
90	47780	NFHA-4.B21 2-Br. Single Family
91	47782	NFHA-4.B23 Handicap Access Single Family
92	47785	NFHA-4.B24 Garage 2-Bay
93	47840	NFHA-4.B38 Recreation Shelter
94	47805	NFHA-4.B26 Garage 2-Bay
95	47801	Residence (4.B25A) (4B25B)
96	47806	NFHA-4.B27 Garage 2- Bay
97	47808	Residence (4.B28A) (4.B28B)
98	47811	NFHA-4.B29 Garage 4-Bay
99	47825	NFHA-4.B31 Garage 4-Bay

N

Author: sszturm
11/4/2024 9:43 AM

0 0.25 0.5 0.75 1 Miles

Scale: 1:24,000

NPS Wildfire Risk Assessments
NPS Fire GIS
November 2024
Data Sources: ESRI Basedata, NPS

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B33 Garage 2-Bay
Unit - Location: CANY - Needles
FMSS ID: 47829, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.58965078' N 109° 45.64911948' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 101

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



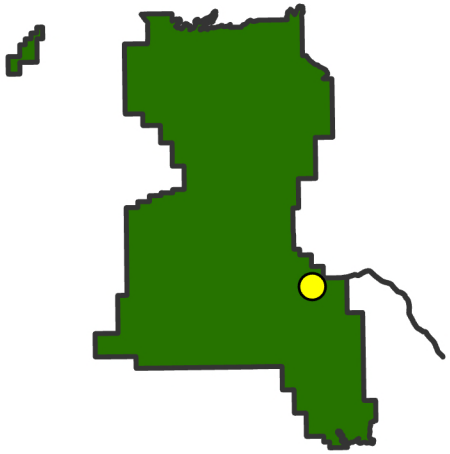

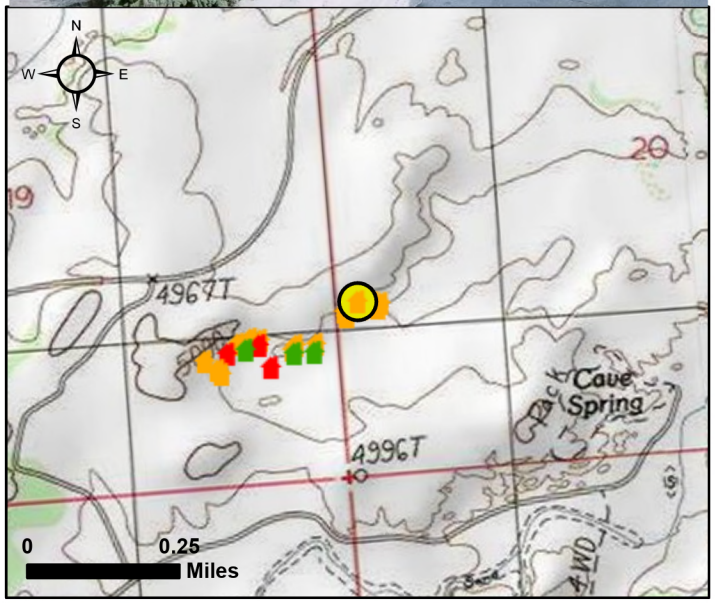

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B34 Garage 2- Bay
Unit - Location: CANY - Needles
FMSS ID: 47831, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.58622886' N 109° 45.63829746' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 103

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: Adjacent to/under deck of facility
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



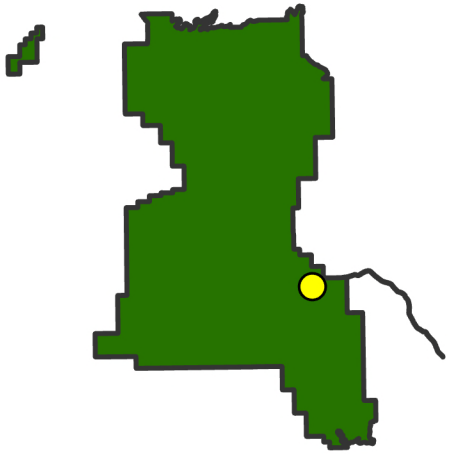

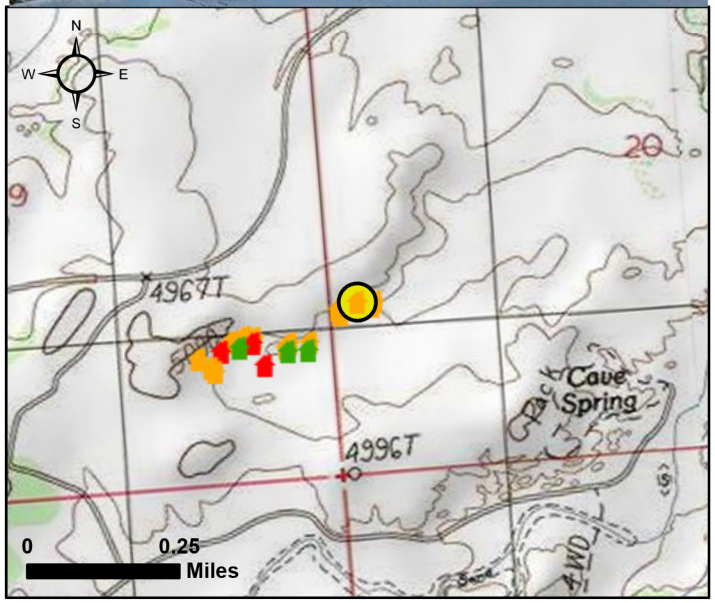

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B37 Garage 2-Bay
Unit - Location: CANY - Needles
FMSS ID: 47838, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.58496712' N 109° 45.60719688' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 106

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



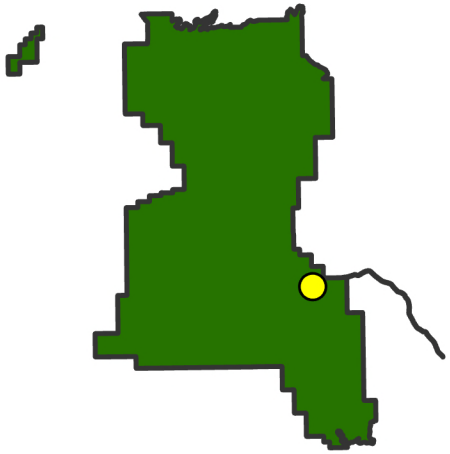

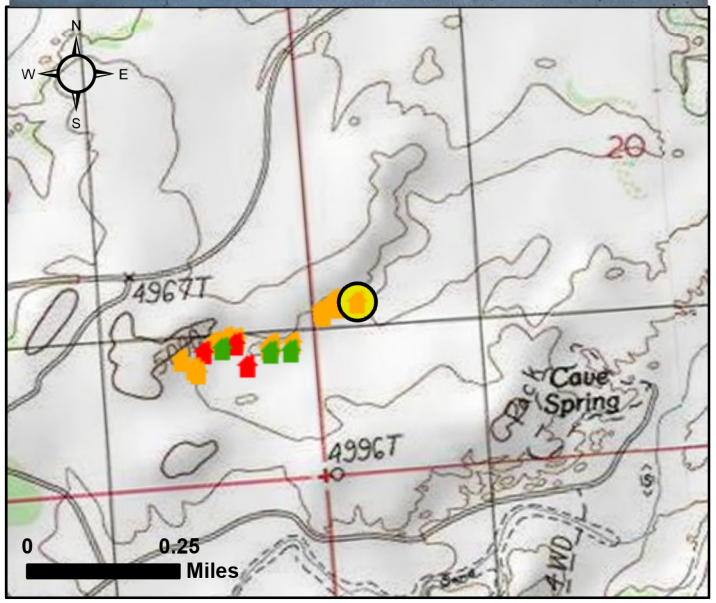

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B24 Garage 2-Bay
Unit - Location: CANY - Needles
FMSS ID: 47785, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.54572532' N 109° 45.82981830' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 92

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Heavy
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Propane Tank: Propane tank at neighboring house 40 feet away.



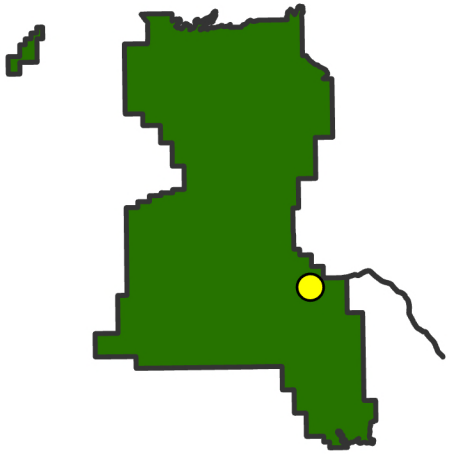

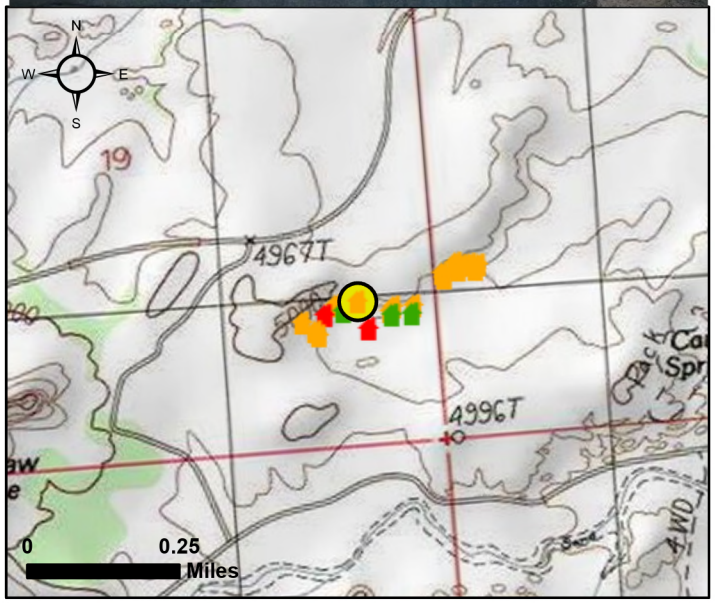

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B27 Garage 2- Bay
Unit - Location: CANY - Needles
FMSS ID: 47806, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.53493156' N 109° 45.76527960' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 96

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Foundation: Stucco.



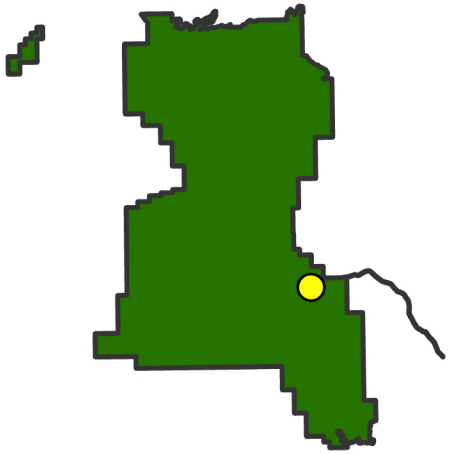

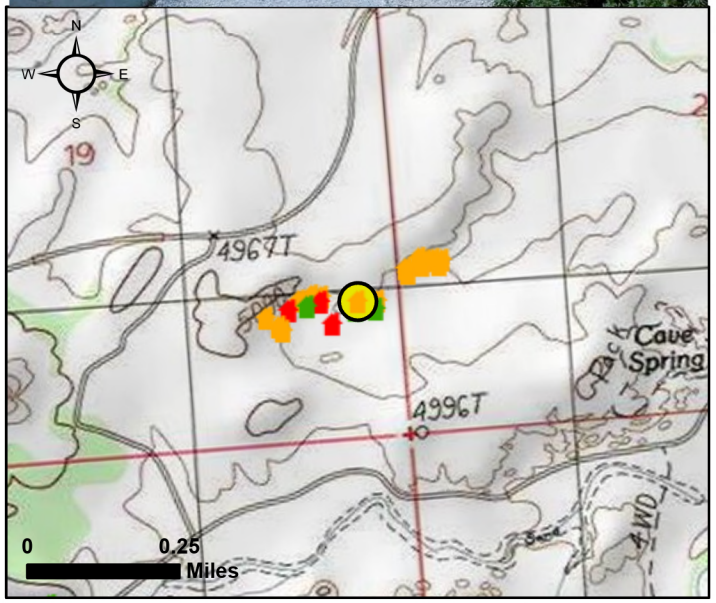

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B29 Garage 4-Bay
Unit - Location: CANY - Needles
FMSS ID: 47811, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.53366580' N 109° 45.72973812' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 98

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Foundation: Stucco.



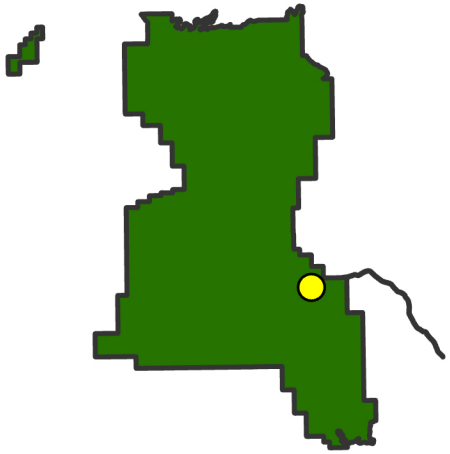

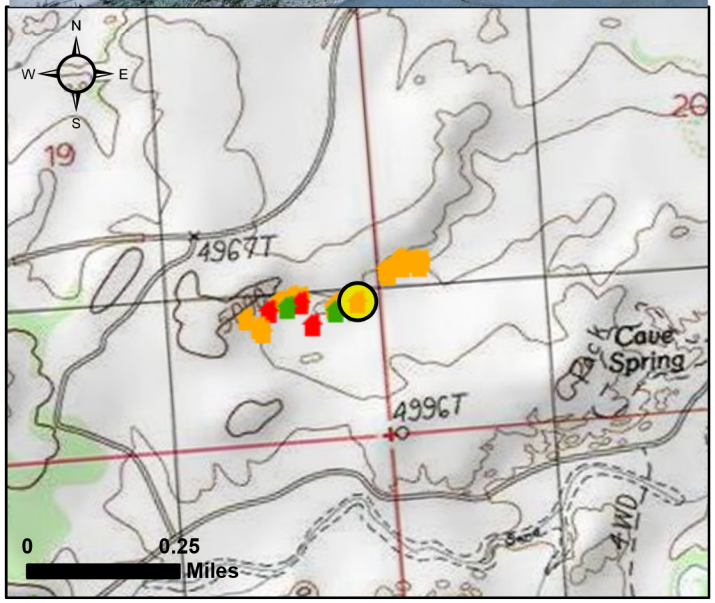

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B26 Garage 2-Bay
Unit - Location: CANY - Needles
FMSS ID: 47805, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.52857954' N 109° 45.77215392' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 94

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Foundation: Stucco.



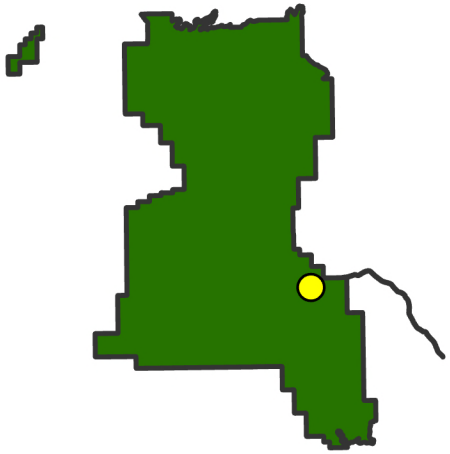

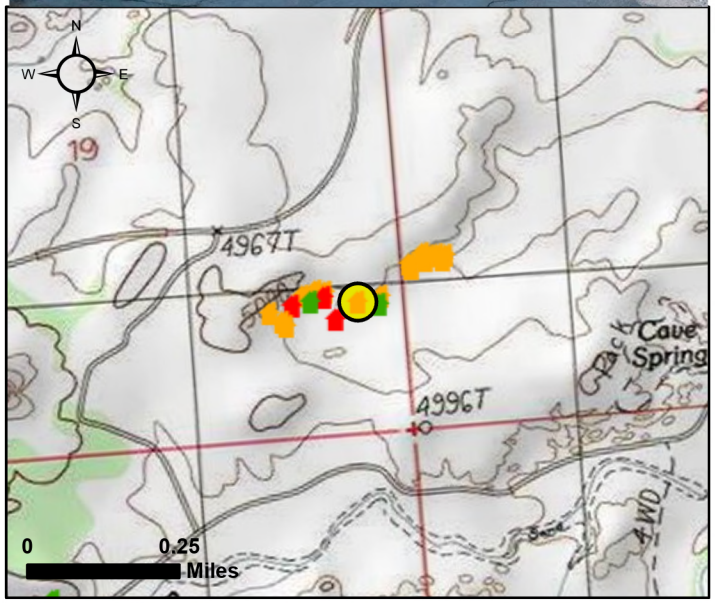

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B38 Recreation Shelter
Unit - Location: CANY - Needles
FMSS ID: 47840, ***Local ID:***
Structure Type, Use: Shade/Picnic Structure, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.50616288' N 109° 45.81386046' W


Rating: High
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 93

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Combustible or no roof
Siding Material: Wood or open sided
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Maintenance: Reduce/remove fuels from walkway. Propane Tank: Small propane grill located on N. side of ramada.



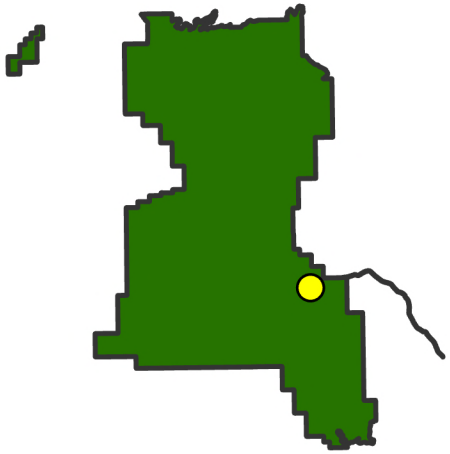

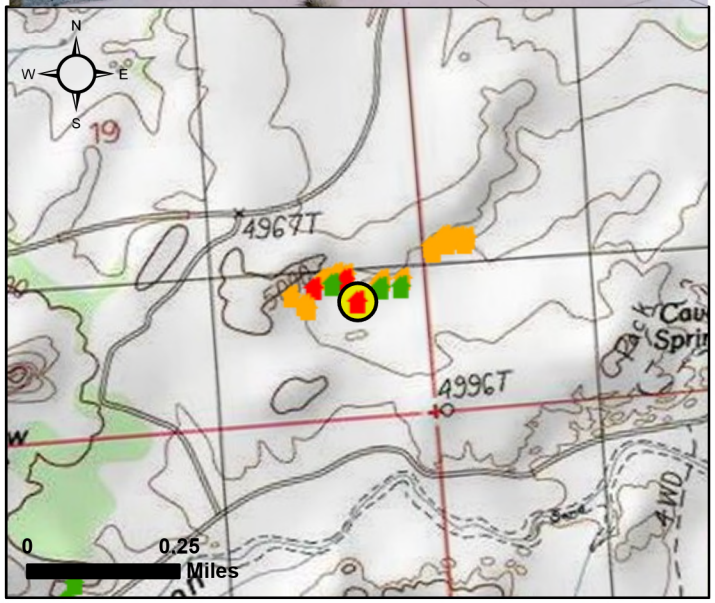

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B31 Garage 4-Bay
Unit - Location: CANY - Needles
FMSS ID: 47825, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.57633330' N 109° 45.67431246' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 99

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



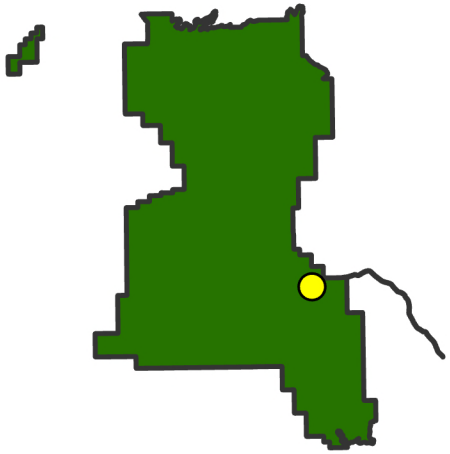

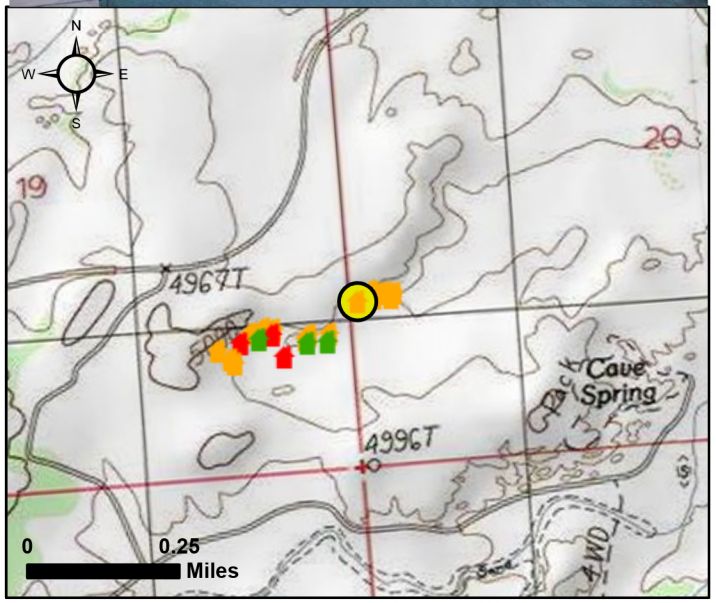

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFVC-4.B1 Visitor Center
Unit - Location: CANY - Needles
FMSS ID: 45703, ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 10.08619218' N 109° 45.56317992' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: No,
Revisit Interval: 7 yrs
Map Label: 72

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Water Supply: 2 Hydrants. 1 North. 1 South. Structure Number: V.C. clearly identified. Maintenance: Moderate fuel accumulations adjacent to buildings. Periodic maintenance required. Propane Tank: Propane tank S. end of employee parking lot. Some fuels present. Safety Zones: Large parking lot.



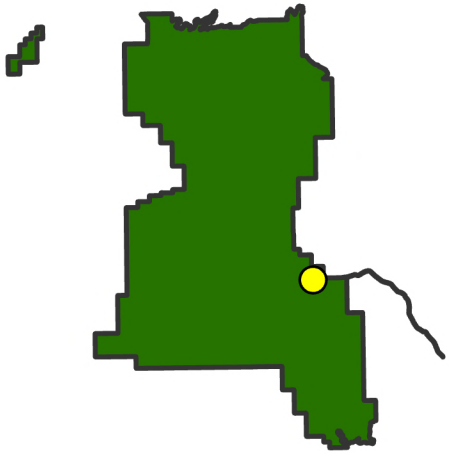

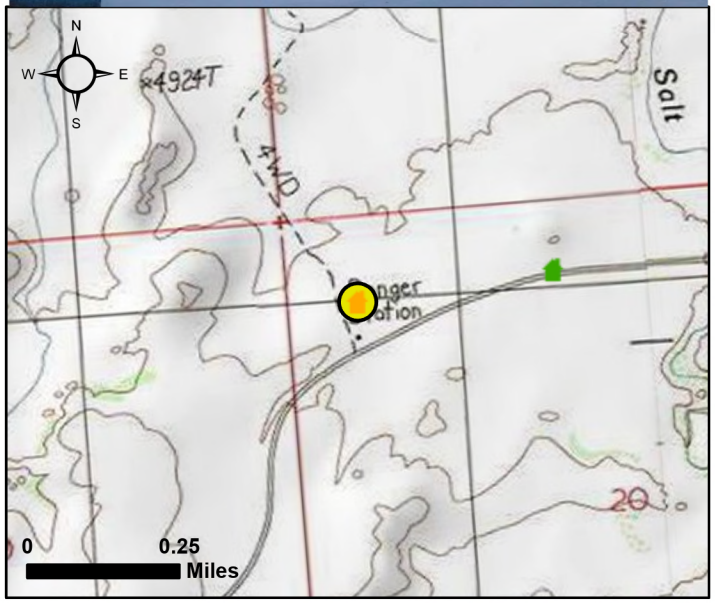

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B36 Garage 2-Bay
Unit - Location: CANY - Needles
FMSS ID: 47836, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.58693926' N 109° 45.62275602' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 104

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: Adjacent to/under deck of facility
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



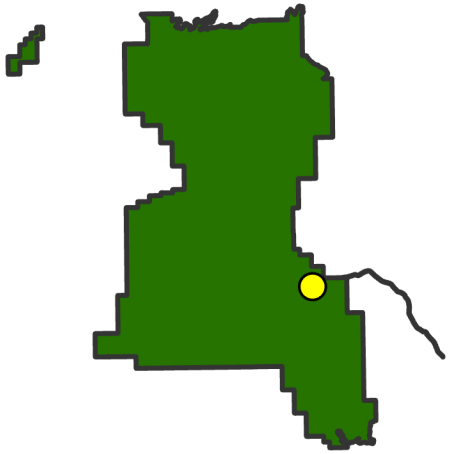

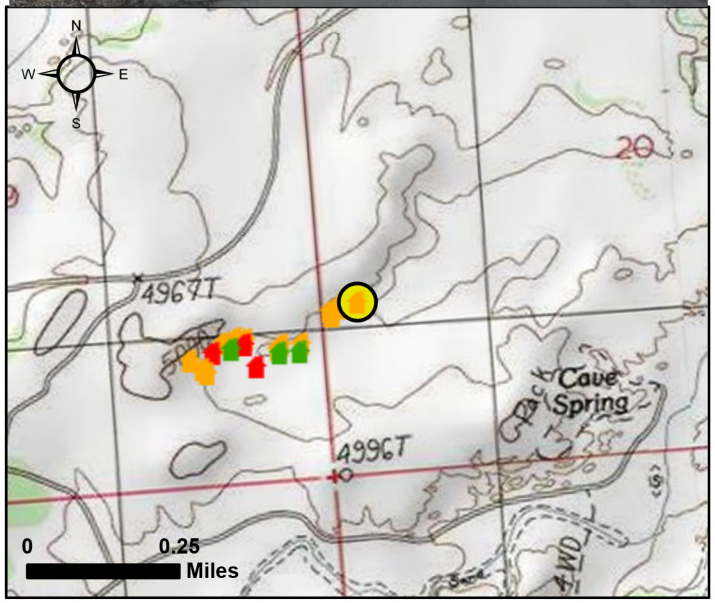

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B21 2-Br. Single Family
Unit - Location: CANY - Needles
FMSS ID: 47780, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.54834498' N 109° 45.84681954' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 90

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Building Number: Number not facing street.



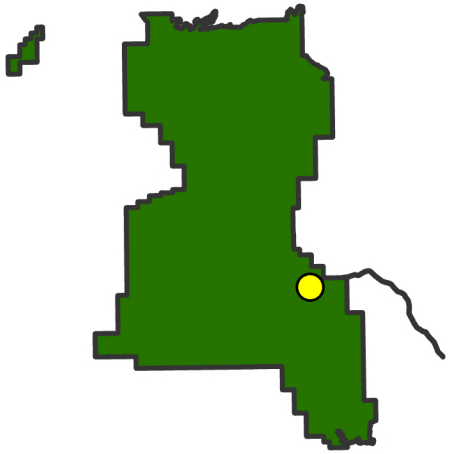

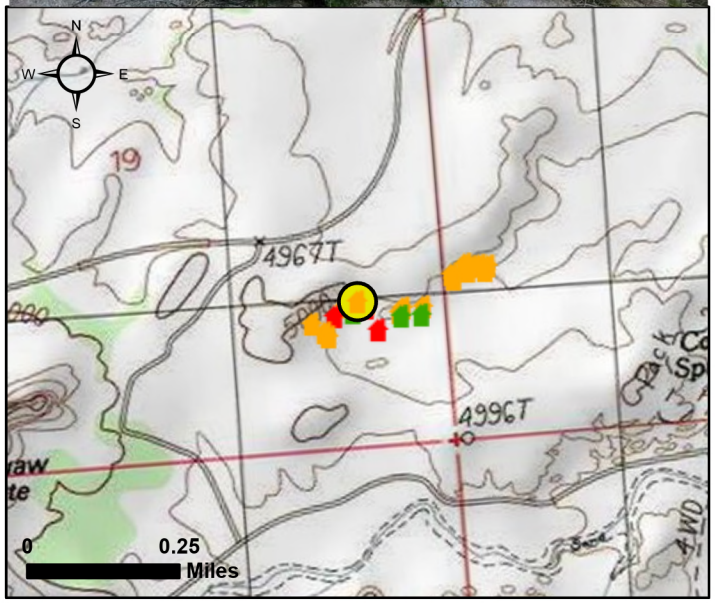

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B22 Garage 6-Bay
Unit - Location: CANY - Needles
FMSS ID: 47784, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.54230748' N 109° 45.87007704' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 88

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



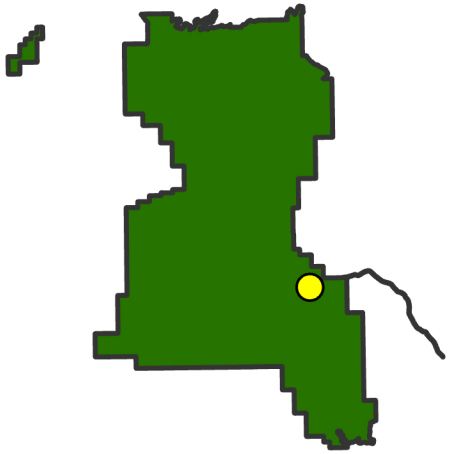

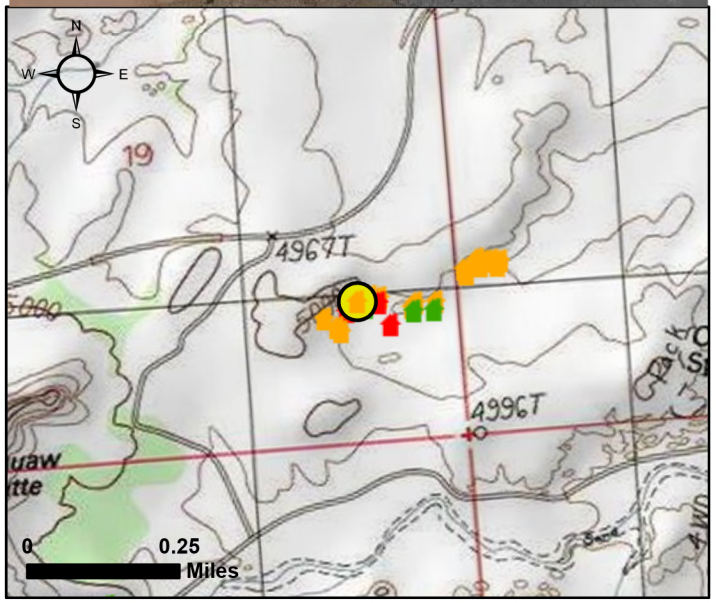

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B23 Handicap Access Single Family
Unit - Location: CANY - Needles
FMSS ID: 47782, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.53887428' N 109° 45.83161890' W


Rating: High
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 91

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Heavy
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Ignition Potential: Deck cover and window shades are made of cured, wooden poles. Maintenance: Some flammable debris around the house.



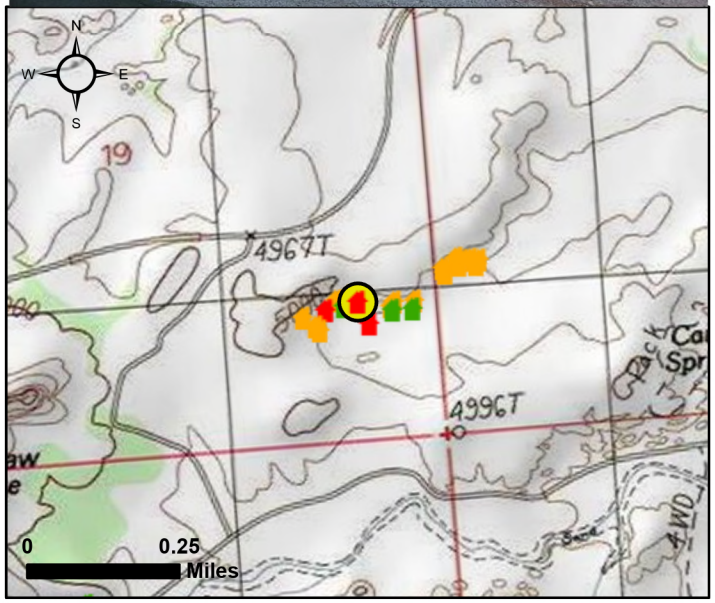

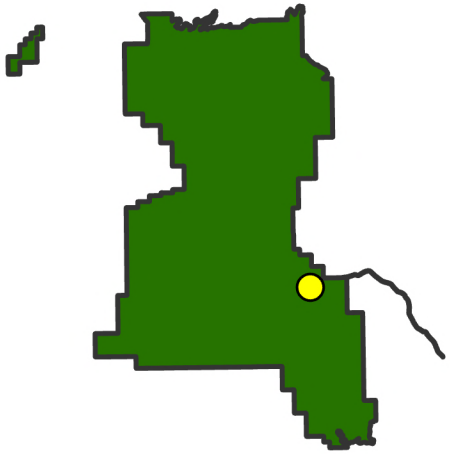

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B19 Single Family Home
Unit - Location: CANY - Needles
FMSS ID: 47771, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.52975422' N 109° 45.89064612' W


Rating: High
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 87

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Heavy
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



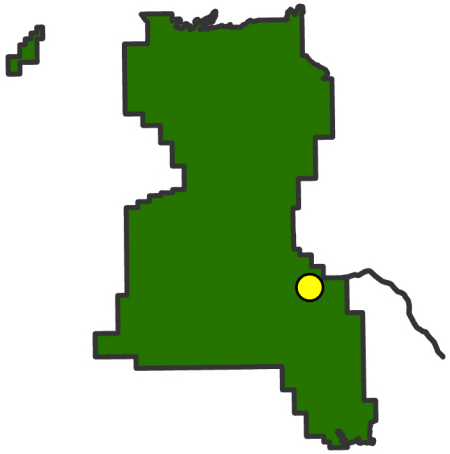

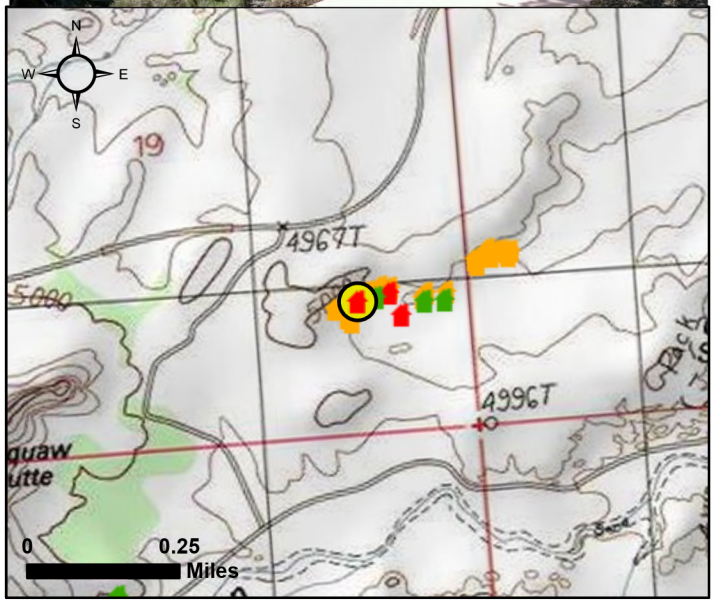

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFUA-4.B2 Generator/Water Building
Unit - Location: CANY - Needles
FMSS ID: 45714, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.10619064' N 109° 46.37578128' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 82

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Overhead Hazard: Phone tower NE of bldg.
minor limitations.



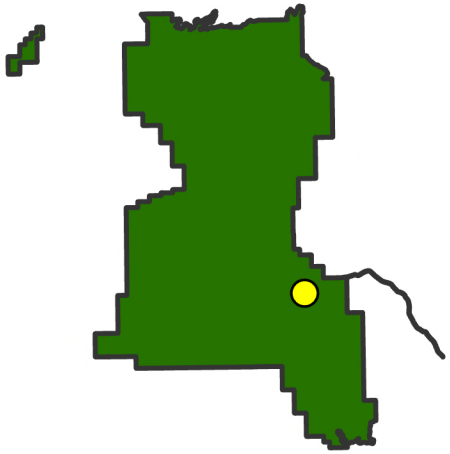

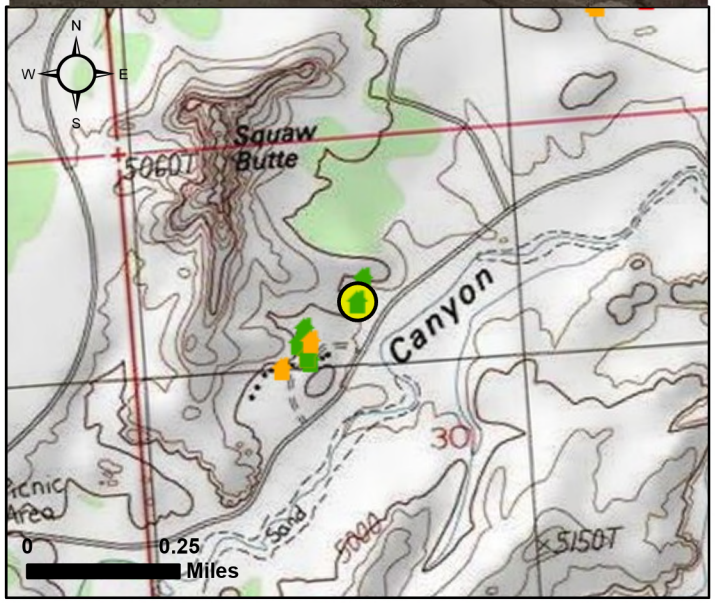

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFSA-4.B42 Maintenance Building
Unit - Location: CANY - Needles
FMSS ID: 47593, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.07341294' N 109° 46.47465588' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 76

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments:



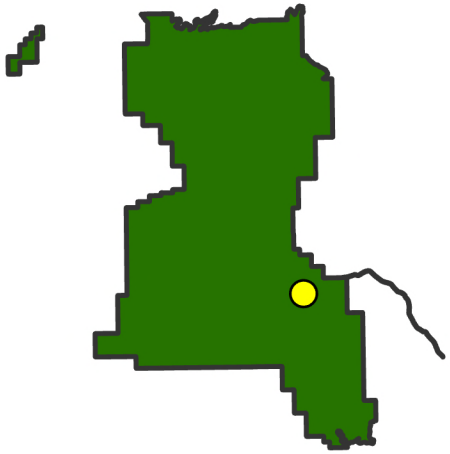

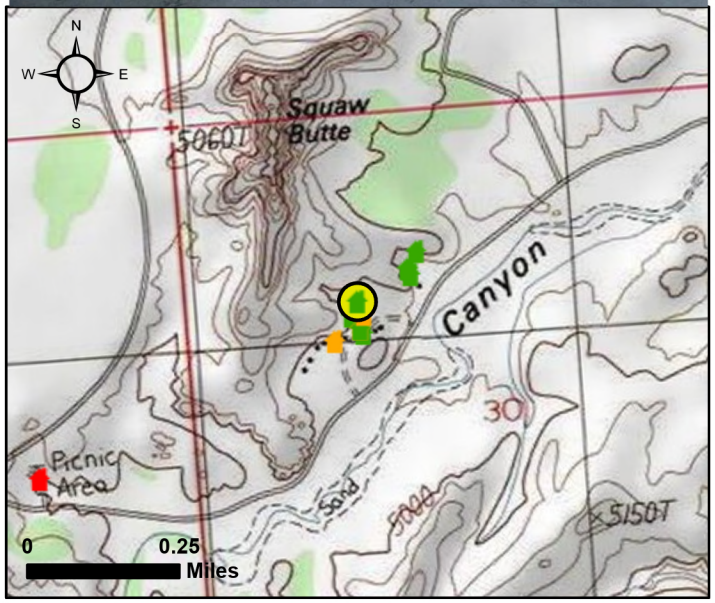

NPS Wildland Fire Risk Assessment - Facility Assessment


For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFSA-4.B43 Pole Barn
Unit - Location: CANY - Needles
FMSS ID: 47616, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.05405778' N 109° 46.48673160' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 75

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: Adjacent to/under deck of facility
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:

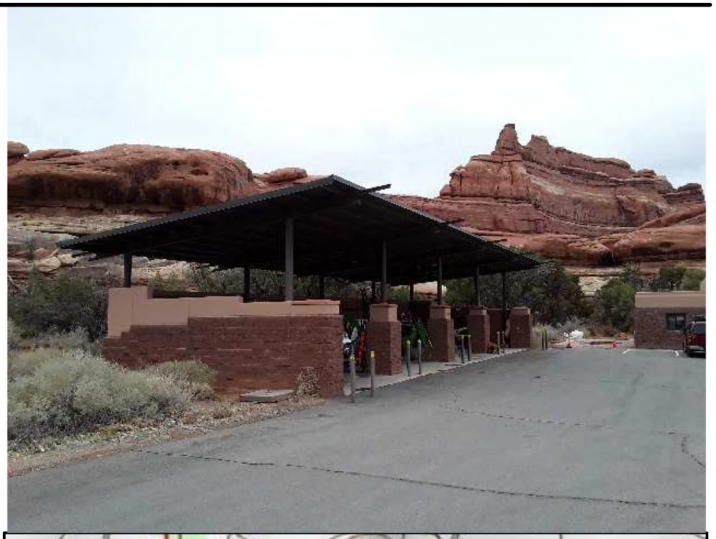

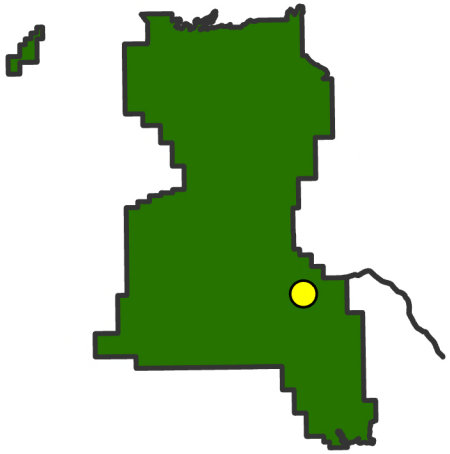

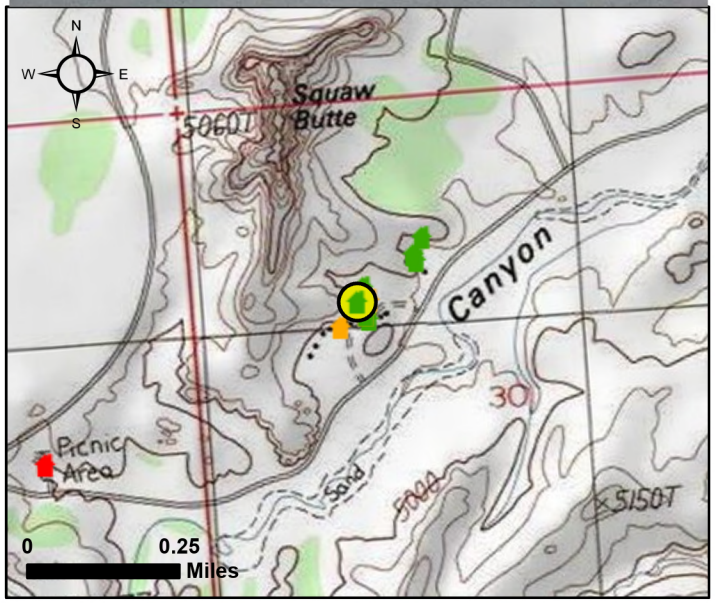

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFSA-4.B45 Ranger Building
Unit - Location: CANY - Needles
FMSS ID: 46696, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.01963266' N 109° 46.52096418' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 74

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: Adjacent to/under deck of facility
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



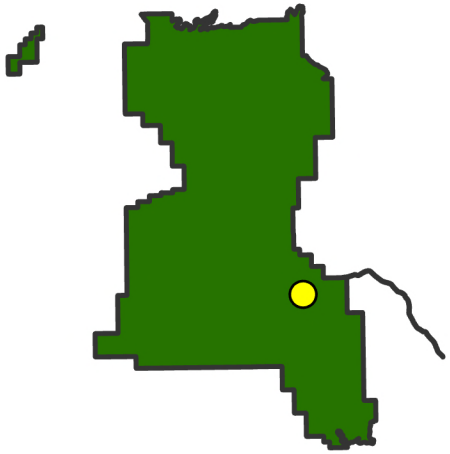

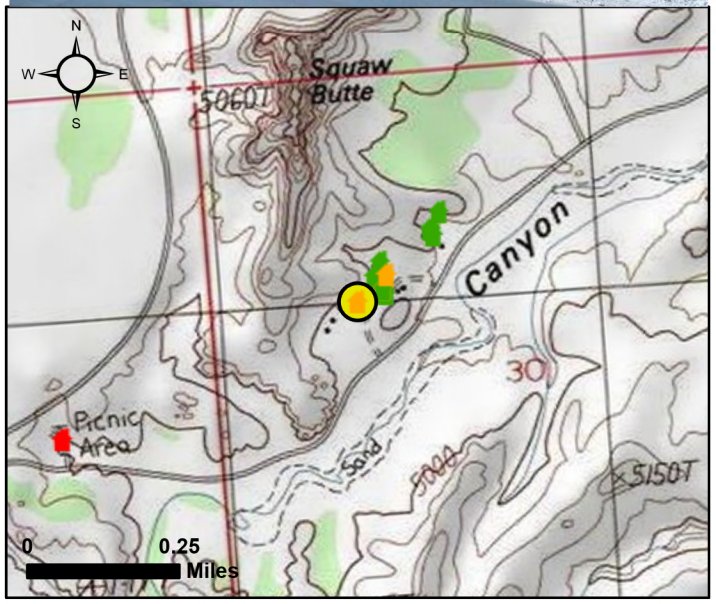

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFSA-4.B44 Volatile Storage Building
Unit - Location: CANY - Needles
FMSS ID: 47601, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.02801130' N 109° 46.46911674' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 79

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass/tundra,northern hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 100 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Treatment: None.



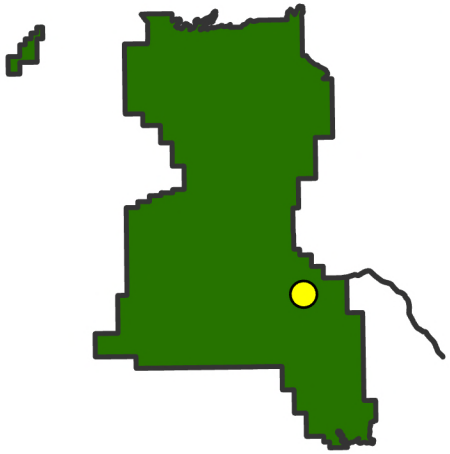

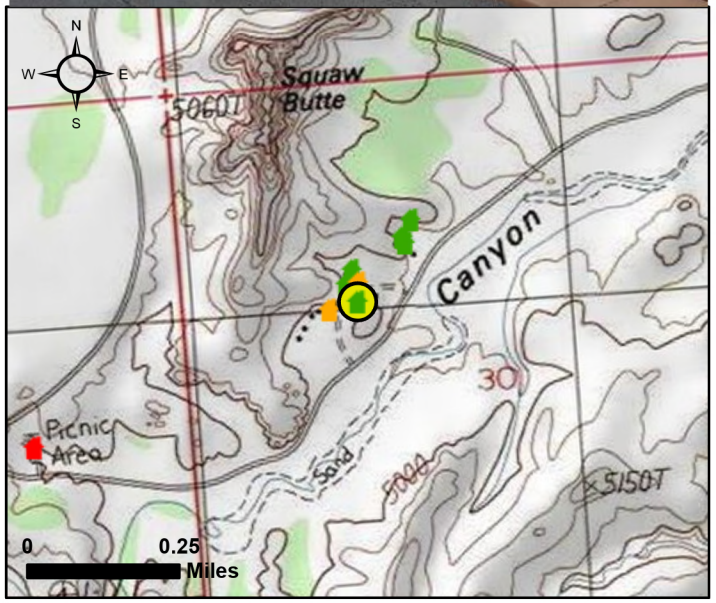

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Propane Tank (4.U-5)
Unit - Location: CANY - Needles
FMSS ID: 47633, ***Local ID:***
Structure Type, Use: Propane Tank, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.03498000' N 109° 46.47336000' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 77

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass/tundra,northern hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments:



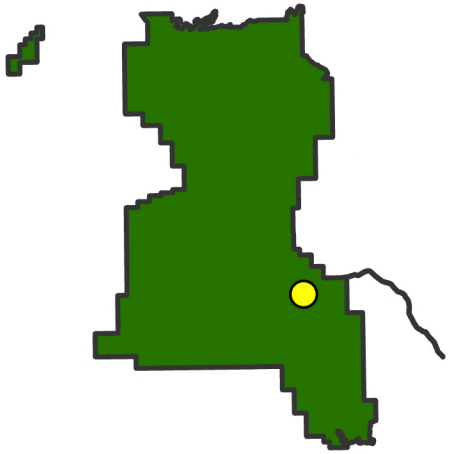

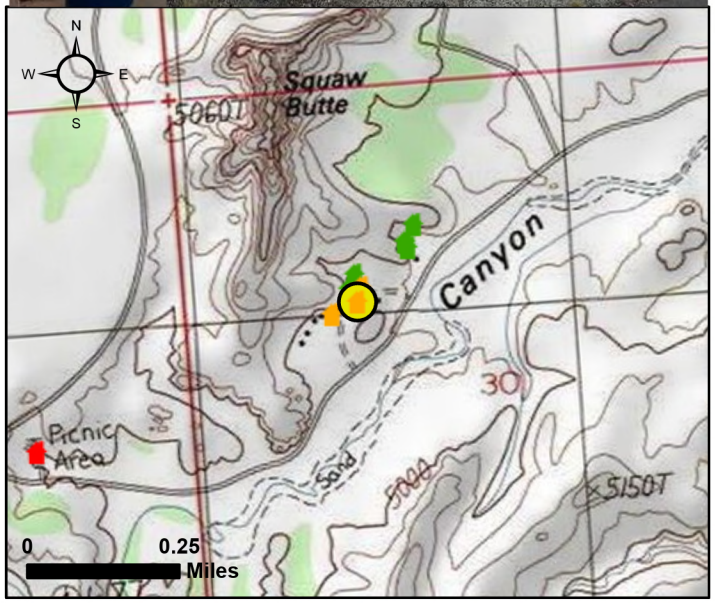

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Gas Tank (4.U-7)
Unit - Location: CANY - Needles
FMSS ID: 47638, ***Local ID:***
Structure Type, Use: Other, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.03498000' N 109° 46.47336000' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 77

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass/tundra,northern hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments:



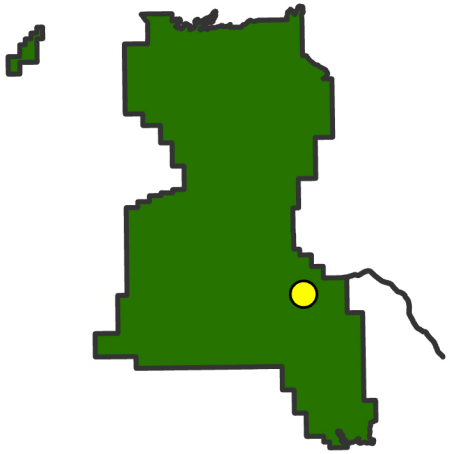

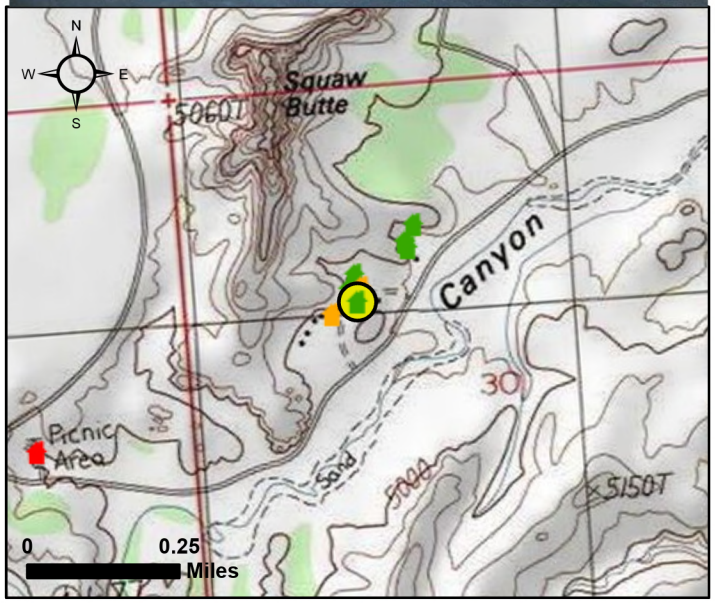

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Diesel Tank
Unit - Location: CANY - Needles
FMSS ID: CANY Diesel Tank (not found), ***Local ID:***
Structure Type, Use: Other, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.11502000' N 109° 46.38000000' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 81

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Building Number: Structure # identified on generator bldgs. Overhead Hazards: Phone tower 70' to N.E., minor limits.



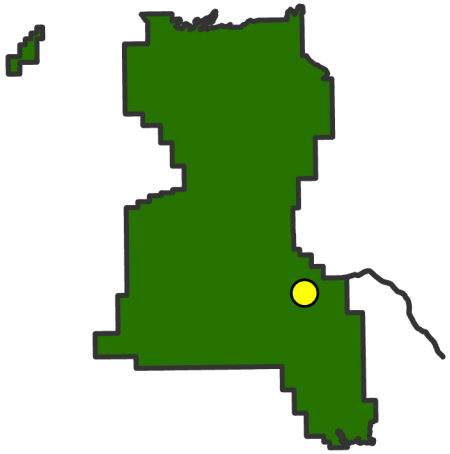

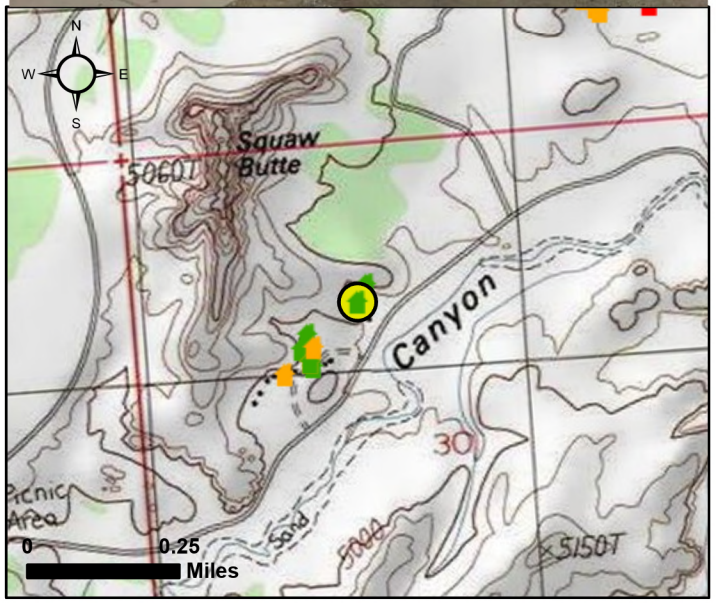

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: 5 Sheds (Building # 4B56)
Unit - Location: CANY - Needles
FMSS ID: CANY 5 Sheds (Building # 4B56), ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.05502000' N 109° 46.46502000' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: yrs
Map Label: 80

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 100 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Wood or open sided
Foundation: Open or deck
Firewood: 5ft to 30ft from facility
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Building Number: 1 of 5 sheds is numbered.



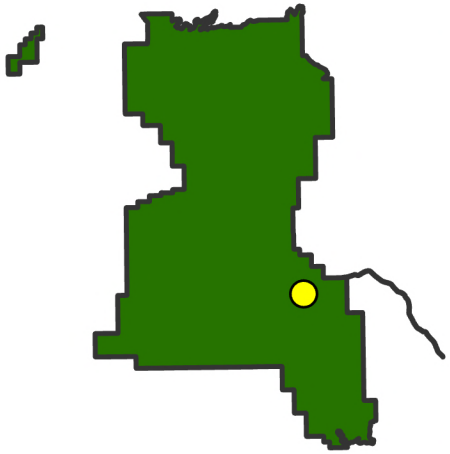

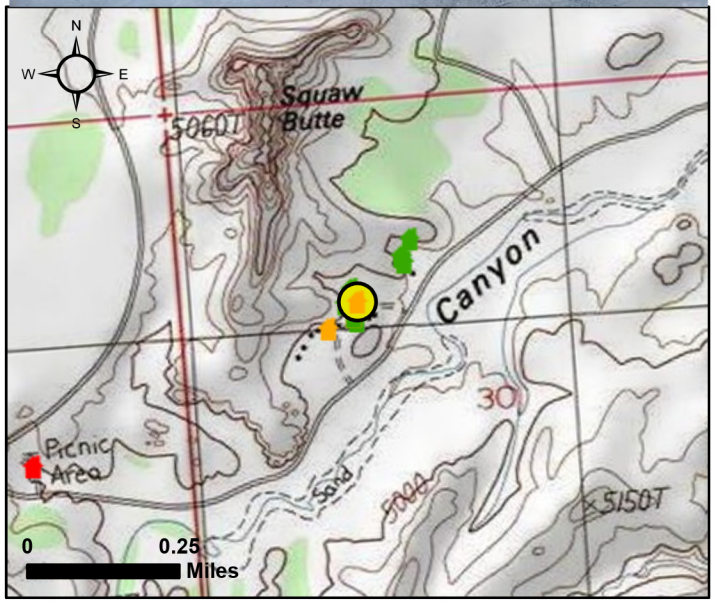

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Phone Bld - Non NPS
Unit - Location: CANY - Needles
FMSS ID: CANY Phone Bld - Non NPS, ***Local ID:***
Structure Type, Use: Communications Site, Administrative
Owner: Individual or Private Corporation
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.13836000' N 109° 46.36164000' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Maintenance Area
Revisit Interval: 7 yrs
Map Label: 83

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Overhead Hazards: Tall antenna without flashing light.



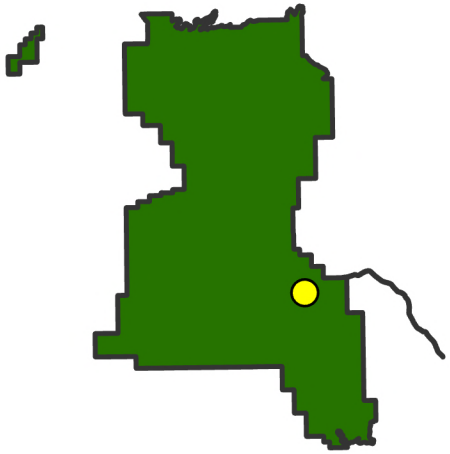

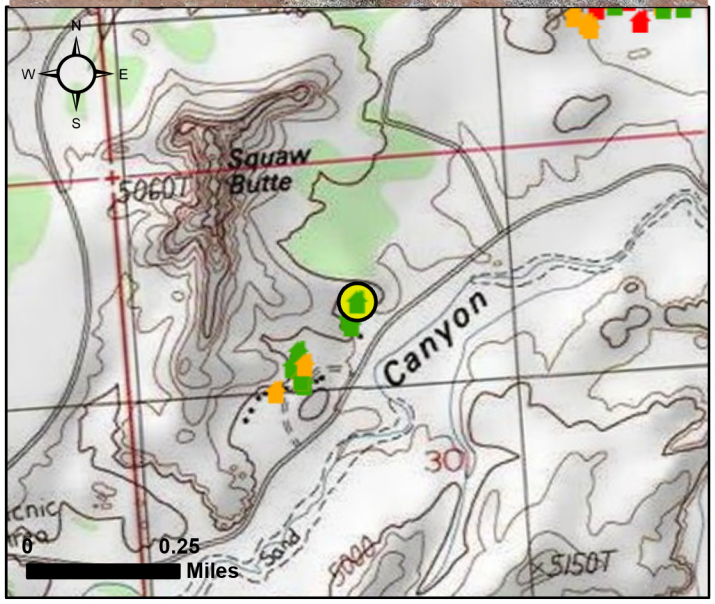

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Restroom (4.B41B)
Unit - Location: CANY - Needles
FMSS ID: 47997, ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.88336000' N 109° 48.10332000' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 67

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Shrub or timber
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments: Maintenance: Some debris adjacent to structure.



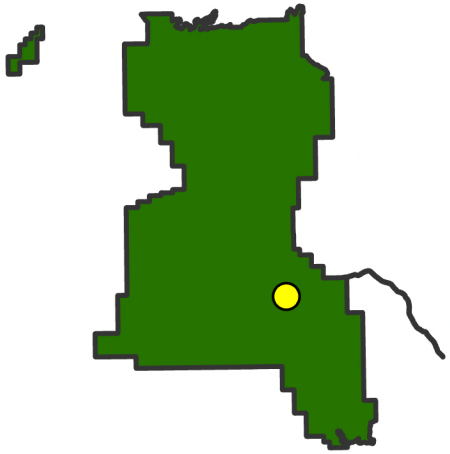

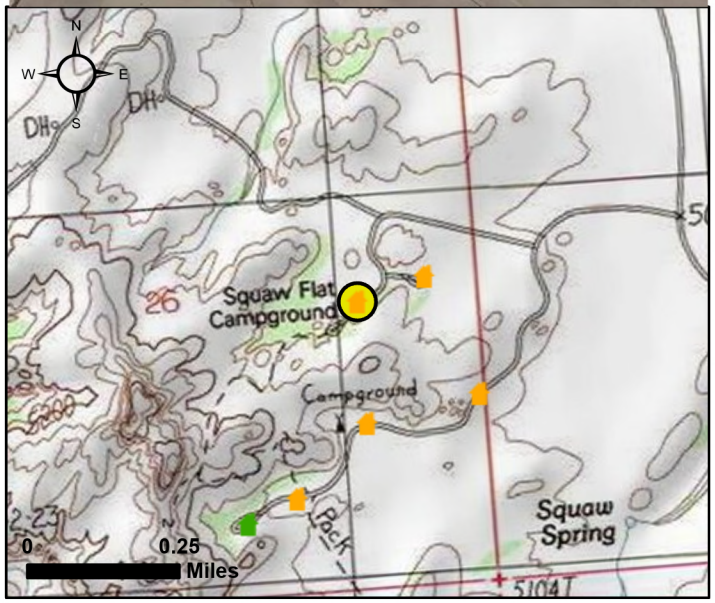

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Squaw Flat CC Restroom A (4.B40)
Unit - Location: CANY - Needles
FMSS ID: 47996, ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.71002000' N 109° 48.10332000' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 68

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and little to no fuels clearance
Overhead Hazards: No overhead hazards

Comments: Fuel Type: Grass/shrub some timber.
Propane Tank: Propane tank. No fuels.



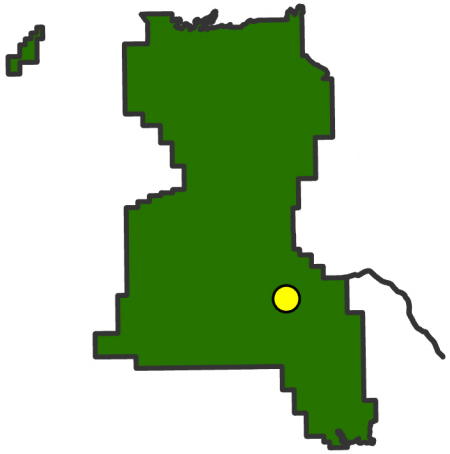

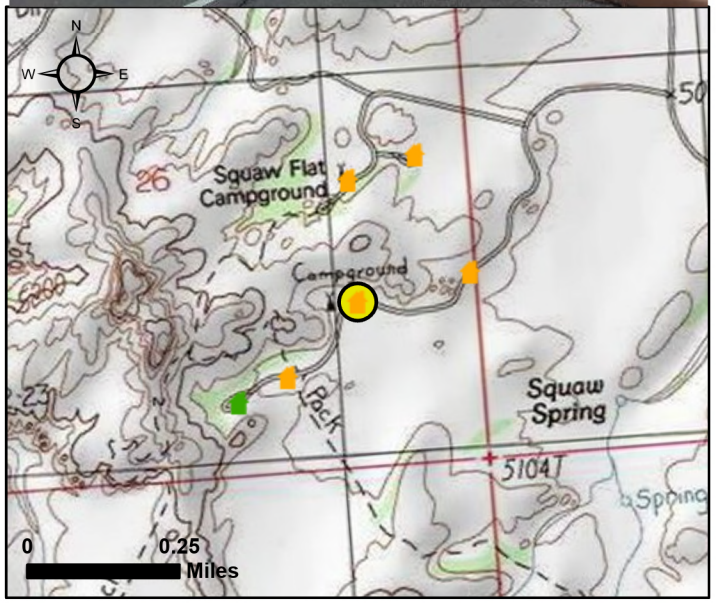

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B16 Garage 2-Car
Unit - Location: CANY - Needles
FMSS ID: 47681, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.52145082' N 109° 45.93185244' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 84

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



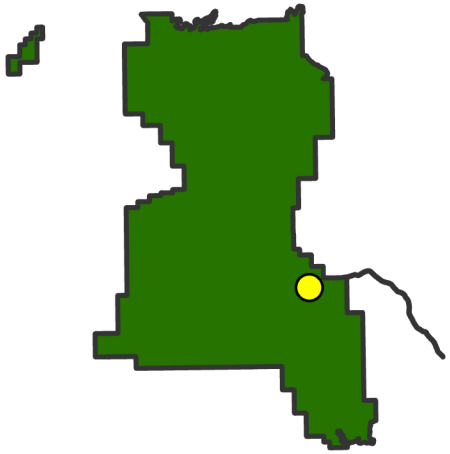

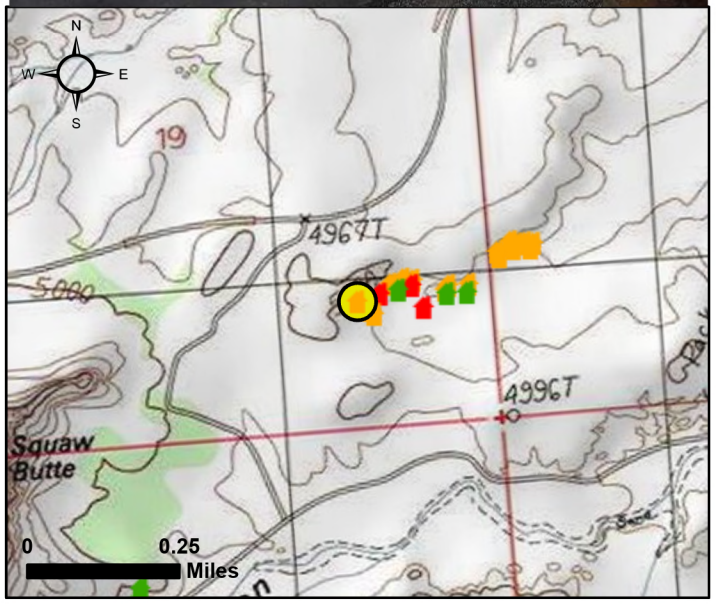

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: NFHA-4.B18 Garage 2-Car
Unit - Location: CANY - Needles
FMSS ID: 47689, ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.50839836' N 109° 45.91011552' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 85

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments:



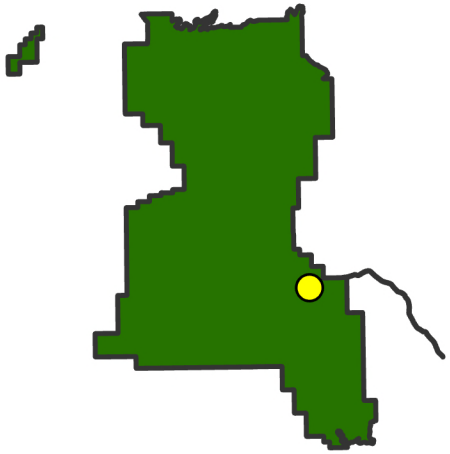

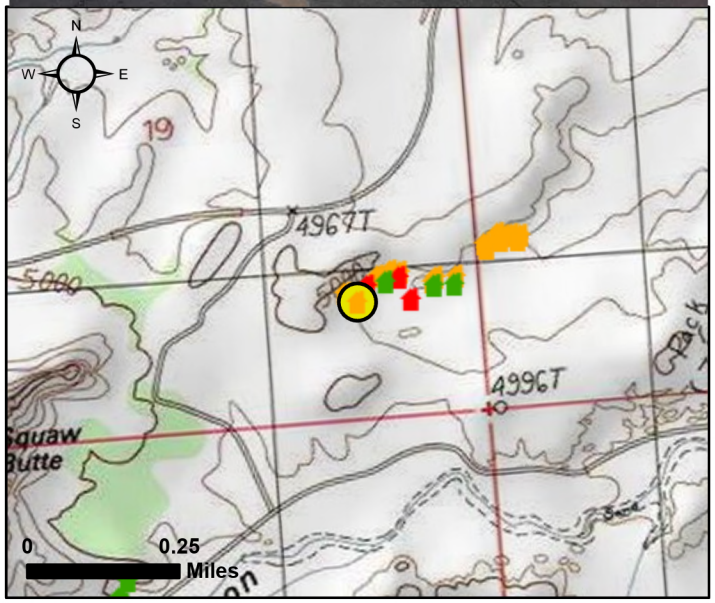

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B17A)(4.B17B)
Unit - Location: CANY - Needles
FMSS ID: 47684, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.50225448' N 109° 45.90403470' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 86

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: Present and fuels clearance
Overhead Hazards: No overhead hazards

Comments:



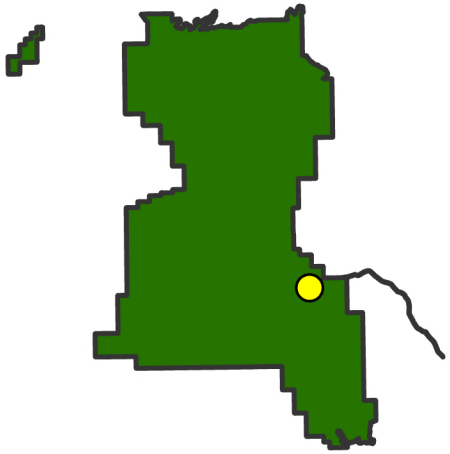

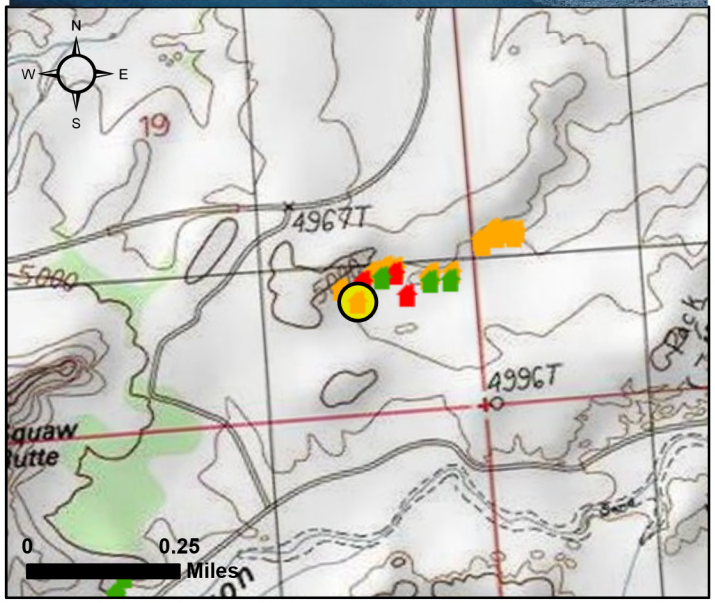

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B20A) (4.B20B)
Unit - Location: CANY - Needles
FMSS ID: 47776, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.53399070' N 109° 45.85665906' W


Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 89

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



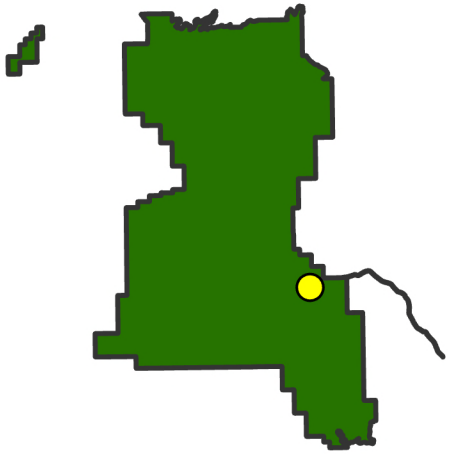

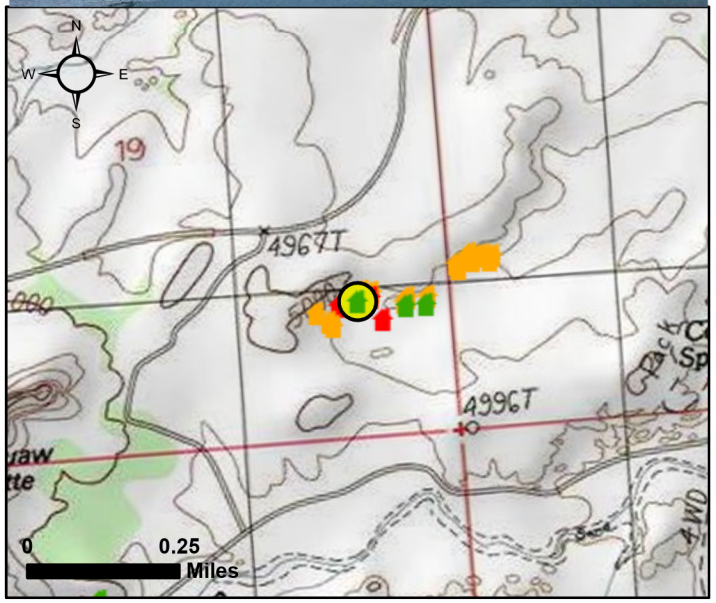

NPS Wildland Fire Risk Assessment - Facility Assessment


For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B25A) (4B25B)
Unit - Location: CANY - Needles
FMSS ID: 47801, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.52323240' N 109° 45.76970016' W

Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 95

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: 100 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards
Comments:



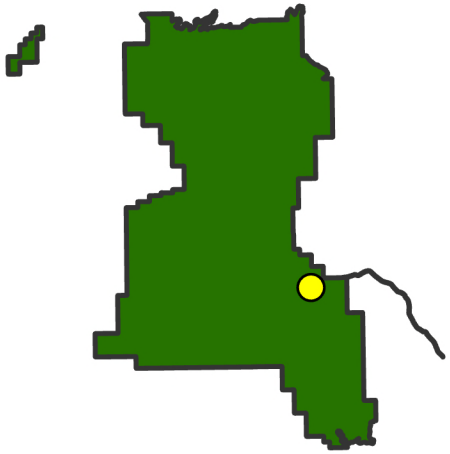

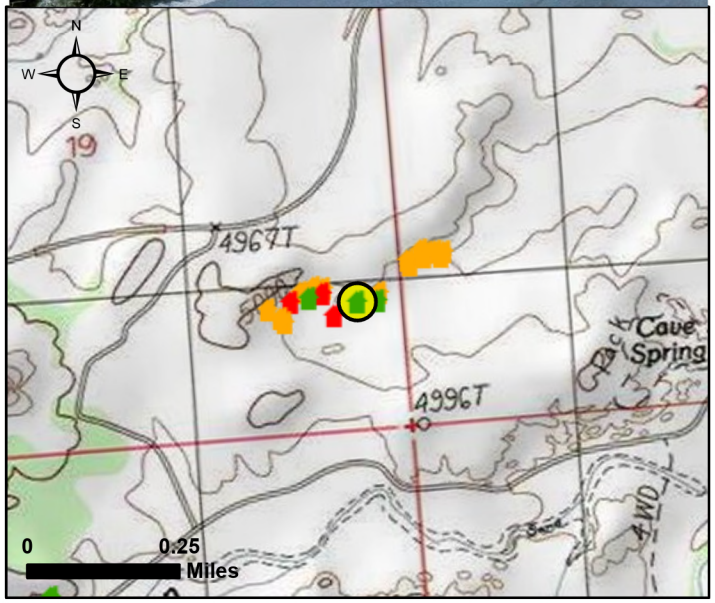

NPS Wildland Fire Risk Assessment - Facility Assessment


For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B28A) (4.B28B)
Unit - Location: CANY - Needles
FMSS ID: 47808, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.52272858' N 109° 45.73383624' W

Rating: Low
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 97

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards
Comments:



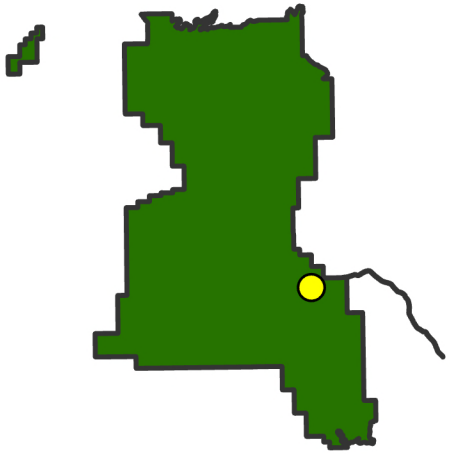

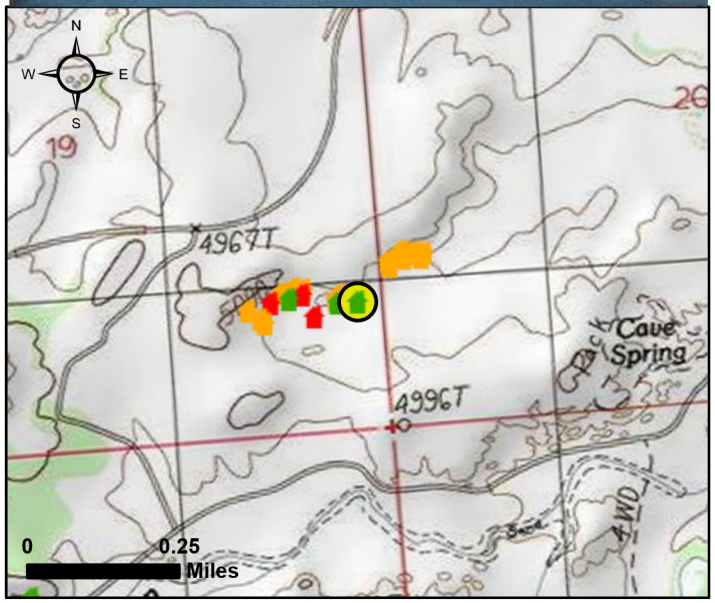

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B30A) (4.B30B)
Unit - Location: CANY - Needles
FMSS ID: 47815, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.56971488' N 109° 45.67028370' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 100

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



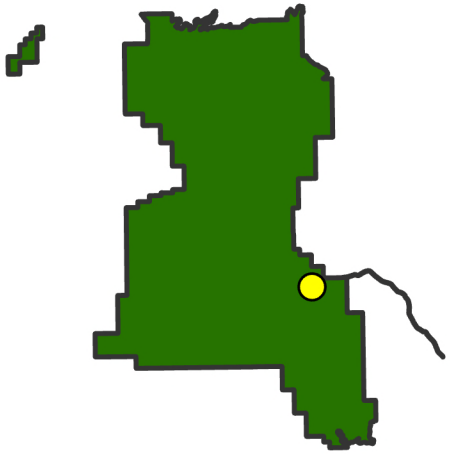

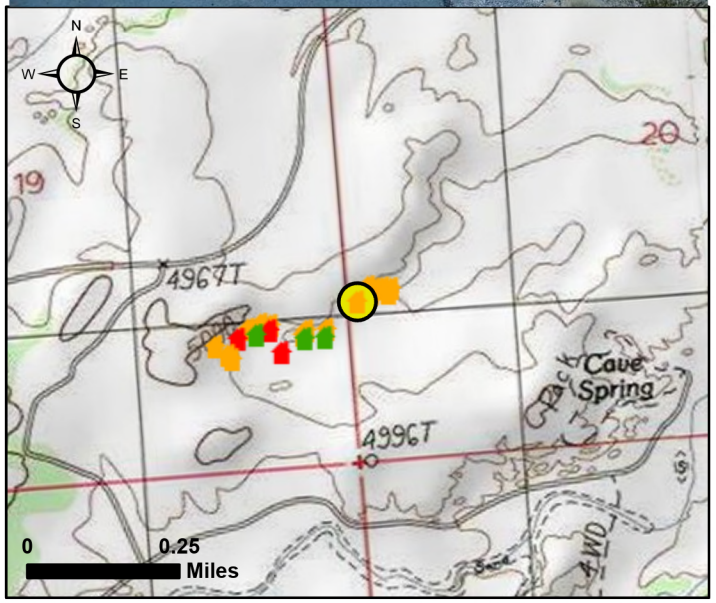

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B32A) (4.B32B)
Unit - Location: CANY - Needles
FMSS ID: 47826, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.57999162' N 109° 45.64449552' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: Yes
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 102

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



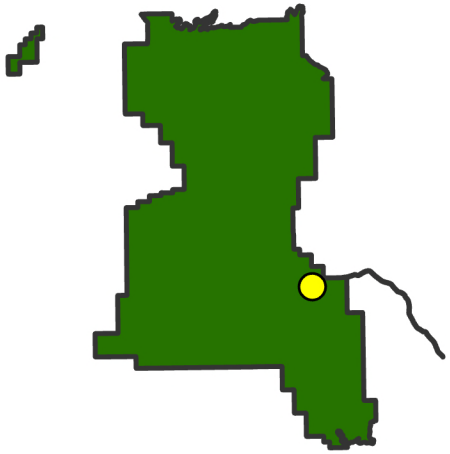

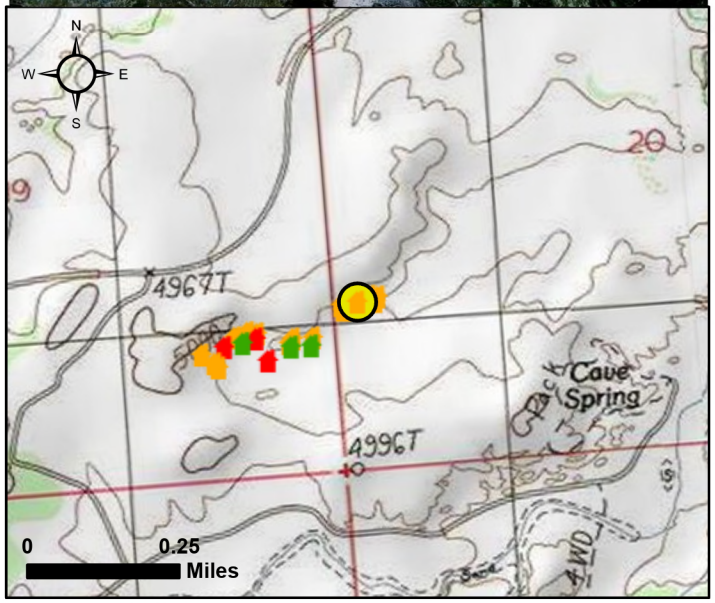

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Residence (4.B35A) (4.B35B)
Unit - Location: CANY - Needles
FMSS ID: 47833, ***Local ID:***
Structure Type, Use: Building, Residence
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 09.57828456' N 109° 45.61371618' W


Rating: Moderate
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: Yes, Needles Residential Area
Revisit Interval: 7 yrs
Map Label: 105

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: Marked and clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments: Propant Tank: No propane tank visible.



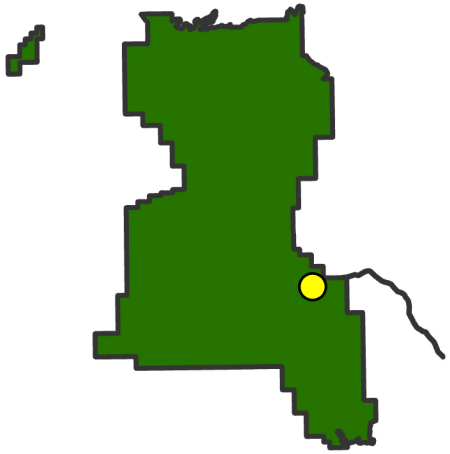

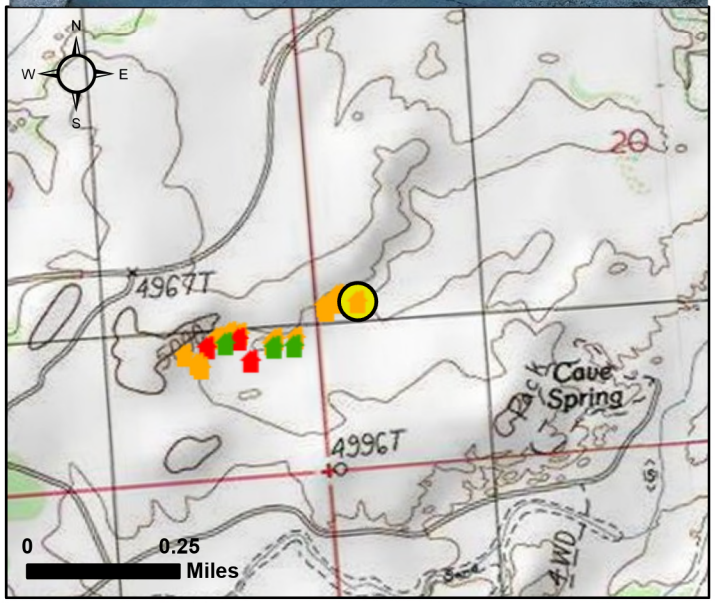

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.85687432' N 109° 47.07074016' W


Rating: High
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 71

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Non-surfaced- gravel,dirt,gradeLess than 5%
Bridge Condition: Less than 300 ft with no turnaround
Access and Turnarounds: Less than 300 ft with no turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Heavy
Defensible Space: No defensible space
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: No reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards

Comments:



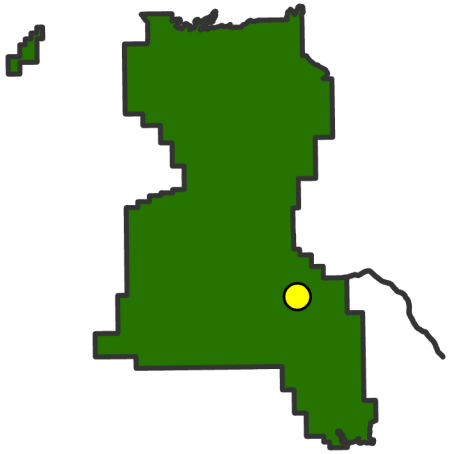

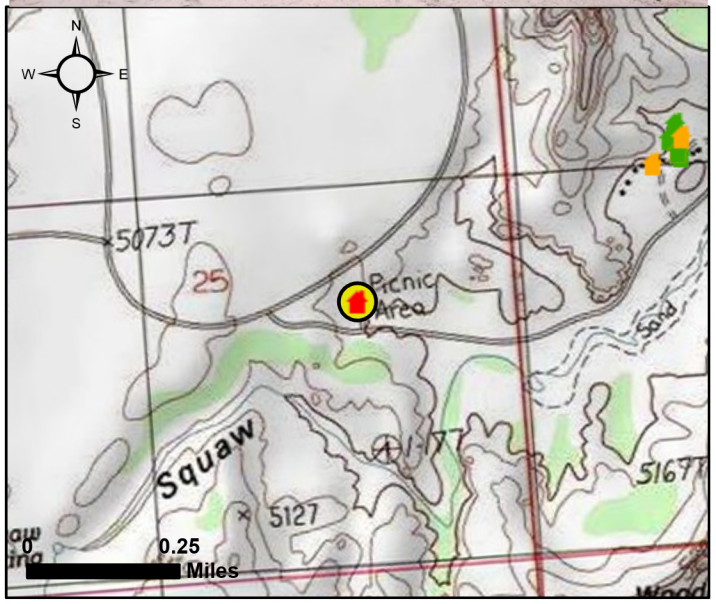

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.73971520' N 109° 47.89687440' W


Rating: Moderate
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 70

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Heavy
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



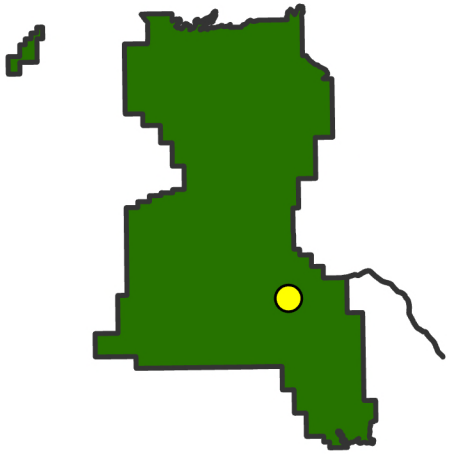

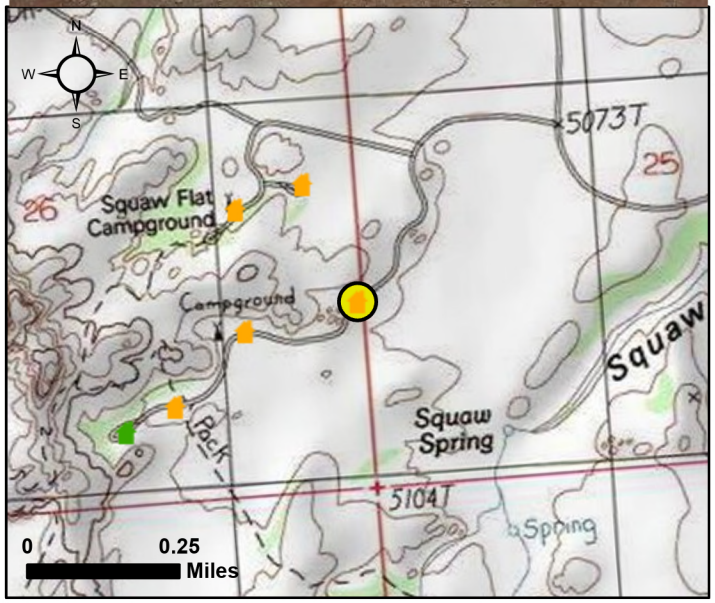

NPS Wildland Fire Risk Assessment - Facility Assessment


For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.61027144' N 109° 48.23915064' W

Rating: Moderate
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 66

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards
Comments:



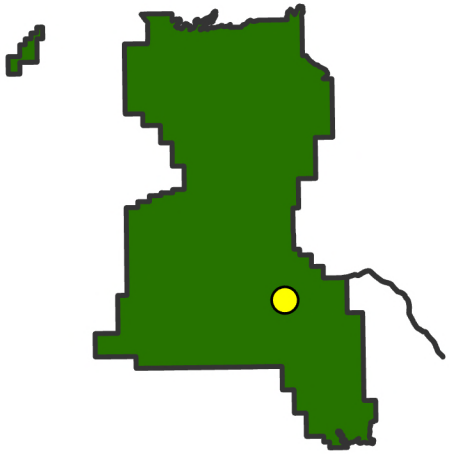

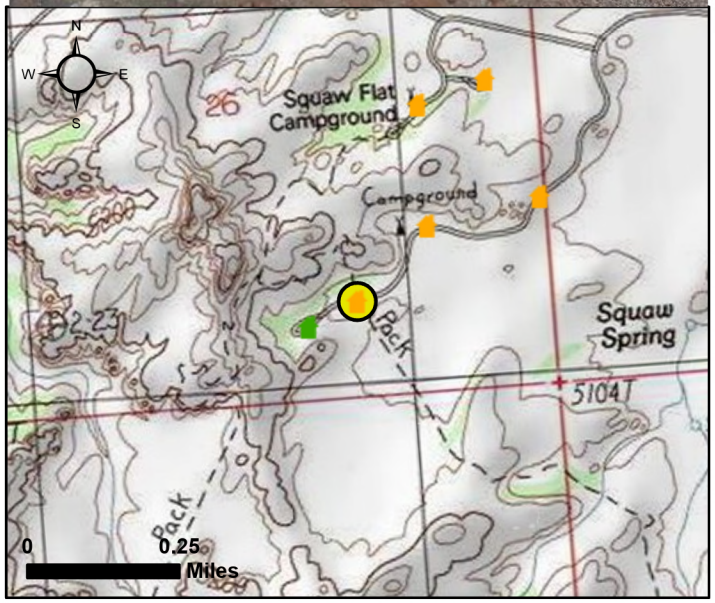

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.57946888' N 109° 48.33056976' W


Rating: Low
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 65

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Surfaced-paved, gradeLess than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



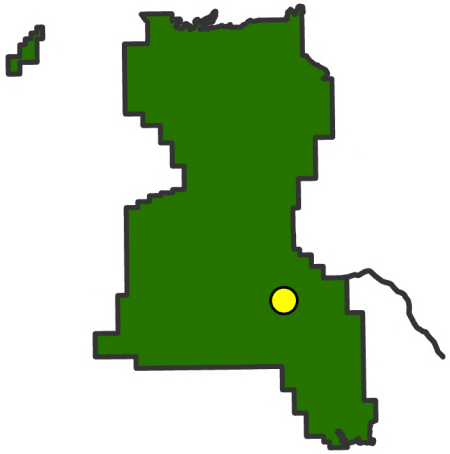

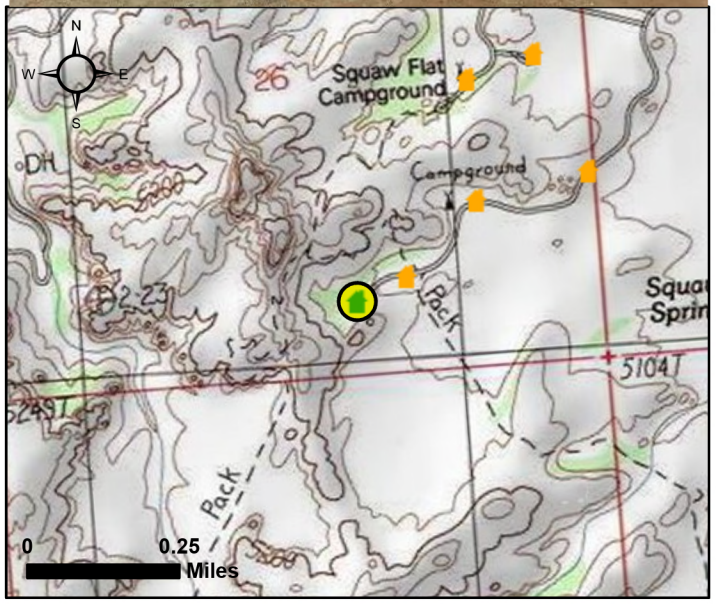

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.51574312' N 109° 49.60969056' W


Rating: Moderate
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 64

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1 lane (Less than 18')
Access Condition: Other than all season
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: No reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards

Comments: dirt road not drivable during March



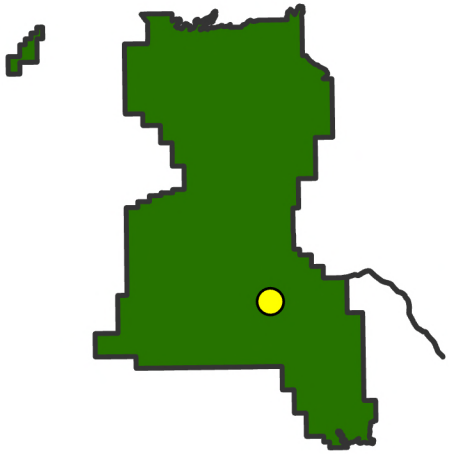

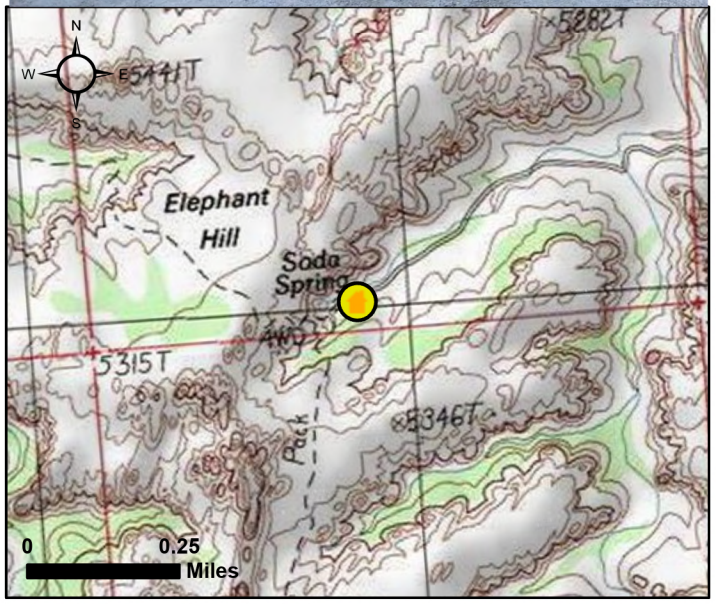

NPS Wildland Fire Risk Assessment - Facility Assessment


For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found, ***Local ID:***
Structure Type, Use: Building, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 10.93937616' N 109° 52.54684440' W

Rating: High
ProtectionLevel: Undesignated,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 63

Primary Access: ATV
Ingress Egress: N/A,access by foot,boat,or air only
Access Width: N/A,access by foot,boat,or air only
Access Condition: N/A,access by foot,boat,or air only
Bridge Condition: N/A,access by foot,boat,or air only
Access and Turnarounds: N/A,access by foot,boat,or air only
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Moderate
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Vinyl
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: No reliable water source nearby
Propane: None
Overhead Hazards: No overhead hazards
Comments: road to it not drivable



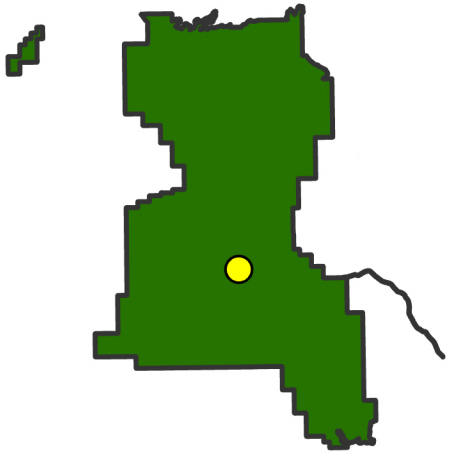

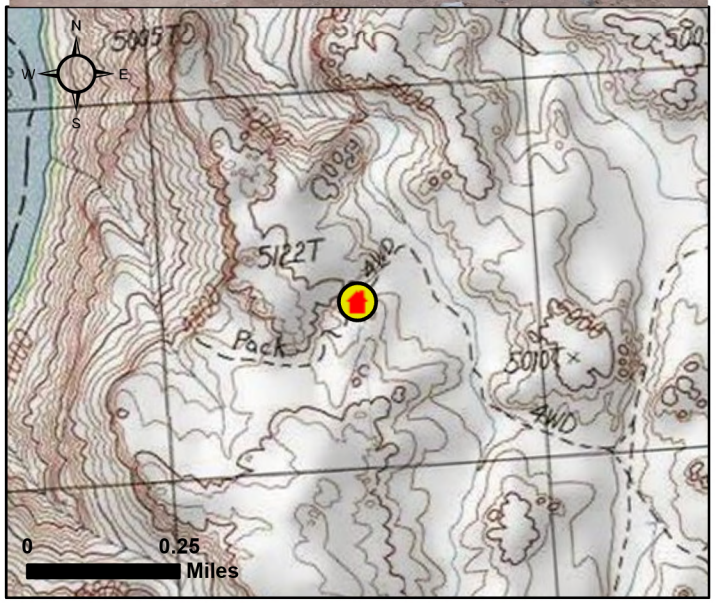

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/


Facility Name: Vault Toilet
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Toilet, Public
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 08.91210720' N 109° 47.97933384' W


Rating: Moderate
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: No
In Community: No,
Revisit Interval: 7 yrs
Map Label: 69

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Greater than 300 ft with turnaround
Access and Turnarounds: Greater than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: Less than 30 ft treated
Topography: Slope Less than 5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards

Comments:



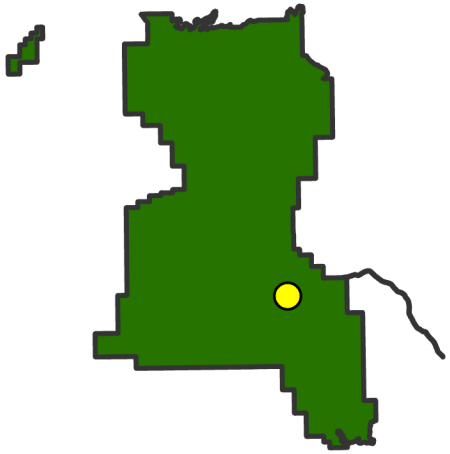

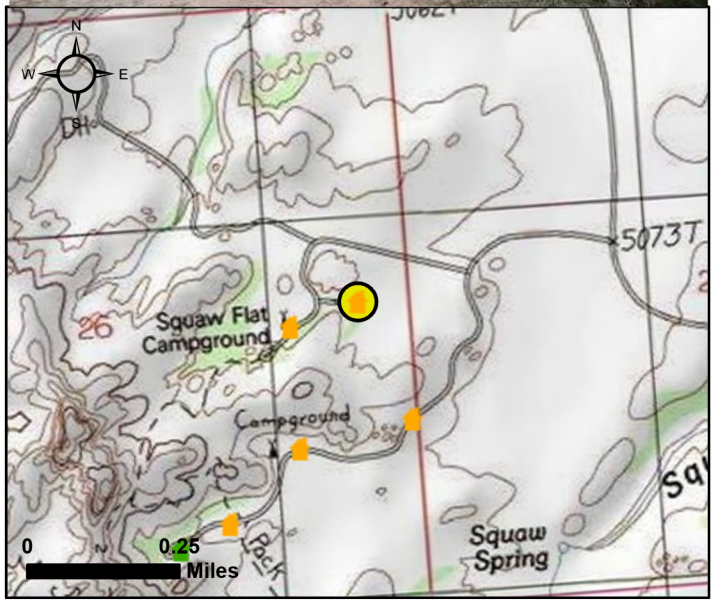

NPS Wildland Fire Risk Assessment - Facility Assessment

For more information visit https://wildfire-risk-assessments-nifc.hub.arcgis.com/

Facility Name: Entrance Station
Unit - Location: CANY - Needles
FMSS ID: not found , ***Local ID:***
Structure Type, Use: Building, Administrative
Owner: National Park Service
Field Crew, Visit Date: Shawn Castillo, March 9, 2021
Coordinates (DDM): 38° 10.10979744' N 109° 45.20652360' W

Rating: Low
ProtectionLevel: ,
Resources of Concern: Unknown
Occupied: Yes
In Community: No,
Revisit Interval: 7 yrs
Map Label: 73

Primary Access: Road
Ingress Egress: 1 road in/out
Access Width: 1.5 lanes (Greater than 18')
Access Condition: Surfaced-paved, gradeGreater than 5%
Bridge Condition: Less than 300 ft with turnaround
Access and Turnarounds: Less than 300 ft with turnaround
Facility Number or Sign: None or not clearly visible
Fuel Type: Grass and shrub, hardwood litter
Fuel Load: Light or no wildland fuels
Defensible Space: 100 ft treated
Topography: Slope Less than 5%
Roof Material: Fire resistant- tar,rubberized
Siding Material: Rock, concrete, metal
Foundation: Closed, Greater than 30in masonry exposed or N/A
Firewood: None
Water Supply: Limited or dependent on electricity
Propane: None
Overhead Hazards: No overhead hazards
Comments:



