


Horseshoe Bend

HOBE - Horseshoe Bend National Military Park

National Park Service
U.S. Department of the Interior

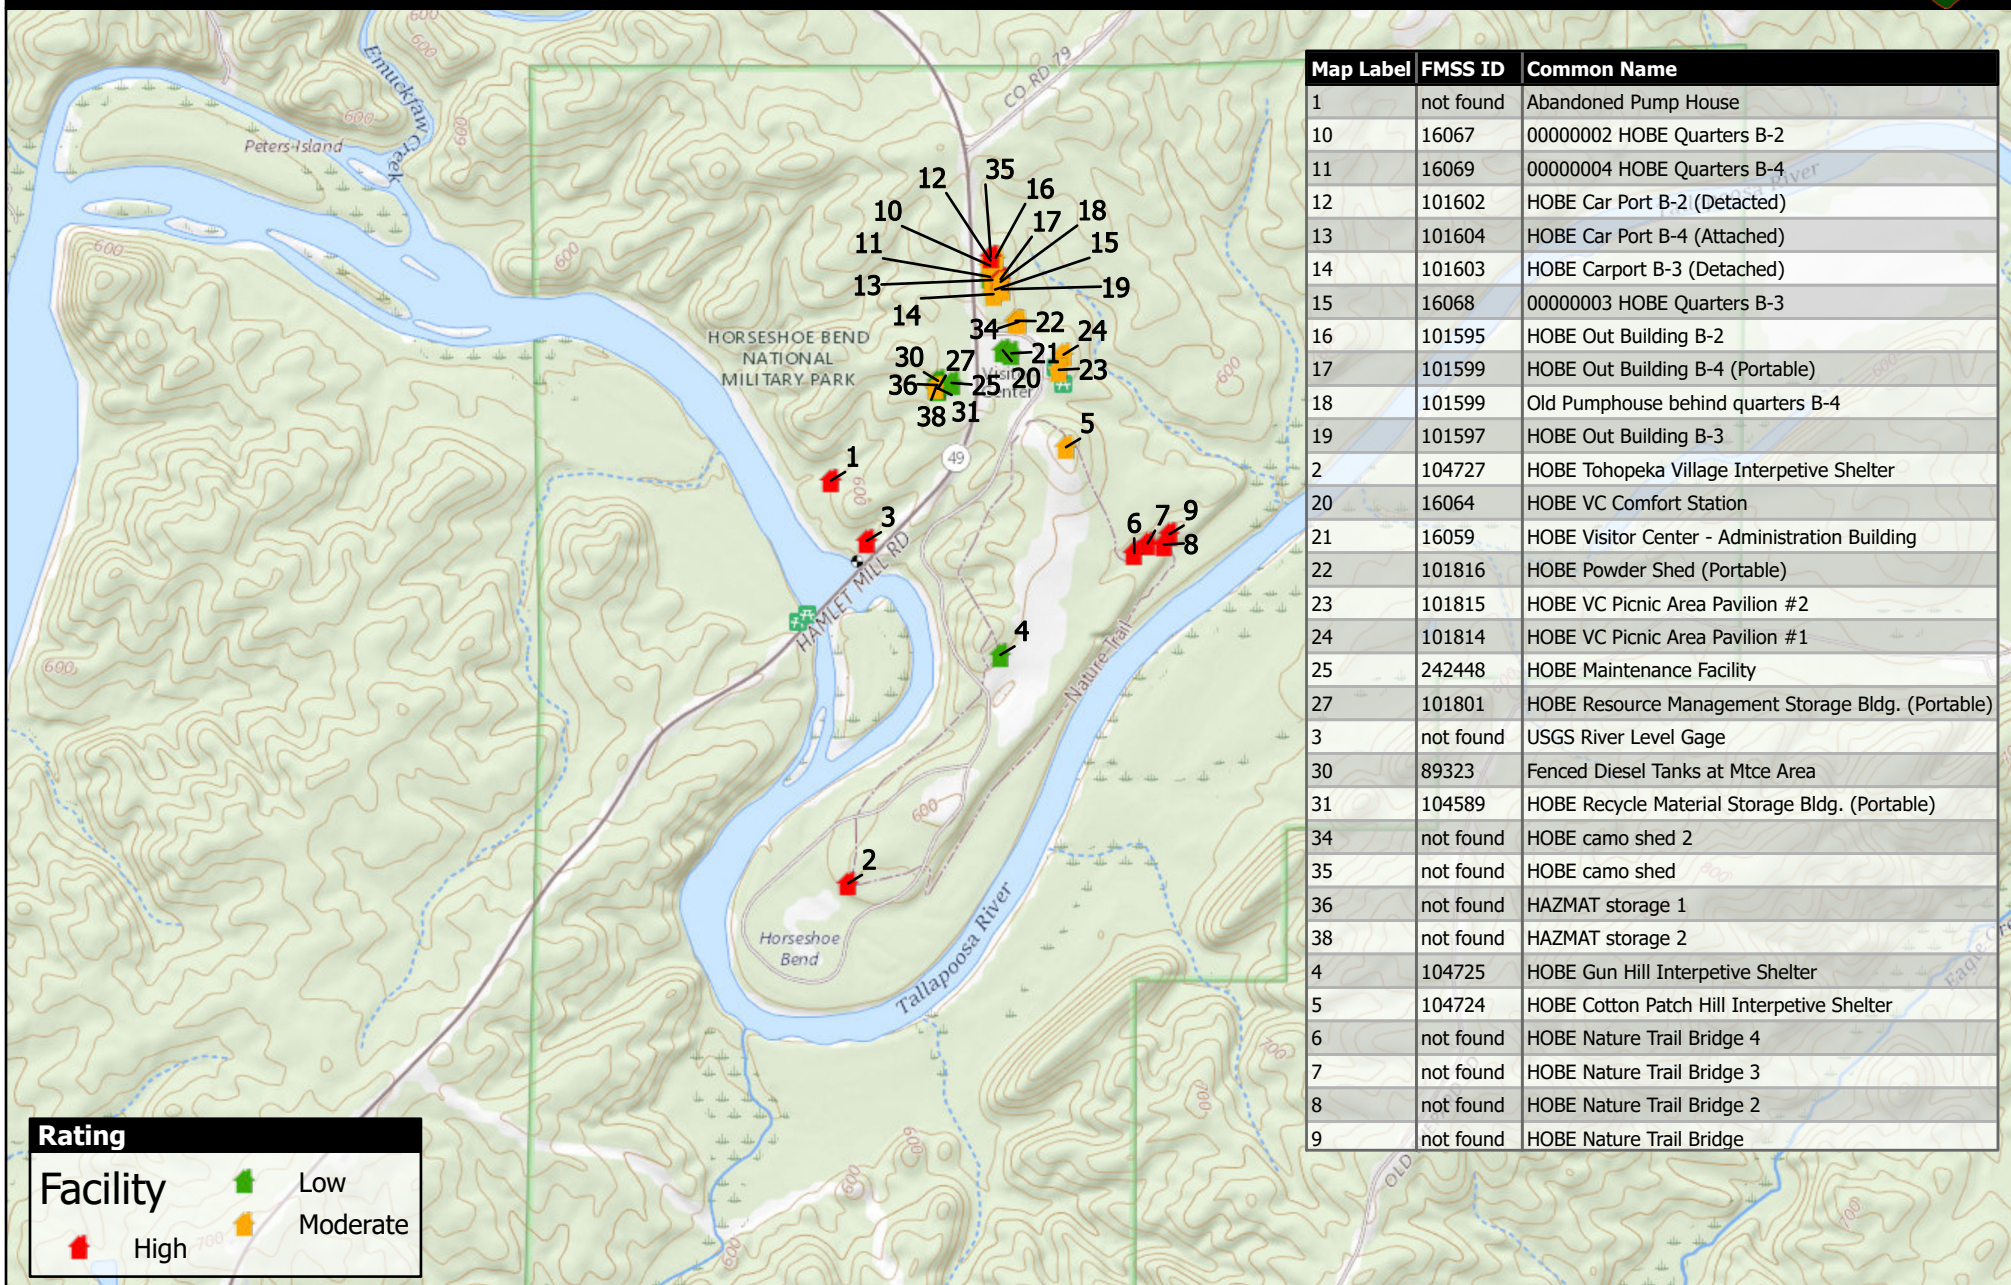

Author: sszturm
1/29/2024 7:41 AM

0 0.25 0.5 0.75 1 Miles

Scale: 1:24,000

NPS Wildfire Risk Assessments
NPS Fire GIS
January 2024
Data Sources: ESRI Basedata, NPS
NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Abandoned Pump House

Unit - Location: HOBE - HOBE
FMSS ID: not found
Structure Type: Building
Structure Use: Admin
Owner: Unknown
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 32° 58.7579' **Long(WGS84):** -85° 44.4266'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Non-surfaced- gravel,dirt,grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: No defensible space
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: no longer in use. photo is from nearby pumphouse in employee quarters of similar design



2021_HOBE_not found _Abandoned Pump House_Front.jpg



Score: 65
Rating: High

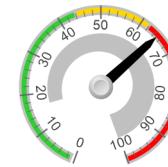

Asset Priority Index (API):
N/A



Factors Driving the Ratings

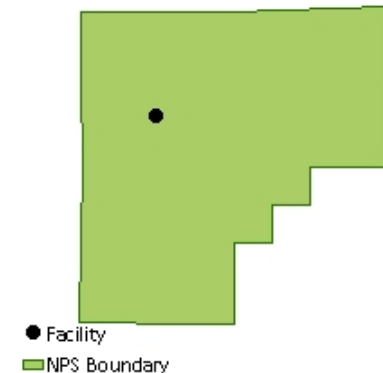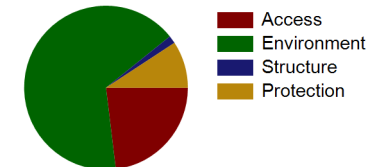



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Tohopeka Village Interpretive Shelter

Unit - Location: HOBE - HOBE
FMSS ID: 104727
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 32° 58.1794' Long(WGS84): -85° 44.3981'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: from parking area, 100m walk along paved trail. best safety zone is at gun hill exhibit or visitor center




2021_HOBE_104727_HOBE Tohopeka Village Interpretive Shelter_Front.jpg



Score: 66
Rating: High

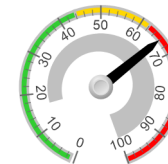

Asset Priority Index
(API):
71

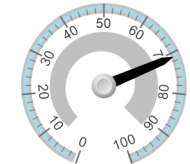

Factors Driving the Ratings

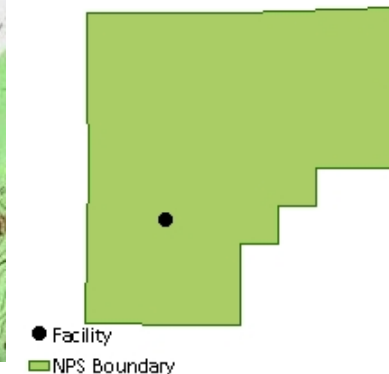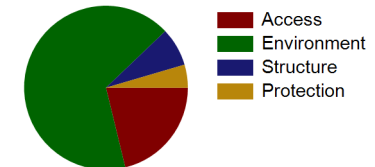



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: USGS River Level Gage

Unit - Location: HOBE - HOBE
FMSS ID: not found
Structure Type: Building
Structure Use: Admin
Owner: Unknown
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: High
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 32° 58.6714' **Long(WGS84):** -85° 44.3655'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: No defensible space
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 21% to 30%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: No safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_HOBE_not found _USGS River Level Gage_Front.jpg


Score: 68
Rating: High

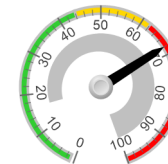


Asset Priority Index (API):
N/A



Factors Driving the Ratings

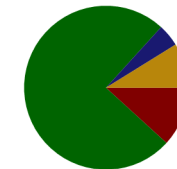

Access
Environment
Structure
Protection

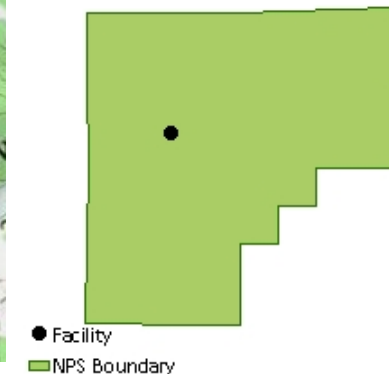



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Gun Hill Interpretive Shelter

Unit - Location: HOBE - HOBE
FMSS ID: 104725
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 32° 58.5074' **Long(WGS84):** -85° 44.1369'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: None visible
Assessment Comments:




2021_HOBE_104725_HOBE Gun Hill Interpretive Shelter_Front.jpg


Score: 41
Rating: Low

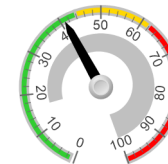

Asset Priority Index (API): 71

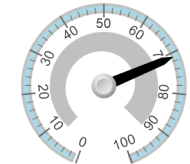

Factors Driving the Ratings

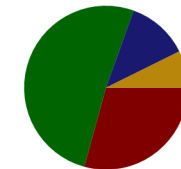

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Cotton Patch Hill Interpretive Shelter

Unit - Location: HOBE - HOBE
FMSS ID: 104724
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? No
Lat(WGS84): 32° 58.8057' **Long(WGS84):** -85° 44.0248'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Slash
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





2021_HOBE_104724_HOBE Cotton Patch Hill Interpretive Shelter_Front.jpg



Score: 49 **Asset Priority Index (API): 71**
Rating: Moderate

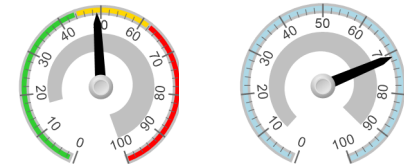

Factors Driving the Ratings

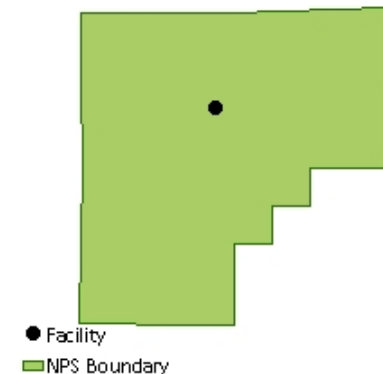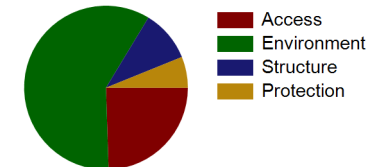



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Nature Trail Bridge 4

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Fence

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 32° 58.6539' Long(WGS84): -85° 43.9079'

Primary Access: Foot

Ingress/Egress: N/A, access by foot, boat or air only

Access Width: N/A, access by foot, boat or air only

Access Condition: N/A, access by foot, boat or air only

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: N/A,access by foot,boat,or air only

Facility Number/Sign: None or not clearly visible

Defensible Space: No defensible space

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments: Wooden Bridge. from parking area, 0.4 mile hike along nature trail. return on nature trail to get to cotton patch exhibit (safety zone)



2021_HOBE_not found _HOBE Nature Trail Bridge 4_Front.jpg




Score: 110
Rating: High

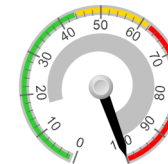


Asset Priority Index
(API):
N/A



Factors Driving the Ratings

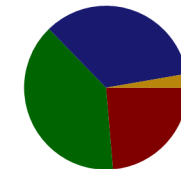

Access
Environment
Structure
Protection

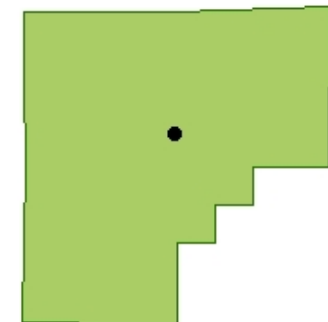

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Nature Trail Bridge 3

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Fence

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? No

Lat(WGS84): 32° 58.6674' Long(WGS84): -85° 43.8852'

Primary Access: Foot

Ingress/Egress: N/A, access by foot, boat or air only

Access Width: N/A, access by foot, boat or air only

Access Condition: N/A, access by foot, boat or air only

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: N/A,access by foot,boat,or air only

Facility Number/Sign: None or not clearly visible

Defensible Space: No defensible space

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Wooden Bridge. from parking area, 0.4 mile hike along nature trail



2021_HOBE_not found _HOBE Nature Trail Bridge 3_Front.jpg


Score: 110
Rating: High

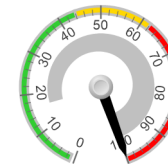


Asset Priority Index
(API):
N/A



Factors Driving the Ratings

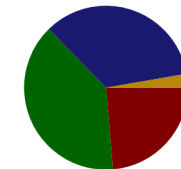

Access
Environment
Structure
Protection

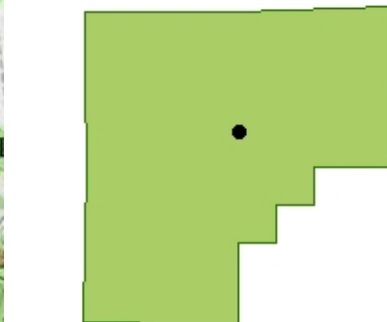

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Nature Trail Bridge 2

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Fence

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 32° 58.6661' Long(WGS84): -85° 43.8573'

Primary Access: Foot

Ingress/Egress: N/A, access by foot, boat or air only

Access Width: N/A, access by foot, boat or air only

Access Condition: N/A, access by foot, boat or air only

Bridge Condition: None/nonflammable, load limit will not limit response

Access & Turnarounds: N/A, access by foot, boat, or air only

Facility Number/Sign: None or not clearly visible

Defensible Space: No defensible space

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: Combustible, adjacent, no veg/debris clearance

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Wooden Bridge. from parking area, 0.5 mile hike along nature trail



2021_HOBE_not found _HOBE Nature Trail Bridge 2_Front.jpg


Score: 110
Rating: High

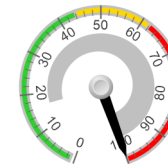



Asset Priority Index
(API):
N/A



Factors Driving the Ratings

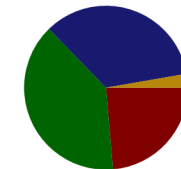

Access
Environment
Structure
Protection

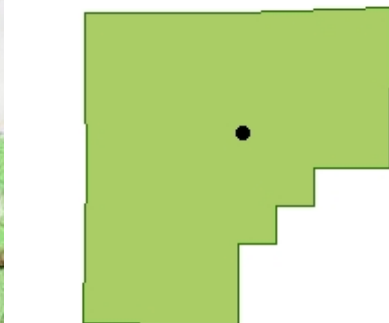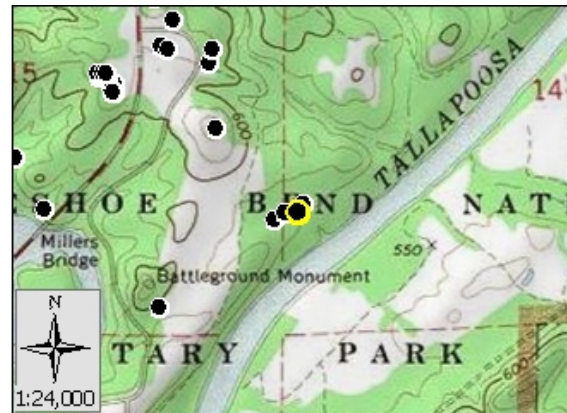

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Nature Trail Bridge

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Fence

Structure Use: Private

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? No

Lat(WGS84): 32° 58.6809' Long(WGS84): -85° 43.8477'

Primary Access: Foot

Ingress/Egress: N/A, access by foot, boat or air only

Access Width: N/A, access by foot, boat or air only

Access Condition: N/A, access by foot, boat or air only

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: N/A,access by foot,boat,or air only

Facility Number/Sign: None or not clearly visible

Defensible Space: No defensible space

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Combustible or no roof

Siding Material: Wood or open sided

Foundation: Open or deck

Fences/Decks: Combustible,adjacent,no veg/debris clearance

Firewood: None

Propane Tanks: None

Water Supply: Reliable water source nearby

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: Wooden Bridge. from parking area, 0.5 mile hike along nature trail



2021_HOBE_not found _HOBE Nature Trail Bridge_Front.jpg


Score: 110
Rating: High

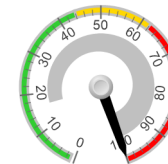



Asset Priority Index
(API):
N/A



Factors Driving the Ratings

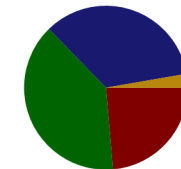

Access
Environment
Structure
Protection

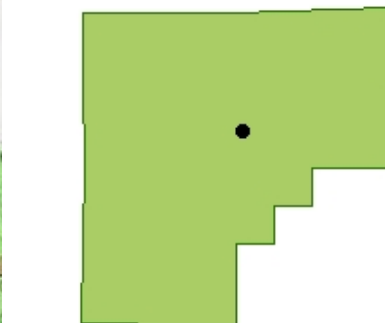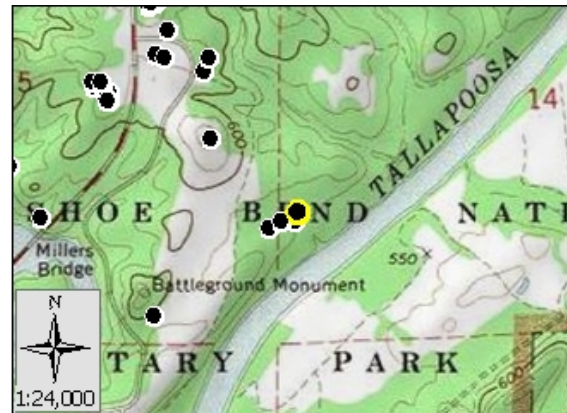

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: 00000002 HOBE Quarters B-2

Unit - Location: HOBE - HOBE

FMSS ID: 16067

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0664' Long(WGS84): -85° 44.1548'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: house number reads "11412"



2021_HOBE_16067_00000002 HOBE Quarters B-2_Front.jpg

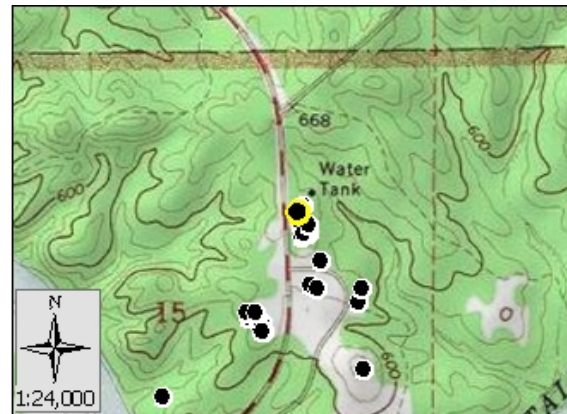


Score: 52
Rating: Moderate

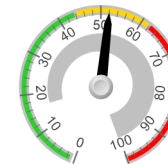


Asset Priority Index
(API):
23



Factors Driving the Ratings

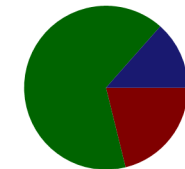

Access
Environment
Structure
Protection

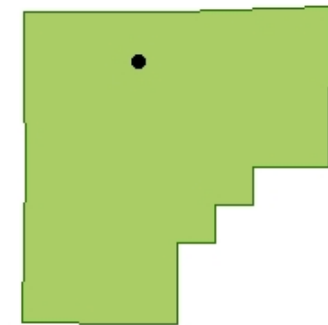

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: 00000004 HOBE Quarters B-4

Unit - Location: HOBE - HOBE

FMSS ID: 16069

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0505' Long(WGS84): -85° 44.1545'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments: house number reads "11384"



2021_HOBE_16069_00000004 HOBE Quarters B-4_Front.jpg

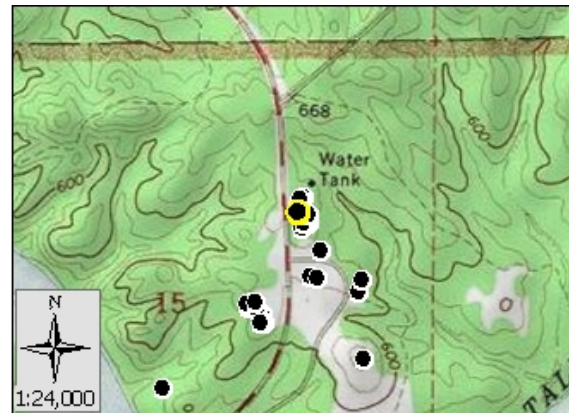


Score: 44
Rating: Low

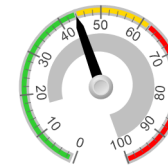


Asset Priority Index
(API):
23



Factors Driving the Ratings

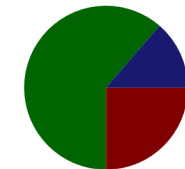

Access
Environment
Structure
Protection

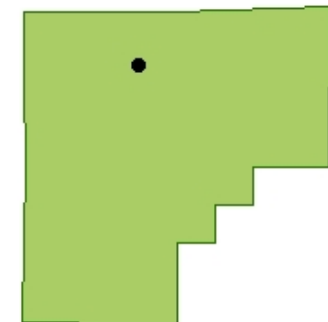

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Car Port B-2 (Detacted)

Unit - Location: HOBE - HOBE
FMSS ID: 101602
Structure Type: Shade
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 32° 59.0738' **Long(WGS84):** -85° 44.1539'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_HOBE_101602_HOBE Car Port B-2 (Detacted)_Front.jpg

Score: 56
Rating: Moderate


Asset Priority Index (API): 13

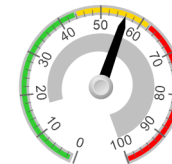

Factors Driving the Ratings

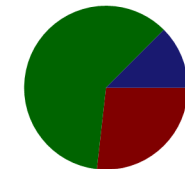

Access
Environment
Structure
Protection

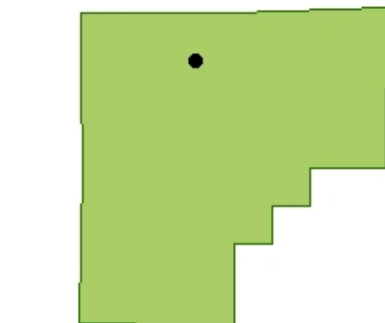

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Car Port B-4 (Attached)

Unit - Location: HOBE - HOBE

FMSS ID: 101604

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0458' Long(WGS84): -85° 44.1507'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2021_HOBE_101604_HOBE Car Port B-4
(Attached)_Front.jpg

Score: 48
Rating: Moderate

Asset Priority Index
(API):
13

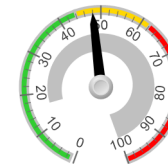

Factors Driving the Ratings

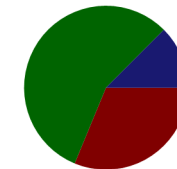

Access
Environment
Structure
Protection



● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Carport B-3 (Detached)

Unit - Location: HOBE - HOBE

FMSS ID: 101603

Structure Type: Shade

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0254' **Long(WGS84):** -85° 44.1485'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Wood or open sided

Foundation: Closed, < 6in masonry exposed

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2021_HOBE_101603_HOBE Carport B-3 (Detached)_Front.jpg

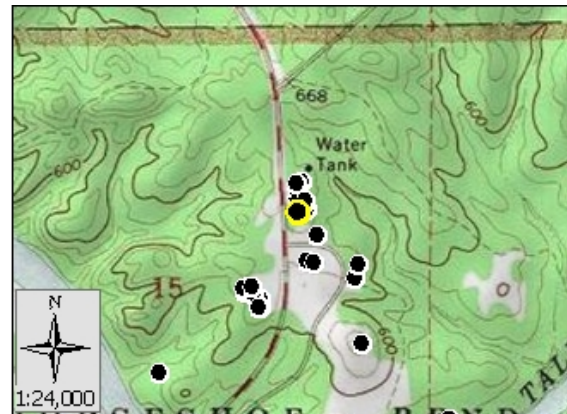


Score: 49
Rating: Moderate

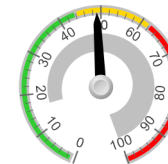


Asset Priority Index (API): 13



Factors Driving the Ratings

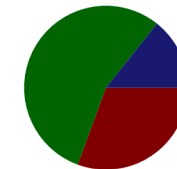

Access
Environment
Structure
Protection

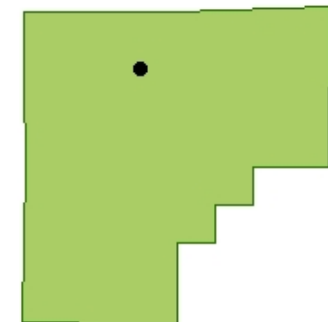

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: 00000003 HOBE Quarters B-3

Unit - Location: HOBE - HOBE

FMSS ID: 16068

Structure Type: Building

Structure Use: Residence

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0319' Long(WGS84): -85° 44.1459'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: 100 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Fire resistant- tar,rubberized

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: house number reads "11360"



2021_HOBE_16068_00000003 HOBE Quarters B-3_Front.jpg


Score: 40
Rating: Low

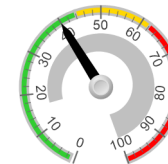


Asset Priority Index
(API):
23



Factors Driving the Ratings

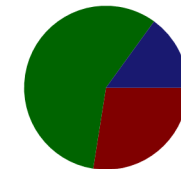

Access
Environment
Structure
Protection

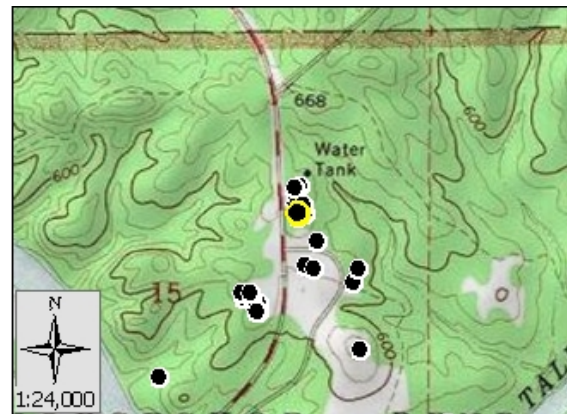

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Out Building B-2

Unit - Location: HOBE - HOBE
FMSS ID: 101595
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 32° 59.0774' **Long(WGS84):** -85° 44.1451'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: Combustible but separated from facility
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_HOBE_101595_HOBE Out Building B-2_Front.jpg

Score: 61
Rating: Moderate
Asset Priority Index (API):
7

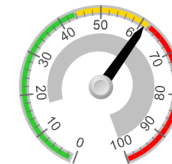

Factors Driving the Ratings

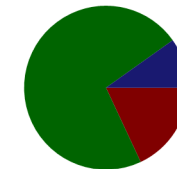

■ Access
 ■ Environment
 ■ Structure
 ■ Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Out Building B-4 (Portable)

Unit - Location: HOBE - HOBE

FMSS ID: 101599

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0467' Long(WGS84): -85° 44.1365'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_HOBE_101599_HOBE Out Building B-4 (Portable)_Front.jpg


Score: 63
Rating: High

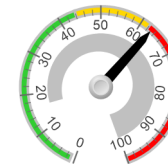


Asset Priority Index (API):
7



Factors Driving the Ratings

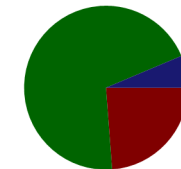

Access
Environment
Structure
Protection

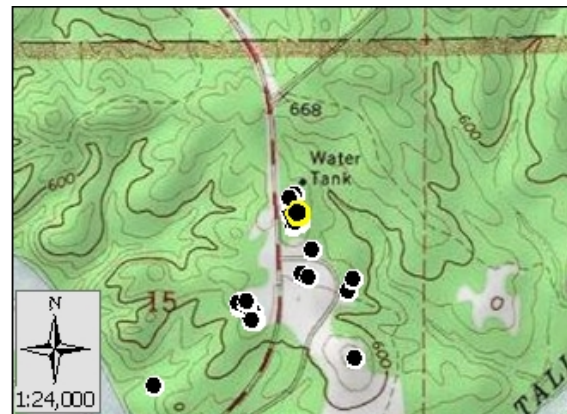



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Old Pumphouse behind quarters B-4

Unit - Location: HOBE - HOBE

FMSS ID: 101599

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0432' Long(WGS84): -85° 44.1365'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments: not used



2021_HOBE_101599_Old Pumphouse behind quarters B-4_Front.jpg


Score: 60
Rating: Moderate

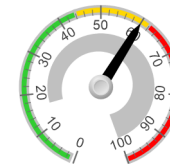


Asset Priority Index
(API):
7



Factors Driving the Ratings

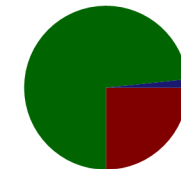

Access
Environment
Structure
Protection

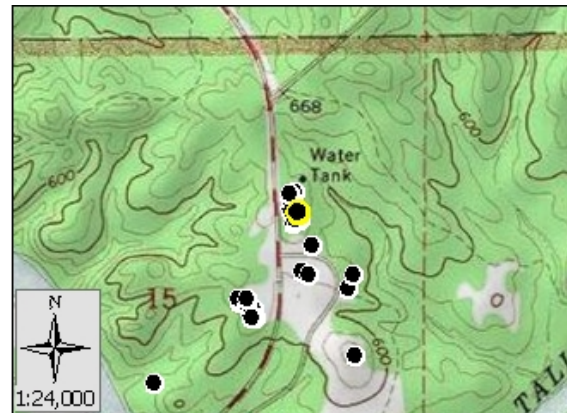

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Out Building B-3

Unit - Location: HOBE - HOBE
FMSS ID: 101597
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 32° 59.0325' **Long(WGS84):** -85° 44.1344'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1 lane (<18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/o turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: Combustible, adjacent, clear of veg/debris
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments: From FMSS_Export - FRPP_PREDUSE: Bldg. Housing, Support (GSF)





2021_HOBE_101597_HOBE Out Building B-3_Front.jpg

Score: 56
Rating: Moderate
Asset Priority Index (API): 7

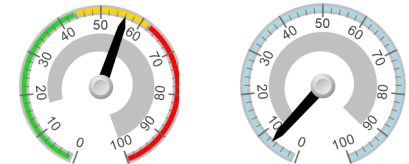

Factors Driving the Ratings

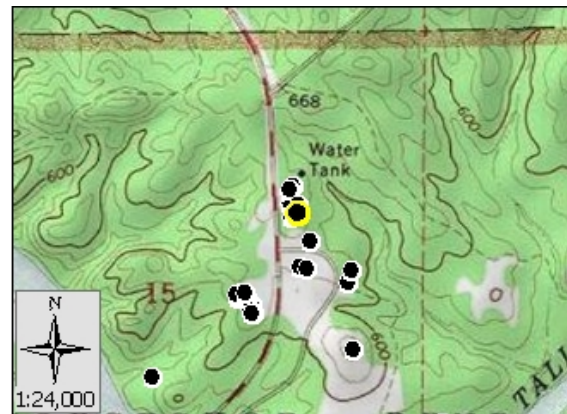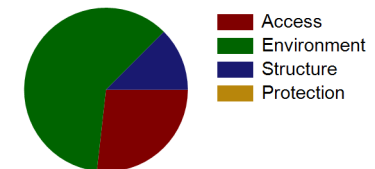



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE VC Comfort Station

Unit - Location: HOBE - HOBE

FMSS ID: 16064

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 58.9447' Long(WGS84): -85° 44.1328'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat: None visible

Assessment Comments:



2021_HOBE_16064_HOBE VC Comfort Station_Front.jpg


Score: 18
Rating: Low

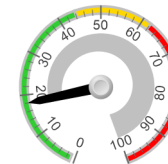



Asset Priority Index
(API):
77



Factors Driving the Ratings

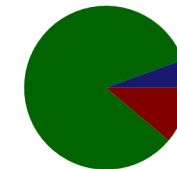

Access
Environment
Structure
Protection

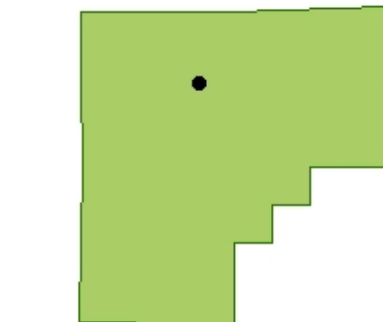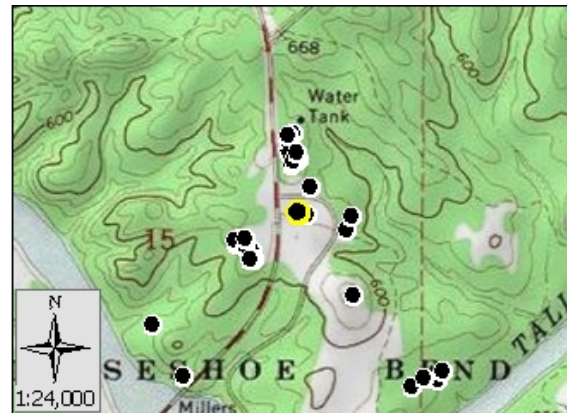

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Visitor Center - Administration Building

Unit - Location: HOBE - HOBE

FMSS ID: 16059

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 58.9406' Long(WGS84): -85° 44.1182'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: Marked and clearly visible

Defensible Space: >100ft treated

Fuel Load (w/in 300 ft): Light

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible, adjacent, clear of veg/debris

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat: None visible

Assessment Comments:



2021_HOBE_16059_HOBE Visitor Center - Administration Building_Front.jpg


Score: 17
Rating: Low

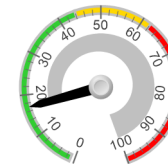


Asset Priority Index
(API):
92



Factors Driving the Ratings

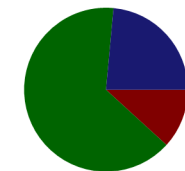

Access
Environment
Structure
Protection

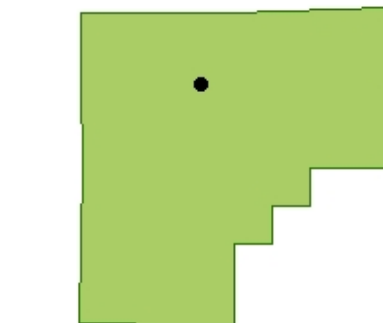

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Powder Shed (Portable)

Unit - Location: HOBE - HOBE
FMSS ID: 101816
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 32° 58.9872' **Long(WGS84):** -85° 44.1108'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Gun powder inside
Assessment Comments:




2021_HOBE_101816_HOBE Powder Shed (Portable)_Front.jpg




Score: 53
Rating: Moderate

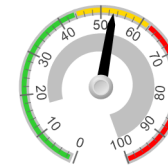


Asset Priority Index (API): 52

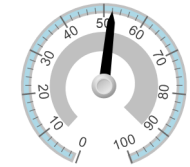

Factors Driving the Ratings

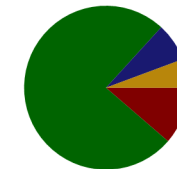

Access
Environment
Structure
Protection

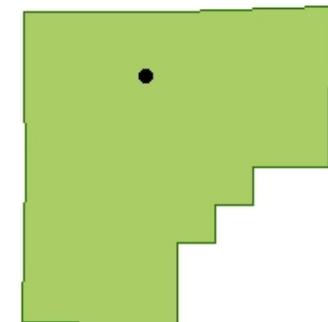

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE VC Picnic Area Pavilion #2

Unit - Location: HOBE - HOBE
FMSS ID: 101815
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 32° 58.9169' **Long(WGS84):** -85° 44.037'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





2021_HOBE_101815_HOBE VC Picnic Area Pavilion #2_Front.jpg



Score: 56
Rating: Moderate
Asset Priority Index (API): 24

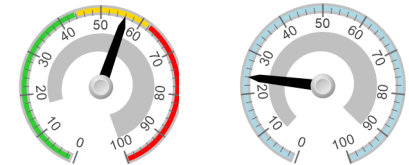

Factors Driving the Ratings

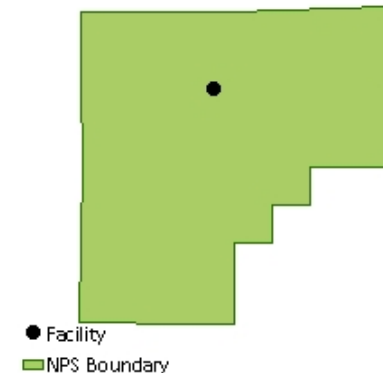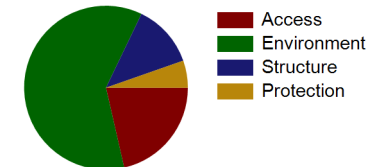



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE VC Picnic Area Pavilion #1


Unit - Location: HOBE - HOBE
FMSS ID: 101814
Structure Type: Shade
Structure Use: Public
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Visitor Center
Lat(WGS84): 32° 58.9386' Long(WGS84): -85° 44.0289'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Reliable water source nearby
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2021_HOBE_101814_HOBE VC Picnic Area Pavilion #1_Front.jpg

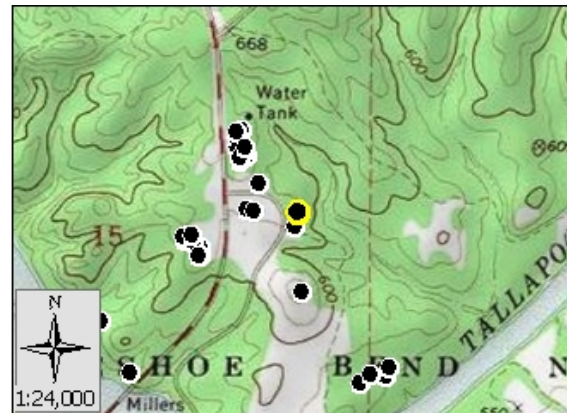

Score: 57
Rating: Moderate
Asset Priority Index (API): 24

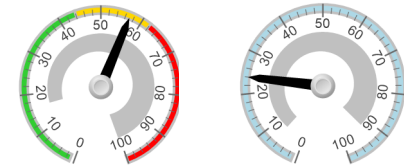

Factors Driving the Ratings

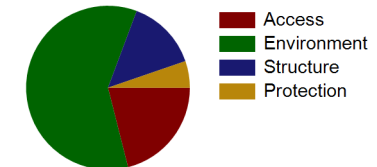



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Material Pole Shed

Unit - Location: HOBE - HOBE
FMSS ID: 101808
Structure Type: None Found
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: None
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.8982' **Long(WGS84):** -85° 44.2597'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible but separated from facility
Firewood: None
Propane Tanks:
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage
Assessment Comments: This area was under construction when visited in 2021. Many building in Maintenance area were moved around. Revisit in 2022 if possible.



2016 HOBE_101808_HOBE Material Pole Shed_Front.jpg


Score:
Rating: None

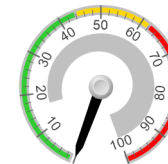


Asset Priority Index (API):
7



Factors Driving the Ratings

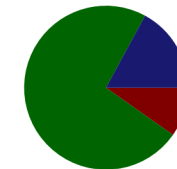

■ Access
■ Environment
■ Structure

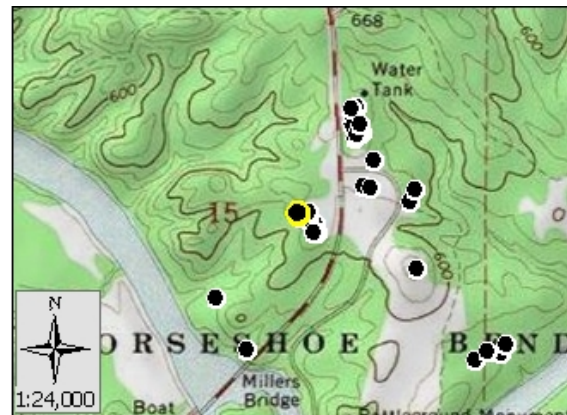



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Sign Shed

Unit - Location: HOBE - HOBE
FMSS ID: 101805
Structure Type: Shade
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.8922' **Long(WGS84):** -85° 44.2565'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: No defensible space
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage
Assessment Comments: From FMSS_Export - FRPP_PREDUSE: Bldg. Shed/Outbuilding (GSF)



2016 HOBE_101805_HOBE Sign Shed_Front.jpg


Score: 50
Rating: Moderate

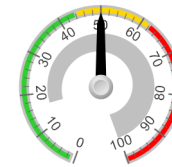

Asset Priority Index (API):
7



Factors Driving the Ratings

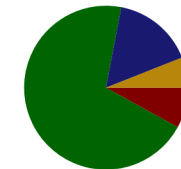

■ Access
■ Environment
■ Structure
■ Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Resource Management Storage Bldg. (Portable)

Unit - Location: HOBE - HOBE
FMSS ID: 101801
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.9004' **Long(WGS84):** -85° 44.2502'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage
Assessment Comments:



2021_HOBE_101801_HOBE Resource Management Storage Bldg. (Portable)_Front.jpg


Score: 39
Rating: Low

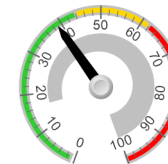

Asset Priority Index (API): 32



Factors Driving the Ratings

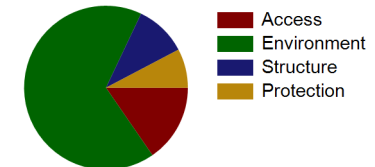



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Tractor Pole Shed

Unit - Location: HOBE - HOBE
FMSS ID: 101807
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.9004' **Long(WGS84):** -85° 44.2423'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage
Assessment Comments: under construction. other "not found" facilities may be moved for construction purposes. this new facility will replace existing maintenance building



2021_HOBE_101807_HOBE Tractor Pole Shed_Front.jpg



Score: 42
Rating: Low

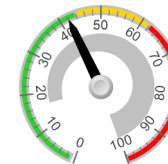

Asset Priority Index (API): 17



Factors Driving the Ratings

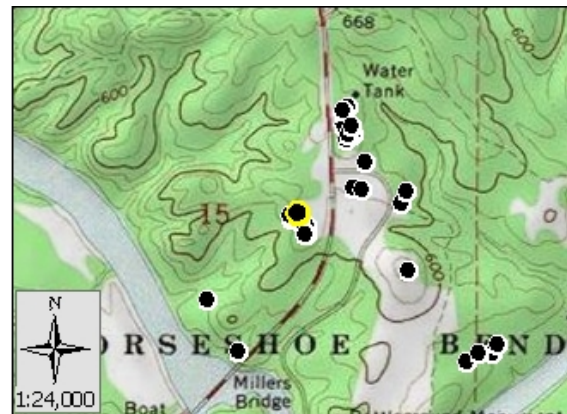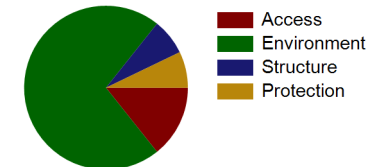



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Fuel Shed

Unit - Location: HOBE - HOBE
FMSS ID: 101802
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.8901' **Long(WGS84):** -85° 44.24'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage
Assessment Comments:



2016 HOBE_101802_HOBE Fuel Shed_Front.jpg



Score: 30
Rating: Low

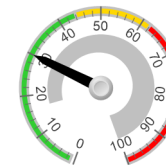

Asset Priority Index (API): 52



Factors Driving the Ratings

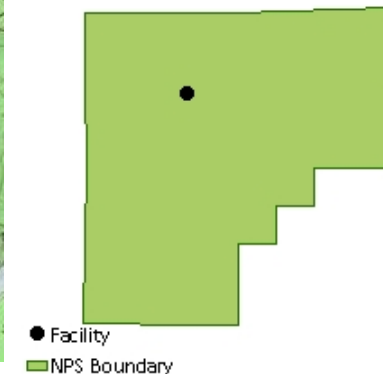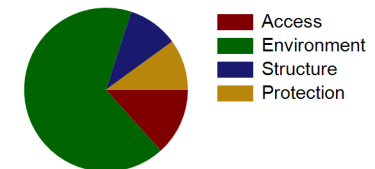



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Fenced Diesel Tanks at Mtce Area

Unit - Location: HOBE - HOBE
FMSS ID: 89323
Structure Type: Utility
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Low
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.8746' **Long(WGS84):** -85° 44.2332'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage and fuel depot
Assessment Comments:



2021_HOBE_89323_Fenced Diesel Tanks at Mtce Area_Front.jpg


Score: 42
Rating: Low

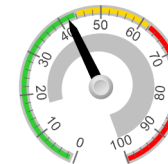


Asset Priority Index (API):
N/A



Factors Driving the Ratings

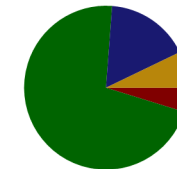

Access
Environment
Structure
Protection

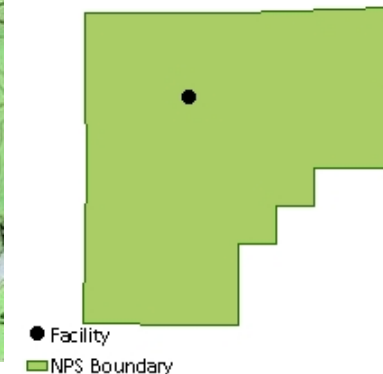

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Recycle Material Storage Bldg. (Portable)

Unit - Location: HOBE - HOBE
FMSS ID: 104589
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.867' **Long(WGS84):** -85° 44.2302'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Fuel depot
Assessment Comments:




2021_HOBE_104589_HOBE Recycle Material Storage Bldg. (Portable)_Front.jpg

Score: 53
Rating: Moderate

Asset Priority Index (API):
7

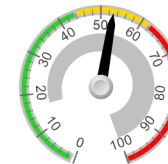

Factors Driving the Ratings

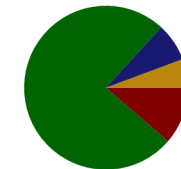

Access
Environment
Structure
Protection





NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Maintenance Building

Unit - Location: HOBE - HOBE

FMSS ID: 16088

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Low

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? Yes

Local ID: [Local_ID]

In a Community? Yes - Maintenance Area

Lat(WGS84): 32° 58.8813' Long(WGS84): -85° 44.2271'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: Overhead hazards will limit aircraft

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT

Triage Category:


Hazmat: Flammables storage and fuel depot

Assessment Comments:



2021_HOBE_16088_HOBE Maintenance Building_Front.jpg


Score: 43
Rating: Low

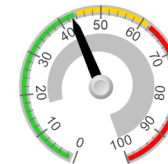


Asset Priority Index
(API):
69



Factors Driving the Ratings

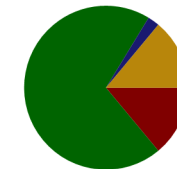

Access
Environment
Structure
Protection

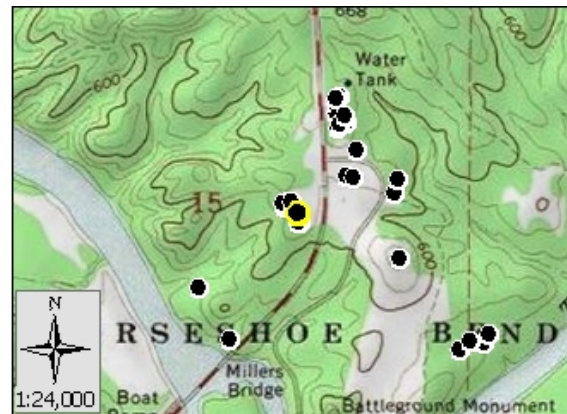



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE Oil Shed

Unit - Location: HOBE - HOBE
FMSS ID: 101804
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021


Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.867' **Long(WGS84):** -85° 44.2253'

Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage and fuel depot
Assessment Comments:



2021_HOBE_101804_HOBE Oil Shed_Front.jpg


Score: 53
Rating: Moderate

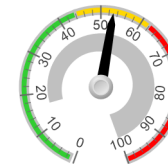


Asset Priority Index (API): 52



Factors Driving the Ratings

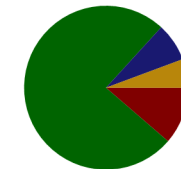

Access
Environment
Structure
Protection

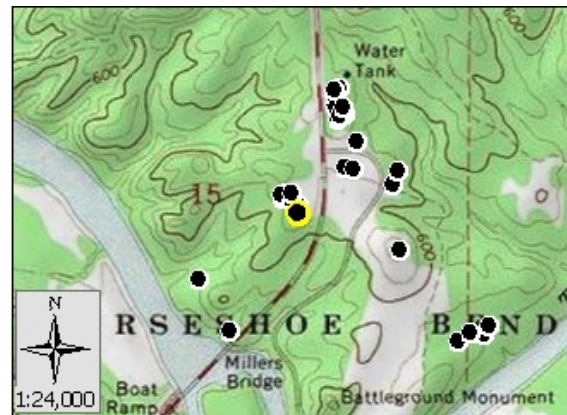



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE camo shed 2

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 58.9855' Long(WGS84): -85° 44.1058'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Slash

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT

Triage Category:


Hazmat: Gun powder inside adjacent shed

Assessment Comments:



2021_HOBE_not found _HOBE camo shed 2_Front.jpg


Score: 55
Rating: Moderate

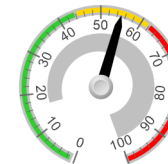

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

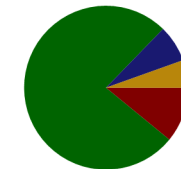

Access
Environment
Structure
Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HOBE camo shed

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: High

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Visitor Center

Lat(WGS84): 32° 59.0795' Long(WGS84): -85° 44.1533'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1 lane (<18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/o turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:


Hazmat:

Assessment Comments:



2021_HOBE_not found _HOBE camo shed_Front.jpg


Score: 63
Rating: High

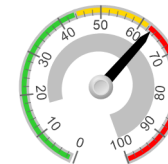

Asset Priority Index
(API):
N/A



Factors Driving the Ratings

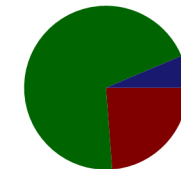

Access
Environment
Structure
Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HAZMAT storage 1

Unit - Location: HOBE - HOBE

FMSS ID: not found

Structure Type: Building

Structure Use: Admin

Owner: NPS

Field Crew: L. Catlin

Last Site Visit Date: 3/21/2021

Rating: Moderate

Protection Level : Not Designated

Resources of Concern Present? Unknown

Occupied? No

Local ID: [Local_ID]

In a Community? Yes - Maintenance Area

Lat(WGS84): 32° 58.8888' **Long(WGS84):** -85° 44.2483'

Primary Access: Road

Ingress/Egress: Two or more roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Heavy

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope <5%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Open or deck

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT

Triage Category:

Hazmat: Flammables storage


Assessment Comments: maybe this is sign shed facility?




2021_HOBE_not found _HAZMAT storage 1_Front.jpg

Score: 49
Rating: Moderate

Asset Priority Index (API):
N/A

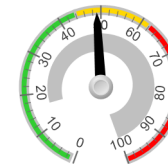

Factors Driving the Ratings

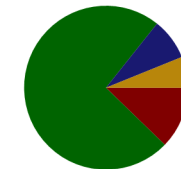

■ Access
■ Environment
■ Structure
■ Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Mobile Mini

Unit - Location: HOBE - HOBE
FMSS ID: not found
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.8856' **Long(WGS84):** -85° 44.2116'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage, diesel tanks
Assessment Comments: maybe this is fuel shed facility?




2021_HOBE_not found _Mobile Mini_Front.jpg

Score: 49
Rating: Moderate

Asset Priority Index (API):
N/A

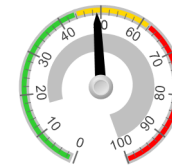

Factors Driving the Ratings

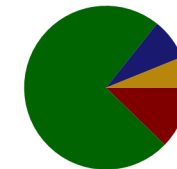

Access
Environment
Structure
Protection



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HAZMAT storage 2

Unit - Location: HOBE - HOBE
FMSS ID: not found
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: L. Catlin
Last Site Visit Date: 3/21/2021

Rating: Moderate
Protection Level : Not Designated
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Maintenance Area
Lat(WGS84): 32° 58.8831' **Long(WGS84):** -85° 44.249'


Primary Access: Road
Ingress/Egress: Two or more roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: No defensible space
Fuel Load (w/in 300 ft): Heavy
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Open or deck
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: Flammables storage
Assessment Comments: maybe this is fuel shed facility?




2021_HOBE_not found_HAZMAT storage 2_Front.jpg

Score: 54
Rating: Moderate

Asset Priority Index (API):
N/A

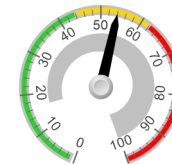

Factors Driving the Ratings

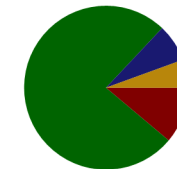

■ Access
■ Environment
■ Structure
■ Protection