


NPS Wildfire Risk Assessments Assessment Locations

Hovenweep National Monument

National Park Service
U.S. Department of the Interior

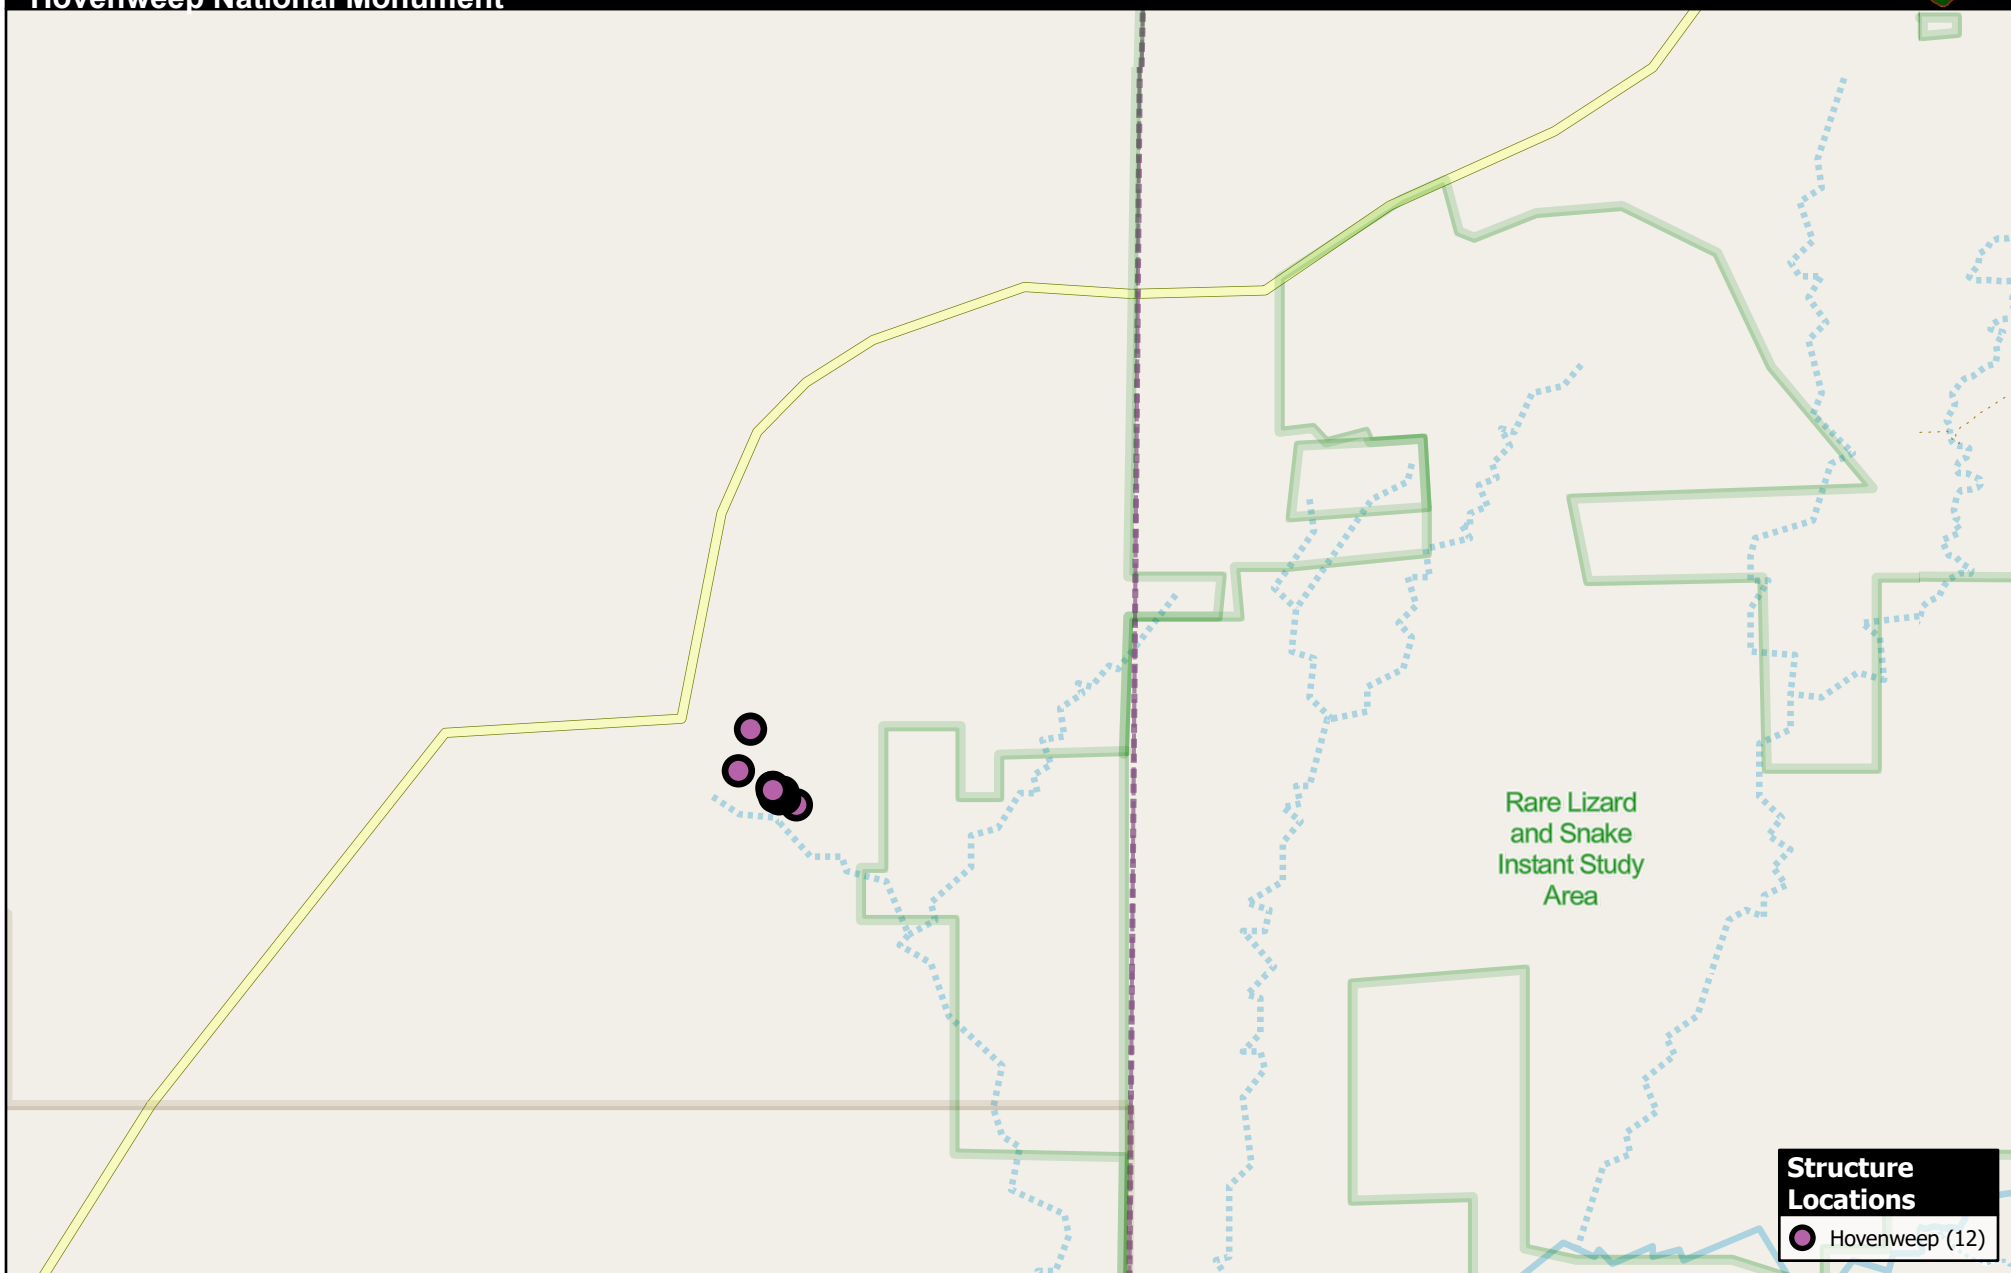

**Structure
Locations**
● Hovenweep (12)



0 5 Miles

Author: sszturm
2/9/2022 7:55 AM


Intermountain Region Geographic Resources Division
March 2020
Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project

Hovenweep National Monument

NPS Wildfire Risk Assessments

National Park Service
U.S. Department of the Interior

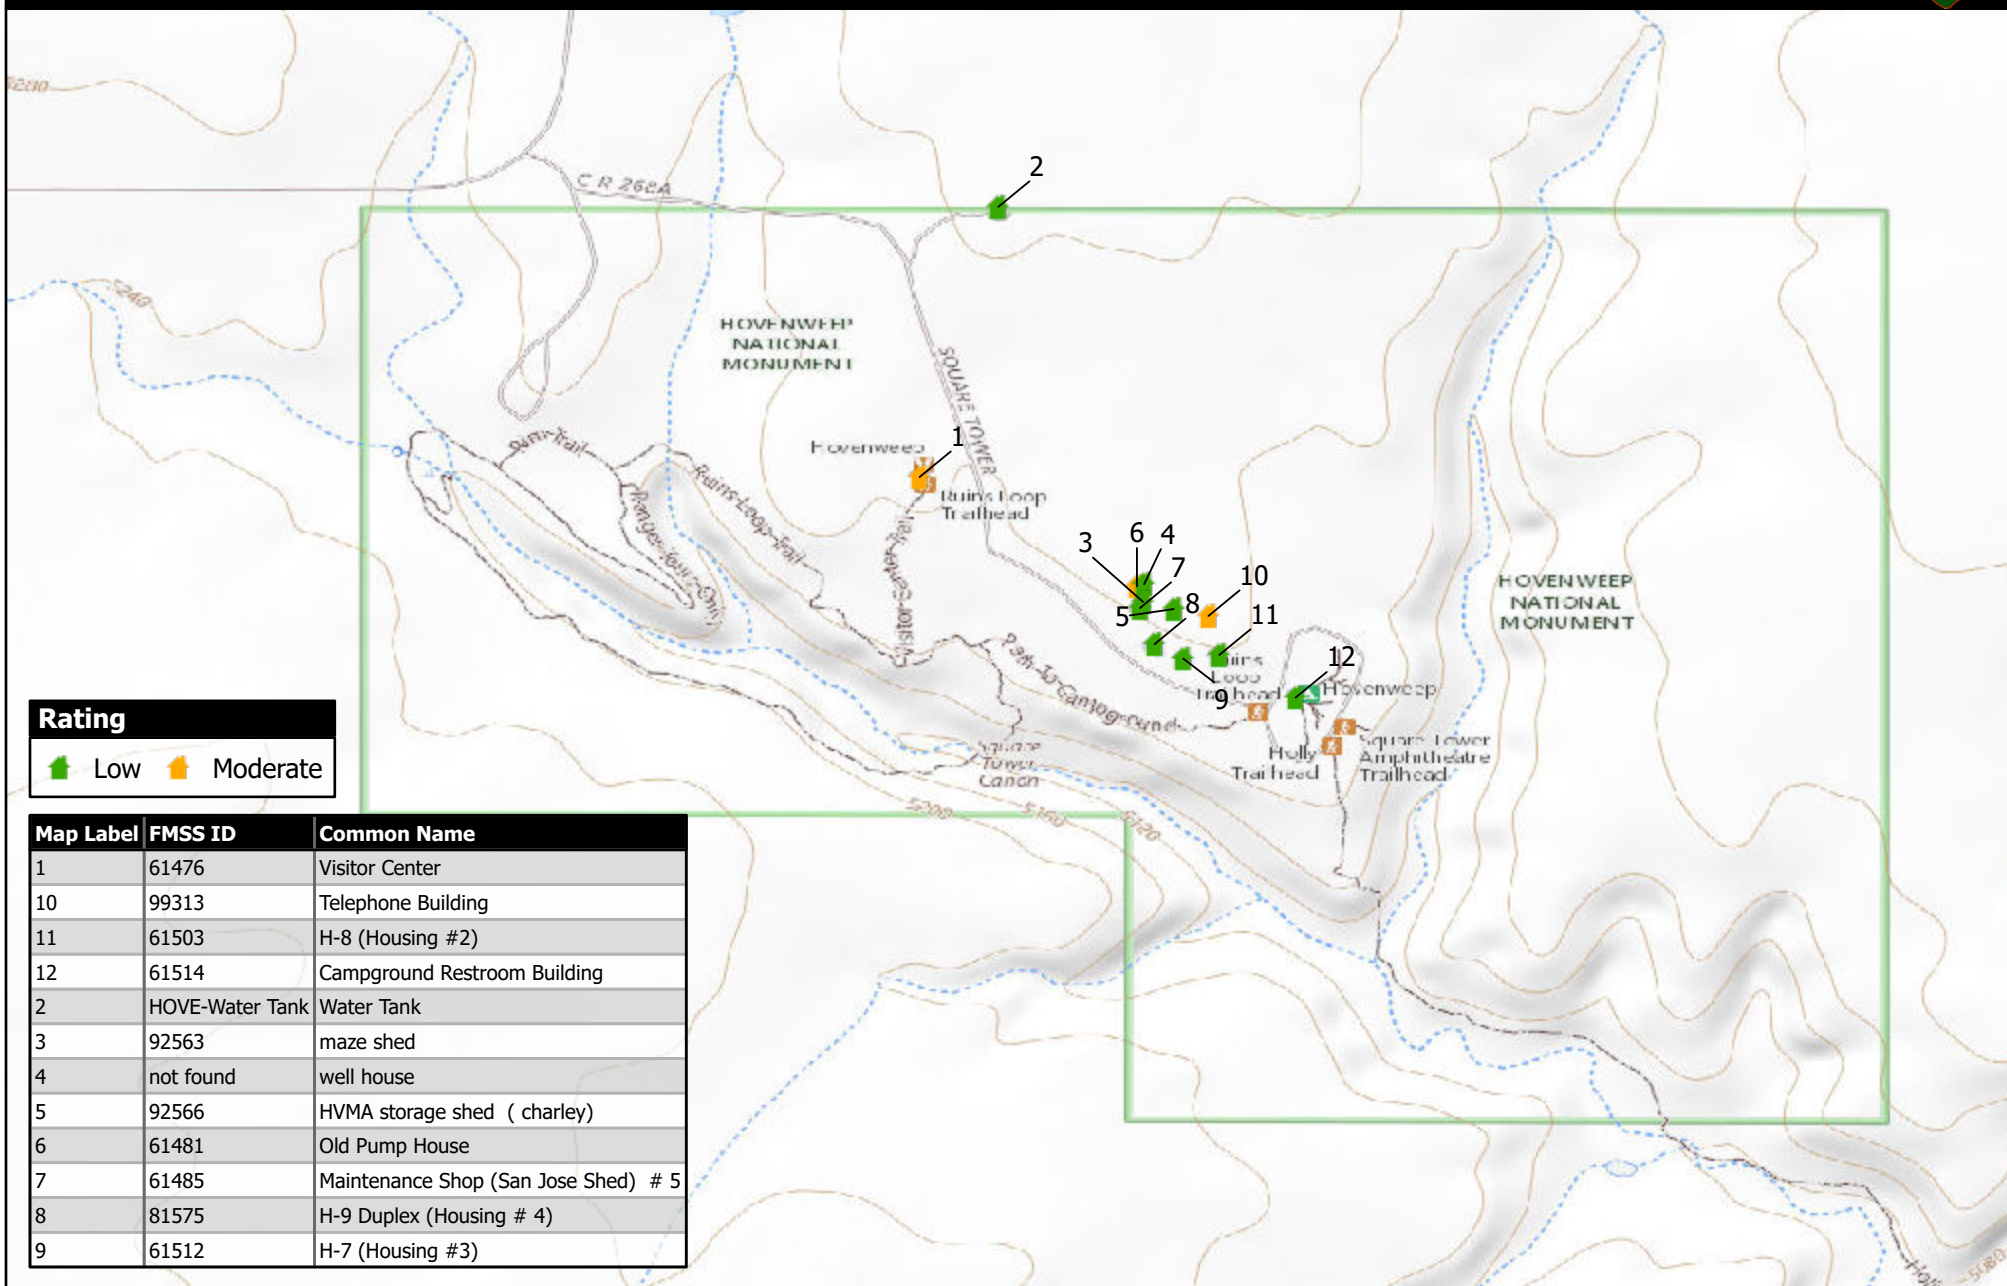

0

0.5
Miles

Author: sszturm
2/9/2022 7:51 AM

Intermountain Region Geographic Resources Division
March 2020

Data Sources: ESRI Basedata, NPS Park Data

NPS Wildfire Risk Assessment Project



NPS Wildand Fire Risk Assessment - Facility Wildfire Risk Assessment Summary

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: HOVE - Hovenweep

Label #	Facility Name	Owner	FMSS ID (if NPS owned)	Facility Type	Facility Use	Occupied	Last Site Visit Date*	Resource Of Concern	Score	Rating	Protection Level	Assessment Comments	Restriction
1	Visitor Center	NPS	61476	Building	Public	Y	3/15/20	Unknown	56	Moderate	Unknown		UNR
2	Water Tank	NPS	HOVE- Water Tank	Utility	Unknown	N	3/15/20	Unknown	39	Low	Unknown		UNR
3	maze shed	NPS	92563	Building	Admin	N	3/15/21	Unknown	27	Low	Unknown		UNR
4	well house	NPS	not found	Utility	Admin	N	3/15/21	Unknown	34	Low	Unknown		UNR
5	HVMA storage shed (charley)	NPS	92566	Building	Admin	N	3/15/21	Unknown	43	Low	Unknown		UNR
6	Old Pump House	NPS	61481	Utility	Admin	No	3/15/20	Unknown	60	Moderate	Unknown		UNR
7	Maintenance Shop (San Jose Shed) # 5	NPS	61485	Building	Admin	Yes	3/15/20	Unknown	38	Low	Unknown		UNR
8	H-9 Duplex (Housing # 4)	NPS	81575	Building	Admin	Y	3/15/20	Unknown	43	Low	Unknown		UNR
9	H-7 (Housing #3)	NPS	61512	Building	Admin		3/15/20	Unknown	41	Low	Unknown		UNR
10	Telephone Building	NPS	99313	Utility	Admin	No	3/15/20	Unknown	54	Moderate	Unknown		UNR
11	H-8 (Housing #2)	NPS	61503	Building	Admin	Y	3/15/20	Unknown	43	Low	Unknown		UNR
12	Campground Restroom Building	NPS	61514	Building	Public		3/15/20	Unknown	39	Low	Unknown		UNR



NPS Wildland Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

NPS Unit - Location: HOVE - Hovenweep

Label #	Facility/Community Name	Assessment Scale	Site Visit Type	Firewise Zone	Treatment	Treatment Description	Person Hours
1	Visitor Center	Individual Facility	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings	Brush around building 10 to 20 feet.	0.0
10	Telephone Building	Facility In Community (Housing, Maintenance & Campground)	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed	Brush around building 10 to 20 feet.	0.0
11	H-8 (Housing #2)	Facility In Community (Housing, Maintenance & Campground)	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed	Brush around building 10 to 20 feet.	0.0
12	Campground Restroom Building	Facility In Community (Housing, Maintenance & Campground)	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings	Brush around building 10 to 20 feet.	0.0
2	Water Tank	Individual Facility					
3	maze shed	Individual Facility					
4	well house	Individual Facility					



NPS Wildand Fire Risk Assessment - Recommended Treatments

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

5	HVMA storage shed (charley)	Individual Facility					
6	Old Pump House	Facility In Community (Housing, Maintenance & Campground)					
7	Maintenance Shop (San Jose Shed) # 5	Facility In Community (Housing, Maintenance & Campground)	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed	Brush around building 10 to 20 feet.	0.0
		Facility In Community (Housing, Maintenance & Campground)	Initial	3	Remove heavy ground fuels such as logs and stumps	Remove dead/down.	0.0
8	H-9 Duplex (Housing # 4)	Facility In Community (Housing, Maintenance & Campground)	Initial	1	Clear adjacent and overhanging fuels to create 10 feet spacing between canopy and structure or chimney openings	Brush around building 10 to 20 feet.	0.0
9	H-7 (Housing #3)	Facility In Community (Housing, Maintenance & Campground)	Initial	1	Flammable ground cover such as leaf litter, woody debris or highly flammable vegetation should be removed	Brush around building 10 to 20 feet.	0.0



NPS Wildland Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Unit - Location: Hovenweep National Monument - Hovenweep

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
1	Visitor Center	Individual Facility	PrepHold	Engine on scene - 1 Type 4 Engine Crew to support and implement burnout	3.0	Engine/OtherVehicle-Wildland Heavy Engine, Type 3,4 or 5, EA	1
				Fuels reduction - Prep for burnout	5.0	Miscellaneous-	2
				Burnout, no line construction necessary - Burnout with 10 gals drip torch fuel, 2 torches	2.0	Fuel-Drip Torch Mix, GL	10
						Fuel Can-	2
10	Telephone Building	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Fuels reduction - Once fuels have been moved away from structure, building will stand alone.	2.5	-	
11	H-8 (Housing #2)	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Engine on scene - Can utilize same resources as Maintenance Shed, Housing #4 and Housing #3 - 1 20 person crew and a type 4 engine.	5.0	-	
				Fuels reduction - Can utilize same resources as Maintenance Shed, Housing #4 and Housing #3 - 1 20 person crew and a type 4 engine.	5.0	-	
12	Campground Restroom Building	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Fuels reduction - Can utilize same resources as Maintenance Shed, Housing #4, Housing #3 and Housing #2 - 1 20 person crew and a type 4 engine.	5.0	-	



NPS Wildand Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
12	Campground Restroom Building	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Engine on scene - Can utilize same resources as Maintenance Shed, Housing #4, Housing #3 and Housing #2 - 1 20 person crew and a type 4 engine.	5.0	-	
2	Water Tank	Individual Facility	Standalone	-		-	
3	maze shed	Individual Facility	PrepLeave	-		-	
4	well house	Individual Facility	PrepLeave	-		-	
5	HVMA storage shed (charley)	Individual Facility	PrepLeave	-		-	
6	Old Pump House	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Remove flammable materials - Remove fuels away from structure	5.0	-	
				Fuels reduction -	5.0	-	
				Engine on scene - Find water source to pump hose lay.	3.0	-	
				Progressive hoselay -	2.0	-	
7	Maintenance Shop (San Jose Shed) # 5	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Engine on scene - Can utilize same resources as CG restroom building, Housing #4, Housing #3 and Housing #2 - 1 20 person crew and a type 4 engine.	5.0	-	
				Fuels reduction - Can utilize same resources as CG restroom building, Housing #4, Housing #3 and Housing #2 - 1 20 person crew and a type 4 engine.	5.0	-	



NPS Wildland Fire Risk Assessment - Recommended Tactics

For more information on the NPS Wildland Fire Risk Assessment project visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Label #	Facility/Community Name	Assessment Scale	Triage Category	Tactic Description	Person Hours	Equipment Description	Equip. Qty
7	Maintenance Shop (San Jose Shed) # 5	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Remove flammable materials - Can utilize same resources as CG restroom building, Housing #4, Housing #3 and Housing #2 - 1 20 person crew and a type 4 engine.	2.5	-	
8	H-9 Duplex (Housing # 4)	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Engine on scene - Can utilize same resources as Maintenance Shed, Housing #2 and Housing #3 - 1 20 person crew and a type 4 engine.	5.0	-	
				Fuels reduction - Can utilize same resources as Maintenance Shed, Housing #2 and Housing #3 - 1 20 person crew and a type 4 engine.	5.0	-	
9	H-7 (Housing #3)	Facility In Community (Housing, Maintenance & Campground)	PrepLeave	Fuels reduction - Can utilize same resources as Maintenance Shed, Housing #4 and Housing #2 - 1 20 person crew and a type 4 engine.	5.0	-	
				Engine on scene - Can utilize same resources as Maintenance Shed, Housing #4 and Housing #2 - 1 20 person crew and a type 4 engine.	5.0	-	



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Visitor Center

Unit - Location: HOVE - Hovenweep
FMSS ID: 61476
Structure Type: Building
Structure Use: Public
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020


Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community?
Lat(WGS84): 37° 23.1467' **Long(WGS84):** -109° 4.52551'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible but separated from facility
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:





2020_HOVE_61476_Visitor Center_Front.jpg

Score: 56 **Asset Priority Index (API): 55**
Rating: Moderate

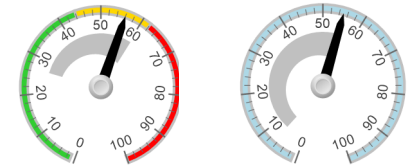

Factors Driving the Ratings

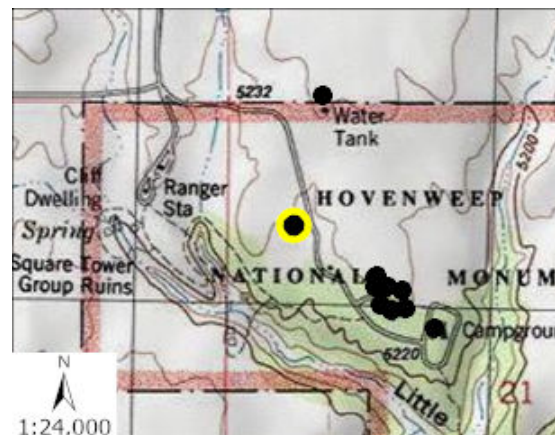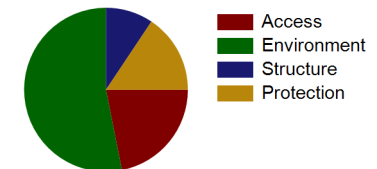



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Water Tank

Unit - Location: HOVE - Hovenweep
FMSS ID: HOVE-Water Tank
Structure Type: Utility
Structure Use: Unknown
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community?
Lat(WGS84): 37° 23.3395' **Long(WGS84):** -109° 4.4694'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: >100ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat:
Assessment Comments:




2020_HOVE_HOVE-Water Tank_Water Tank_Front.jpg


Score: 39
Rating: Low

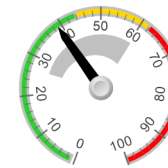


Asset Priority Index (API):
N/A

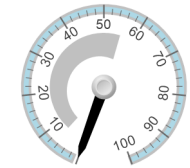

Factors Driving the Ratings

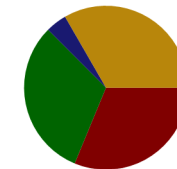

■ Access
■ Environment
■ Structure
■ Protection

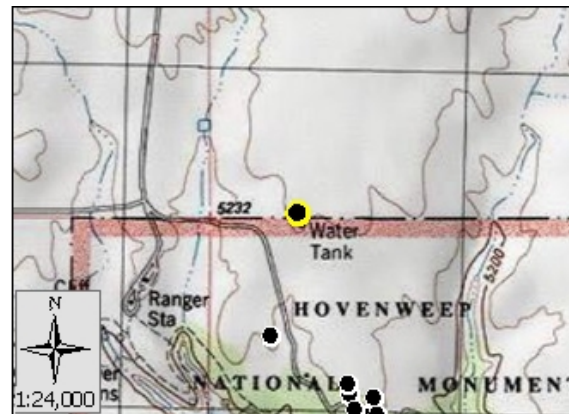

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: maze shed

Unit - Location: HOVE - Hovenweep
FMSS ID: 92563
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2021


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0577' **Long(WGS84):** -109° 4.36623'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Vinyl
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Present and fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat: fuel station nearby
Assessment Comments:



2021_HOVE_92563_maze shed _Front.jpg


Score: 27
Rating: Low

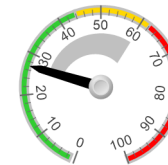


Asset Priority Index (API):
7



Factors Driving the Ratings

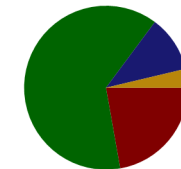

■ Access
■ Environment
■ Structure
■ Protection

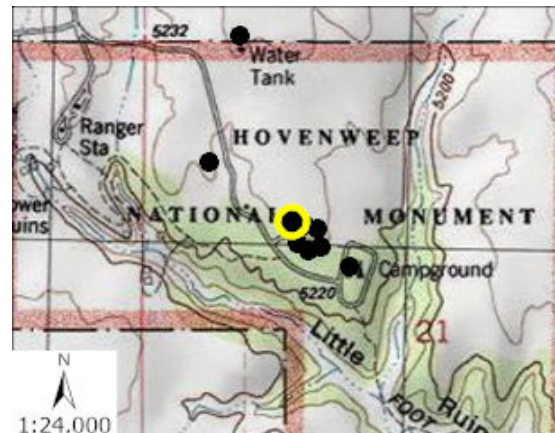



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: well house

Unit - Location: HOVE - Hovenweep
FMSS ID: not found
Structure Type: Utility
Structure Use: Admin
Owner: NPS
Field Crew: castillo
Last Site Visit Date: 3/15/2021


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0703' **Long(WGS84):** -109° 4.36547'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Non-surfaced- gravel,dirt,grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_HOVE_not found _well house _Front.jpg


Score: 34
Rating: Low

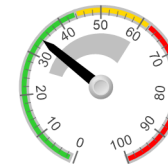


Asset Priority Index (API):
N/A



Factors Driving the Ratings

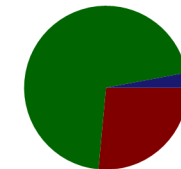

■ Access
■ Environment
■ Structure
■ Protection

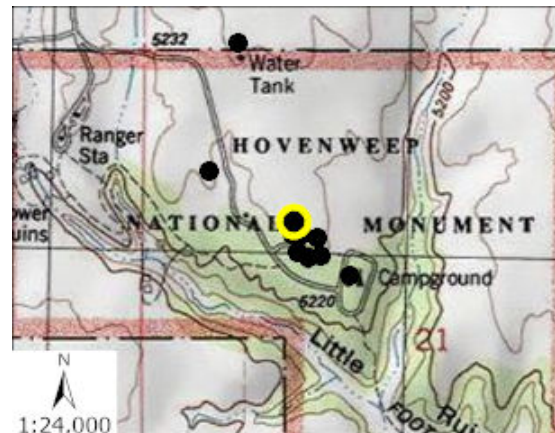



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: HVMA storage shed (charley)

Unit - Location: HOVE - Hovenweep
FMSS ID: 92566
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2021


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? No
Local ID: [Local_ID]
In a Community? Yes - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0526' **Long(WGS84):** -109° 4.34433'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 2 lanes (>24ft)
Access Condition: Surfaced-paved, grade<5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is <300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope <5%
Roof Material: Noncombustible or not applicable
Siding Material: Vinyl
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2021_HOVE_92566_HVMA storage shed (charley)_Front.jpg


Score: 43
Rating: Low

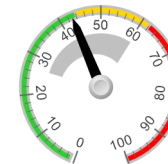


Asset Priority Index (API):
7



Factors Driving the Ratings

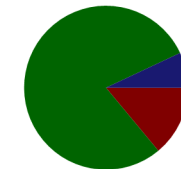

■ Access
■ Environment
■ Structure
■ Protection

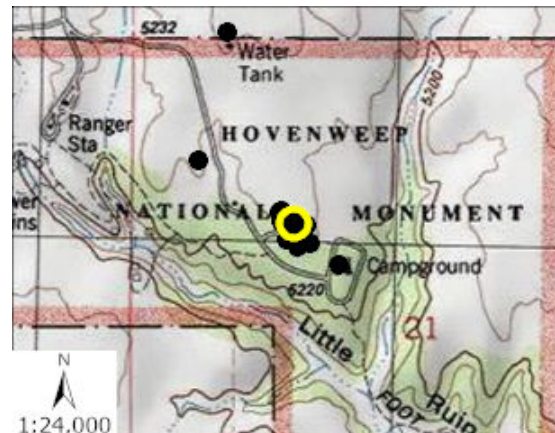



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Old Pump House

Unit - Location: HOVE - Hovenweep
FMSS ID: 61481
Structure Type: Utility
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020


Rating: Moderate
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied?
Local ID: [Local_ID]
In a Community? - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0687' **Long(WGS84):** -109° 4.37046'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: <30 ft treated
Fuel Load (w/in 300 ft): Light
Fuel Type (w/in 300ft): Shrub or timber
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Wood or open sided
Foundation: Closed, 6in to 30in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Limited or dependent on electricity
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_HOVE_61481_Old Pump House_Front.jpg


Score: 60
Rating: Moderate

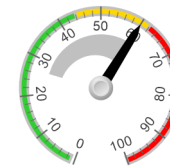



Asset Priority Index (API):
7



Factors Driving the Ratings

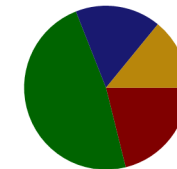

Access
Environment
Structure
Protection

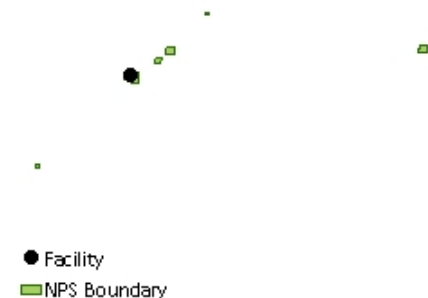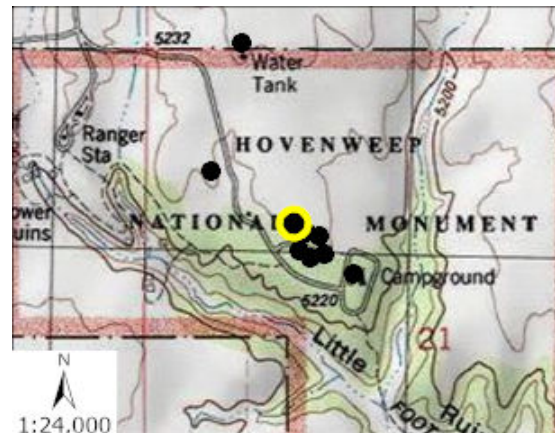



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Maintenance Shop (San Jose Shed) # 5


Unit - Location: HOVE - Hovenweep
FMSS ID: 61485
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020

Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied?
Local ID: [Local_ID]
In a Community? - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0533' **Long(WGS84):** -109° 4.36832'


Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 100 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, < 6in masonry exposed
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: None
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: Hazmat, UXO,etc. , PLEASE COMMENT
Triage Category:
Hazmat: fuel station adjacent
Assessment Comments:



2020_HOVE_61485_Maintenance Shop (San Jose Shed)
5_Front.jpg

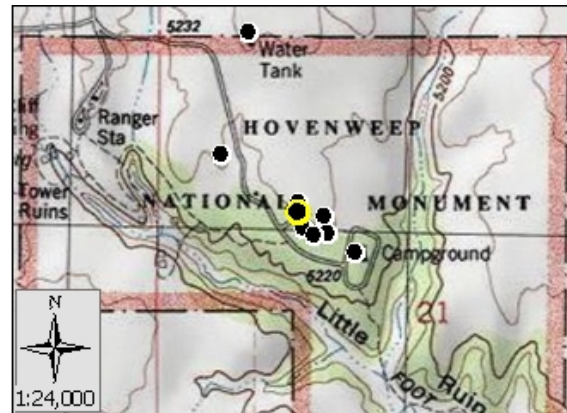


Score: 38
Rating: Low

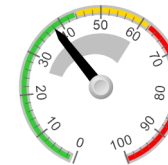


Asset Priority Index (API):
7



Factors Driving the Ratings

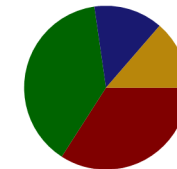

■ Access
■ Environment
■ Structure
■ Protection

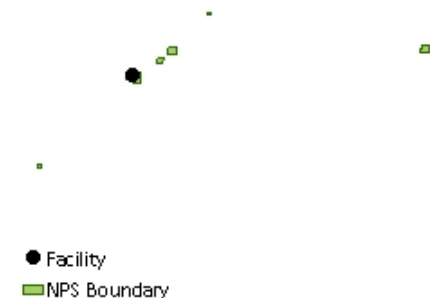



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: H-9 Duplex (Housing # 4)

Unit - Location: HOVE - Hovenweep
FMSS ID: 81575
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0276' **Long(WGS84):** -109° 4.35804'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Adjacent to facility and no fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_HOVE_81575_H-9 Duplex (Housing # 4)_Front.jpg


Score: 43
Rating: Low

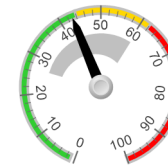


Asset Priority Index (API): 30



Factors Driving the Ratings

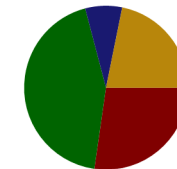

Access
Environment
Structure
Protection

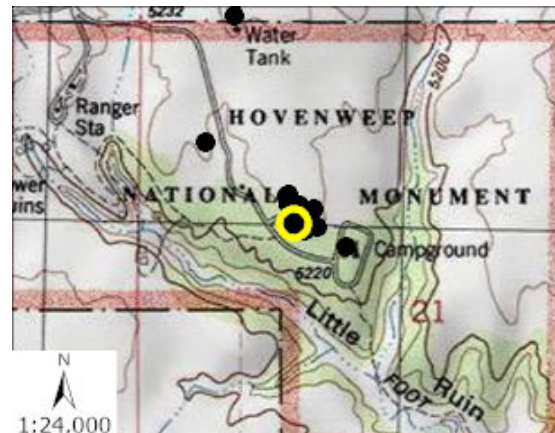



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: H-7 (Housing #3)

Unit - Location: HOVE - Hovenweep
FMSS ID: 61512
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied?
Local ID: [Local_ID]
In a Community? - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0173' **Long(WGS84):** -109° 4.33748'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: Marked and clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: Combustible but separated from facility
Firewood: None
Propane Tanks: Adjacent to facility and no fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:



2020_HOVE_61512_H-7 (Housing #3)_Front.jpg


Score: 41
Rating: Low

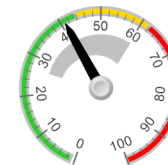


Asset Priority Index (API): 30



Factors Driving the Ratings

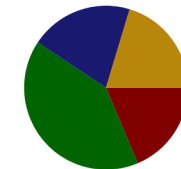

Access
Environment
Structure
Protection

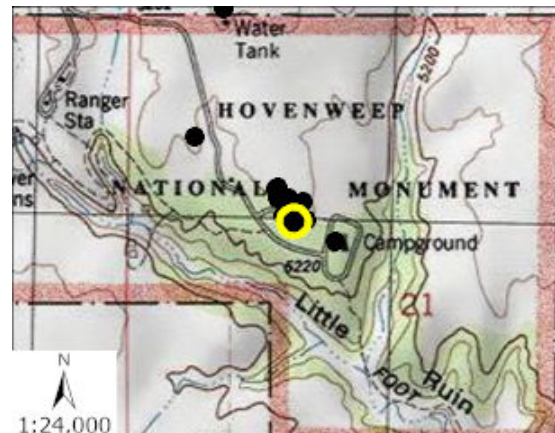



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Telephone Building

Unit - Location: HOVE - Hovenweep

FMSS ID: 99313

Structure Type: Utility

Structure Use: Admin

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/15/2020

Rating: Moderate

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied?

Local ID: [Local_ID]

In a Community? - Housing, Maintenance & Campground

Lat(WGS84): 37° 23.0477' **Long(WGS84):** -109° 4.31949'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade>5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is >300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: <30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Shrub or timber

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: None or noncombustible

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None

Triage Category:

Hazmat:


Assessment Comments:




2020_HOVE_99313_Telephone Building_Front.jpg

Score: 54
Rating: Moderate



Asset Priority Index (API): 13

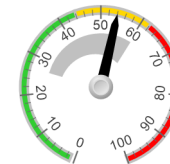

Factors Driving the Ratings

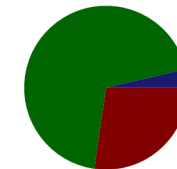

Access
Environment
Structure
Protection

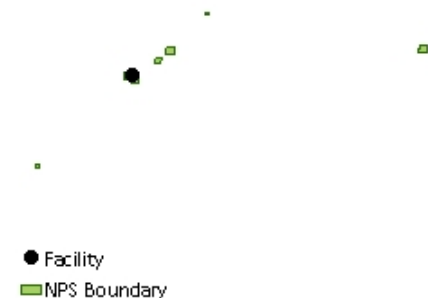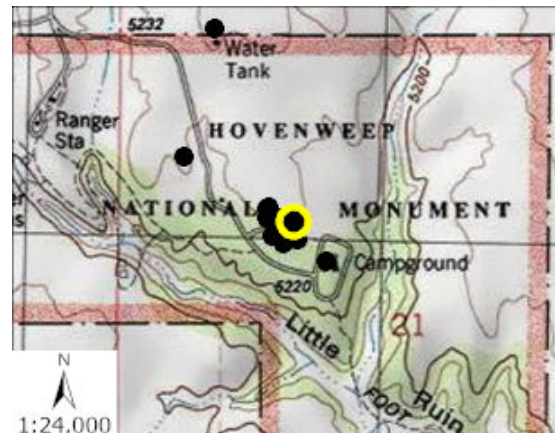



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: H-8 (Housing #2)

Unit - Location: HOVE - Hovenweep
FMSS ID: 61503
Structure Type: Building
Structure Use: Admin
Owner: NPS
Field Crew: Castillo
Last Site Visit Date: 3/15/2020


Rating: Low
Protection Level : Unknown
Resources of Concern Present? Unknown
Occupied? Yes
Local ID: [Local_ID]
In a Community? - Housing, Maintenance & Campground
Lat(WGS84): 37° 23.0199' **Long(WGS84):** -109° 4.31179'

Primary Access: Road
Ingress/Egress: One roads in/out
Access Width: 1.5 lanes (>18ft)
Access Condition: Surfaced-paved, grade>5%
Bridge Condition: None/nonflammable,load limit will not limit response
Access & Turnarounds: Access is >300 ft from facility w/turnaround
Facility Number/Sign: None or not clearly visible
Defensible Space: 30 ft treated
Fuel Load (w/in 300 ft): Moderate
Fuel Type (w/in 300ft): Grass,shrub,hardwood litter
Topography (w/in 300ft): Slope 5% to 20%
Roof Material: Noncombustible or not applicable
Siding Material: Rock, concrete, metal
Foundation: Closed, >30in masonry exposed or N/A
Fences/Decks: None or noncombustible
Firewood: None
Propane Tanks: Adjacent to facility and no fuels clearance
Water Supply: Pressurized hydrant(s) or fixed sprinkler system
Overhead Hazards: No overhead hazards
Safety Zones: Potential safety zone(s) in area
Additional Obstacles: None
Triage Category:
Hazmat:
Assessment Comments:




2020_HOVE_61503_H-8 (Housing #2)_Front.jpg


Score: 43
Rating: Low

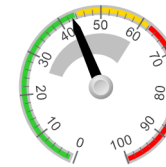


Asset Priority Index (API): 30

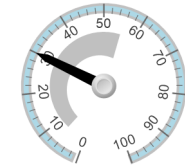

Factors Driving the Ratings

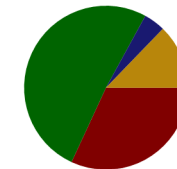

Access
Environment
Structure
Protection

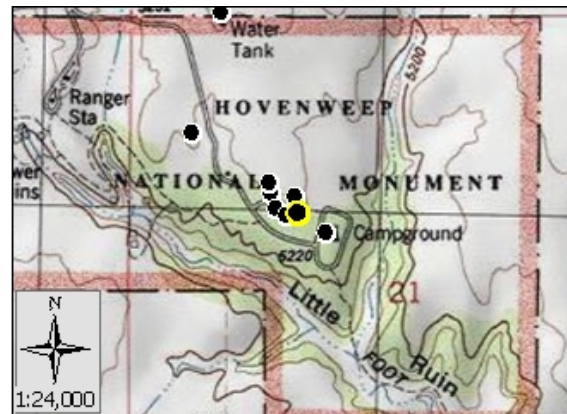

● Facility
■ NPS Boundary



NPS Wildand Fire Risk Assessment - Facility Assessment

For more information visit <https://wildfire-risk-assessments-nifc.hub.arcgis.com>

Facility: Campground Restroom Building

Unit - Location: HOVE - Hovenweep

FMSS ID: 61514

Structure Type: Building

Structure Use: Public

Owner: NPS

Field Crew: Castillo

Last Site Visit Date: 3/15/2020

Rating: Low

Protection Level : Unknown

Resources of Concern Present? Unknown

Occupied?

Local ID: [Local_ID]

In a Community? - Housing, Maintenance & Campground

Lat(WGS84): 37° 22.9895' Long(WGS84): -109° 4.25739'

Primary Access: Road

Ingress/Egress: One roads in/out

Access Width: 1.5 lanes (>18ft)

Access Condition: Surfaced-paved, grade<5%

Bridge Condition: None/nonflammable,load limit will not limit response

Access & Turnarounds: Access is <300 ft from facility w/turnaround

Facility Number/Sign: None or not clearly visible

Defensible Space: 30 ft treated

Fuel Load (w/in 300 ft): Moderate

Fuel Type (w/in 300ft): Grass,shrub,hardwood litter

Topography (w/in 300ft): Slope 5% to 20%

Roof Material: Noncombustible or not applicable

Siding Material: Rock, concrete, metal

Foundation: Closed, >30in masonry exposed or N/A

Fences/Decks: Combustible but separated from facility

Firewood: None

Propane Tanks: None

Water Supply: Pressurized hydrant(s) or fixed sprinkler system

Overhead Hazards: No overhead hazards

Safety Zones: Potential safety zone(s) in area

Additional Obstacles: None


Triage Category:

Hazmat:


Assessment Comments:



2020_HOVE_61514_Campground Restroom Building_Front.jpg

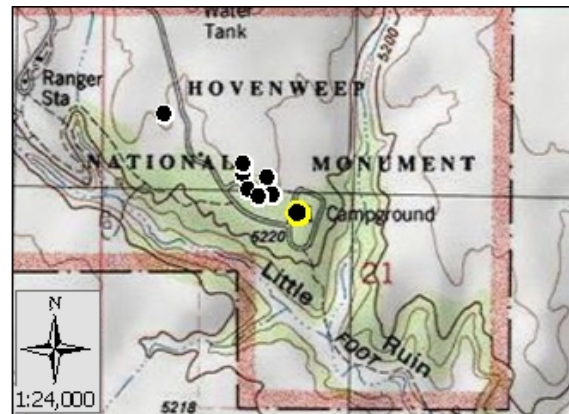


Score: 39
Rating: Low

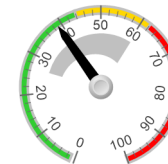

Asset Priority Index
(API):
44



Factors Driving the Ratings

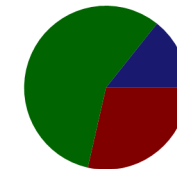

Access
Environment
Structure
Protection

